RECEIVED

Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesians

FORM APPROVEDOMB No. 1004-0137 Expires: January 31, 2018

5. Lease Serial No.

LC-029415-A

Di	CTDIATII AFTERNIA A A LU-U.	29413-A
SUNDRY NOTICES AND REPORTS	WELLS ARIESIAO.C	ttee or Tribe Name
Do not use this form for proposals to drill or	to re-enter an	

abandoned well. Use Form 3160-3 (APD) for such proposals. 7. If Unit of CA/Agreement, Name and/or No SUBMIT IN TRIPLICATE - Other instructions on page 2 1. Type of Well 8. Well Name and No. PUCKETT A 24 X Oil Well Gas Well 2. Name of Operator HUDSON OIL COMPANY OF TEXAS 9. API Well No. 35-015-10302 3a. Address 3b. Phone No. (include area code) 10. Field and Pool or Exploratory Area MALJAMAR 1 616 Texas Street Fort Worth, TX 76102 817-336-7109 4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description) 11. Country or Parish, State Sec 24, T17S - R31E 25' FNL & 1295' FEL EDDY COUNTY, NM 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Acidize Deepen Production (Start/Resume) Water Shut-Off ✓ Notice of Intent Alter Casing Hydraulic Fracturing Reclamation Well Integrity Casing Repair New Construction Subsequent Report FOR FOR Change Plans ✓ Plug and Abandon Final Abandonment Notice Convert to Injection Plug Back 13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be perfonned or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has detennined that the site is ready for final inspection.) 1. MIRU well service rig and plugging equipment. POOH and lay down rods. RD pumping tee and install 7-1/6" 3K BOP's. Strap tubing out of hole and stand back in derrick. 2. RIH with 5-1/2" GR to 3,500'. Set CIBP @ 3,475'. RIH with tubing and tag CIBP. Displace well with 9.5 ppg mud. Test casing to 1000 psi. Spot 25 sx cement on top of CIBP. POOH with tubing and WOC. 3. RIH with tbg and tag cement @ 3,225'. If neccasary pump additional cment to bring top to 3,225'. POOH with tbg. 4. RIH and perforate 5-1/2" casing @ 7970 Squeeze 35'sx cement plug from 1,970' - 1,850'. WOC. RIH and tag cement. POOH. (Yaks & B.S.W.) 5.4. RIH and perforate 5-1/2" casing @ 712". Squeeze cement across 8-5/8" shoe from 242"-512". WOC. RIH and tag cement. POOH with tubing. 6. RIH and perforate 5-1/2" and 8-5/8" casing @ 60'. Squeeze 50 sx cement to surface.
7. 6. Cut off well head and verify cement to surface around both casing strings. Install below ground dry hole marker. Cut off anchors, restore and reseed to the surface around both casing strings. RECLAMATION: "Rip and remove caliche, contour to surrounding topography, reseed." 14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed) REGULATORY CONSULTANT LORNES Title 04/29/2019 Signat Date THE SPACE FOR FEDERAL OR STATE OFICE USE Approved by Conditions of approval, if any, are attached. Approval of this notice does not warrant or ceptify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States

false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

Anhy @ 575' Top of Salt @ 730' Base of Salt @ 1,776' Yates @ 1,970' Queen @ 2,915' Grayburg @ 3,278'

San Andres @ 3,664'

Operator:

Hudson Oil Company of Texas

Well Name:

Puckett "A" #24 Maljamar

Field: County/State:

Eddy County, New Mexico

API Number Lease Number

Location:

30-015-10302 LC-029415-A

Sec 24 - T17S - R31E

25' FNL & 1295' FEL

DRILLING DETAILS						
Spud Date:	3-30-64	KB [ft]:	3,919'			
TD:	3,960'	GL [ft]:	3,917'			
PBTD	3,640'	KB-GL:	2			

WELLHEAD AND TREE DETAILS Size & Rating

A Section:

B Section: Tree:

	10 14 Y Y 1	CASING	DETAIL	S		CMTING	DETAILS
Hole	Size	Wght	Grde	TOL	Depth	Vol	TOC [ft],
12-1/4"	8-5/8"	24	1-55	\	612'	100 sx	7
7-7/8"	5-1/2"	15.5	1-55		3,959'	350 sx	3,150' TL
7-770	3 1/2						1

TOC?

8-5/8" @ 612'

9887F33	Downhole Item	Length	/ Depth
S. ACTED VALLE SALES	KB Correction	2.00	2.00
	2-3/8" 4.7# J-55 8rd EUE	3,515.00	3,517.00
113	SSN	1.10	3,518.10
ļ	Perf Sub	3.00	3,521.10
	MA	31.00	3,552.10
	IMA		

Downhole Item	Length	Depth Set
Polish Rod	18.00	18.00
140 3/4" Steel Rods	3,500.00	3,518.00
2" x 1-1/2" x 10' pump	10.00	3,528.00
Z XI I/Z XIV FUND		

TOC @ 3150' Temp Log

3,538' - 3,550'

CIBP @ 3,645' w/5' Cmt

3,695' - 3,718'


3,927' - 3,951' 🎍

TD @ 3,960' -

PERFORATION DETAILS						
Zone	Gross Interval	Net Pay	Shots	IP Date	P&A'd	
Grayburg	3,538' - 3,550'	12	24	9-15-75		
San Andress	3,695' - 3,718'	23	92	5-4-64	7-30-75	
San Andress	3,927' - 3,951'	24	96	5-4-64	7-30-75	

		TREATM	IENT DETAIL			
Interval	bbls	Type	Sd [lbs]	ISIP	ATR	ATP
2 5201 2 5501	12	Acid			4	2600
3,538' - 3,550' 3,695' - 3,951'	238	Gel	5.000		10	2900

Date:	4/10/2019
By:	Greg Milner

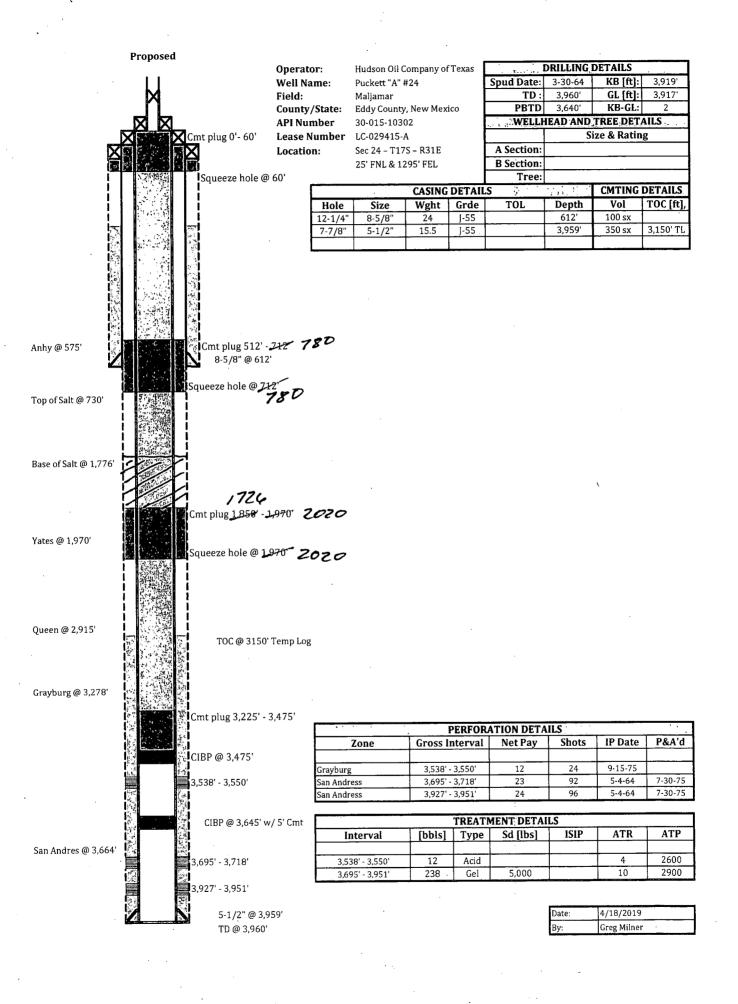

Hudson Oil of Texas - P&A Procedure - 4/16/2019

Puckett "A" #24

API #: 35-015-10302

AFE#:

Field: Maljamar

Surf Location: Sec 24, T17S – R31E

25' FNL & 1295' FEL

Latitude: 00.0000° N / Longitude: -00.0000° W

Eddy County, NM Spud Date: 3-30-64

Directions to Location

From Maljamar: West on Hwy 82 for 4 miles. Turn south into location.

Description	Size	Wght	Grade	ID	Drift	Burst	Collapse	Btm MD	TOC
Surface	8-5/8"	24	J-55	8.097"	7.972"	2,950	1,370	556'	-
Production	5-1/2"	15.5	J-55	4.95"	4.825"	4,810	4,040	3,280'	1,117' est
Tubing	2-3/8"	4.7	J-55	1.995"	1.901"	7,700	8,100	8,135'	

KB:, 3,919' **GL:** 3,917' **PBTD:** 3,640' **TD:** 3,960'

Current Perfs: 3,538 – 3,550°

Objective: P&A Well Bore in complianace with the rules and regulations for the state of New Mexico.

Proposed Perfs: None

Procedure

- 1. MIRU well service rig and plugging equipment. POOH and lay down rods. RD pumping tee and install 7-1/6" 3K BOP's. Strap tubing out of hole and stand back in derrick.
- 2. RIH with 5-1/2" GR to 3,500'. Set CIBP @ 3,475'. RIH with tubing and tag CIBP. Displace well with 9.5 ppg mud. Test casing to 1000 psi. Spot 25 sx cement on top of CIBP. POOH with tubing and WOC.
- 3. RIH with tbg and tag cement @ 3,225'. If neccasary pump additional cment to bring top to 3,225'. POOH with tbg.
- 4. RIH and perforate 5-1/2" casing @ 1,970'. Squeeze 35 sx cement plug from 1,970' 1,850'. WOC. RIH and tag cement. POOH. (Yeles & B.Self)
- 4. RIH and perforate 5-1/2" casing @ 712. Squeeze cement across 8-5/8" shoe from 712' 512'. WOC. RIH and tag cement. POOH with tubing. (7. Salf & Shoe)
- 5. RIH and perforate 5-1/2" and 8-5/8" casing @ 60'. Squeeze 50 sx cement to surface.
- 6. Cut off well head and verify cement to surface around both casing strings. <u>Install below ground dry</u> hole marker. Cut off anchors, restore and reseed location.

THIS PROCEDURE HAS BEEN PROPOSED IN CONSIDERATION OF AND WITH RESPECT GIVEN TO THE MANY VARIABLES AND POTENTIAL PROBLEMS THAT MAY BE ENCOUNTERED IN THIS WELL IN THIS GEOGRAPHICAL AREA. THEREFORE, THIS PROCEDURE IS TO SERVE AS A GENERAL GUIDELINE AND WILL BE REVIEWED AND MODIFIED WHEN REQUIRED AS DETERMINED BY ACTUAL WELLBORE CONDITIONS ENCOUNTERED IN THE OPERATIONS. SAFETY AND PRUDENT PRACTICES WILL TAKE PRIORITY AT ALL TIMES.

Prior to rig up of any operations and prior to the actual operations, always hold safety meeting to discuss any potential hazards, accurately record names of all personnel on location, pick meeting place, discuss evacuation plans, designate hospital of choice and have coordinates and phone numbers for care flight operations if necessary. Completely discuss the operation and/or rig-up so that all personnel understand the plan, responsibilities and any potential changes that may take place during the rig up or operation

	Date:
Greg Milner	
	Greg Milner

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>minety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.