	1 / / 1					
Sugnit I Co	opy To Appropriate District	State of Nev	v Mexico		Form C-103	
	(575) 393-6161	Energy, Minerals and	Natural Resources		Revised July 18, 2013	
	nch Dr., Hobbs, NM 88240 (575) 748-1283			WELL API NO. 30-015-334	42	
811 S. First	St., Ártesia, NM 88210 - (505) 334-6178	OIL CONSERVAT		5. Indicate Type of		
	- (505) 534-6178 razos Rd., Aztec, NM 87410	1220 South St.		STATE 🔽	FEE 🔲	
	- (505) 476-3460 Francis Dr., Santa Fe, NM	Santa Fe, N	M 87505	6. State Oil & Gas	Lease No.	
87505				V-267	в	
	SUNDRY NOT	CES AND REPORTS ON WI SALS TO DRILL OR TO DEEPEN O	ELLS	7. Lease Name or U	Jnit Agreement Name	
DIFFEREN	T RESERVOIR. USE "APPLIC	CATION FOR PERMIT" (FORM C-1	01) FOR SUCH	Big Wa H	2 state	
PROPOSAL	of Well: Oil Well	Gas Well 🗍 Other		8. Well Number	10	
	2. Name of Operator				9. OGRID Number	
· · · · · · · · · · · · · · · · · · ·	OXY USA	WTP Limited Partnership			192463	
3. Addres	ss of Operator	0250 Midland TV 70710		10. Pool name or W		
4. Well L		0250 Midland, TX 79710		Indian Basinl	Ap. Penn(Assoc)	
	. 1	2004 feet from the No	The line and	707	i ant	
	Section 2		Range 24E		the <u>east</u> line	
		11. Elevation (Show whethe		NMPM (	County Eddy	
* + + +	******	38		.,		
					•	
	12. Check A	Appropriate Box to Indica	te Nature of Notice,	, Report or Other D	ata	
	NOTICE OF IN					
PERFORM		PLUG AND ABANDON				
		CHANGE PLANS			LTERING CASING	
	ALTER CASING		CASING/CEMEN			
			o, tointo, o'Emer			
	LOOP SYSTEM					
OTHER:			OTHER:			
13. De	escribe proposed or compl	leted operations. (Clearly state	e all pertinent details, ar	nd give pertinent dates,	including estimated date	
	oposed completion or reco	rk). SEE RULE 19.15.7.14 N	MAC. For Multiple Co	ompletions: Attach wel	lbore diagram of	
pro		405' Perfs-8031-8211'				
					,	
		.543' w/ 1380sx, 14-3/4" hole				
		456', DVT @ 7023' w/ 1450sx,			<i>e</i>	
	*Peri @ 2450,	sqz 600sx cmt, Perf @ 2250',	sqz 450sx cmt – circ sur	†		
	1. RIH & set CIBP	@ 7981' w/ 25sx cmt to 7881	- woc + Ta	م ا	RECEIVED	
		: @ 7605-7505' WOC-Tag		, ,		
	<ol><li>3. M&amp;P 25sx cm1</li></ol>	: @ 7073-6973' WOC-Tag		A	0 0 0 000	
		: @ 5830-5730' WOC-Tag		A	UG 2 8 2019	
		@ 4165-4065' WOC-Tag				
		: @ 2500-2200' WOC-Tag			TI-ARTESIAO.C.D.	
	7. M&P 25sx cmt 8. M&P 100sx cm	: @ 1593-1493' WOC-Tag ht @ 500' to surface – Per	F 0.500'L	Attempt to 5	Par & Surf	
	0. IVIAE LUUSX CA 10# MI F hetw	een plugs – Above ground ste	el tanks will be utilized	T	Ø	
					7	
Spud Date:		Rig Releas	se Date:			
Ver			Ļ	/		
1 See	e Attached	COAS	Must be PI	lugged by	8/28/20	
I hereby cer	tify that the information a	above is true and complete to t	he best of my knowledg	ge and belief.	/ /	
SIGNATUI	RE Va T	TITLE	Sr. Regulatory Adviso	or DATE	6/26/19	
				· · · · ·		
Type or prin	nt name <u>David Stewar</u>	t E-mail addr	ess: <u>david_stewart(</u>	@oxy.com PHONE:	432-685-5717	
For State U	se Only				ı	
	n 1-4-		XX a		shalia	
<ul> <li>APPROVE</li> <li>Conditions</li> </ul>	D BY: of Approval (if any):		AIC NIg-	DATE	0/20/17	
Conditions	or rippioval (II ally).		U.		£€	
					v	

## OXY USA WTP LP - Proposed Big Walt 2 State #10 API No. 30-015-33442

100sx @ 500'-surface

25sx @ 1593-1493' WOC-Tag

# 60sx @ 2500-2200' WOC-Tag

25sx @ 4165-4065' WOC-Tag


25sx @ 5830-5730' WOC-Tag

\

25sx @ 7073-6973' WOC-Tag

25sx @ 7605-7505' WOC-Tag

CIBP @ 7981' w/ 25sx to 7881'

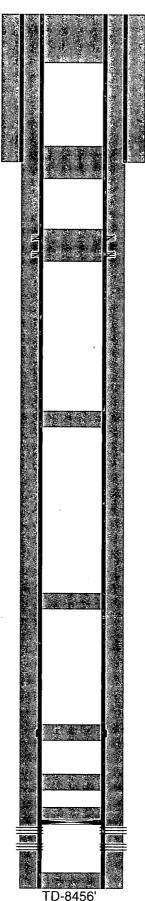

14-3/4" hole @ 1543' 9-5/8" csg @ 1543' w/ 1380sx-TOC-Surf-Circ

#### \*Perf @ 2250', sqz 450sx cmt-circ surf \*Perf @ 2450', sqz 600sx cmt, TOC-2300'-TS

1

8-3/4" hole. @ 8456' 7" csg @ 8456' w/ 1450sx-\*TOC-2500'-TS DVT @ 7023'

{

Perfs @ 8031-8211'

PB-8405'

**OXY USA WTP LP - Current** Big Walt 2 State #10 API No. 30-015-33442

> Perfs @ 8031-8211' TD-8456'

14-3/4" hole @ 1543' 9-5/8" csg @ 1543' w/ 1380sx-TOC-Surf-Circ

#### \*Perf @ 2250', sqz 450sx cmt-circ surf \*Perf @ 2450', sqź 600sx cmt, TOC-2300'-TS

8-3/4" hole @ 8456' 7" csg @ 8456' w/ 1450sx-\*TOC-2500'-TS DVT @ 7023'

# CONDITIONS FOR PLUGGING AND ABANDONMENT

## District II / Artesia N.M.

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If the well is not plugged within 1
- 7. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 8. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 9. Produced water will not be used during any part of the plugging operation.
- 10. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 11. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 12. Class 'C' cement will be used above 7500 feet.
- 13. Class 'H' cement will be used below 7500 feet.
- 14. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 15. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than **3000' is allowed between cement plugs in cased hole and 2000' in open** hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
  - A) Fusselman
  - B) Devonian
  - C) Morrow
  - D) Wolfcamp
  - E) Bone Springs
  - F) Delaware
  - G) Any salt sections
  - H) Abo
  - I) Glorieta
  - J) Yates.
  - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

#### DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name2. Lease and Well Number3. API Number4. Unit Letter5. QuarterSection (feet from the North, South, East or West)6. Section, Township and Range7. Plugging Date8. County(SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)