
•					.	
		ş	HEGENEO		r	
	UNITED STATE PARTMENT OF THE II	NTERIOR	NOC3C5'2t		Ex	FORM APPROVED OMB No. 1004-0137 cpires: October 31, 2021
	EAU OF LAND MAN		SAGEN ADTICS		5. Lease Serial No.	NM-0558581 Nm 106231
Do not use this	NOTICES AND REPC form for proposals to Use Form 3160-3 (Al	o ariii or to	re-enter an	W-10-0	6. If Indian, Allottee	or Tribe Name
SUBMIT IN	TRIPLICATE - Other instru	ctions on page	2		7. If Unit of CA/Agr	eement, Name and/or No.
1. Type of Well Image: Oil Well Image: Gas *	Well Other				8. Well Name and No	^{0.} McINTYRE G FEDERAL #002
2. Name of Operator SOUTHWEST ROYALTIES, INC.					9. API Well No. 30-0	15-20647
3a. Address P.O. BOX 53570 3b. Phone			include area code)		10. Field and Pool or	
MIDLAND, TEXAS 797		(432) 207-305	4	. .		KSON; SR-Q-G-SA
4. Location of Well (<i>Footage, Sec., T.,R.,M., or Survey Description</i>) 1650' FNL & 2310' FEL; G, SEC. 21, T-17S, R30E					 Country or Parish EDDY COUNTY, 	
12. CHI	ECK THE APPROPRIATE BO	DX(ES) TO IND	ICATE NATURE C	F NOTI	CE, REPORT OR OT	HER DATA
TYPE OF SUBMISSION	·		ТҮРЕ	OFACT	ΓΙΟΝ	
✓ Notice of Intent	Acidize	Deepe	n [ulic Fracturing [action (Start/Resume)	Water Shut-Off
Subsequent Report	Casing Repair		Construction		mplete oorarily Abandon	Other
Final Abandonment Notice	Convert to Injection	Plug E			r Disposal	
 NU BOP. UNSEAT ANCHO RU WIRELINE. SET CIBP (TIH W/ OPEN ENDED 2-7/8 CMT. WOC FOR 4 HRS. TAG TO PERFORATE SQUEEZE HI PERFORATE SQUEEZE HI ND BOP. CUT WELLHEAD MOVE OUT ALL SURFACE REMOVE CALICHE FROM 	2500'. TBG. TAG CIBP. CIRCU Set CIB P OF CMT. 1150 OLES AT 1100'. SQUEEZE OLES AT 600'. CIRCULATI INSTALL BELOW GROUN EQUIPMENT INCLUDING	50 SX CLASS CLASS C CA D LEVEL DR' ELECTRIC PO	10# GELLED B C C CMT. WOC F C CMT. WOC F T TO SURFACE Y HOLE MARKEF OLES, ETC.	pted fo RINE. SI 20/3 OR 4 HF . 47 2	RS. TAG CMT. T S	ASS C CMT OR DUMP BAIL 35' an (or spot 2557 ag 1050
**NO SURFACE PIT. ALL WO					Surf all	-
14. I hereby certify that the foregoing is	round le	och dr	y hole	м	ærker	requeired.
LINDSAY LIVESAY			REGULATO	RY ANA	LYST	
Signature	\		Date		08/30/2	2019
	THE SPACE	FOR FEDE	RAL OR STA	TE OF	ICE USE	
Approved by	R. amos		Title St	AE 7	, ,	Date 10-25-15
Conditions of approval, if any, are attac certify that the applicant holds legal or which would intitle the applicant to con-	equitable title to those rights i			D		· · · · · · · · · · · · · · · · · · ·
Title 18 U.S.C Section 1001 and Title 4 any false, fictitious or fraudulent statem	3 U.S.C Section 1212, make interest or representations as to a	t a crime for any ny matter within	v person knowingly i its jurisdiction.	and will	fully to make to any c	lepartment or agency of the United State
(Instructions on page 2)						· · · · · · · · · · · · · · · · · · ·
	inter.	·				
•	جي ر					

~ ~
~ /
- <i>I</i> / /
- N
()
M

SOUTHWEST ROYALTIES, INC.

McINTYRE G FEDERAL #002 30-015-20647


CURRENT GRAYBURG JACKSON; SR-Q-G-SA WELL

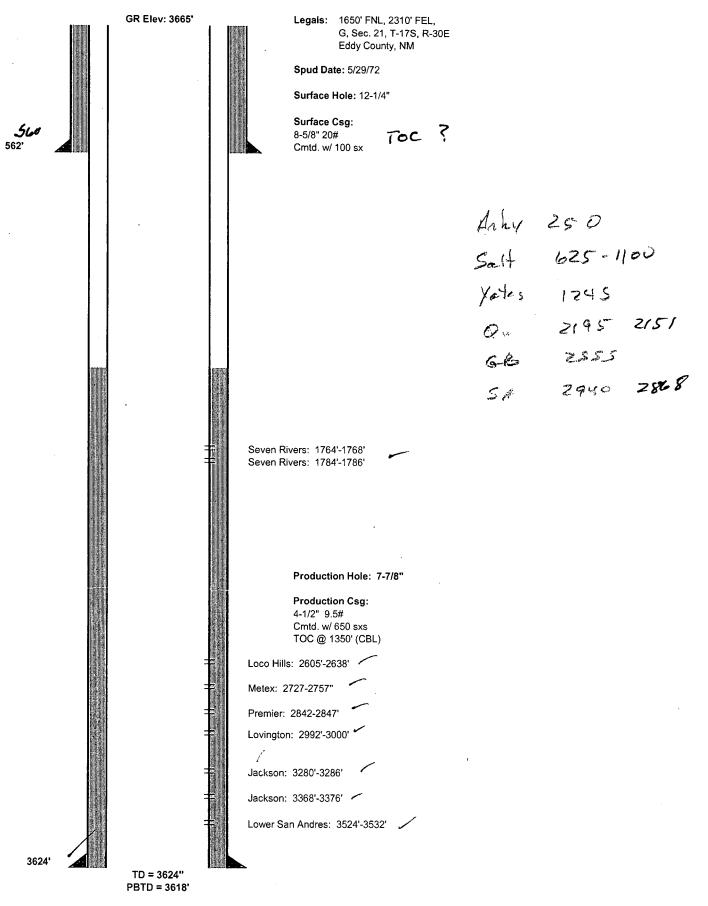

SOUTHWEST ROYALTIES, INC.

McINTYRE G FEDERAL #002 30-015-20647



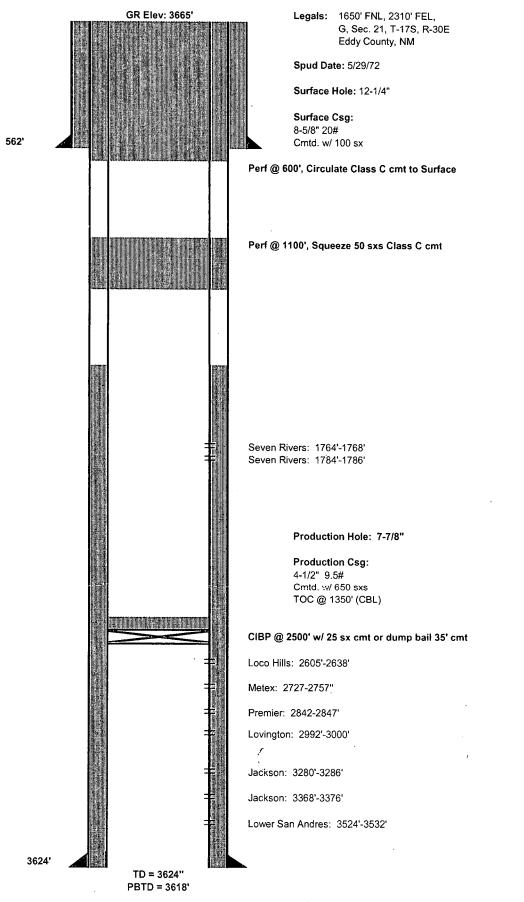

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat - Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted

