

OCT 02 2002

alsi
[Signature]

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO.
30-005-63104


Indicate Type of Lease
STATE FEE

State Oil & Gas Lease No.

Lease Name or Unit Agreement Name
Ramos FEE

Well No.
1

Pool name or Wildcat
Long Arroyo, Dev., NE

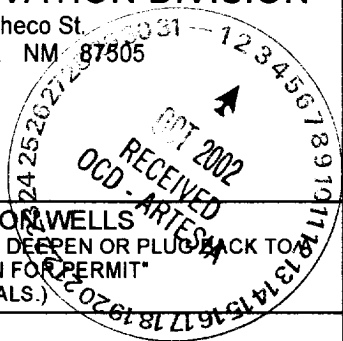

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

Type of Well:
OIL WELL GAS WELL OTHER

Name of Operator
Marbob Energy Corporation

Address of Operator
P.O. Box 227 Artesia, N.M. 88210

Well Location
Unit Letter G : 330 Feet From The North Line and 2486 Feet From The East Line
Section 33 Township 12S Range 28E NMPM Chaves County

Elevation (Show whether DF, RKB, RT, GR, etc.)
3607' GR

11 Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ANBANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Notify OCD 24 Hrs. before starting plugging

1. POH w/ tubing
2. Set 5 1/2 CIBP @ 8100 (perf 8169 - 8184) cap w/ ^{35'} 30' cmt.
3. Spot ~~100'~~ plug @ 7226' ^{25 SX ← 25 SX @ 6091'}
4. Spot ~~100'~~ plug @ ~~4257'~~ ^{25 SX @ 5155'} ← 25 SX @ 2924'
5. Spot 100' plug @ 1680 (8 5/8 shoe @ 1630) woc tag
6. Spot 100' plug @ 365' (13 3/8 shoe @ 311) woc tag
7. Spot 60' plug from 60' to surface
8. Cut off well head install dry hole marker

Salt gel mud consisting of 10#
Brine W/25# of gel per bbl
must be placed between each plug

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *[Signature]* TITLE PRODUCTION ANALYST DATE 10/2/02

TYPE OR PRINT NAME TELEPHONE NO.

(This space for State Use)

APPROVED BY *[Signature]* TITLE *[Signature]* DATE OCT 11 2002

CONDITIONS OF APPROVAL, IF ANY: