


STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

U.S. CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.O.S.	
LAND OFFICE	
OPERATOR	1

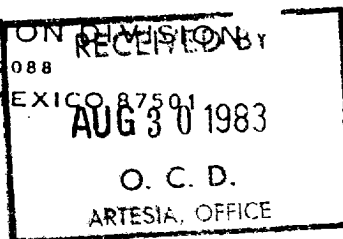

5a. Indicate Type of Lease	
State ☒	For ☐
5. State Oil & Gas Lease No.	
E-4397	

SUNDARY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☐ OIL WELL ☐ GAS WELL ☐ OTHER- <u>Water Injection</u>		7. Unit Agreement Name <u>East Millman Pool Ut. Tr.</u>
2. Name of Operator <u>Sun Exploration and Production Company</u> ✓		8. Farm or Lease Name
3. Address of Operator <u>P.O. Box 1861, Midland, Texas 79702</u>		9. Well No. <u>1</u>
4. Location of Well UNIT LETTER <u>I</u> , <u>1650</u> FEET FROM THE <u>South</u> LINE A <u>990</u> FEET FROM THE <u>East</u> LINE, SECTION <u>12</u> TOWNSHIP <u>19-S</u> RANGE <u>28-E</u> N.M.P.M.		10. Field and Pool, or Wildcat <u>Millman (Q-G) East</u>
15. Elevation (Show whether DF, RT, GR, etc.) <u>GR 3375'</u>		12. County <u>Eddy</u>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☒	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING O-N-S. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MIRU Pu an OTIS WL. Set blanking plug in OSTSD (1.448 NO-GO)
at 1564' test tbg. to 1000#. Check annulus for communication.
If tbg and csg communicated, install BOP, RLSE 2 3/8 CL tbg. and POH. (lease plug in place.)
Replace bad tbg. and run back in hole w/ 2 3/8 CL tbg. Circ annulus w/ 9# brine containing
10 gals KW-79/100 bbls. latch on to OSTSD, test rbg, OTIS retrieve blanking plug,
return will to injection.
If tbg test okay, retrieve blanking plug, rlse pkr and POH.
Redress PKR, RIH w 2 3/8 CL tbg. and OTIS PKR to 1565. Circ annulus w/9# brine containing
10 Gals KW-79/100 BBLs, set PKR and return will to injection.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Dee Ann Kemp TITLE Sr. Acct. Asst. DATE 8-29-83
APPROVED BY M. H. Walker TITLE OIL AND GAS INSPECTOR DATE AUG 31 1983
CONDITIONS OF APPROVAL, IF ANY: