

**Dudley Cornell A 001**

Dakota  
API # 30-045-08661  
T-29N, R-12-W, Sec. 1  
San Juan County, New Mexico

**History**

11/15/60: Spud Date  
12/12/60: Completion Date  
9/9/75: Repaired Casing leak and Installed tubing w/ pkr.  
No record or leak location (Procedure states that  
150 sx cement was planned to squeeze leak.)  
FDA comments: Casing leak @ 3996-4090'.  
2 3/8" tubing @ 6488'  
4/20/12: Changed master valve. Swabbed well  
for ~3 days. Treated for paraffin. Recovered ~18 bbls.

OIL CONS. DIV DIST. 3

DEC 18 2015


**Formation Tops**

Ojo Alamo  
Kirtland/Fruitland  
Pictured Cliffs  
Mesaverde  
Gallup  
Dakota

**Dakota Perforations**

6434-6438'	6446-6451'
6518-6534'	6564-6568'
6585-6587'	6601-6603'

Frac'd 135,000# 20/40 sand, & 90,000 gal wtr.

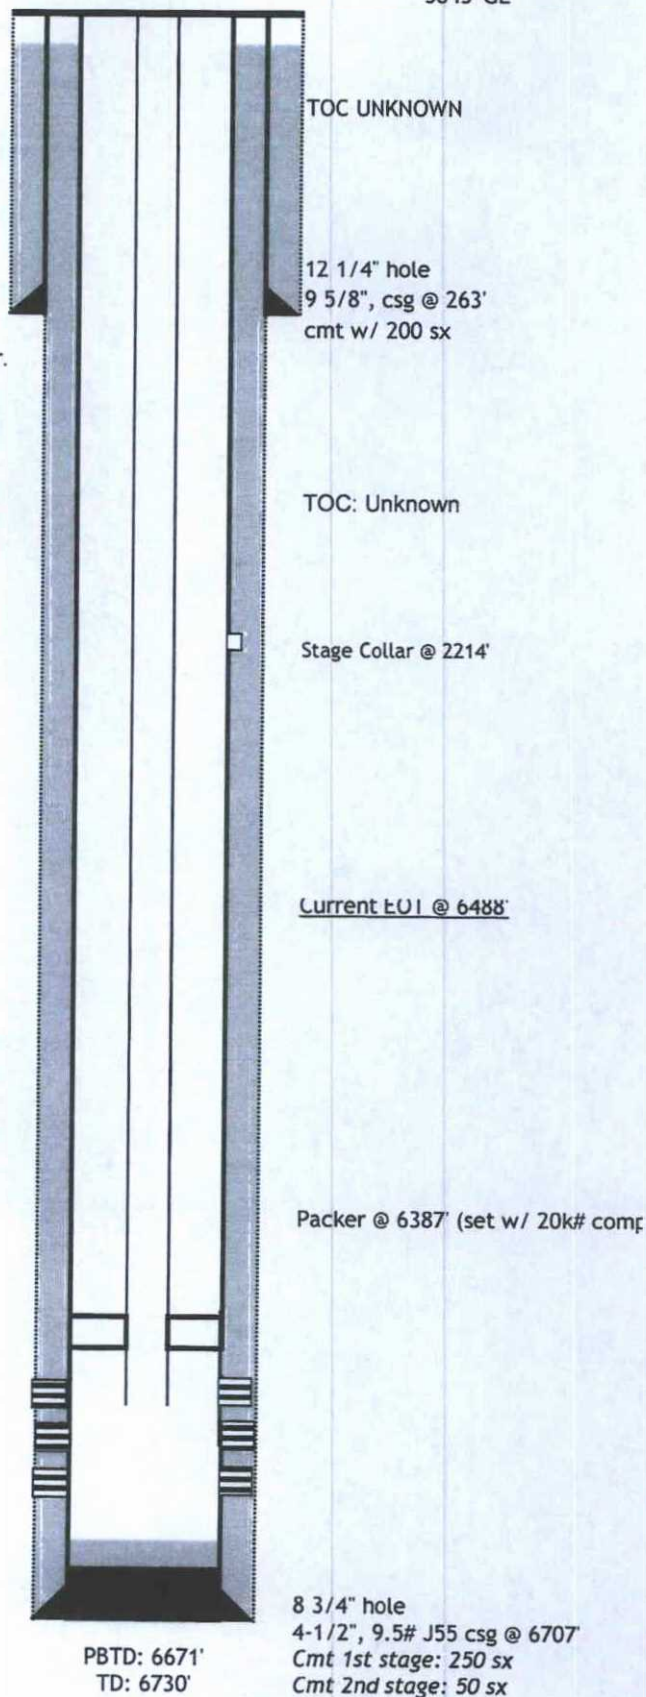

AA (4/5/11)