Form 3160-5 (August 2007)

2. Name of Operator

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED

6. If Indian Allottee or Tribe Name

	OMB No. 1004-0137
	Expires: July 31, 2010
0 166	0.

5. Lease Serial Y

NMNM021123

	Do not use this form for proposals to drill or to re-enter an	
	abandoned well. Use Form 3160-3 (APD) for such proposals	2
	SUBMIT IN TRIPLICATE - Other instructions on page 2.	2
e of Well		Q

Hilcorp Energy Company

If Unit of CA/Agreement, Name and/or No. 8. Well Name and No. 9. API Well No. 30-045-10881

3a. Address 382 Road 3100, Aztec, NM 87410

Oil Well

3b. Phone No. (include area code) 10. Field and Pool or Exploratory Area 505-599-3400 **BLANCO MESAVERDE**

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

X Gas Well

11. Country or Parish, State

Unit L (NWSW) 1650' FSL & 990' FWL, Sec. 08, T31N, R12W

Other

San Juan **New Mexico**

12 CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE REPORT OR OTHER DATA

12. CILCOL TIL ALTROPHIATE BOX(ES) TO INDICATE NATORE OF NOTICE, REPORT OR OTHER DATA									
TYPE OF ACTION									
Acidize	Deepen	Production (Start/Resume)	Water Shut-Off						
Alter Casing	Fracture Treat	Reclamation	Well Integrity						
Casing Repair	New Construction	X Recomplete	Other						
Change Plans	Plug and Abandon	Temporarily Abandon							
Convert to Injection	Plug Back	Water Disposal							
	Acidize Alter Casing Casing Repair Change Plans	Acidize Deepen Alter Casing Fracture Treat Casing Repair New Construction Change Plans Plug and Abandon	TYPE OF ACTION Acidize Deepen Production (Start/Resume) Alter Casing Fracture Treat Reclamation Casing Repair New Construction X Recomplete Change Plans Plug and Abandon Temporarily Abandon						

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once Testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

Hilcorp Energy Company requests permission to recomplete the subject well in the Mesaverde and downhole commingle with the existing Dakota. Please see the attached procedure, wellbore diagram, plat and GCP. A closed loop system will be used. Interim reclamation will be performed after surface disturbing activities.

Notify NMOCD 24 hrs prior to beginning operations

NMOCD

HOLD CTON FOR DITC

ILL 1 9 2019

DISTRICT III

SEE ATTACHED FOR **CONDITIONS OF APPROVAL**

I hereby certify that the foregoing is true and correct. Name (Printed/Typed)

Amanda Walker

entitle the applicant to conduct operations thereon

Operations/Regulatory Technician - Sr.

6/3/2019

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would

Title

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

OCD Permitting

Form C-102 August 1, 2011

Permit 268162

1625 N. French Dr., Hobbs, NM 88240

Phone:(575) 393-6161 Fax:(575) 393-0720 **District II**

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 **District III**

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170 **District IV**

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

WELL LOCATION AND ACREAGE DEDICATION PLAT

1. API Number 30-045-10881	2. Pool Code 72319	3. Pool Name BLANCO-MESAVERDE (PRORATED GAS)
4. Property Code	5. Property Name	6. Well No.
325106	LEEDS	001
7. OGRID No.	8. Operator Name	9. Elevation
372171	HILCORP ENERGY COMPANY	6009


10. Surface Location

UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County	
L	8	31N	12W		1650	S	990	W	SAN JU	AN

11. Bottom Hole Location If Different From Surface

UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County
Walter District Colored Colored Processing	12. Dedicated Acres 320.00		13. Joint or Infill		14. Consolidation Code			15. Order No.	

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

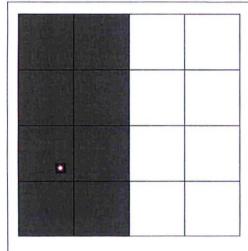

OPERATOR CERTIFICATION

I hereby certify that the information contained herein is true and complete to the best of my knowledge and belief, and that this organization either owns a working interest or unleased mineral interest in the land including the proposed bottom hole location(s) or has a right to drill this well at this location pursuant to a contract with an owner of such a mineral or working interest, or to a voluntary pooling agreement or a compulsory pooling order heretofore entered by the division.

E-Signed By: Amanda Walker

Title: Operations/Regulatory Tech Sr.

Date: 6/3/2019

SURVEYOR CERTIFICATION

I hereby certify that the well location shown on this plat was plotted from field notes of actual surveys made by me or under my supervision, and that the same is true and correct to the best of my belief.

Surveyed By:

James P. L

Date of Survey:

4/5/1960

Certificate Number:

1463



LEEDS 1 MESA VERDE RECOMPLETION SUNDRY

API#:


3004510881

JOB PROCEDURES

- ✓ NMOCD
 ✓ BLM
- Contact OCD and BLM (where applicable) 24 hrs prior to MIRU or running MITs. Record and document all casing pressures dally, Including BH, IC (if present) and PC. Comply with all NMOCD, BLM (where applicable), and HEC safety and environmental regulations.
- 1. MIRU workover rig and associated equipment; NU and test BOP.
- 2. TOOH with 2" tubing set at 6,988'.
- 3. Set a 5-1/2" cast iron bridge plug at +/- 6,873' to isolate the Dakota
- Load hole with fluid, PT the csg to 600 psi and run a CBL on the 5-1/2" casing. Verify cement bond within the Mesa Verde and confirm TOC. Review CBL results with the regulatory agencies and perform cmt remediation, as required.
- 5. Perform a witnessed MIT test on the csg with the appropriate regulatory agencies to 600 psi
- 6. Set a 5-1/2" cast iron bridge plug at +/- 5,315' to provide a base for the frac.
- 7. Perforate the Mesa Verde. (Top perforation @ 4,018', Bottom perforation @ 5,215')
- 8. RIH w/ BHA (frac string, packer, burst disc sub), set packer @ ~3,918'.
- 9. ND BOPs, NU frac stack. PT frac stack to 9,000#. PT frac string to 9,000#, PT backside to 300# (to insure packer is set). NOTE: frac string is 2-7/8" 6.5# P110 with BTS-8 connections. PT is to max anticipated treating pressure (~60% of burst)
- 10. Break disc with slickline
- 11. Frac the Mesa Verde in 1-2 stages down the frac string.
- 12. Flowback well for 1-3 days as required
- 13. MIRU workover rig. Nipple down frac stack, nipple up BOPs and test.
- 14. Release packer and POOH w/ frac string
- 15. TIH w/ mill and clean down to the top of the base of frac plug at 5,315'. Take Mesa Verde gas samples and send for analysis
- 16. Drill out base of frac plug and cleanout to DK isolation plug at 6,873'. POOH.
- 17. Drill out Dakota isolation plug and cleanout to PBTD of 7,050°. TOOH.
- 18. TIH and land production tubing. ND BOPs and NU tree. Pump off expendable check.
- 19. RDMO. Get a commingled Dakota/Mesa Verde flow rate.



HILCORP ENERGY COMPANY LEEDS 1 MESA VERDE RECOMPLETION SUNDRY

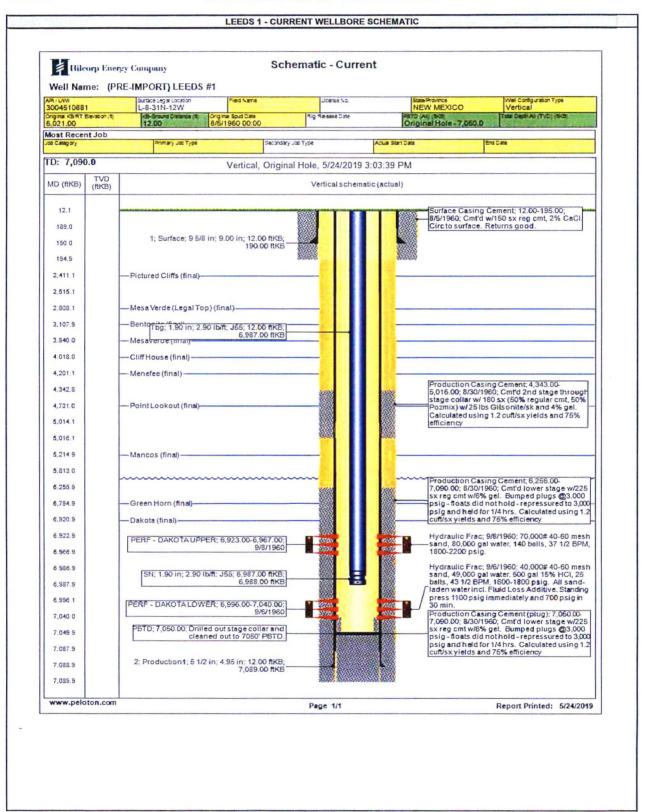

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intent to Recomplete & Commingle

Well:

. . . .

Leeds 1 30-045-10881

CONDITIONS OF APPROVAL

1. Contact BLM Inspection and Enforcement @ (505) 564 - 7750, 24 hours prior to conducting MIT work so an inspector can be present to witness the MIT.

Contact John Hoffman, Petroleum Engineer @ (505) 564 – 7742 to discuss any failed MIT results and/or your remedial action and isolation plans.

Submit the electronic copy of the MIT Test Chart and CBL for verification to the following addresses: jhoffman@BLM.gov and Brandon.Powell@state.nm.us.

- 2. The following modifications to your recompletion program are to be made:
 - a) Upon rigging up, record Bradenhead pressure and monitor same during recompletion operations. Notify BLM and NMOCD if anomalous pressure changes occur. Provide monitoring results in the subsequent Report of Operations.
 - b) Casing pressure test for fracture stimulation operations cannot exceed the internal yield strength of the casing including a 20% safety factor unless a waiver is granted. Stimulation operations cannot exceed this test pressure.
 - c) CIBP for base of fracture stimulation to be set less 50' above top existing perforation.
- 3. File well test and recompletion results within 30 days of completing recompletion operations.