

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-B1424.

5. LEASE DESIGNATION AND SERIAL NO.

NOO-C-14-20-5321

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Navajo Tribe "BT"

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Yah-Teh-Hey (Wildcat)

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 16, T25N, R18W

12. COUNTY OR PARISH 13. STATE

San Juan New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

TEXACO, Inc.

3. ADDRESS OF OPERATOR

P. O. Box EE, Cortez, Colorado 81321

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.)
At surface

NE $\frac{1}{4}$ NE $\frac{1}{4}$ Sec. 16

660' FNL & 660' FEL, Sec. 16

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5669' GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETION ☐

ABANDON* ☒

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☐


(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

This well was completed shut-in., uneconomical to produce.

Abandonment procedure:

Run free point survey. Cut & recover 7" casing. Cut packer off @ 6728' & squeeze 30 sacks cement 6750' to TD to cover all perfs. Fill with mud. Spot 50 sacks cement across top of 7" casing stub. Fill hole with mud. Spot 100 sacks cement from 4200' to 4350' (top DeChelly). Fill hole with mud. Spot 100 sacks cement 2450' to 2600' (top Todilito). Fill hole with mud. Set cement retainer at 1570' (above bottom of 9-5/8" surface pipe at 1620'). Displace 100 sacks cement through retainer with tubing. Fill hole with mud. Spot 10 sacks cement at surface and erect standard dry hole marker.

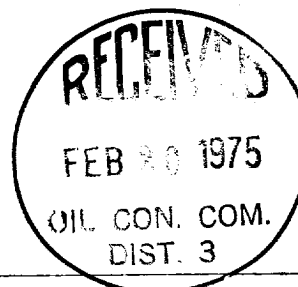

18. I hereby certify that the foregoing is true and correct

SIGNED

Alvin R. Marx

TITLE **Field Foreman**

DATE **2-19-75**

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side