

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 077085

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Omter

9. WELL NO.

4

10. FIELD AND POOL, OR WILDCAT

Fulcher-Kutz

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Unit L, Sec. 26, T28N, R10W

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

1.

OIL ☐ GAS ☒
WELL WELL OTHER

2. NAME OF OPERATOR

Tenneco Oil Company

3. ADDRESS OF OPERATOR

1860 Lincoln, Suite 1200, Denver, Colorado 80203

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)

At surface

1650 FSL and 990 FWL

11. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5832 KB

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐

PULL OR ALTER CASING

☒

FRACTURE TREAT

☒

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

☒

ABANDON*

REPAIR WELL

☒

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐

REPAIRING WELL

☐

FRACTURE TREATMENT

☐

ALTERING CASING

☐

SHOOTING OR ACIDIZING

☐

ABANDONMENT*


☐

(Other)

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. MIRUPU and pull tubing.
2. Clean out hole to 1970' w/4 3/4" bit using gas.
3. Run 3 1/2" OD csg. to TD and cement. Tail in w/flac cement. Will use sufficient cement to circulate to surface. Displace cement w/500 gals. perf acid & 1% KCL water.
4. WOC 12 hrs. Run GR-N collar log from 100' to TD.
5. Perf. Pictured Cliff 10-20 holes.
6. Stimulate as necessary to establish commercial production.
7. Swab to clean up. Run 1" tubing. Connect well to sales line and run deliverability test.

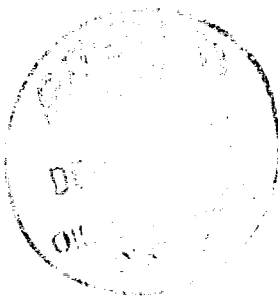

RECEIVED

DEC 12 1975

U. S. GEOLOGICAL SURVEY
WASHINGTON, D. C.

18. I hereby certify that the foregoing is true and correct

SIGNED

Paul J. Dicks

TITLE

Production Clerk

DATE

12-9-75

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side