


NO. OF COPIES RECEIVED	3
DISTRIBUTION	
SANTA FE	1
FILE	1 ✓
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

NEW MEXICO OIL CONSERVATION COMMISSION

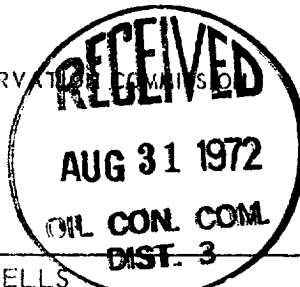

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease State <input type="checkbox"/> Federal <input type="checkbox"/>	
8. State Oil & Gas Lease No.	
7. Unit Agreement Name	
8. Farm or Lease Name Riddle B	
9. Well No. 2	
10. Field and Pool, or Wildcat Blanco Mesa Verde	
12. County San Juan	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator El Paso Natural Gas Company
3. Address of Operator PO Box 990, Farmington, NM 87401
4. Location of Well UNIT LETTER <u>H</u> , <u>1650</u> FEET FROM THE <u>North</u> LINE AND <u>890</u> FEET FROM THE <u>East</u> LINE, SECTION <u>23</u> TOWNSHIP <u>30N</u> RANGE <u>10W</u> NMPM.
15. Elevation (Show whether DF, RT, GR, etc.) 6299' DF

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <u>Case cement, perf & frac</u> <input checked="" type="checkbox"/>

SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

If order to increase production it is planned to workover and restimulate this well in the following manner:

Pull tubing, set a drillable bridge plug near the bottom of the 7" casing and pressure test to 1000 psi.

If tubing is stuck, cut off tubing approximately 100' below the 7" casing shoe, set a drillable cement retainer near the bottom of the 7" casing, squeeze the open hole with approximately 200 sks. of cement.

Pressure test the 7" casing to 1000 psi.

Isolate and squeeze cement any leaks. If leaks are squeezed near the base of the Ojo Alamo formation, no additional block squeeze of the 7" annulus is planned.

If there are no leaks near the base of the Ojo Alamo formation, perforate 2 squeeze holes at the base of the Ojo Alamo formation and block squeeze the 7" annulus with approximately 125 sks. of cement.

Clean out if hole conditions permit, otherwise sidetrack and redrill to approximately 5525'.

Run a full string of 4 1/2" production casing and sufficient amount of cement to tie into the 7" casing shoe. Selectively perforate and sand-water fracture the Mesa Verde formation.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Petroleum Engineer DATE August 29, 1972

APPROVED BY Original Signed by Emery C. Arnold TITLE SUPERVISOR DIST. #3 DATE AUG 31 1972

CONDITIONS OF APPROVAL, IF ANY: