

				1 1			
		OCI	-HOB	RC			
Form 3160-5 (June 2015)		UNITED STATES DEPARTMENT OF THE INTERIOR			FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018		
SUM	BUREAU OF LAND MANA	GEMENT			ial No.	IY 51, 2018	
Do not abandor	use this form for proposals to ned well. Use form 3160-3 (AP	drill or to re-enter D) for such propos	an BB	6. If Indian,	Allottee or Tr	ibe Name	
SUBA	NDRY NOTICES AND REPO use this form for proposals to bed well. Use form 3160-3 (AP MIT IN TRIPLICATE - Other ins	tructions on page	2	302017 7. If Unit or	CA/Agreeme	nt, Name and/or	
1. Type of Well			MA	RENED 8. Well Nam		·····	
Oil Well Gas Well Other     Contact: DAVID			RE			IDSON 31 FEDERAL 006	
CIMAREX ENERGY C	O OF COLORABOMail: DEYLER	MILAGRO-RES.COM		30-025-	31402		
3a. Address 600 N. MARIENFELD, SUITE 600 MIDLAND, TX 79701		3b. Phone No. (include area code) Ph: 432-687-3033			10. Field and Pool or Exploratory Area BUFFALO QUEEN		
4. Location of Well (Footag	1)		11. County or Parish, State				
Sec 29 T18S R33E SV	VSE 560FSL 1880FEL			LEA CO	OUNTY, NM	1	
12. CHECK T	THE APPROPRIATE BOX(ES)	TO INDICATE NA	ATURE O	OF NOTICE, REPORT,	OR OTHE	R DATA	
TYPE OF SUBMISSIC	DN	TYPE OF ACTION					
Notice of Intent	□ Acidize			Production (Start/]	INT TO DA TMA		
□ Subsequent Report	<ul> <li>Alter Casing</li> <li>Casing Repair</li> </ul>	Hydraulic New Cons		Reclamation Recomplete	mplete P&A NR		
Final Abandonment N							
	Convert to Injection			U Water Disposal			
<ul> <li>following completion of the testing has been completed. determined that the site is refunded to the site is refunded.</li> <li>1) SET 4-1/2" CIBP @</li> <li>2) PUMP 70 SXS.CMT</li> <li>3) PUMP 25 SXS.CMT</li> <li>4) PERF. X ATTEMPT</li> <li>5) PERF. X CIRC. TO</li> <li>6) DIG OUT X CUT OI</li> <li>CSGS. X INSTALL GF</li> <li>DURING THIS PROCI</li> </ul>	th the work will be performed or provid involved operations. If the operation re Final Abandonment Notices must be fi- eady for final inspection. 4,350'; PUMP 25 SXS.CMT. @ T. @ 3,362'-2,716'(T/YATES,B/S T. @ 1,421'-1,311'(T/ANHY.); We TO SQZ. 40 SXS.CMT. @ 478 SURF., FILLING ALL ANNULI, FF WELLHEAD 3' B.G.L.; VERIF ROUND LEVEL DRY HOLE MAR EDURE WE PLAN TO USE THE POSAL, PER OCD RULE 19.15.	esults in a multiple comp led only after all require 4,350'-4,100'; CIRO ALT); WOC X TAG OC X TAG CMT. PL '-378'(8-5/8"CSG.Sf 35 SXS.CMT. @ 10 FY CMT. TO SURF. RKER. E CLOSED-LOOP S	letion or rec nents, inclu CMT. PLU UG. IOE); WO 0'-3'. ON ALL A	ompletion in a new interval, a ding reclamation, have been of JG. IC X TAG. ANNULI; WELD ON STE	Form 3160-4 ompleted and	must be filed of the operator has	
			C	SEE ATTACH		-	
14. I hereby certify that the for	Electronic Submission	IERGY CO OF COLO	RADO, sei	nt to the Hobbs			
Name (Printed/Typed) DA	AVID A EYLER	Title	AGEN			1	
Signature (El	lectronic Submission)	Date	04/13/2	APPROVE	D	-	
	THIS SPACE F	OR FEDERAL OF	STATE	OFFICE USE			
		Title		MAY 16,2017	2	Date	
Approved By							
certify that the applicant holds le	re attached. Approval of this notice doe gal or equitable title to those rights in the t to conduct operations thereon	es not warrant or ne subject lease		PR Swart	EMENT		
Conditions of approval, if any, a certify that the applicant holds le which would entitle the applican Title 18 U.S.C. Section 1001 and	gal or equitable title to those rights in the	es not warrant or he subject lease Offi a crime for any person k	e <b>BUF</b> owingly an	PR Swart, REAU OF LAND MANAG CARLEBAD RIELD OFF	EMENT Gent or age	ency of the Unite	

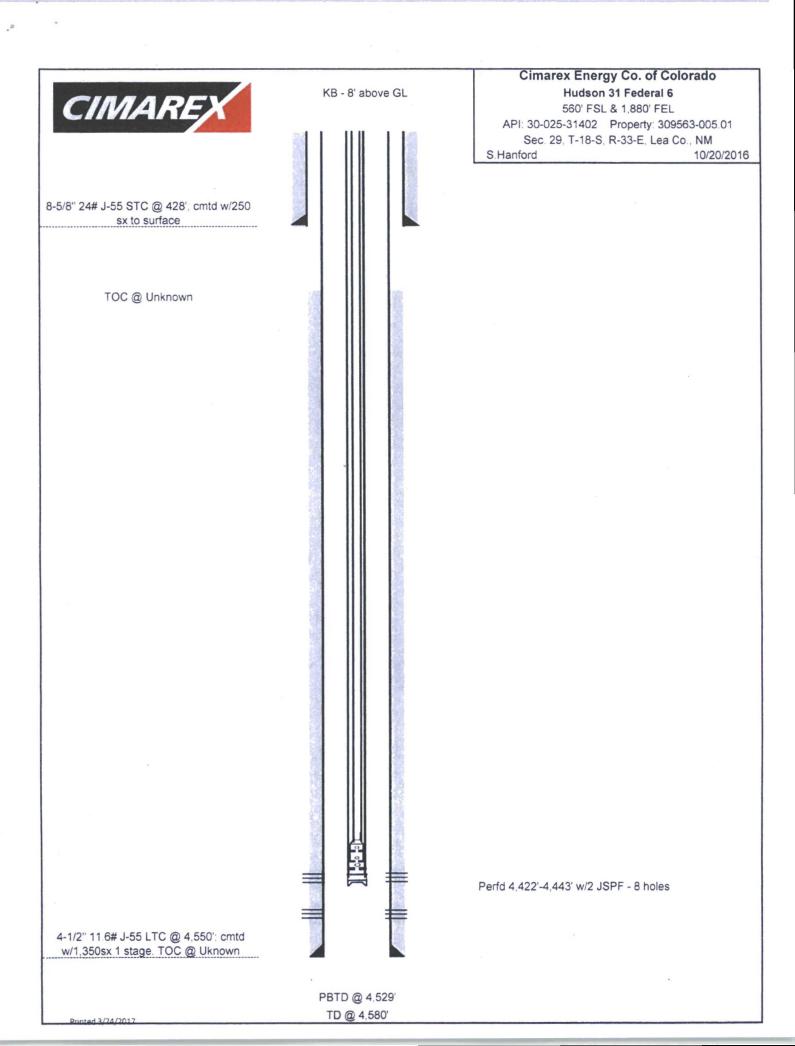

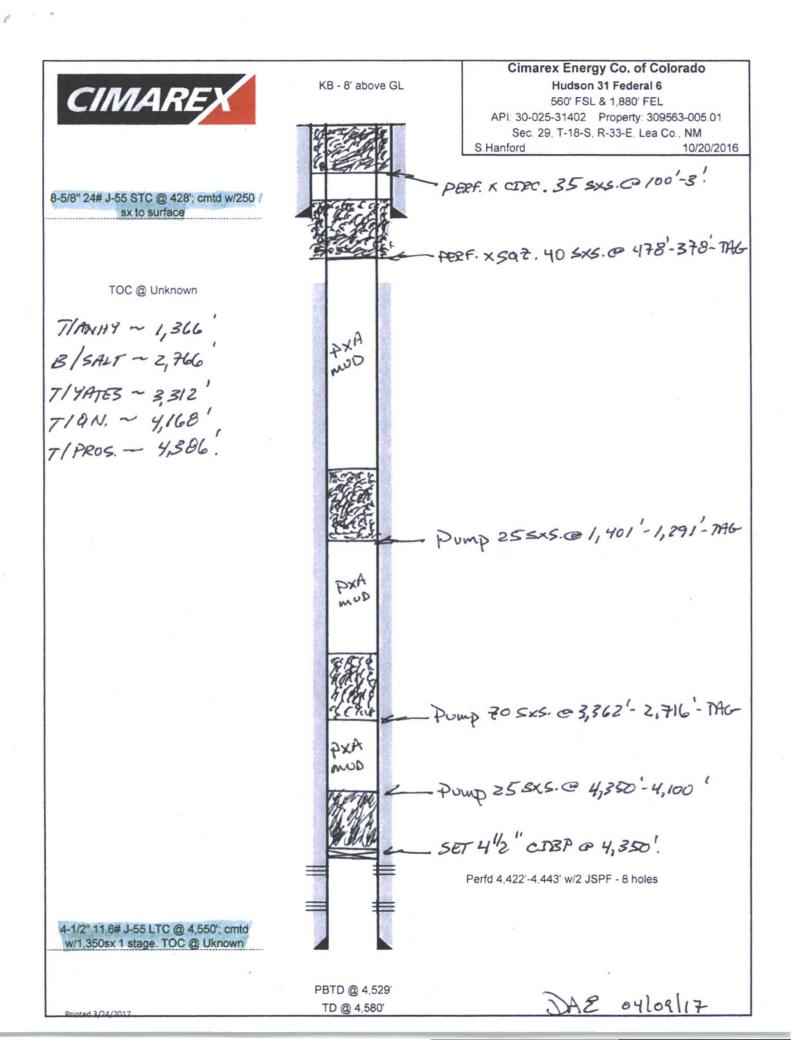

## **Conditions of Approval**

# Cimarex Energy Co. of Colorado HUDSON 31 FEDERAL-6, API 3002531402 T18S-R33E,29.560s1880e May 17, 2017

- 1. Operator is required to have the BLM approved NOI procedure with applicable conditions of approval on location during this workover operation.
- 2. Due to being within the Lesser Prairie Chicken habitat, this workover activity will be restricted to the hours of 9:00am through 3:00am for the period of March 1 through June 15.
- 3. Subject to like approval by the New Mexico Oil Conservation Division.
- 4. <u>Notify 575-393-3612 Lea Co as work begins</u>. <u>Plugging procedures are to be witnessed</u>. If there is no response leave a voice mail with the API#, workover purpose, and a call back phone number.
- 5. Surface disturbance beyond the existing pad must have prior approval.
- 6. A closed loop system is required. The operator shall properly dispose of drilling/circulating contents at an authorized disposal site. Tanks are required for all operations, no excavated pits.
- 7. Functional  $H_2S$  monitoring equipment shall be on location.
- 8. 2000 (2M) Blow Out Prevention Equipment to be used. All BOPE and workover procedures shall establish fail safe well control. Ram(s) for the work string(s) used is required equipment. Manual BOP closure system including a blind ram and pipe ram(s) designed to close on all (hand wheels) equipment shall be installed regardless of BOP design. Function test the installed BOPE to 500psig when well conditions allow. Related equipment, (choke manifolds, kill trucks, gas vent or flare lines, etc.) shall be employed when needed for reasonable well control requirements.
- 9. All waste (i.e. trash, salts, chemicals, sewage, gray water, etc.) created as a result of work over operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area. Porto-johns and trash containers will be on-location during any other crew-intensive operations.
- 10. The BLM PET witness is to run tbg tally and agree to cement volumes and placement. Sample each plug for cement curing time and tag and/or pressure test as requested by BLM PET witness.
- 11. Cementing procedure is subject to the next three numbered paragraphs.
- 12. Mix cement plugs to cover a minimum of 100ft plus 10ft for every 1,000ft to the bottom of the plug, rounding the number of necessary sacks up to the nearest 5 sacks. Never use less than 25sx. Examples: A cement plug set at 8000 in 7" casing would require a min of 35sx. A 25sx plug in 5 <sup>1</sup>/<sub>2</sub>" casing should cover 250ft, which may exceed 100ft plus 10ft per 1000ft.
- 13. Class H > 7500ft & C < 7500ft) cement plugs(s) will be necessary. For any plug that requires a tag or pressure test a minimum WOC time of 4 hours(C) & 8 hours(H) is recommended. Formation isolation plugs of Class "C" to be mixed 14.8#/gal, 1.32 ft<sup>3</sup>/sx, 6.3gal/sx water and "H" to be mixed 16.4#/gal, 1.06ft<sup>3</sup>/sx, 4.3gal/sx water.

- 14. Minimum requirement for mud placed between plugs is 25 sacks of salt water gel per 100 barrels in 9 lb/gal brine.
- 15. File subsequent sundry Form 3160-5 within 30 days of workover procedures. Submit the (BLM Form 3160-5 subsequent report (daily reports) via BLM's Well Information System; https://www.blm.gov/wispermits/wis/SP (email pswartz@blm.gov for operator setup instructions). Include (dated daily) descriptions of the well work, ie. procedure descriptions and setting depths of each plug in the subsequent sundry.
- 16. Wellbore plugging is to be accomplished within 90 days of approval.

### **Requirements for ground level dry hole markers**

### Well Identification Markers

The BLM Carlsbad Field Office (CFO) Conditions of Approval (COA) Requires that ground level dry hole markers placed on well within the Lesser Prairie Chicken habitat area. The dry hole markers will be to the following specifications. The operator will construct the markers as follows:

An 8 inch X 8 inch steel plate 1/8 to 3/16 of an inch thick is to be placed on the old dry hole marker stand pipe 2 inches from ground level, in the Lesser Prairie Chicken habitat area.

- Steel plate may be welded or bolted approximately 2 inches from ground level on the stand pipes. If plates are bolted to the stand pipe, the person installing the plate will be required to weld a pipe collar on the plate and place a minimum of two set screws/bolt on each collar. Aluminum data plates may be bolted with minimum ¼ inch bolt and locking nuts or self tapping fine threaded screws. A minimum of one in each corner is to be installed on each plate.
- 2. An 8 inch x 8 inch aluminum plate, which is 12 gauge or .080 sign material (1/8 inch aluminum plate may be used in place of the .080 plate) with the required information for that well stamped or engraved in a minimum 3/8 inch tall letter or number.
- 3. The following information will be stamped or engraved on the 8 inch X 8 inch aluminum plate in the following order.
  - a. First row: Operators name
  - b. Second row: Well name and number
  - c. Third row: Legal location to include <sup>1</sup>/<sub>4</sub> <sup>1</sup>/<sub>4</sub>, Section, Township, and range. If the legal location cannot be placed on one row it can be split into two rows with the <sup>1</sup>/<sub>4</sub> <sup>1</sup>/<sub>4</sub> (example: 1980 FNL 1980 FWL) being on the top row.

NMOCD Order No. R-12965 also required the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a ground level dry hole marker was installed as required in the COA's from the BLM.

### **Reclamation Objectives and Procedures**

#### In Reply Refer To: 1310

**Reclamation Objective:** At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as needed. This will apply to well pads, facilities, and access roads. Barricade all access road(s) at the starting point. If reserve pits have not been adequately reclaimed due to salts or other contaminants, propose a plan for BLM approval to provide restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations should have included adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For locations and/or access roads not having an approved plan, or an inadequate plan for surface reclamation the operator must submit a proposal describing the procedures for reclamation. The appropriate time for submittal would be when filing the Notice of Intent, or with the Subsequent Sundry Report of Abandonment on Form 3160-5. The final reclamation goal is to be completed within 6 months of wellbore abandonment.
- 3. With an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It may be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives.
- 4. Upon reclamation conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a BLM specialist to inspect the location to verify work was completed as per approved plans.
- 5. The BLM approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been tentatively reestablished. If the objectives have not been met BLM will be notify the operator of the required corrective actions.

- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time the full BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the full BLM objectives have been met, submit a Final Abandonment Notice (FAN) Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time a BLM specialist will again inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability for the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Environmental Protection Specialist 575-234-5909, 575-361-2648 (Cell)

Trishia Bad Bear Natural Resource Specialist 575-393-3612, 575-390-2258 (Cell)

Jesse Bassett Natural Resource Specialist 575-234-5913, 575-499-5114 (Cell)

Paul Murphy Natural Resource Specialist 757-234-5975, 575-885-9264 (Cell)

Henryetta Price Environmental Protection Specialist 575-234-5951, 575-706-2780 (Cell) Robertson, Jeffery Natural Resource Specialist 575-234-2230, 575-706-1920 (Cell)

Vance Wolf Natural Resource Specialist 575-234-5979

Brooke Wilson Natural Resource Specialist 575-234-6237

Arthur Arias Environmental Protection Specialist 575-234-6230, 575-499-3378 (Cell)

Shelly Tucker Environmental Protection Specialist 575-234-5905, 575-361-0084 (Cell)