Submit 1 Copy To Appropriate Dis	strict Office	State of No	ew Mexico			Т	Form C-103		
<u>District I</u> - (575) 393-6161	Energy.	Energy, Minerals and Natural Resources			Revised July 18,2013				
1625 N. French Dr., Hobbs, NM 88 District II - (575) 748-1283	3240				WELL API NO. 30.025.34782				
811 S. First St., Artesia, NM 88210	OIL C	OIL CONSERVATION DIVISION			e Type of L	ease			
<u>Disrtict III - (505)</u> 334-6178 1000 Rio Brazos Rd. Aztec, NM 8'	7410	1220 South S	t. Francis Dr.	ST	ATE 🗸	]	FEE		
<u>District IV - (505) 476-3460</u>		Santa Fe, NM 87505			6. State Oil & Gas Lease No.				
1220 S. St. Francis Dr., Santa Fe, N		OTS ON WEI	1 C	7 [ 2252 ]	Name or Un	it Agreeme	ant Nama		
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR DEEPEN OR PLUG BACK TO A DIFFERENT					7. Lease Name or Unit Agreement Name  New Mexico BZ State NCT-8				
RESERVIOR. USE "APPLICATION	ON FOR PERMIT" (FORM C-101) F	FOR SUCH PRO	POSALS.)		8. Well Number				
JI	Gas Well Other				#016				
2. Name of Operator	Apache Corporation	on		9. OGRII	9. OGRID Numer <b>873</b>				
3. Address of Operator	Apache Corporati	OII		10. Pool 1	10. Pool Name or Wildcat				
	ns Airpark Lane, Ste. 3000	0, Midland, 1	TX 79705	Te	Teague; Paddock-Blinebry				
4. Well Location Unit Letter	O : 330	feet from the	S line and	1980	feet from t	E	line		
Section	16 Township		Range 37E			County	LEA		
	11. Elevation (S)		OR, RKB,RT, GR, etc.	)					
	10 61 1 1 7		804' GR		1 5				
	12. Check Appropriate Bo	ox To Indicat		•					
· · · · · · · · · · · · · · · · · · ·	OF INTENTION TO:	upou 🗆		UBSEQUEN	_		• □		
PERFORM REMEDIAL WO TEMPORARILY ABANDON	RK PLUG AND ABA CHANGE PLANS		REMEDIAL WORK COMMENCE DRILLI	NG OPNS [	_ ALTERIN □ PANDA	IG CASIN	G ∐ □		
PULL OR ALTER CASING	MULTIPLE COM	_ =	CASING/CEMENT J	_	_				
DOWNHOLE COMMINGLE					_				
CLOSED-LOOP SYSTEM									
OTHER:			OTHER:						
	r completed operations. (C		_				-		
• • • •	osed work.) SEE RULE 19	.15.7.14 NM	AC. For Multiple (	Completions:	Attach we	ellbore dia	agram or		
proposed completion or r	ecompletion.								
	roposes to P&A the above		_	-			ystem will		
be used for	all fluids from this wellbo	ore and disp	osed of required b	y OCD Rule	19.15.17.1	4 NMAC.			
4" diameter 4' tall Marker SEE ATTACHED CO				CONDITION	S				
	4 diameter 4 tali Mari		OF APPROVAL	SONDITION	O				
Spud Date:			Rig Release Date:						
~pub 2 uto.			Tug Tieremse 2 mier	<u> </u>					
I hereby certify that the information above is true and complete to the best of my knowledge and belief.									
CICNIATIDE	Cuina a Bundea	TITLE	On Baalamatia		DATE	4.0	2/0/00		
SIGNATURE _	Guínn Burks	TITLE -	Sr. Reclamation	n Foreman	DATE -	12	2/2/20		
Type or print name	Guinn Burks	F-mail add			DIVOLUE				
· · · · · -			auinn hurke@ana	checorn com	PHUNE	/22.E	56-01/2		
For State Use Only	Guilli Burks	_ L-man add.	guinn.burks@apa	checorp.com	_PHONE:	432-5	556-9143		
For State Use Only APPROVED BY:	Kerry Fortner	TITLE	guinn.burks@apa  Compliance Off		_PHONE: _ DATE	432-5 1/13/21	556-9143		



 LEASE NAME
 NM BZ State NCT-8

 WELL #
 #016

 API #
 30.025.34782

 COUNTY
 LEA, NM

0

600

12 1/4" Hole 8 5/8" 24 # @ 1180' w/ 460 sx CIRC to surf

1200

1800

2400

3000

3600

4200

4800


- - - -

6000

5400

2 7/8" tbg @ 5827'

7 7/8" Hole 5 1/2" 17# @ 6000' w/ 1325 sx CIRC to surf

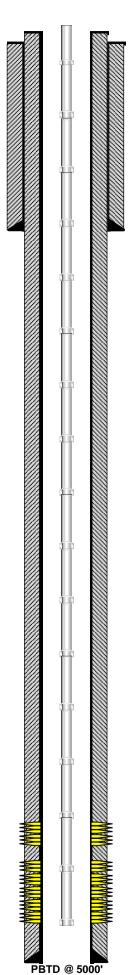

TD @ 6000'

Perfs @ 5026'-5222'

Perfs @ 5337'-5805'



 LEASE NAME
 NM BZ State NCT-8

 WELL #
 #016

 API #
 30.025.34782

 COUNTY
 LEA, NM

PROPOSED PROCEDURE

0

600

12 1/4" Hole 8 5/8" 24 # @ 1180' w/ 460 sx CIRC to surf

1200

1800

2400

3000

3600

4200


NOTE: Prior to MIRU P&A rig, a WO rig will MIRU & pull prod equipment & set two CIBP's to prep for P&A

CIBP @ 5000' w/no cmt

CIBP @ 5300' w/ 35' cmt

5400

7 7/8" Hole 5 1/2" 17# @ 6000' 6000 w/ 1325 sx CIRC to surf

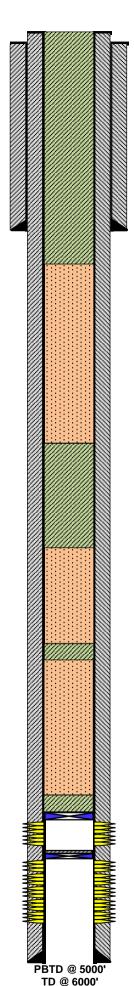

 PUH & spot 125 sx @ 1230' to surf, Fill up. (Surf Shoe, Rustler, Water Board, & Surf Plug)

3. PUH & spot 75 sx Class "C" cmt from 3180'-2478', WOC/TAG (Queen & Yates)

2. PUH & spot 25 sx Class "C" cmt from 3890'-3690', WOC/TAG (San Andres)

1. MIRU P&A rig, RIH w/ tbg & verify CIBP @ 5000', CIRC w/MLF & spot 25 sx Class "C" cmt from 5000'-4800'. (Paddock & Glorieta)

Perfs @ 5026'-5222'

Perfs @ 5337'-5805'

# CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

## Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be SO' below the bottom and 50' above the top of the Formation.

**21.** If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, woe and tagged. These plugs will be set SO' below formation bottom to 50' above formation top inside the casing.

## DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

### SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

#### SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III
1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 13743

#### **CONDITIONS OF APPROVAL**

Operator	:		OGRID:	Action Number:	Action Type:
	APACHE CORPORATION	303 Veterans Airpark Ln	873	13743	C-103F
#1000	Midland, TX79705				

OCD Reviewer	Condition
plmartinez	None