
Office	To Appropriate District: 12 1	M Stat	te of New Me	exico			Form C-103		
<u>District I</u> – (575	<u>District I</u> – (575) 393-6161 Energy, Minerals and Natural Resources				Revised July 18, 2013				
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283						WELL API NO. 30-015-32868			
811 S. First St.,	Ártesia, NM 88210		SERVATION		5. Indicate Type of Lease				
District III – (50 1000 Rio Brazo	05) 334-6178 os Rd., Aztec, NM 87410		South St. Fran		STAT	STATE X FEE			
District IV – (5	<u>District IV</u> – (505) 476-3460 Santa Fe, NM 8/505						e No.		
1220 S. St. Fran 87505	ncis Dr., Santa Fe, NM								
		CES AND REPORT			7. Lease Na	ne or Unit A	Agreement Name		
	THIS FORM FOR PROPOSA ESERVOIR. USE "APPLICA				James Ranch	Unit			
PROPOSALS.)		8. Well Nun	1						
1. Type of \	Well: Oil Well 🗶 🤇	Gas Well Oth	er		9. OGRID N	80			
2. Name of	Operator XTO Energy,	Inc.			005380	005380			
3. Address of	•				10. Pool nar	10. Pool name or Wildcat			
	liday Hill rd BLDG #5,	Midland TX 79707	7		Quahada Ridge; Delaware, Southeast				
4. Well Loc						. 0 . 1			
	t Letter B :		n the North			t from the			
Sec	tion 36	Townsh	1	inge 30E RKB, RT, GR, etc.	NMPM	Coun	ity Eddy		
		3318' C		KKD, KI, GK, etc.	′				
	12. Check A	ppropriate Box	to Indicate N	ature of Notice,	Report or O	ther Data			
	NOTICE OF INT	TENTION TO:		l que	SEQUENT	DEDOD-	T OE:		
PERFORM F	REMEDIAL WORK	PLUG AND ABAN	NDON X	REMEDIAL WOR			RING CASING 🗌		
TEMPORARILY ABANDON									
PULL OR ALTER CASING   MULTIPLE COMPL   CASING/CEMEI					T JOB [				
DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM					Notify OCI	24 hrs. prio	r to any work		
OTHER:	OOP SYSTEM			OTHER:	done				
	ribe proposed or comple								
	arting any proposed wor osed completion or reco		0.15.7.14 NMAC	C. For Multiple Co	mpletions: Att	ach wellbore	e diagram of		
prop	osed completion of reco	inpletion.							
XTO Energy,	Inc Respectfully submits noti	ce to Plug back the wel	ll above with the fol	lowing procedure below	v,				
	tbg and rods. RIH w/ 5-1/2" B				Tag. CIBP (	<b>2</b> 11046'			
	./2" BIBP to 10,472' w/ 35' cm -7/8" tubing @ 7289' Return t			Гаg.					
	. ,,, o								
	Г								
Spud	07/29/2003								
-									
I hereby certif	fy that the information al	bove is true and co	emplete to the be	est of my knowledg	ge and belief.				
SIGNATURE	Casoi Evans		TITLE Re	gulatory Analyst		DATE_	03/01/2021		
		=		cassia avons@	vtoeneray.com	DII:0:-	432 214 7887		
Type or print	name Cassie Evans		E-mail address	:cassie_evans@	Atochergy.com	_ PHONE: _	432.214.7887		
For State Use	<del>e Omy</del>								
APPROVED		el	TITLE	Staff Man	eager	_DATE	3/11/2021		
Conditions of	Approval (if any):			$\omega$	U				

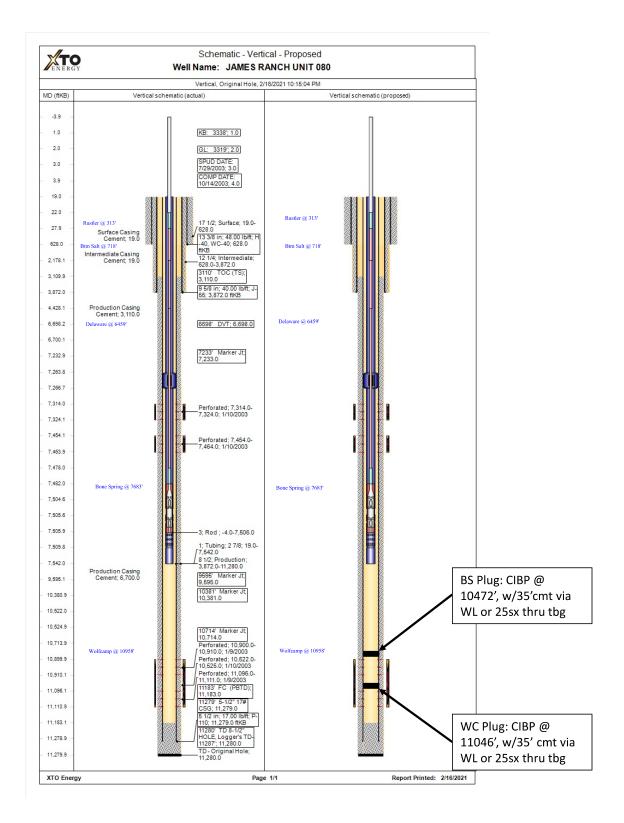

## CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- A notice of intent to plug and abandon a wellbore is required to be approved before plugging
  operations are conducted. A cement evaluation tool is required in order to ensure isolation of
  producing formations, protection of water and correlative rights. A cement bond log or other
  accepted cement evaluation tool is to be provided to the division for evaluation if one has not
  been previously run or if the well did not have cement circulated to surface during the original
  casing cementing job or subsequent cementing jobs. Insure all bradenheads have been
  exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
  - A) Fusselman
  - B) Devonian
  - C) Morrow
  - D) Wolfcamp
  - E)Bone Springs
  - F) Delaware
  - G) Any salt sections
  - H) Abo
  - I) Glorieta
  - J) Yates.
  - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

## **DRY HOLE MARKER REQUIRMENTS**

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III
1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

## **State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 20449

## **CONDITIONS OF APPROVAL**

Operator:		OGRID:	Action Number:	Action Type:
XTO PERMIAN O	PERATING LLC. 6401 HOLIDAY HILL ROAD	373075	20449	C-103F
BUILDING 5 MID	LAND, TX79707			

OCD Reviewer	Condition
gcordero	None