	y To Appropriate District	2	State of New M	exico		Form C-103
Office District I – (57	75) 393-6161	Energy, N	Minerals and Nat	ural Resources		Revised July 18, 2013
1625 N. Frenc	ch Dr., Hobbs, NM 88240				WELL API N	
District II – (5	575) 748-1283 t., Artesia, NM 88210	OIL CO	NSERVATIO1	N DIVISION		30-015-05019
District III - (:	505) 334-6178	122	0 South St. Fra	ncis Dr.	5. Indicate T	· · — —
1000 Rio Braz	zos Rd., Aztec, NM 87410		Santa Fe, NM 8		STAT	
	(505) 476-3460 ancis Dr., Santa Fe, NM		Janua I C, I VIVI C	77303	6. State Oil &	& Gas Lease No. E-5300
87505	anois Dr., Santa r e, ravi					E-3300
		ΓICES AND REP			7. Lease Nan	ne or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH						Constate
PROPOSALS.)					8. Well Num	iber #3
	Well: Oil Well	Gas Well 🔲 (Other			
2. Name of					9. OGRID N	
Rover Operating, LLC 3. Address of Operator					10 D 1	371484 W:11
3. Address		5 th St., Ste 700 Pla	no TV 75075		10. Pool nam	ie or wildcat burg Jackson; SR-QN-GB-SA
4 777 11 7		5 St., Ste /00 Fla	IIIO, 1 A / 30 / 3		(28309) Gray	burg Jackson, SK-QN-GB-SA
4. Well Lo					2 2	
	nit Letter:		om the <u>South</u>	line and <u>2310</u>		
Se	ction 36	Towns	1	ange 31E	NMPM	County Eddy
		11. Elevation	1	R, RKB, RT, GR, etc.,)	
			4090	5' GL		
						_
	12. Check A	Appropriate Bo	x to Indicate N	ature of Notice, F	Report or Oth	er Data
	NOTICE OF I	NITENTION T	O:	l QUID	SECHENT	REPORT OF:
PERFORM	REMEDIAL WORK			REMEDIAL WOR		TALFORT OF. ☐ ALTERING CASING ☐
	RILY ABANDON			COMMENCE DR		
	ALTER CASING			CASING/CEMEN	-]
	E COMMINGLE		J	O, toll to, ozilizit		
	OOP SYSTEM				1	CD 24 hrs. prior to any work
OTHER:				OTHER:	done	
		1 4 1 4	(Classiler state all a	4' 4 1 4 1 1	•	1-4 :11:4:41
	ribe proposed or comp					
of sta	arting any proposed wo	ork). SEE RULE				h wellbore diagram of
of sta		ork). SEE RULE				
of sta	arting any proposed wo	ork). SEE RULE completion.	19.15.7.14 NMA	C. For Multiple Com	pletions: Attac	h wellbore diagram of
of sta	arting any proposed wo	ork). SEE RULE completion.	19.15.7.14 NMA	C. For Multiple Com	pletions: Attac	
of sta	arting any proposed wo	ork). SEE RULE completion.	19.15.7.14 NMA	C. For Multiple Com	pletions: Attac	h wellbore diagram of
of sta propo 1. Prep loc down.	arting any proposed wo	ork). SEE RULE completion.	19.15.7.14 NMA	C. For Multiple Com	pletions: Attac	h wellbore diagram of
of sta propo 1. Prep loc down. 2. RU Wire	arting any proposed woosed completion or rec c. MIRU, POOH w/	ork). SEE RULE completion. rods and pump	19.15.7.14 NMAG	C. For Multiple Com	pletions: Attac	h wellbore diagram of
of sta propo 1. Prep loc down. 2. RU Wire 3. Set 5-1/	arting any proposed woosed completion or reconstant with the completion of reconstant with the completion of the complet	ork). SEE RULE completion. rods and pumpering. ering. 1/35' cmt, circ v	19.15.7.14 NMAG	C. For Multiple Com	pletions: Attac	h wellbore diagram of
of sta propo 1. Prep loc down. 2. RU Wire 3. Set 5-1/ 4. 40 sx 21	arting any proposed woosed completion or reconstant with the completion of reconstant with the completion of the completion of the completion with the completion of the completion with t	ork). SEE RULE completion. rods and pumpering. ring. 1/35' cmt, circ value.	19.15.7.14 NMAG	C. For Multiple Com	pletions: Attac	h wellbore diagram of
of star propo 1. Prep loc down. 2. RU Wire 3. Set 5-1/ 4. 40 sx 21 5. 80 sx 82	arting any proposed woosed completion or reconsed completion or reconsed. MIRU, POOH w/ peline, RIH w/ gauge 2" CIBP @ 3734' was 15' - 2215', P.S. & Teo' - 1020', P.S. & Teo' -	ork). SEE RULE completion. rods and pumpering. ring. rAG. TAG.	i9.15.7.14 NMAG , laying down, w/ P&A mud, t	C. For Multiple Com	pletions: Attac	h wellbore diagram of
of star propo 1. Prep loc down. 2. RU Wire 3. Set 5-1/ 4. 40 sx 21 5. 80 sx 82	arting any proposed woosed completion or reconstant with the completion of reconstant with the completion of the completion of the completion with the completion of the completion with t	ork). SEE RULE completion. rods and pumpering. ring. rAG. TAG.	i9.15.7.14 NMAG , laying down, w/ P&A mud, t	C. For Multiple Com	pletions: Attac	h wellbore diagram of
of sta propo 1. Prep loc down. 2. RU Wire 3. Set 5-1/ 4. 40 sx 21 5. 80 sx 82 6. 100 sx 4	arting any proposed woosed completion or reconsed completion or reconsed. MIRU, POOH w/ peline, RIH w/ gauge 2" CIBP @ 3734' was 15' - 2215', P.S. & Teo' - 1020', P.S. & Teo' -	ork). SEE RULE completion. rods and pumpering. r/35' cmt, circ variation. TAG. empt to circ cn	nt to surface. V	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP.	pletions: Attac . Release TAC	h wellbore diagram of
of sta propo 1. Prep loc down. 2. RU Wire 3. Set 5-1/ 4. 40 sx 21 5. 80 sx 82 6. 100 sx 4	arting any proposed woosed completion or reconsed completion or reconsed with the completion of reconsed with the completion of reconsed with the complete w	ork). SEE RULE completion. rods and pumpering. r/35' cmt, circ variation. TAG. empt to circ constall DHM. Cut	nt to surface. V	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP.	pletions: Attac . Release TAC	h wellbore diagram of
of sta propo 1. Prep loc down. 2. RU Wire 3. Set 5-1/ 4. 40 sx 21 5. 80 sx 82 6. 100 sx 4	arting any proposed woosed completion or reconsed completion or reconsed with the completion of reconsed with the completion of reconsed with the complete w	ork). SEE RULE completion. rods and pumpering. r/35' cmt, circ variation. TAG. empt to circ cn	nt to surface. V	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP.	pletions: Attac . Release TAC	h wellbore diagram of
of sta propo 1. Prep loc down. 2. RU Wire 3. Set 5-1/ 4. 40 sx 21 5. 80 sx 82 6. 100 sx 4	arting any proposed woosed completion or reconsed completion or reconsed with the completion of reconsed with the completion of reconsed with the complete w	ork). SEE RULE completion. rods and pumpering. r/35' cmt, circ variation. TAG. empt to circ constall DHM. Cut	nt to surface. V	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP.	pletions: Attac . Release TAC	h wellbore diagram of
of sta propo 1. Prep loc down. 2. RU Wire 3. Set 5-1/ 4. 40 sx 21 5. 80 sx 82 6. 100 sx 4 7. Cut off V	arting any proposed woosed completion or reconsed completion or reconsed with the completion of reconsed with the completion of reconsed with the complete w	ork). SEE RULE completion. rods and pumpering. ring. rAG. rAG. empt to circ constall DHM. Cut	nt to surface. V	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP. ors 3' below GL. F	pletions: Attac . Release TAC	h wellbore diagram of
of sta propo 1. Prep loc down. 2. RU Wire 3. Set 5-1/ 4. 40 sx 21 5. 80 sx 82 6. 100 sx 4	arting any proposed woosed completion or reconsed completion or reconsed completion or reconsed with the completion of the complete of the com	ork). SEE RULE completion. rods and pumpering. ring. rAG. rAG. empt to circ constall DHM. Cut	nt to surface. V	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP. ors 3' below GL. F	pletions: Attac . Release TAC	h wellbore diagram of
of sta propo 1. Prep loc down. 2. RU Wire 3. Set 5-1/ 4. 40 sx 21 5. 80 sx 82 6. 100 sx 4 7. Cut off V	arting any proposed woosed completion or reconsed completion of the	ork). SEE RULE completion. rods and pumpering. r/35' cmt, circ variation. TAG. empt to circ constall DHM. Cut before cut off	nt to surface. V	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP. ors 3' below GL. F	Pletions: Attac	th wellbore diagram of
of star proportion of star propo	arting any proposed woosed completion or reconsed completion of the comp	ork). SEE RULE completion. rods and pumpering. ring. rAG. rAG. empt to circ constall DHM. Cut before cut off COA's****	nt to surface. Very off mast anchors. Rig Release Da	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP. ors 3' below GL. F	. Release TAC OC & TAG. RD MO.	th wellbore diagram of
of star proportion of star propo	arting any proposed woosed completion or reconsed completion of the	ork). SEE RULE completion. rods and pumpering. ring. rAG. rAG. empt to circ constall DHM. Cut before cut off COA's****	nt to surface. Very off mast anchors. Rig Release Da	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP. ors 3' below GL. F	. Release TAC OC & TAG. RD MO.	th wellbore diagram of
of star proportion of star propo	arting any proposed woosed completion or reconsed completion or reco	ork). SEE RULE completion. rods and pump ering. //35' cmt, circ v TAG. FAG. empt to circ cn estall DHM. Cut before cut off O COA's**** above is true and	nt to surface. Very off mast anchors. Rig Release Da	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP. ors 3' below GL. F	. Release TAC OC & TAG. RD MO.	th wellbore diagram of
of star proportion of star propo	arting any proposed woosed completion or reconsed completion of the comp	ork). SEE RULE completion. rods and pump ering. //35' cmt, circ v TAG. FAG. empt to circ cn estall DHM. Cut before cut off O COA's**** above is true and	nt to surface. Very off mast anchors. Rig Release Da	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP. ors 3' below GL. F	DC & TAG. RD MO. UGGED BY 2 and belief.	th wellbore diagram of
of stapropole 1. Prep loc down. 2. RU Wire 3. Set 5-1/ 4. 40 sx 21 5. 80 sx 82 6. 100 sx 4 7. Cut off V Spud Date: ** I hereby certification of the standard standar	arting any proposed woosed completion or reconsed completion of the	ering. 2 ring. 2 ring. 3 rag. 4 rag. 5 rag. 5 rag. 6 rag. 7 ra	nt to surface. Very respectively. The surface of the surface of the surface of the surface of the surface. The surface of the	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP. ors 3' below GL. F te: MUST BE PL est of my knowledge Petroleum Engir	DC & TAG. RD MO. UGGED BY 2 and belief.	th wellbore diagram of the company o
of staproped 1. Prep lock down. 2. RU Wires 3. Set 5-1/4. 40 sx 21 5. 80 sx 82 6. 100 sx 4 7. Cut off V Spud Date: Type or print to standard proped Type or print to standard proped.	arting any proposed wo osed completion or reconsed completion of the completion of th	ering. 2 ring. 2 ring. 3 rag. 4 rag. 5 rag. 5 rag. 6 rag. 7 ra	nt to surface. Very respectively. The surface of the surface of the surface of the surface of the surface. The surface of the	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP. ors 3' below GL. F te: MUST BE PL est of my knowledge Petroleum Engir	DC & TAG. RD MO. UGGED BY 2 and belief.	th wellbore diagram of C, POOH tubing, laying
of stapropole 1. Prep loc down. 2. RU Wire 3. Set 5-1/ 4. 40 sx 21 5. 80 sx 82 6. 100 sx 4 7. Cut off V Spud Date: ** I hereby certification of the standard standar	arting any proposed wo osed completion or reconsed completion of the completion of th	ering. 2 ring. 2 ring. 3 rag. 4 rag. 5 rag. 5 rag. 6 rag. 7 ra	nt to surface. Very respectively. The surface of the surface of the surface of the surface of the surface. The surface of the	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP. ors 3' below GL. F te: MUST BE PL est of my knowledge Petroleum Engir	DC & TAG. RD MO. UGGED BY 2 and belief.	th wellbore diagram of the company o
of staproped 1. Prep lock down. 2. RU Wires 3. Set 5-1/4. 40 sx 21 5. 80 sx 82 6. 100 sx 4 7. Cut off V Spud Date: Type or print to standard proped Type or print to standard proped.	arting any proposed wo osed completion or reconsed completion of the completion of th	ering. 2 ring. 2 ring. 3 rag. 4 rag. 5 rag. 5 rag. 6 rag. 7 ra	nt to surface. Very off mast anchor of mast	C. For Multiple Com ND WH. NU BOP est to 500 psi. Wo erify ND BOP. ors 3' below GL. F te: MUST BE PL est of my knowledge Petroleum Engir	DC & TAG. RD MO. UGGED BY 2 and belief.	th wellbore diagram of the company o

Conditions of Approval (if any): Released to Imaging: 2/8/2023 3:06:45 PM

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - 1) Glorieta
 - J) Yates.
 - K) Cherry Canyon Eddy County
 - L) Potash---(In the R-111-P Area (Page 3 & 4), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

R-111-P Area

T 18S - R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

T 19S - R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A-F. Sec 27 Unit A,B,C,F,G,H.

T 19S - R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

T 19S - R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

T 20S - R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G.

T 20S - R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

T 20S - R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36.

T 21S - R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

T 21S - R 30E

Sec 1 – Sec 36

T 21S - R 31E

Sec 1 – Sec 36

T 22S - R 28E

Sec 36 Unit A,H,I,P.

T 22S - R 29E

Sec 1. Sec2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

T 22S - R 30E

Sec 1 – Sec 36

T 22S - R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

T 23S - R 28E

Sec 1 Unit A

T 23S - R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

T 23S - R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

T 23S - R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E.

T 24S – R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

T 24S - R 30E

Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.

T 24S - R 31E

Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.

T 25S - R 31E

Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

ROVER OPERATING, LLC WELLBORE DIAGRAM

Lease/Well No.: **CONSTATE No. 3 ELEVATION, GL:** 4,096 ft

Location: 2,310' FSL & 2,310' FEL


> UL: J, SEC: 36, T: 16-S, R:31-E FIELD: GRAYBURG-JACKSON; SR-QN-GB-SA

EDDY County, NM

LEASE No.: State Lse. E-5300 Spudded: 11/16/1961 API No.: 30-015-05019 Drlg Stopped: 12/4/1961 Completed: 12/22/1961

> ROTARY TOOLS LAT:

LONG:

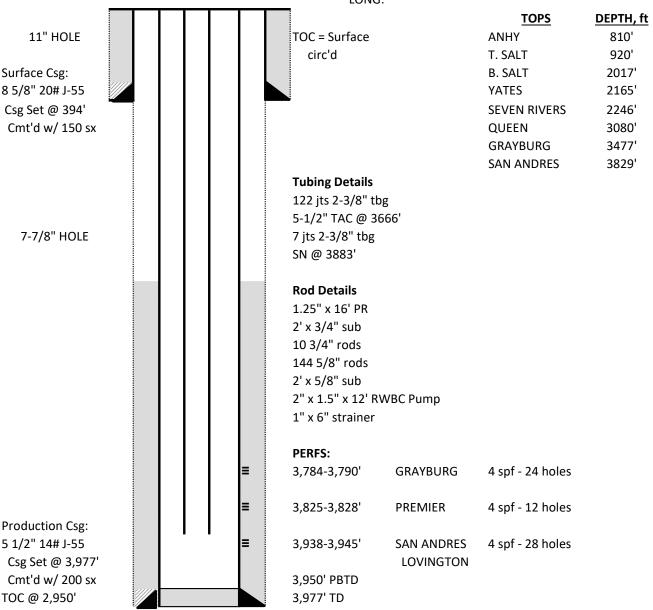

WBD CURRENT Released to Imaging: 2/8/2023 3:06:45 PM

ROVER OPERATING, LLC WELLBORE DIAGRAM

Lease/Well No.: **CONSTATE No. 3** ELEVATION, GL: 4,096 ft

Location: 2,310' FSL & 2,310' FEL

UL: J, SEC: 36, T: 16-S, R:31-E FIELD: GRAYBURG-JACKSON; SR-QN-GB-SA

EDDY County, NM


 LEASE No.:
 State Lse. E-5300
 Spudded:
 11/16/1961

 API No. :
 30-015-05019
 Drlg Stopped:
 12/4/1961

 Completed:
 12/22/1961

LAT:

LONG:

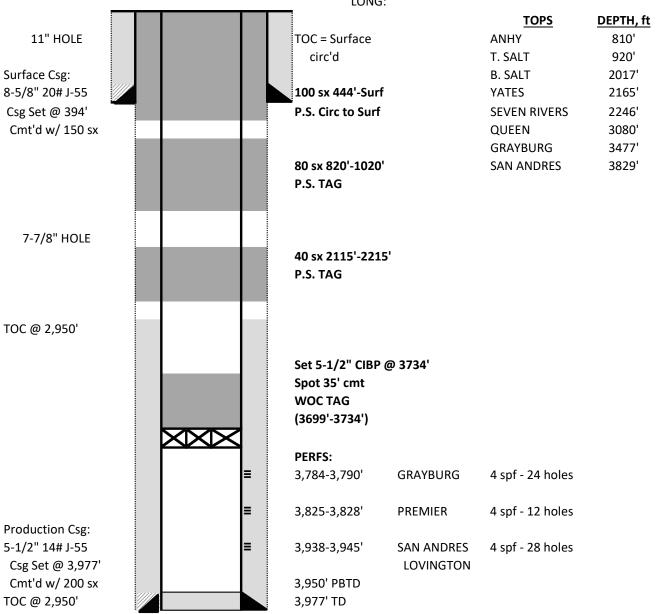

WBD PROPOSED
Released to Imaging: 2/8/2023 3:06:45 PM

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 183355

CONDITIONS

Operator:	OGRID:
ROVER OPERATING, LLC	371484
1255 W. 15th St.	Action Number:
Plano, TX 75075	183355
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
gcordero	None	2/8/2023