Office	State of New Mexico	Form C-103 of 1	
<u>District I</u> – (575) 393-6161 Ene: 1625 N. French Dr., Hobbs, NM 88240	rgy, Minerals and Natural Resources	Revised July 18, 2013 WELL API NO. 30-025-03200	
District II – (575) 748-1283 811 S. First St., Artesia, NM 88210	L CONSERVATION DIVISION	5. Indicate Type of Lease	
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr.	STATE X FEE	
District IV – (505) 476-3460	Santa Fe, NM 87505	6. State Oil & Gas Lease No.	
1220 S. St. Francis Dr., Santa Fe, NM 87505			
SUNDRY NOTICES AND (DO NOT USE THIS FORM FOR PROPOSALS TO DE		7. Lease Name or Unit Agreement Name	
DIFFERENT RESERVOIR. USE "APPLICATION FOI		Northeast Pearl Queen Unit	
PROPOSALS.) 1. Type of Well: Oil Well ☐ Gas Well	X Other	8. Well Number 20	
Name of Operator Breitburn Operating I		9. OGRID Number	
3. Address of Operator 1111 Bagby Street, S		370080	
Houston, TX 77002		Pearl Queen (49780)	
4. Well Location			
Unit Letter J : 1980	feet from the South line and	2180 feet from the East line	
Section 23	Township 19S Range 35E	NMPM Lea County	
11. Elev	ration (Show whether DR, RKB, RT, GR, etc.	2.)	
10 01 1 4	A December 11 to NI to COLD	D col D	
12. Check Appropria	ate Box to Indicate Nature of Notice	, Report or Other Data	
NOTICE OF INTENTIO	ON TO:	BSEQUENT REPORT OF:	
	ND ABANDON X REMEDIAL WOL		
TEMPORARILY ABANDON	E PLANS COMMENCE DF	RILLING OPNS. P AND A	
PULL OR ALTER CASING MULTIP	LE COMPL CASING/CEMEN	NT JOB	
DOWNHOLE COMMINGLE			
CLOSED-LOOP SYSTEM			
OTHER:	OTHER:		
	ations. (Clearly state all pertinent details, at RULE 19.15.7.14 NMAC. For Multiple Co	nd give pertinent dates, including estimated date	
proposed completion or recompletion		Simpletions. Attach wendore diagram of	
4,920' - Set CIBP in 2-7/8" tubing 20' above			
3,380' - Perf 2-7/8" Liner @ 3,380'. Attemp		ot exceed 500 psi on SQZ.	
2,980' - Mix, Spot, & attempt SQZ cmt plu	or f/ 3.380' - 2.980' in the 2-7/8" and 2-	-7/8" x 4-1/2" annulus w/ (6.0 bbls / 33 cuft/ 25 sx)	
Class "C" 1.32 yield cmt. WOC 4hrs. Tag		(0.0 - 1.1 -	
207' - Perf 2-7/8' & 4-1/2" Csg 50' below 8-	-5/8" csg shoe @ 207'. Attempt SQZ. Do no	ot exceed 500 psi on SQZ.	
Surface Casing Shoe Plug: Mix, Spot, & At bbls / 68 cuft / 51 sx) Class "C" 1.32 yield o	tempt SQZ cmt f/ 207' - Surface in the 2-7/	/8", 2-7/8" x 4-1/2" & 4-1/2" x 8-5/8" annuli w/ (12	
4" diameter 4' tall Above Ground Mar	<mark>ker</mark>	SEE ATTACHED CONDITIONS	
		OF APPROVAL	
Spud Date:	Rig Release Date:		
Space Batter	Ing release Bate.		
I hereby certify that the information above is tr	ue and complete to the best of my knowled	ge and belief.	
SIGNATURE SIGNATURE	TITLE Sr. Regulatory Analyst	DATE 03/01/2023	
Type or print name Lauri M. Stanfield	E-mail address: Lauri.Stanfield@m	navresources.com PHONE: 713-437-8052	
For State Use Only	_		
APPROVED BY: X	TITLE Compliance Officer A	DATE 3/2/23	
Conditions of Approval (if any):	575-263-6633		

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - 1) Glorieta
 - J) Yates.
 - K) Cherry Canyon Eddy County
 - L) Potash---(In the R-111-P Area (Page 3 & 4), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

R-111-P Area

T 18S - R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

T 19S - R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A-F. Sec 27 Unit A,B,C,F,G,H.

T 19S - R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

T 19S - R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

T 20S - R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G.

T 20S - R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

T 20S - R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36.

T 21S - R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

T 21S - R 30E

Sec 1 – Sec 36

T 21S - R 31E

Sec 1 – Sec 36

T 22S - R 28E

Sec 36 Unit A,H,I,P.

T 22S - R 29E

Sec 1. Sec2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

T 22S - R 30E

Sec 1 – Sec 36

T 22S - R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

T 23S - R 28E

Sec 1 Unit A

T 23S - R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

T 23S - R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

T 23S - R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E.

T 24S – R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

T 24S - R 30E

Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.


T 24S - R 31E


Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.

T 25S - R 31E

Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

Received by Opy P: Appropriate 3:11:40.	State of New Me	exico		Form C-103 of 10
District I – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals and Natural Resources		WELL API NO.	Revised July 18, 2013
<u>District II</u> – (575) 748-1283	OIL CONSERVATION DIVISION		30-025-03200	
811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178	1220 South St. Fran		5. Indicate Type of STATE X	
1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460	Santa Fe, NM 87		6. State Oil & Gas	
1220 S. St. Francis Dr., Santa Fe, NM 87505			o. State on & das	Lease 110.
	ICES AND REPORTS ON WELLS SSALS TO DRILL OR TO DEEPEN OR PL		7. Lease Name or	Unit Agreement Name
DIFFERENT RESERVOIR. USE "APPLI	CATION FOR PERMIT" (FORM C-101) FOR		Northeast Pearl Qu	een Unit
PROPOSALS.) 1. Type of Well: Oil Well	Gas Well X Other		8. Well Number	20
2. Name of Operator	Operating LP		9. OGRID Number 370080	er
3. Address of Operator 1111 Bag			10. Pool name or	Wildcat
	TX 77002		Pearl Queen (4978	
4. Well Location				
Unit Letter J :	1980 feet from the South	line and2	feet from	n the <u>East</u> line
Section 23	1	ange 35E	NMPM Lea	County
	11. Elevation (Show whether DR)	, RKB, RT, GR, etc.)	
12. Check	Appropriate Box to Indicate N	fature of Notice,	Report or Other l	Data
NOTICE OF IN	ITENTION TO:	l SUB	SEQUENT REF	PORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON 🖾	REMEDIAL WOR		ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DR	ILLING OPNS.	P AND A
PULL OR ALTER CASING	MULTIPLE COMPL	CASING/CEMEN	T JOB	
DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM				
OTHER:		OTHER:		
	oleted operations. (Clearly state all pork). SEE RULE 19.15.7.14 NMAC			
proposed completion or rec		. For Muruple Co	impletions. Attach w	enoore diagram of
	ng 20' above perforations. Dump bail	l 35' Cmt on top.		
3,380' - Perf 2-7/8" Liner @ 3,38	80'. Attemp to SQZ into 2-7/8" x 4-1	1/2" annulus. Do no	t exceed 500 psi on S	QZ.
2,980' - Mix, Spot, & attempt SO	QZ cmt plug f/ 3,380' - 2,980' in the		7/8" x 4-1/2" annulus	w/ (6.0 bbls / 33 cuft/ 25 sx)
	4hrs. Tag & Record. Isolates Yates			
207' - Perf 2-7/8' & 4-1/2" Csg 5	60' below 8-5/8" csg shoe @ 207'. At	ttempt SQZ. Do not	exceed 500 psi on S	QZ.
Surface Casing Shoe Plug: Mix,	Spot, & Attempt SQZ cmt f/ 207' -	Surface in the 2-7/8	", 2-7/8" x 4-1/2" &	4-1/2" x 8-5/8" annuli w/ (12
bbis / 68 cutt / 31 sx) Class "C"	1.32 yield cement. WOC 4 hrs. Tag	& Record.		
				\neg
Spud Date:	Rig Release Da	ate:		
I hereby certify that the information	shave is two and complete to the h	agt of my knowlode	o and haliaf	
i nereby certify that the information	above is true and complete to the o	est of my knowledg	ge and benef.	
SIGNATURE SIGNATURE	TITLE Sr. R	Regulatory Analyst	DA	TE 03/01/2023
=				
Type or print name Lauri M. Stan: For State Use Only	E-mail address	S: Lauri.Stanfield@ma	PH(ONE: <u>713-437-8052</u>
	mer c			
APPROVED BY: Conditions of Approval (if any):	TITLE		DAT	.E

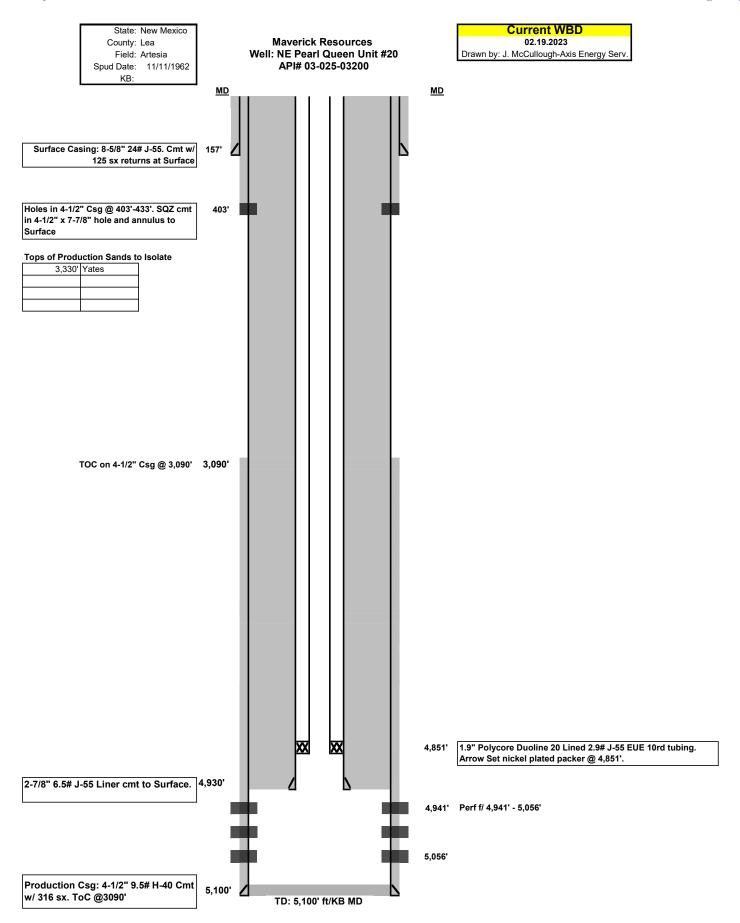

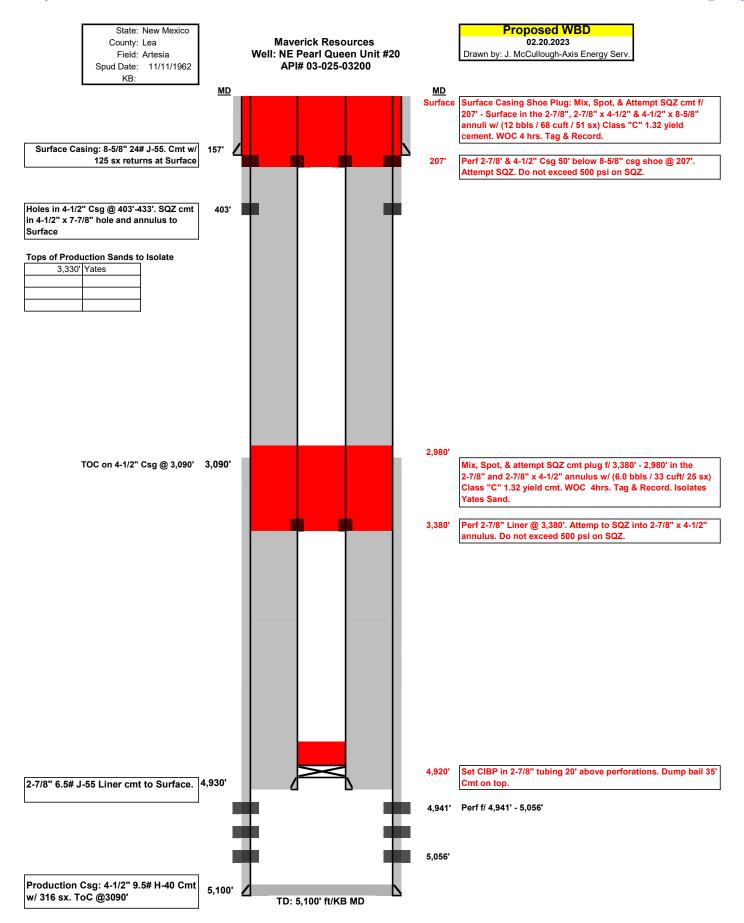

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 191849

COMMENTS

Operator:	OGRID:
BREITBURN OPERATING LP	370080
1111 Bagby St. Suite 1600	Action Number:
Houston, TX 77002	191849
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM	3/3/2023

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 191849

CONDITIONS

Operator:	OGRID:
BREITBURN OPERATING LP	370080
1111 Bagby St. Suite 1600	Action Number:
Houston, TX 77002	191849
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
kfortner	See attached COA	3/2/2023