

Form 3160-3
(June 2015)

FORM APPROVED
OMB No. 1004-0137
Expires: January 31, 2018

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
APPLICATION FOR PERMIT TO DRILL OR REENTER

1a. Type of work: <input type="checkbox"/> DRILL <input type="checkbox"/> REENTER		5. Lease Serial No.
1b. Type of Well: <input type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other		6. If Indian, Allottee or Tribe Name
1c. Type of Completion: <input type="checkbox"/> Hydraulic Fracturing <input type="checkbox"/> Single Zone <input type="checkbox"/> Multiple Zone		7. If Unit or CA Agreement, Name and No.
2. Name of Operator		8. Lease Name and Well No.
3a. Address		9. API Well No. 30-005-64396
3b. Phone No. (include area code)		10. Field and Pool, or Exploratory
4. Location of Well (Report location clearly and in accordance with any State requirements. *) At surface At proposed prod. zone		11. Sec., T. R. M. or Blk. and Survey or Area
14. Distance in miles and direction from nearest town or post office*		12. County or Parish
		13. State
15. Distance from proposed* location to nearest property or lease line, ft. (Also to nearest drig. unit line, if any)	16. No of acres in lease	17. Spacing Unit dedicated to this well
18. Distance from proposed location* to nearest well, drilling, completed, applied for, on this lease, ft.	19. Proposed Depth	20. BLM/BIA Bond No. in file
21. Elevations (Show whether DF, KDB, RT, GL, etc.)	22. Approximate date work will start*	23. Estimated duration
24. Attachments		

The following, completed in accordance with the requirements of Onshore Oil and Gas Order No. 1, and the Hydraulic Fracturing rule per 43 CFR 3162.3-3 (as applicable)

- | | |
|--|---|
| 1. Well plat certified by a registered surveyor. | 4. Bond to cover the operations unless covered by an existing bond on file (see Item 20 above). |
| 2. A Drilling Plan. | 5. Operator certification. |
| 3. A Surface Use Plan (if the location is on National Forest System Lands, the SUPO must be filed with the appropriate Forest Service Office). | 6. Such other site specific information and/or plans as may be requested by the BLM. |

25. Signature	Name (Printed/Typed)	Date
Title		
Approved by (Signature)	Name (Printed/Typed)	Date
Title	Office	

Application approval does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.
Conditions of approval, if any, are attached.

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.



(Continued on page 2)

*(Instructions on page 2)

This grid represents a standard section. You may superimpose a non-standard section, or larger area, over this grid. Operators must outline the dedicated acreage in a red box, clearly show the well surface location and bottom hole location, if it is directionally drilled, with the dimensions from the section lines in the cardinal directions. If this is a horizontal wellbore show on this plat the location of the First Take Point and Last Take Point, and the point within the Completed interval (other than the First Take Point or Last Take Point) that is closest to any outer boundary of the tract.

Surveyors shall use the latest United States government survey or dependent resurvey. Well locations will be in reference to the New Mexico Principal Meridian. If the land is not surveyed, contact the OCD Engineering Bureau. Independent subdivision surveys will not be acceptable.

MEDICINE HAT STATE COM 3H
 EL. = 3615.8

GEODETIC COORDINATES
 NAD 83 NMSP EAST
 SURFACE LOCATION
 N.= 721001.94
 E.= 609143.59
 LAT. = 32.9818436°N
 LONG. = 104.1122070°W

KICK OFF POINT
 707' FSL, 310' FEL
 N.= 721001.94
 E.= 609143.59
 LAT. = 32.9818436°N
 LONG. = 104.1122070°W

FIRST TAKE POINT
 100' FNL, 330' FWL
 N.= 720186.02
 E.= 609775.31
 LAT. = 32.9795974°N
 LONG. = 104.1101525°W

LAST TAKE POINT
 100' FSL, 330' FWL
 N.= 715112.02
 E.= 609848.03
 LAT. = 32.9656507°N
 LONG. = 104.1099505°W


BOTTOM OF HOLE
 1' FSL, 330' FWL
 N.= 715013.05
 E.= 609849.55
 LAT. = 32.9653787°N
 LONG. = 104.1099462°W

CORNER COORDINATES TABLE
 NAD 83 NMSP EAST



A	N.= 725554.99	E.= 604165.61
B	N.= 725564.86	E.= 606807.87
C	N.= 725574.73	E.= 609450.13
D	N.= 725523.66	E.= 612153.96
E	N.= 725530.56	E.= 614752.22
F	N.= 722885.75	E.= 614763.15
G	N.= 720240.47	E.= 614777.92
H	N.= 717641.13	E.= 614789.47
I	N.= 715038.00	E.= 614803.13
J	N.= 715021.17	E.= 612171.00
K	N.= 715010.75	E.= 609519.63
L	N.= 717652.34	E.= 609479.13
M	N.= 720294.20	E.= 609443.93
N	N.= 720301.65	E.= 606860.95
O	N.= 720294.37	E.= 604169.21
P	N.= 722912.42	E.= 604167.13
Q	N.= 722934.64	E.= 609480.07
R	N.= 720227.61	E.= 612143.37

LEGEND

- SECTION LINE
- - - QUARTER LINE
- LEASE LINE
- - - - - WELL PATH

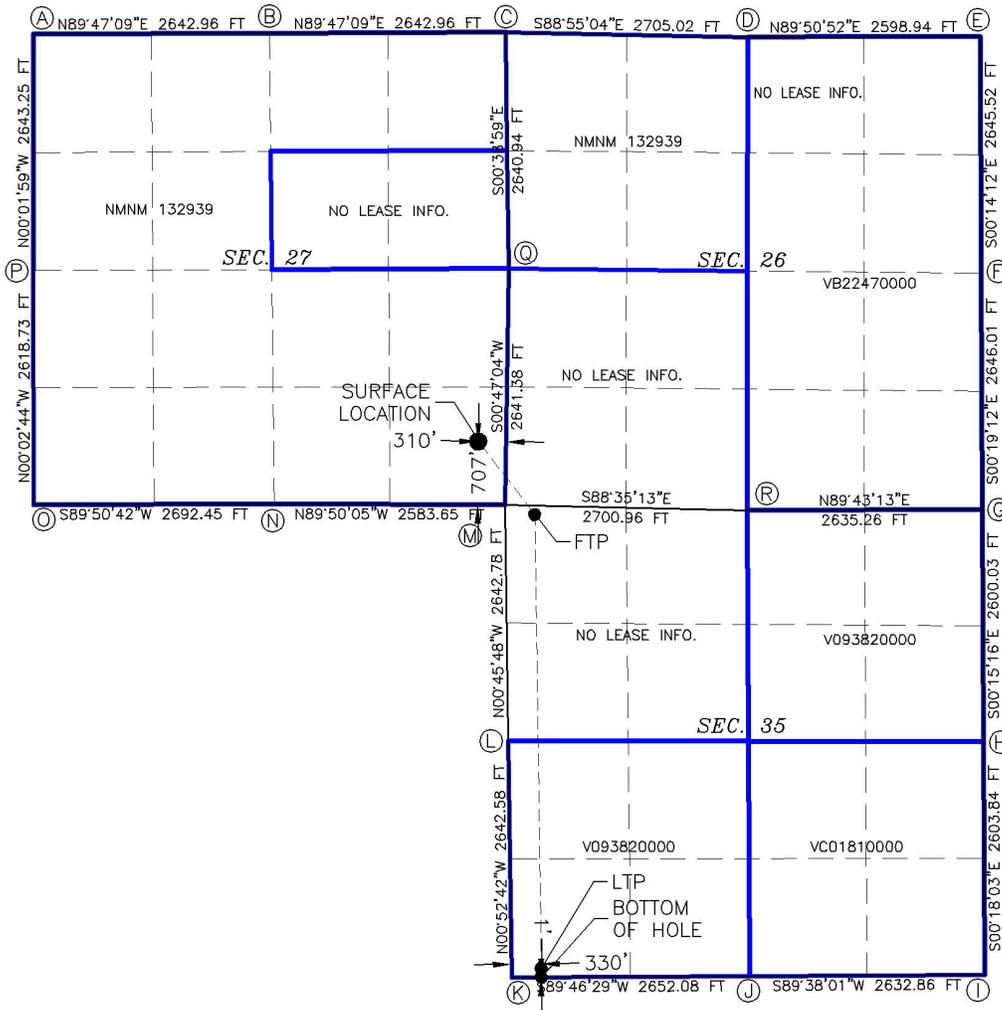

SECTION 27, TOWNSHIP 15 SOUTH, RANGE 28 EAST, N.M.P.M. CHAVES COUNTY, STATE OF NEW MEXICO SITE MAP

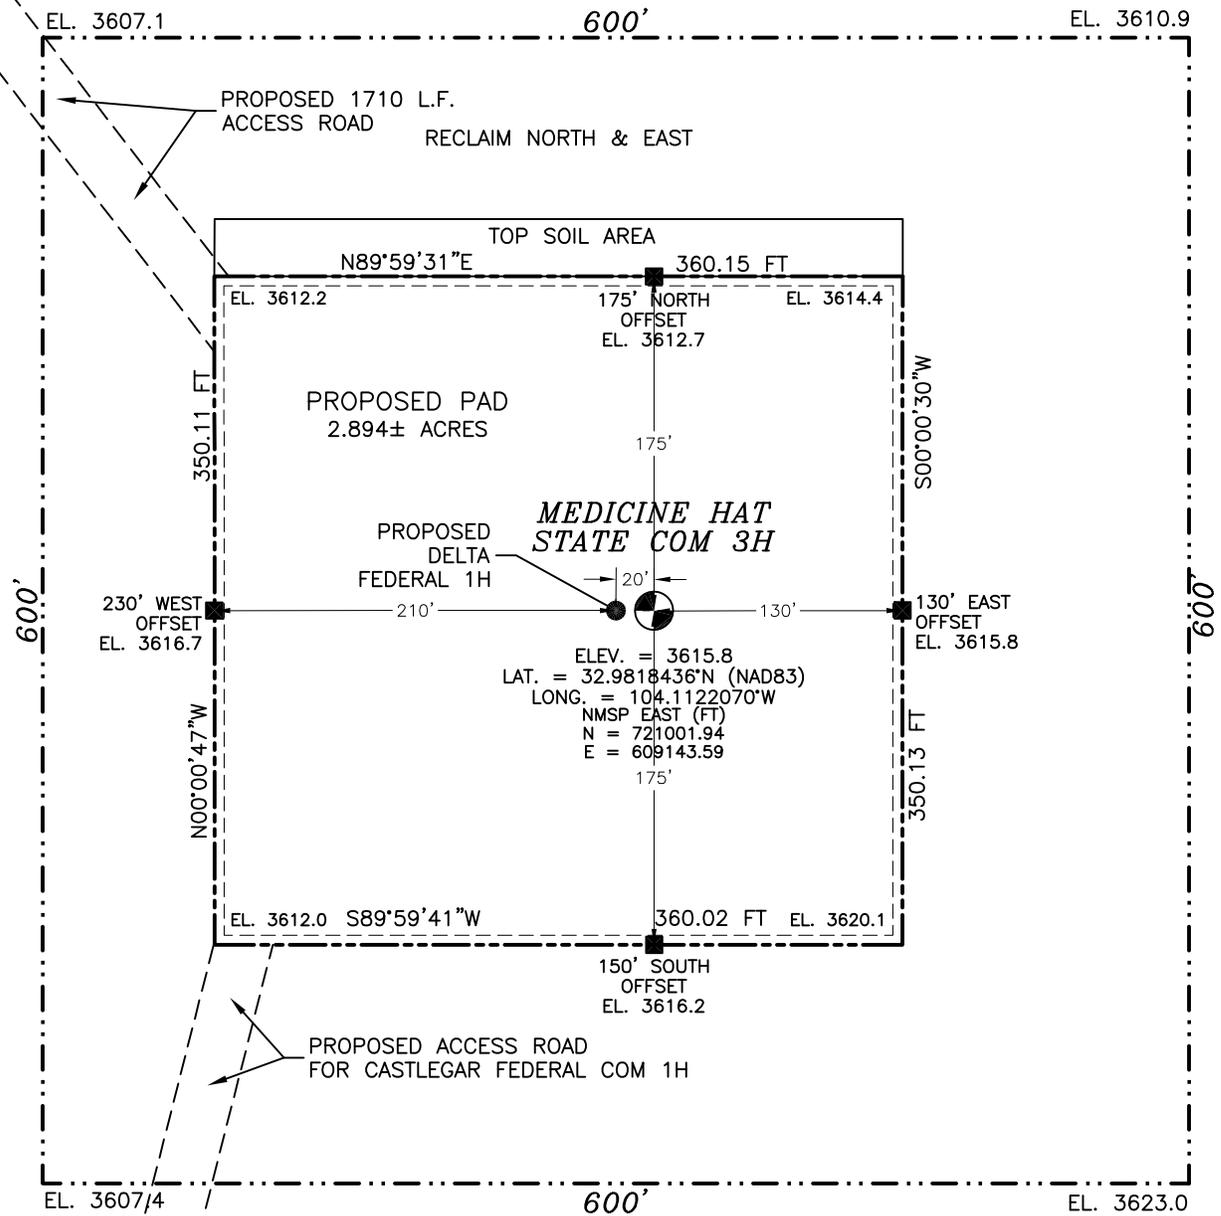

DIRECTIONS TO LOCATION
 FROM THE INTERSECTION OF ST. HWY. 82 (LOVINGTON HWY.) & CO. RD. 209 (TURKEY TRACT RD.), GO NORTH ON CO. RD. 209 APPROX. 5 MILES TO END COUNTY MAINTENANCE, CONTINUE NORTH ON TURKEY TRACT ROAD APPROX. 8.4 MILES TO AN EXISTING PAD, CONTINUE NORTHWEST & NORTH APPROX. 0.65 MILES, TURN LEFT (NORTHWEST) ON CALICHE ROAD AND GO APPROX. 0.75 MILES, TURN LEFT (SOUTHWEST) ON CALICHE ROAD AND GO APPROX. 0.6 MILES TO A ROAD SIGN FOLLOWING ROAD APPROX. 1710' TO THE NORTHWEST PAD CORNER TO THIS LOCATION.

MACK ENERGY CORPORATION
MEDICINE HAT STATE COM 3H
 LOCATED 707 FT. FROM THE SOUTH LINE
 AND 310 FT. FROM THE EAST LINE OF
 SECTION 27, TOWNSHIP 15 SOUTH,
 RANGE 28 EAST, N.M.P.M.
 CHAVES COUNTY, STATE OF NEW MEXICO

FEBRUARY 13, 2024


SURVEY NO. 10001

I, FILIMON F. PARMILLO, A NEW MEXICO REGISTERED PROFESSIONAL SURVEYOR CERTAIN TO THE DIRECTION OF THIS SURVEY, THAT THE SURVEY WAS MADE TO THE BEST OF MY KNOWLEDGE AND BELIEF AND TO MEET THE MINIMUM STANDARDS FOR THIS TYPE OF SURVEY.




MADRON PROFESSIONAL SURVEYING, INC. 301 SOUTH CANAL CARLSBAD, NEW MEXICO
 (575) 234-3327

SECTION 27, TOWNSHIP 15 SOUTH, RANGE 28 EAST, N.M.P.M.
CHAVES COUNTY, STATE OF NEW MEXICO
INTERIM SITE RECLAMATION

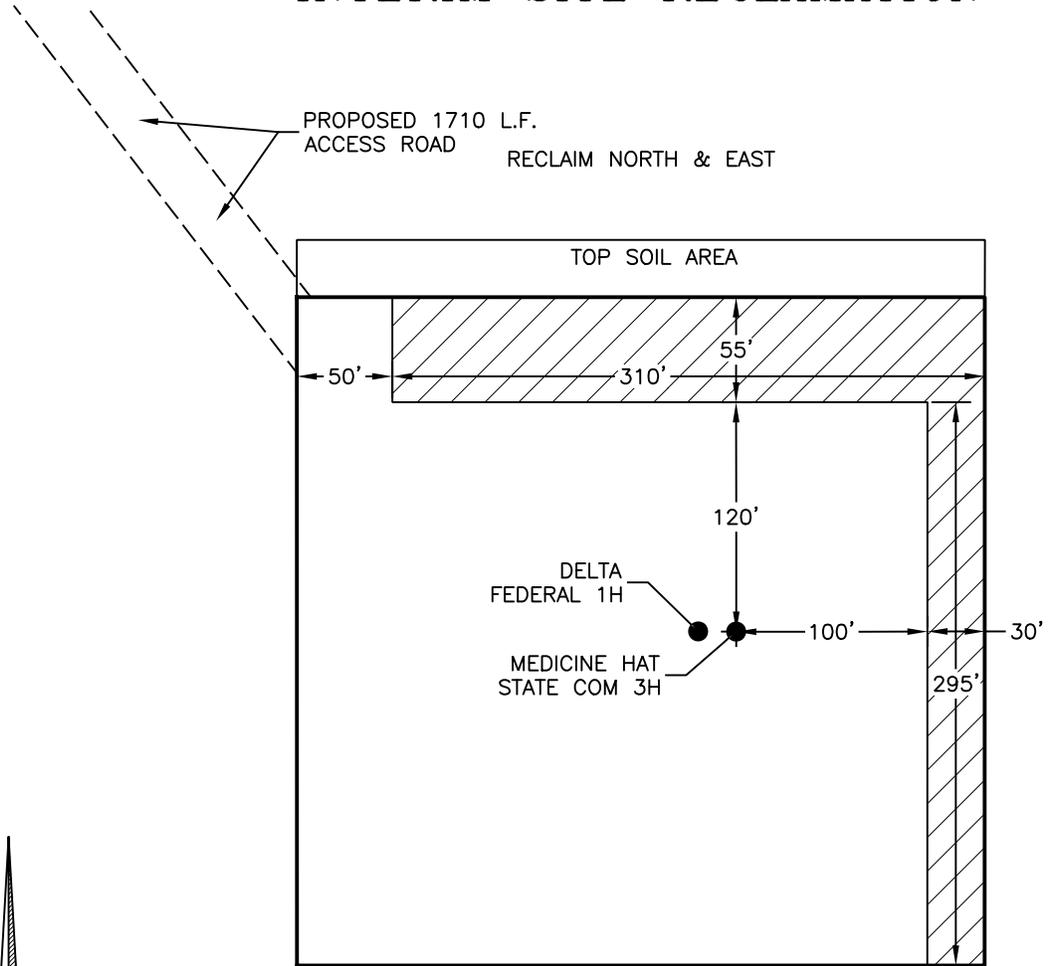

PROPOSED ACCESS ROAD FOR CASTLEGAR FEDERAL COM 1H

 DENOTES RECLAMATION AREA
0.595± ACRES RECLAMATION AREA




MACK ENERGY CORPORATION
MEDICINE HAT STATE COM 3H
LOCATED 707 FT. FROM THE SOUTH LINE
AND 310 FT. FROM THE EAST LINE OF
SECTION 27, TOWNSHIP 15 SOUTH,
RANGE 28 EAST, N.M.P.M.
CHAVES COUNTY, STATE OF NEW MEXICO

FEBRUARY 13, 2024

SURVEY NO. 10001

MADRON SURVEYING, INC. 301 SOUTH CANAL CARLSBAD, NEW MEXICO
(575) 234-3327

SECTION 27, TOWNSHIP 15 SOUTH, RANGE 28 EAST, N.M.P.M.
CHAVES COUNTY, STATE OF NEW MEXICO
LOCATION VERIFICATION MAP

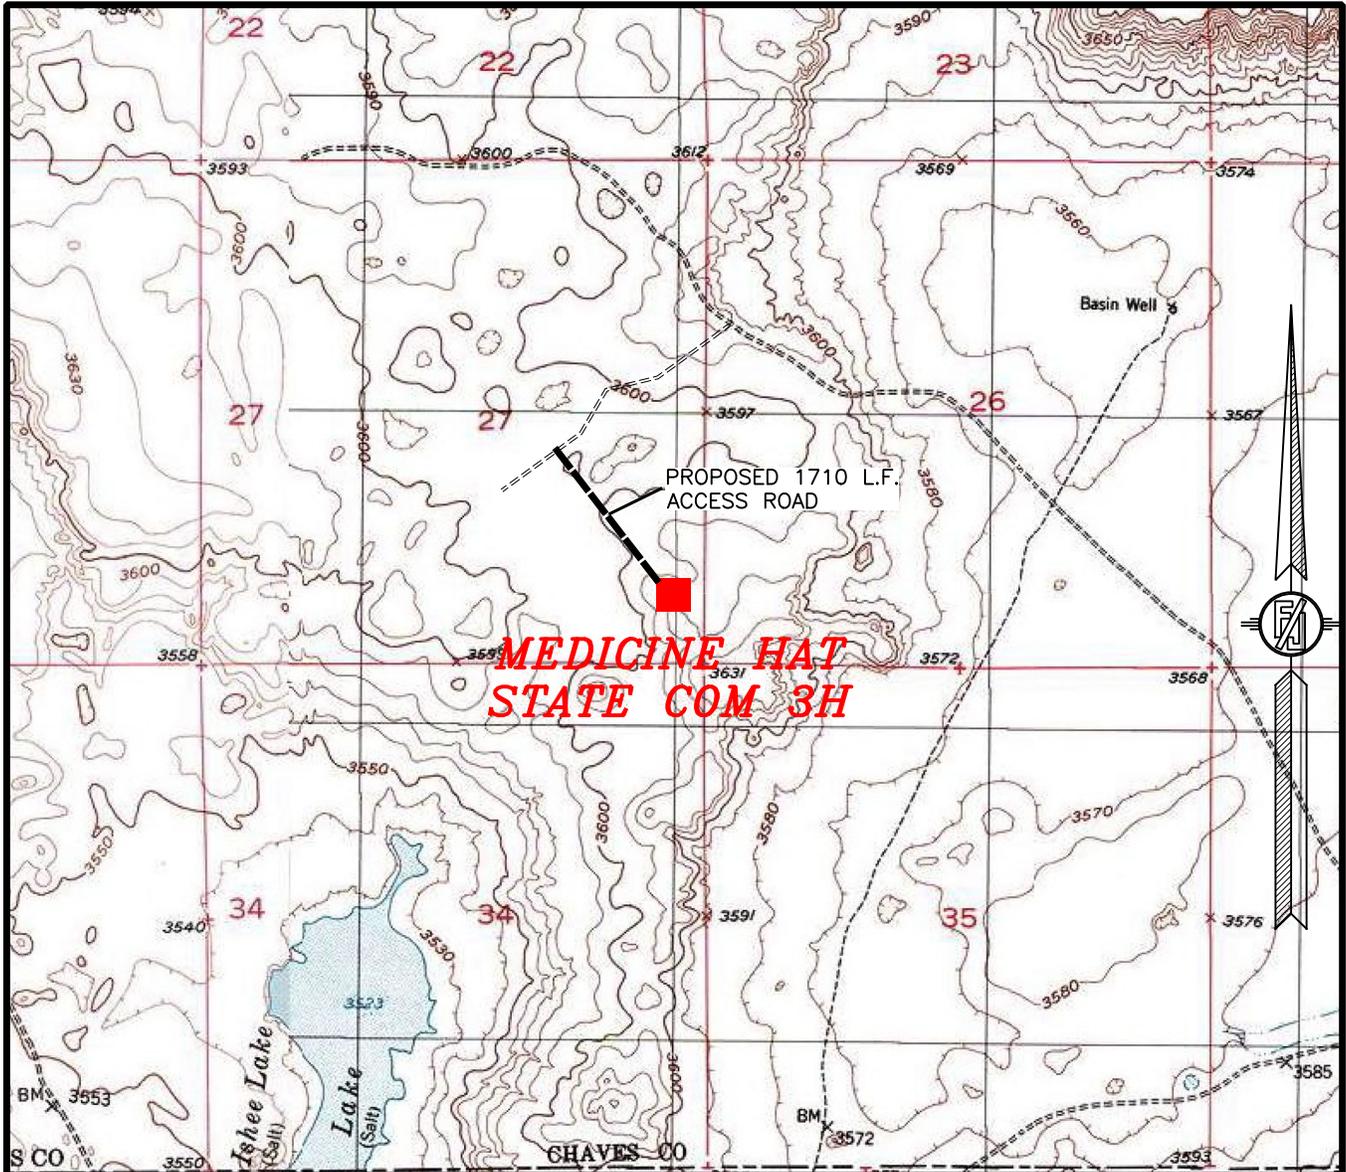

USGS QUAD MAP:
BASIN WELL
DIAMOND MOUND


NOT TO SCALE

MACK ENERGY CORPORATION
MEDICINE HAT STATE COM 3H
LOCATED 707 FT. FROM THE SOUTH LINE
AND 310 FT. FROM THE EAST LINE OF
SECTION 27, TOWNSHIP 15 SOUTH,
RANGE 28 EAST, N.M.P.M.
CHAVES COUNTY, STATE OF NEW MEXICO

FEBRUARY 13, 2024

MADRON SURVEYING, INC. 301 SOUTH CANAL CARLSBAD, NEW MEXICO
(575) 234-3327 SURVEY NO. 10001

SECTION 27, TOWNSHIP 15 SOUTH, RANGE 28 EAST, N.M.P.M. CHAVES COUNTY, STATE OF NEW MEXICO VICINITY MAP

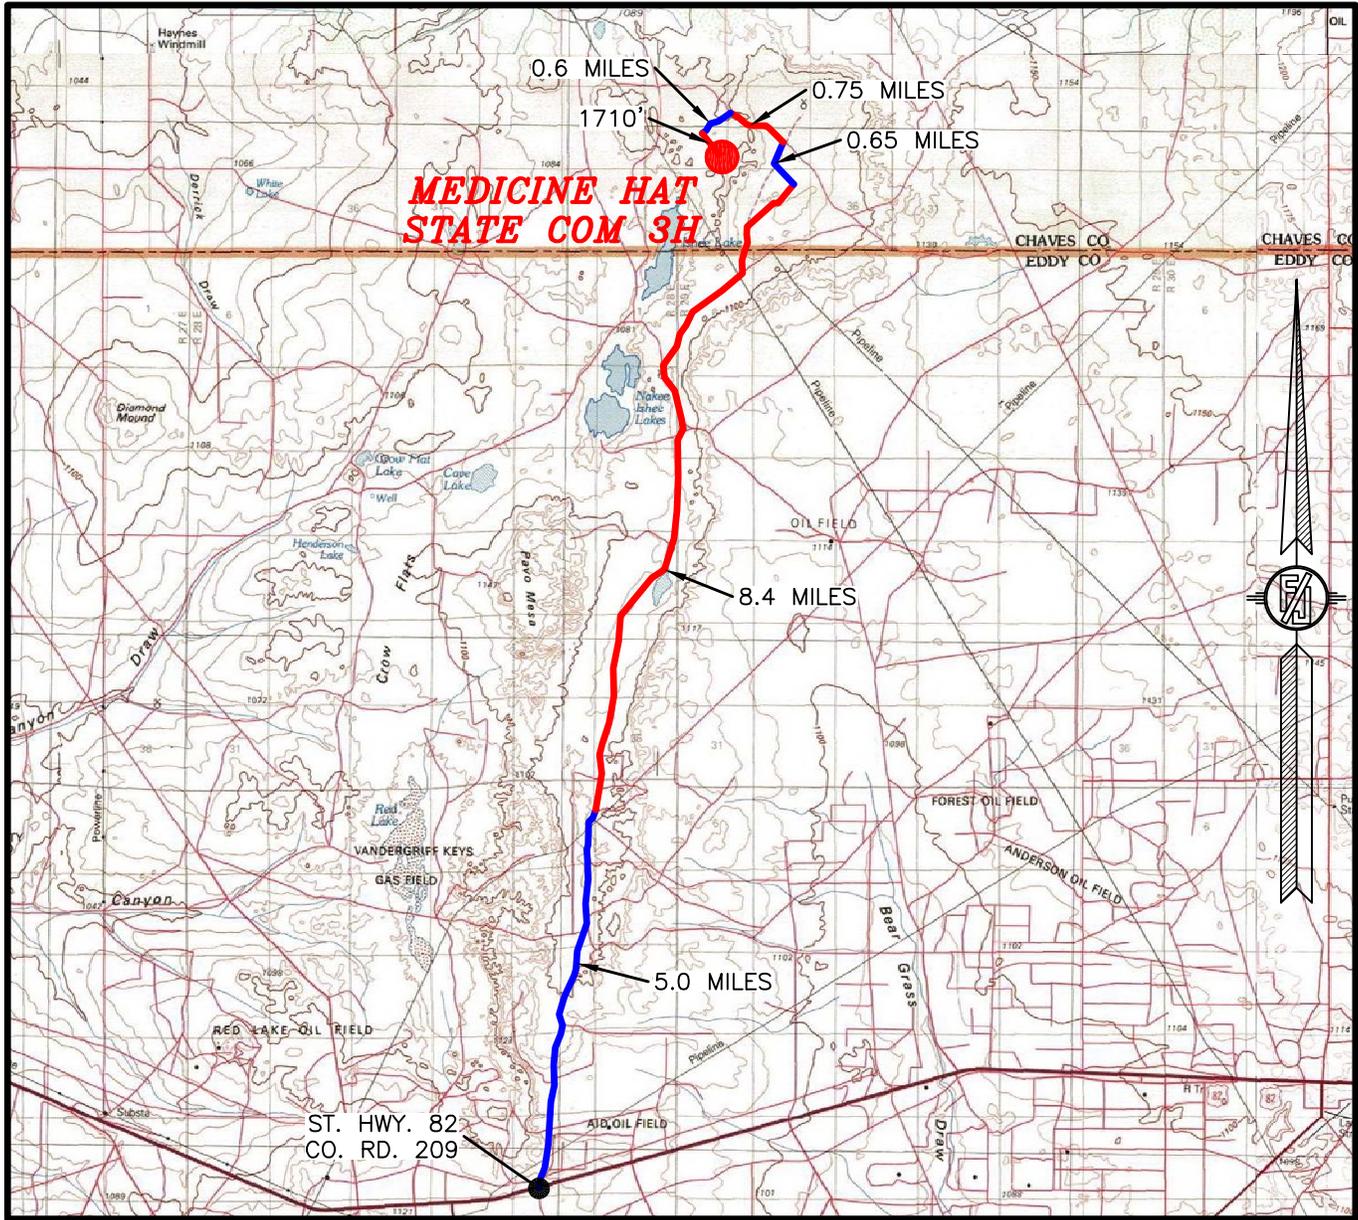

DISTANCES IN MILES

NOT TO SCALE

DIRECTIONS TO LOCATION


FROM THE INTERSECTION OF ST. HWY. 82 (LOVINGTON HWY.) & CO. RD. 209 (TURKEY TRACT RD.), GO NORTH ON CO. RD. 209 APPROX. 5 MILES TO END COUNTY MAINTENANCE, CONTINUE NORTH ON TURKEY TRACT ROAD APPROX. 8.4 MILES TO AN EXISTING PAD, CONTINUE NORTHWEST & NORTH APPROX. 0.65 MILES, TURN LEFT (NORTHWEST) ON CALICHE ROAD AND GO APPROX. 0.75 MILES, TURN LEFT (SOUTHWEST) ON 20' CALICHE ROAD AND GO APPROX. 0.6 MILES TO A ROAD SURVEY, FOLLOW ROAD SURVEY APPROX. 1710' TO THE NORTHWEST PAD CORNER FOR THIS LOCATION.

MACK ENERGY CORPORATION
MEDICINE HAT STATE COM 3H
 LOCATED 707 FT. FROM THE SOUTH LINE
 AND 310 FT. FROM THE EAST LINE OF
 SECTION 27, TOWNSHIP 15 SOUTH,
 RANGE 28 EAST, N.M.P.M.
 CHAVES COUNTY, STATE OF NEW MEXICO

FEBRUARY 13, 2024

MADRON SURVEYING, INC. 301 SOUTH CANAL CARLSBAD, NEW MEXICO
 (575) 234-3327 SURVEY NO. 10001

SECTION 27, TOWNSHIP 15 SOUTH, RANGE 28 EAST, N.M.P.M.
CHAVES COUNTY, STATE OF NEW MEXICO
AERIAL PHOTO

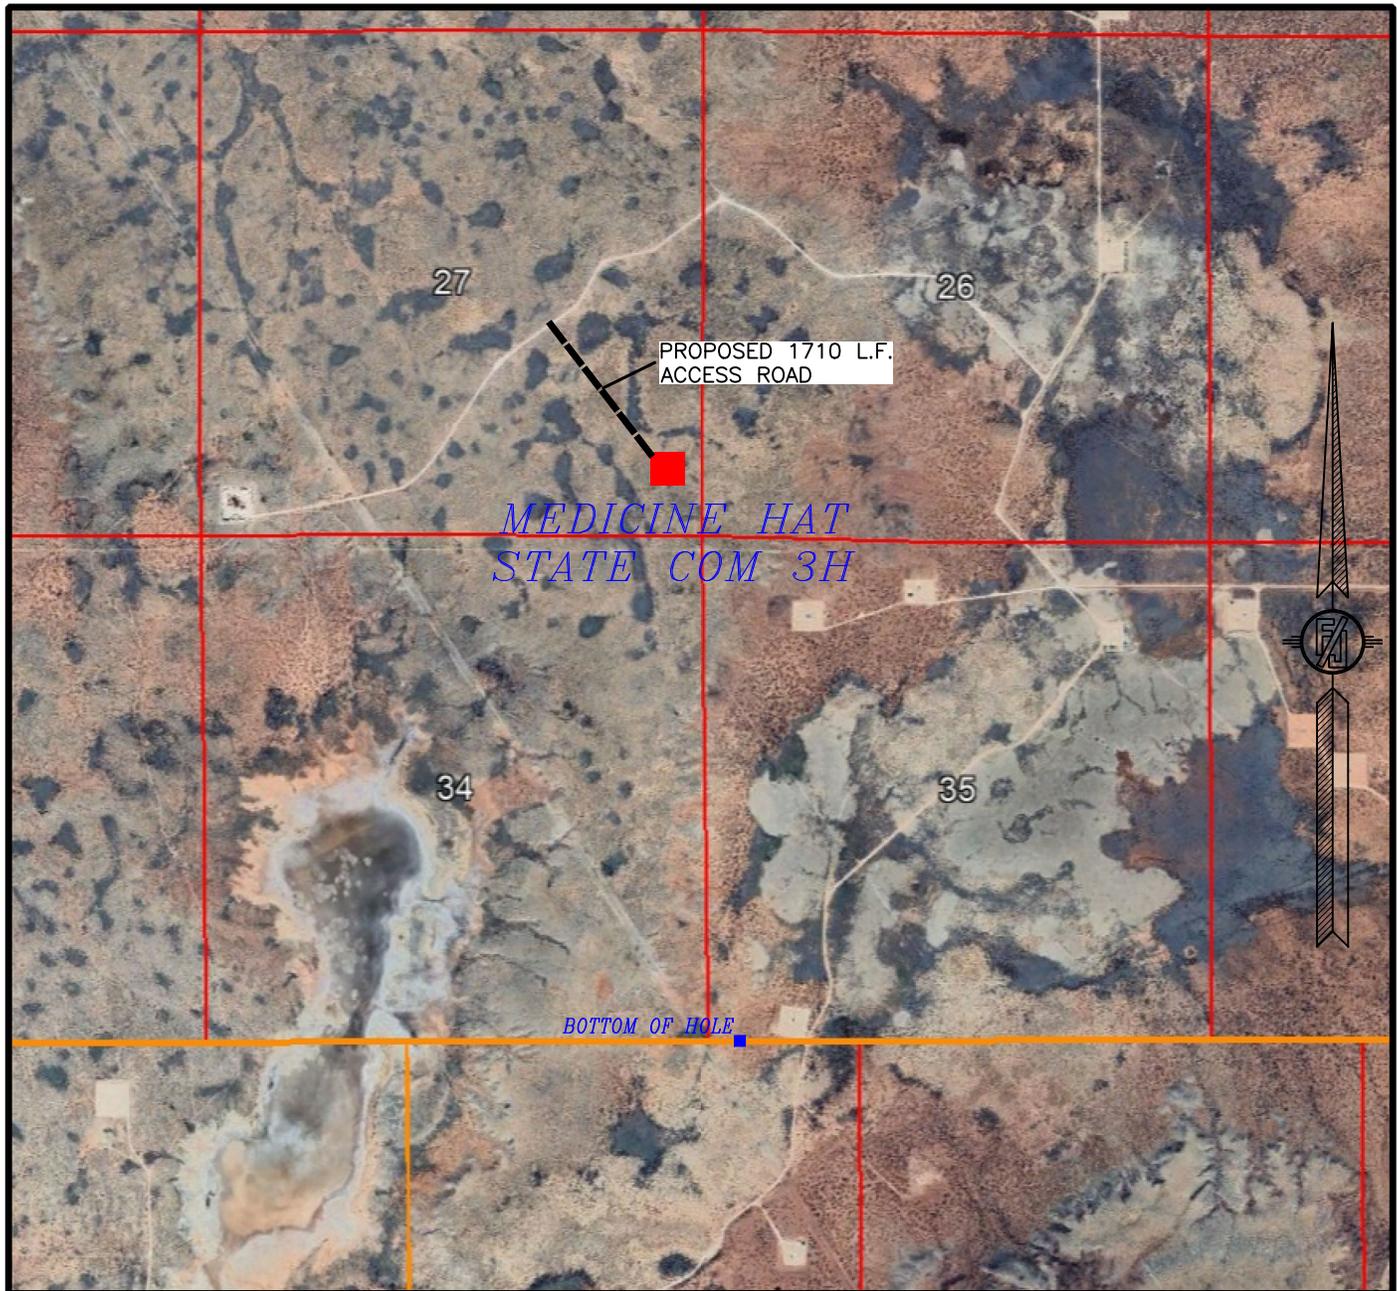

NOT TO SCALE
AERIAL PHOTO:
GOOGLE EARTH
APR. 2023


MACK ENERGY CORPORATION
MEDICINE HAT STATE COM 3H
LOCATED 707 FT. FROM THE SOUTH LINE
AND 310 FT. FROM THE EAST LINE OF
SECTION 27, TOWNSHIP 15 SOUTH,
RANGE 28 EAST, N.M.P.M.
CHAVES COUNTY, STATE OF NEW MEXICO

FEBRUARY 13, 2024

SURVEY NO. 10001

MADRON SURVEYING, INC. 301 SOUTH CANAL CARLSBAD, NEW MEXICO
(575) 234-3327

SECTION 27, TOWNSHIP 15 SOUTH, RANGE 28 EAST, N.M.P.M.
CHAVES COUNTY, STATE OF NEW MEXICO
AERIAL ACCESS ROUTE MAP

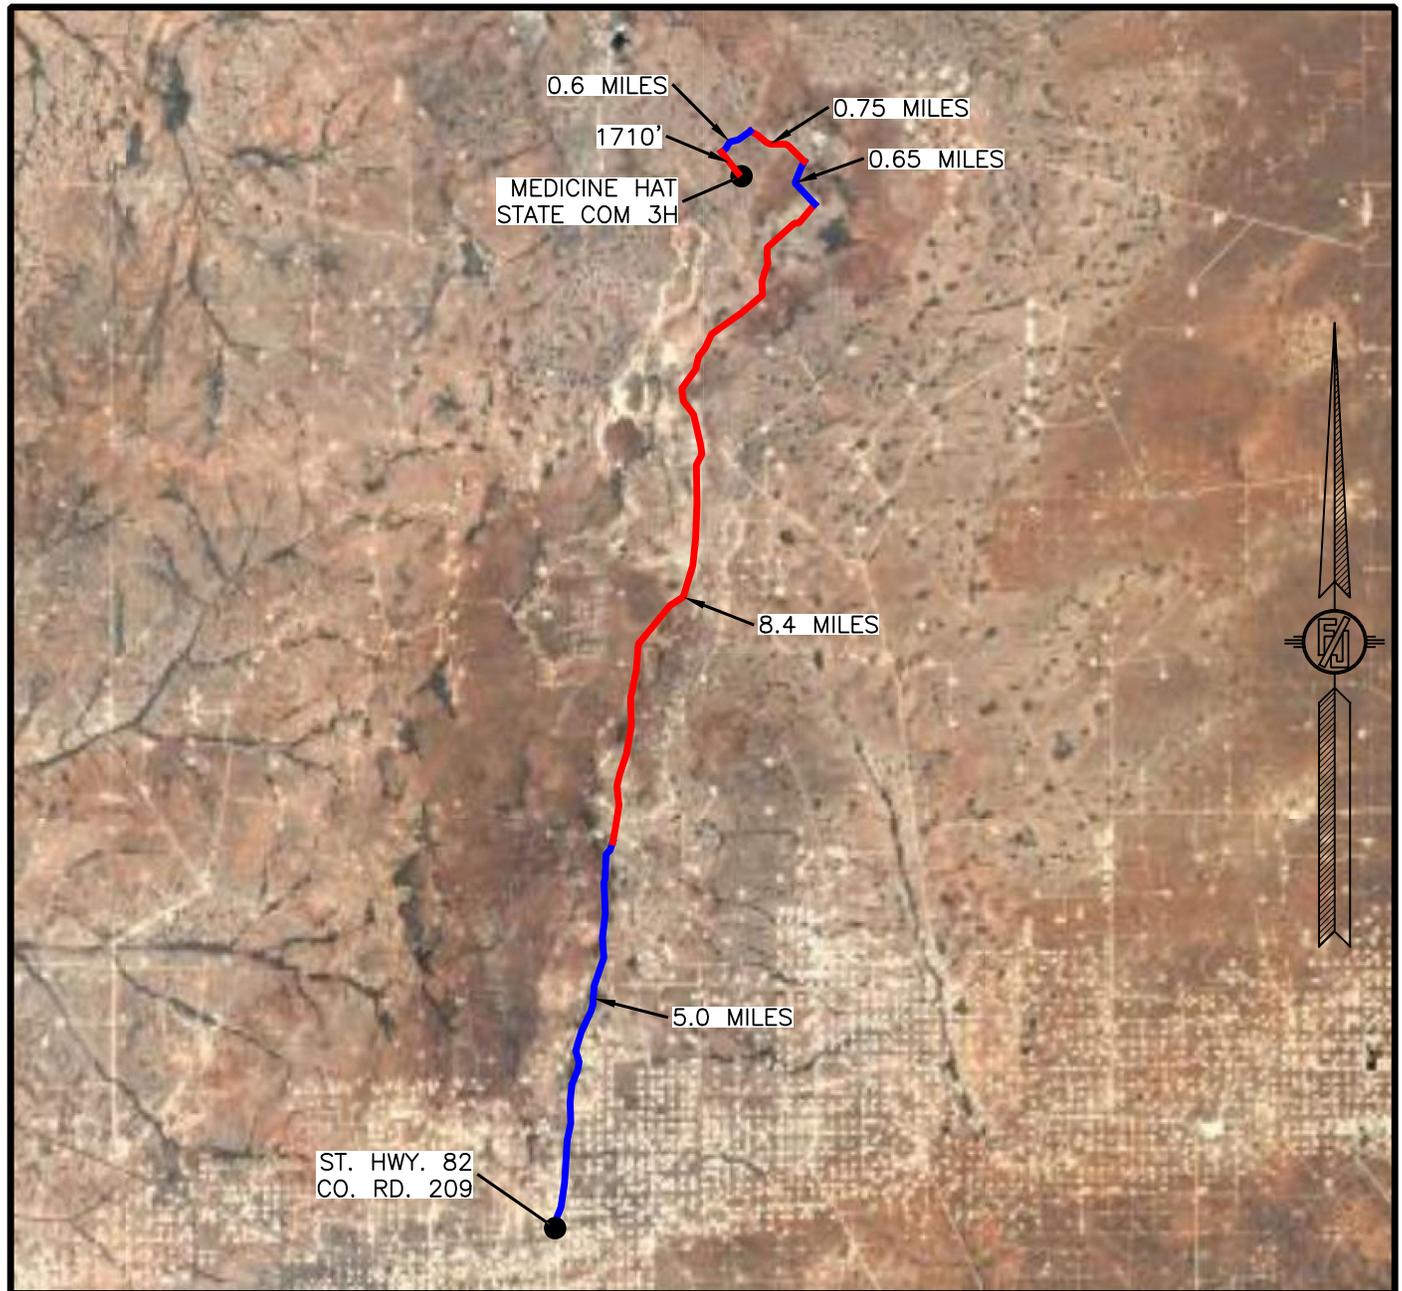

NOT TO SCALE
AERIAL PHOTO:
GOOGLE EARTH
APR. 2023

MACK ENERGY CORPORATION
MEDICINE HAT STATE COM 3H
LOCATED 707 FT. FROM THE SOUTH LINE
AND 310 FT. FROM THE EAST LINE OF
SECTION 27, TOWNSHIP 15 SOUTH,
RANGE 28 EAST, N.M.P.M.
CHAVES COUNTY, STATE OF NEW MEXICO

FEBRUARY 13, 2024

SURVEY NO. 10001



MADRON SURVEYING, INC. 301 SOUTH CANAL CARLSBAD, NEW MEXICO
(575) 234-3327

ACCESS ROAD PLAT


ACCESS ROAD FOR DELTA FEDERAL 1H & MEDICINE HAT STATE COM 3H

MACK ENERGY CORPORATION

CENTERLINE SURVEY OF AN ACCESS ROAD CROSSING
SECTION 27, TOWNSHIP 15 SOUTH, RANGE 29 EAST, N.M.P.M.
CHAVES COUNTY, STATE OF NEW MEXICO
FEBRUARY 13, 2024

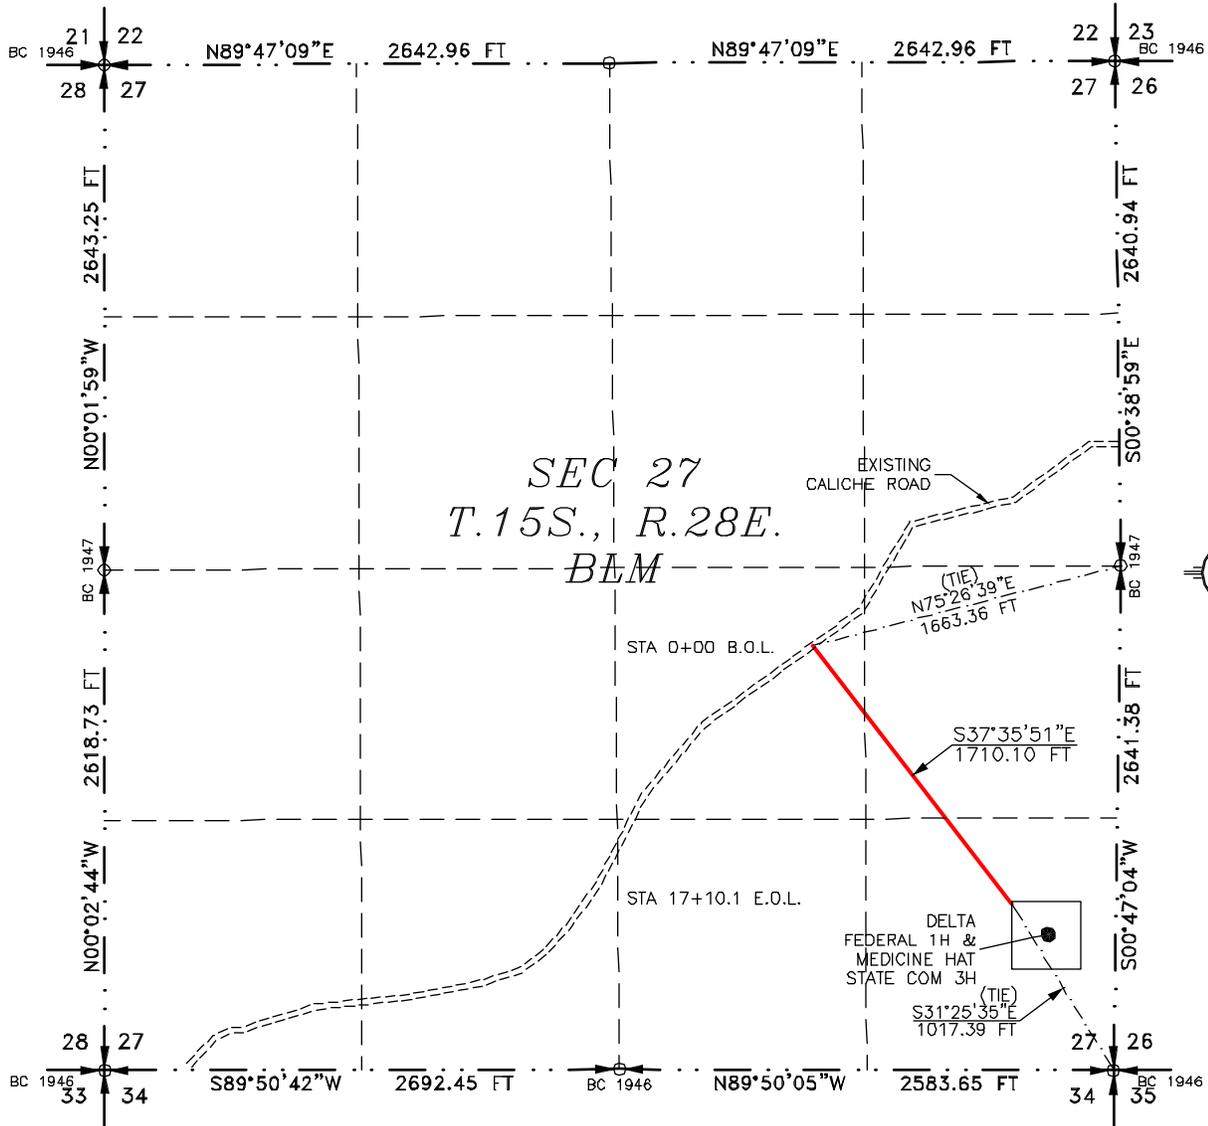

SEE NEXT SHEET (2-2) FOR DESCRIPTION



GENERAL NOTES

- 1.) THE INTENT OF THIS ROUTE SURVEY IS TO ACQUIRE AN EASEMENT.
- 2.) BASIS OF BEARING AND DISTANCE IS NMS83 EAST (NAD83) MODIFIED TO SURFACE COORDINATES. NAD 83 (FEET) AND NAVD 88 (FEET) COORDINATE SYSTEMS USED IN THE SURVEY.

SURVEYOR CERTIFICATE

I, FILMON F. JARAMILLO, A NEW MEXICO PROFESSIONAL SURVEYOR NO. 12797, HEREBY CERTIFY THAT I HAVE CONDUCTED AND AM RESPONSIBLE FOR THIS SURVEY, THAT THIS SURVEY IS TRUE AND CORRECT TO THE BEST OF MY KNOWLEDGE AND BELIEF, AND THAT THIS SURVEY AND PLAT MEET THE MINIMUM STANDARDS FOR LAND SURVEYING IN THE STATE OF NEW MEXICO.

IN WITNESS WHEREOF, THIS CERTIFICATE IS EXECUTED AT CARLSBAD, NEW MEXICO, THIS 13TH DAY OF FEBRUARY 2024.



MADRON SURVEYING, INC.
301 SOUTH CANAL
CARLSBAD, NEW MEXICO 88220
Phone (575) 234-3327

SURVEY NO. 10001

MADRON SURVEYING, INC. 301 SOUTH CANAL CARLSBAD, NEW MEXICO (575) 234-3327

ACCESS ROAD PLAT

ACCESS ROAD FOR DELTA FEDERAL 1H & MEDICINE HAT STATE COM 3H

MACK ENERGY CORPORATION

**CENTERLINE SURVEY OF AN ACCESS ROAD CROSSING
SECTION 27, TOWNSHIP 15 SOUTH, RANGE 29 EAST, N.M.P.M.
CHAVES COUNTY, STATE OF NEW MEXICO
FEBRUARY 13, 2024**

DESCRIPTION

A STRIP OF LAND 30 FEET WIDE CROSSING BUREAU OF LAND MANAGEMENT LAND IN SECTION 27, TOWNSHIP 15 SOUTH, RANGE 29 EAST, N.M.P.M., CHAVES COUNTY, STATE OF NEW MEXICO AND BEING 15 FEET EACH SIDE OF THE FOLLOWING DESCRIBED CENTERLINE SURVEY:

BEGINNING AT A POINT WITHIN THE NW/4 SE/4 OF SAID SECTION 27, TOWNSHIP 15 SOUTH, RANGE 29 EAST, N.M.P.M., WHENCE THE EAST QUARTER CORNER OF SAID SECTION 27, TOWNSHIP 15 SOUTH, RANGE 29 EAST, N.M.P.M. BEARS N75°26'39"E, A DISTANCE OF 1663.36 FEET;
THENCE S37°35'51"E A DISTANCE OF 1710.10 FEET THE TERMINUS OF THIS CENTERLINE SURVEY, WHENCE THE SOUTHEAST CORNER OF SAID SECTION 27, TOWNSHIP 15 SOUTH, RANGE 29 EAST, N.M.P.M. BEARS S31°25'35"E, A DISTANCE OF 1017.39 FEET;

SAID STRIP OF LAND BEING 1710.10 FEET OR 103.64 RODS IN LENGTH, CONTAINING 1.178 ACRES MORE OR LESS AND BEING ALLOCATED BY FORTIES AS FOLLOWS:

NW/4 SE/4	448.62 L.F.	27.19 RODS	0.309 ACRES
NE/4 SE/4	692.83 L.F.	41.99 RODS	0.477 ACRES
SE/4 SE/4	568.65 L.F.	34.46 RODS	0.392 ACRES

SURVEYOR CERTIFICATE

I, FILIMON F. JARAMILLO, A NEW MEXICO PROFESSIONAL SURVEYOR NO. 12797, HEREBY CERTIFY THAT I HAVE CONDUCTED AND AM RESPONSIBLE FOR THIS SURVEY, THAT THIS SURVEY IS TRUE AND CORRECT TO THE BEST OF MY KNOWLEDGE AND BELIEF, AND THAT THIS SURVEY AND PLAT MEET THE MINIMUM STANDARDS FOR LAND SURVEYING IN THE STATE OF NEW MEXICO.

IN WITNESS WHEREOF THIS CERTIFICATE IS EXECUTED AT CARLSBAD, NEW MEXICO, THIS 14th DAY OF MARCH 2024



MADRON SURVEYING, INC.
301 SOUTH CANAL
CARLSBAD, NEW MEXICO 88220
Phone (575) 234-3327

SURVEY NO. 10001

GENERAL NOTES

- 1.) THE INTENT OF THIS ROUTE SURVEY IS TO ACQUIRE AN EASEMENT.
- 2.) BASIS OF BEARING AND DISTANCE IS NMSP EAST (NAD83) MODIFIED TO SURFACE COORDINATES. NAD 83 (FEET) AND NAVD 88 (FEET) COORDINATE SYSTEMS USED IN THE SURVEY.

SHEET: 2-2

MADRON SURVEYING, INC. 301 SOUTH CANAL CARLSBAD, NEW MEXICO (575) 234-3327

State of New Mexico
 Energy, Minerals and Natural Resources Department

Submit Electronically
 Via E-permitting

Oil Conservation Division
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

NATURAL GAS MANAGEMENT PLAN

This Natural Gas Management Plan must be submitted with each Application for Permit to Drill (APD) for a new or recompleted well.

Section 1 – Plan Description Effective May 25, 2021

I. Operator: Mack Energy Corporation **OGRID:** 013837 **Date:** 04 / 15 / 2024

II. Type: Original Amendment due to 19.15.27.9.D(6)(a) NMAC 19.15.27.9.D(6)(b) NMAC Other.

If Other, please describe: _____

III. Well(s): Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

Well Name	API	ULSTR	Footages	Anticipated Oil BBL/D	Anticipated Gas MCF/D	Anticipated Produced Water BBL/D
Medicine Hat State Com 3H		Sec 27 T15S R28E	707 FSL 310 FEL	100	100	1,000

IV. Central Delivery Point Name: DCP Midstream Linam Ranch Processing Plant/Durango Midstream[See 19.15.27.9(D)(1) NMAC]

V. Anticipated Schedule: Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

Well Name	API	Spud Date	TD Reached Date	Completion Commencement Date	Initial Flow Back Date	First Production Date
Medicine Hat State Com 3H		6/1/2024	6/21/2024	7/21/2024	7/21/2024	7/21/2024

VI. Separation Equipment: Attach a complete description of how Operator will size separation equipment to optimize gas capture.

VII. Operational Practices: Attach a complete description of the actions Operator will take to comply with the requirements of Subsection A through F of 19.15.27.8 NMAC.

VIII. Best Management Practices: Attach a complete description of Operator’s best management practices to minimize venting during active and planned maintenance.

Section 2 – Enhanced Plan

EFFECTIVE APRIL 1, 2022

Beginning April 1, 2022, an operator that is not in compliance with its statewide natural gas capture requirement for the applicable reporting area must complete this section.

Operator certifies that it is not required to complete this section because Operator is in compliance with its statewide natural gas capture requirement for the applicable reporting area.

IX. Anticipated Natural Gas Production:

Well	API	Anticipated Average Natural Gas Rate MCF/D	Anticipated Volume of Natural Gas for the First Year MCF

X. Natural Gas Gathering System (NGGS):

Operator	System	ULSTR of Tie-in	Anticipated Gathering Start Date	Available Maximum Daily Capacity of System Segment Tie-in

XI. Map. Attach an accurate and legible map depicting the location of the well(s), the anticipated pipeline route(s) connecting the production operations to the existing or planned interconnect of the natural gas gathering system(s), and the maximum daily capacity of the segment or portion of the natural gas gathering system(s) to which the well(s) will be connected.

XII. Line Capacity. The natural gas gathering system will will not have capacity to gather 100% of the anticipated natural gas production volume from the well prior to the date of first production.

XIII. Line Pressure. Operator does does not anticipate that its existing well(s) connected to the same segment, or portion, of the natural gas gathering system(s) described above will continue to meet anticipated increases in line pressure caused by the new well(s).

Attach Operator’s plan to manage production in response to the increased line pressure.

XIV. Confidentiality: Operator asserts confidentiality pursuant to Section 71-2-8 NMSA 1978 for the information provided in Section 2 as provided in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and attaches a full description of the specific information for which confidentiality is asserted and the basis for such assertion.

Section 3 - Certifications

Effective May 25, 2021

Operator certifies that, after reasonable inquiry and based on the available information at the time of submittal:

Operator will be able to connect the well(s) to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system; or

Operator will not be able to connect to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system.

If Operator checks this box, Operator will select one of the following:

Well Shut-In. Operator will shut-in and not produce the well until it submits the certification required by Paragraph (4) of Subsection D of 19.15.27.9 NMAC; or

Venting and Flaring Plan. Operator has attached a venting and flaring plan that evaluates and selects one or more of the potential alternative beneficial uses for the natural gas until a natural gas gathering system is available, including:

- (a) power generation on lease;
- (b) power generation for grid;
- (c) compression on lease;
- (d) liquids removal on lease;
- (e) reinjection for underground storage;
- (f) reinjection for temporary storage;
- (g) reinjection for enhanced oil recovery;
- (h) fuel cell production; and
- (i) other alternative beneficial uses approved by the division.

Section 4 - Notices

1. If, at any time after Operator submits this Natural Gas Management Plan and before the well is spud:

(a) Operator becomes aware that the natural gas gathering system it planned to connect the well(s) to has become unavailable or will not have capacity to transport one hundred percent of the production from the well(s), no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised venting and flaring plan containing the information specified in Paragraph (5) of Subsection D of 19.15.27.9 NMAC; or

(b) Operator becomes aware that it has, cumulatively for the year, become out of compliance with its baseline natural gas capture rate or natural gas capture requirement, no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised Natural Gas Management Plan for each well it plans to spud during the next 90 days containing the information specified in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and shall file an update for each Natural Gas Management Plan until Operator is back in compliance with its baseline natural gas capture rate or natural gas capture requirement.

2. OCD may deny or conditionally approve an APD if Operator does not make a certification, fails to submit an adequate venting and flaring plan which includes alternative beneficial uses for the anticipated volume of natural gas produced, or if OCD determines that Operator will not have adequate natural gas takeaway capacity at the time a well will be spud.

VI. Separation Equipment:

Mack Energy Corporation(MEC) production facilities include separation equipment designed to efficiently separate gas from liquid phases to optimize gas capture based on projected and estimated volumes from the targeted pool of our completion project. MEC will utilize flowback separation equipment and production separation equipment designed and built to industry specifications after the completion to optimize gas capture and send gas to sales or flare based on analytical composition. MEC operates facilities that are typically multi-well facilities. Production separation equipment is upgraded prior to new wells being completed, if determined to be undersized or inadequate. This equipment is already on-site and tied into our sales gas lines prior to the new drill operations.

VII. Operational Practices:

1. Subsection (A) Venting and Flaring of Natural Gas. MEC understands the requirements of NMAC 19.15.27.8 which outlines that the venting and flaring of natural gas during drilling, completion or production operations that constitutes waste as defined in 19.15.2 are prohibited.
2. Subsection (B) Venting and Flaring during drilling operations. This gas capture plan isn't for a well being drilled.
3. Subsection (C) Venting and flaring during completion or recompletion. Flowlines will be routed for flowback fluids into a completion or storage tank and if feasible under well conditions, flare rather than vent and commence operation of a separator as soon as it is technically feasible for a separator to function.
 - At any point in the well life (completion, production, inactive) an audio, visual and olfactory inspection be performed at prescribed intervals (weekly or monthly) pursuant to Subsection D of 19.15.27.8 NMAC, to confirm that all production equipment is operating properly and there are no leaks or releases.
4. Subsection (D) Venting and flaring during production operations
 - At any point in the well life (completion, production, inactive) an audio, visual and olfactory inspection be performed at prescribed intervals (weekly or monthly) pursuant to Subsection D of 19.15.27.8 NMAC, to confirm that all production equipment is operating properly and there are no leaks or releases.
 - Monitor manual liquid unloading for wells on-site or in close proximity (<30 minutes' drive time), take reasonable actions to achieve a stabilized rate and pressure at the earliest practical time, and take reasonable actions to minimize venting to the maximum extent practicable.
 - MEC will not vent or flare except during the approved activities listed in NMAC 19.15.27.8 (D) 14.
5. Subsection (E) Performance standards
 - All tanks and separation equipment are designed for maximum throughput and pressure to minimize waste.
 - If a flare is utilized during production operations it will have a continuous pilot and is located more than 100 feet from any known well or storage tanks.
 - At any point in the well life (completion, production, inactive) an audio, visual and olfactory inspection be performed at prescribed intervals (weekly or monthly) pursuant to Subsection D of 19.15.27.8 NMAC, to confirm that all production equipment is operating properly and there are no leaks or releases.

6. Subsection (F) Measurement or estimation of vented and flared natural gas
 - o Measurement equipment is installed to measure the volume of natural gas flared from process piping.
 - o When measurement isn't practicable, estimation of vented and flared natural gas will be completed as noted in 19.15.27.8 (F) 5-6.

VIII. Best Management Practices:

1. MEC has adequate storage and takeaway capacity for wells it chooses to complete as the flowlines at the sites are already in place and tied into a gathering system.
2. MEC will flare rather than vent vessel blowdown gas when technically feasible during active and/or planned maintenance to equipment on-site.
3. MEC combusts natural gas that would otherwise be vented or flared, when technically feasible.
4. MEC will shut in wells in the event of a takeaway disruption, emergency situation, or other operations where venting or flaring may occur due to equipment failures.
5. MEC has a gas gathering system in place(CTB-887)a with multiple purchaser's to limit venting or flaring, due to purchaser shut downs.

Month	Gas (MCF)
1	10550
2	8917
3	7769
4	6913
5	6247
6	5712
7	5273
8	4904
9	4589
10	4317
11	4080
12	3871
13	3685
14	3518
15	3368
16	3231
17	3107
18	2993
19	2889
20	2792
21	2702
22	2619
23	2542
24	2469
25	2402
26	2338
27	2278
28	2221
29	2168
30	2118
31	2070
32	2024
33	1981
34	1940
35	1900
36	1863
37	1827
38	1793
39	1760
40	1729
41	1698
42	1669
43	1641

44	1615
45	1589
46	1564
47	1540
48	1516
49	1494
50	1472
51	1451
52	1431
53	1411
54	1392
55	1374
56	1356
57	1339
58	1322
59	1305
60	1289
61	1274
62	1259
63	1244
64	1230
65	1216
66	1202
67	1189
68	1176
69	1164
70	1151
71	1140
72	1128
73	1116
74	1105
75	1094
76	1084
77	1073
78	1063
79	1053
80	1043
81	1034
82	1024
83	1015
84	1006
85	998
86	989
87	980

88	972
89	964
90	956
91	948
92	941
93	933
94	926
95	918
96	911
97	904
98	897
99	891
100	884
101	877
102	871
103	865
104	858
105	852
106	846
107	840
108	835
109	829
110	823
111	818
112	812
113	807
114	801
115	796
116	791
117	786
118	781
119	776
120	771
121	766
122	762
123	757
124	753
125	748
126	744
127	739
128	735
129	731
130	726
131	722

132	718
133	714
134	710
135	706
136	702
137	698
138	694
139	691
140	687
141	683
142	680
143	676
144	673
145	669
146	666
147	662
148	659
149	655
150	652
151	649
152	646
153	642
154	639
155	636
156	633
157	630
158	627
159	624
160	621
161	618
162	615
163	613
164	610
165	607
166	604
167	601
168	599
169	596
170	593
171	591
172	588
173	586
174	583
175	581

176	578
177	576
178	573
179	571
180	568
181	566
182	564
183	561
184	559
185	557
186	554
187	552
188	550
189	548
190	546
191	543
192	541
193	539
194	537
195	535
196	533
197	531
198	529
199	527
200	525
201	523
202	521
203	519
204	517
205	515
206	513
207	511
208	509
209	508
210	506
211	504
212	502
213	500
214	499
215	497
216	495
217	493
218	492
219	490

220	488
221	487
222	485
223	483
224	482
225	480
226	478
227	477
228	475
229	474
230	472
231	470
232	469
233	467
234	466
235	464
236	463
237	461
238	460
239	458
240	457
241	456
242	454
243	453
244	451
245	450
246	448
247	447
248	446
249	444
250	443
251	442
252	440
253	439
254	438
255	436
256	435
257	434
258	433
259	431
260	430
261	429
262	428
263	426

264	425
265	424
266	423
267	421
268	420
269	419
270	418
271	417
272	416
273	414
274	413
275	412
276	411
277	410
278	409
279	408
280	406
281	405
282	404
283	403
284	402
285	401
286	400
287	399
288	398
289	397
290	396
291	395
292	394
293	393
294	392
295	391
296	390
297	389
298	388
299	387
300	386
301	385
302	384
303	383
304	382
305	381
306	380
307	379

308	378
309	377
310	376
311	375
312	374
313	373
314	373
315	372
316	371
317	370
318	369
319	368
320	367
321	366
322	365
323	365
324	364
325	363
326	362
327	361
328	360
329	359
330	359
331	358
332	357
333	356
334	355
335	355
336	354
337	353
338	352
339	351
340	351
341	350
342	349
343	348
344	347
345	347
346	346
347	345
348	344
349	344
350	343
351	342

352	341
353	341
354	340
355	339
356	339
357	338
358	337
359	336
360	336
361	335
362	334
363	334
364	333
365	332
366	331
367	331
368	330
369	329
370	329
371	328
372	327
373	327
374	326
375	325
376	325
377	324
378	323
379	323
380	322
381	321
382	321
383	320
384	320
385	319
386	318
387	318
388	317
389	316
390	316
391	315
392	315
393	314
394	313
395	313

396	312
397	312
398	311
399	310
400	310
401	309
402	309
403	308
404	307
405	307
406	306
407	306
408	305
409	305
410	304
411	303
412	303
413	302
414	302
415	301
416	301
417	300
418	299
419	299
420	298
421	298
422	297
423	297
424	296
425	296
426	295
427	295
428	294
429	294
430	293
431	293
432	292
433	292
434	291
435	291
436	290
437	289
438	289
439	288

440	288
441	287
442	287
443	286
444	286
445	286
446	285
447	285
448	284
449	284
450	283
451	283
452	282
453	282
454	281
455	281
456	280
457	280
458	279
459	279
460	278
461	278
462	277
463	277
464	277
465	276
466	276
467	275
468	275
469	274
470	274
471	273
472	273
473	273
474	272
475	272
476	271
477	271
478	270
479	270
480	269
481	269
482	269
483	268

484	268
485	267
486	267
487	266
488	266
489	266
490	265
491	265
492	264
493	264
494	264
495	263
496	263
497	262
498	262
499	262
500	261
501	261
502	260
503	260
504	260
505	259
506	259
507	258
508	258
509	258
510	257
511	257
512	256
513	256
514	256
515	255
516	255
517	255
518	254
519	254
520	253
521	253
522	253
523	252
524	252
525	252
526	251
527	251

528	251
529	250
530	250
531	249
532	249
533	249
534	248
535	248
536	248
537	247
538	247
539	247
540	246
541	246
542	246
543	245
544	245
545	245
546	244
547	244
548	244
549	243
550	243
551	242
552	242
553	242
554	241
555	241
556	241
557	240
558	240
559	240
560	239
561	239
562	239
563	239
564	238
565	238
566	238
567	237
568	237
569	237
570	236
571	236

572	236
573	235
574	235
575	235
576	234
577	234
578	234
579	233
580	233
581	233
582	233
583	232
584	232
585	232
586	231
587	231
588	231
589	230
590	230
591	230
592	230
593	229
594	229
595	229
596	228
597	228
598	228
599	227
600	227
601	227
602	227
603	226
604	226
605	226
606	225
607	225
608	225
609	225
610	224
611	224
612	224
613	223
614	223
615	223

616	223
617	222
618	222
619	222
620	222
621	221
622	221
623	221
624	220
625	220
626	220
627	220
628	219
629	219
630	219
631	219
632	218
633	218
634	218
635	218
636	217
637	217
638	217
639	216
640	216
641	216
642	216
643	215
644	215
645	215
646	215
647	214
648	214
649	214
650	214
651	213
652	213
653	213
654	213
655	212
656	212
657	212
658	212
659	211

660	211
661	211
662	211
663	210
664	210
665	210
666	210
667	210
668	209
669	209
670	209
671	209
672	208
673	208
674	208
675	208
676	207
677	207
678	207
679	207
680	206
681	206
682	206
683	206
684	206
685	205
686	205
687	205
688	205
689	204
690	204
691	204
692	204
693	203
694	203
695	203
696	203
697	203
698	202
699	202
700	202
701	202
702	201
703	201

704	201
705	201
706	201
707	200
708	200
709	200
710	200
711	200
712	199
713	199
714	199
715	199
716	198
717	198
718	198
719	198
720	198
721	197
722	197
723	197
724	197
725	197
726	196
727	196
728	196
729	196
730	196
731	195
732	195
733	195
734	195
735	194
736	194
737	194
738	194
739	194
740	193
741	193
742	193
743	193
744	193
745	192
746	192
747	192

748	192
749	192
750	192
751	191
752	191
753	191
754	191
755	191
756	190
757	190
758	190
759	190
760	190
761	189
762	189
763	189
764	189
765	189
766	188
767	188
768	188
769	188
770	188
771	187
772	187
773	187
774	187
775	187
776	187
777	186
778	186
779	186
780	186
781	186
782	185
783	185
784	185
785	185
786	185
787	185
788	184
789	184
790	184
791	184

792	184
793	183
794	183
795	183
796	183
797	183
798	183
799	182
800	182
801	182
802	182
803	182
804	182
805	181
806	181
807	181
808	181
809	181
810	181
811	180
812	180
813	180
814	180
815	180
816	180
817	179
818	179
819	179
820	179
821	179
822	179
823	178
824	178
825	178
826	178
827	178
828	178
829	177
830	177
831	177
832	177
833	177
834	177
835	176

836	176
837	176
838	176
839	176
840	176
841	175
842	175
843	175
844	175
845	175
846	175
847	174
848	174
849	174
850	174
851	174
852	174
853	174
854	173
855	173
856	173
857	173
858	173
859	173
860	172
861	172
862	172
863	172
864	172
865	172
866	172
867	171
868	171
869	171
870	171
871	171
872	171
873	170
874	170
875	170
876	170
877	170
878	170
879	170

880	169
881	169
882	169
883	169
884	169
885	169
886	169
887	168
888	168
889	168
890	168
891	168
892	168
893	168
894	167
895	167
896	167
897	167
898	167
899	167
900	167
901	166
902	166
903	166
904	166
905	166
906	166
907	166
908	165
909	165
910	165
911	165
912	165
913	165
914	165
915	164
916	164
917	164
918	164
919	164
920	164
921	164
922	163
923	163

924	163
925	163
926	163
927	163
928	163
929	163
930	162
931	162
932	162
933	162
934	162
935	162
936	162
937	161
938	161
939	161
940	161
941	161
942	161
943	161
944	161
945	160
946	160
947	160
948	160
949	160
950	160
951	160
952	160
953	159
954	159
955	159
956	159
957	159
958	159
959	159
960	158
961	158
962	158
963	158
964	158
965	158
966	158
967	158

968	157
969	157
970	157
971	157
972	157
973	157
974	157
975	157
976	156
977	156
978	156
979	156
980	156
981	156
982	156
983	156
984	156
985	155
986	155
987	155
988	155
989	155
990	155
991	155
992	155
993	154
994	154
995	154
996	154
997	154
998	154
999	154
1000	154
1001	153
1002	153
1003	153
1004	153
1005	153
1006	153
1007	153
1008	153
1009	153
1010	152
1011	152

1012	152
1013	152
1014	152
1015	152
1016	152
1017	152
1018	152
1019	151
1020	151
1021	151
1022	151
1023	151
1024	151
1025	151
1026	151
1027	151
1028	150
1029	150
1030	150
1031	150
1032	150
1033	150
1034	150
1035	150
1036	149
1037	149
1038	149
1039	149
1040	149
1041	149
1042	149
1043	149
1044	149
1045	149
1046	148
1047	148
1048	148
1049	148
1050	148
1051	148
1052	148
1053	148
1054	148
1055	147

1056	147
1057	147
1058	147
1059	147
1060	147
1061	147
1062	147
1063	147
1064	146
1065	146
1066	146
1067	146
1068	146
1069	146
1070	146
1071	146
1072	146
1073	146
1074	145
1075	145
1076	145
1077	145
1078	145
1079	145
1080	145
1081	145
1082	145
1083	144
1084	144
1085	144
1086	144
1087	144
1088	144
1089	144
1090	144
1091	144
1092	144
1093	143
1094	143
1095	143
1096	143
1097	143
1098	143
1099	143

1100	143
1101	143
1102	143
1103	142
1104	142
1105	142
1106	142
1107	142
1108	142
1109	142
1110	142
1111	142
1112	142
1113	142
1114	141
1115	141
1116	141
1117	141
1118	141
1119	141
1120	141
1121	141
1122	141
1123	141
1124	140
1125	140
1126	140
1127	140
1128	140
1129	140
1130	140
1131	140
1132	140
1133	140
1134	139
1135	139
1136	139
1137	139
1138	139
1139	139
1140	139
1141	139
1142	139
1143	139

1144	139
1145	138
1146	138
1147	138
1148	138
1149	138
1150	138
1151	138
1152	138
1153	138
1154	138
1155	138
1156	137
1157	137
1158	137
1159	137
1160	137
1161	137
1162	137
1163	137
1164	137
1165	137
1166	137
1167	136
1168	136
1169	136
1170	136
1171	136
1172	136
1173	136
1174	136
1175	136
1176	136
1177	136
1178	135
1179	135
1180	135
1181	135
1182	135
1183	135
1184	135
1185	135
1186	135
1187	135

1188	135
1189	135
1190	134
1191	134
1192	134
1193	134
1194	134
1195	134
1196	134
1197	134
1198	134
1199	134



U.S. Department of the Interior
BUREAU OF LAND MANAGEMENT

Drilling Plan Data Report

10/07/2024

APD ID: 10400099059 **Submission Date:** 06/18/2024
Operator Name: MACK ENERGY CORPORATION
Well Name: MEDICINE HAT STATE COM **Well Number:** 3H
Well Type: OIL WELL **Well Work Type:** Drill

Highlighted data reflects the most recent changes

[Show Final Text](#)

Section 1 - Geologic Formations

Formation ID	Formation Name	Elevation	True Vertical	Measured Depth	Lithologies	Mineral Resources	Producing Formatio
14268104	QUATERNARY	0	0	0	ANHYDRITE, SILTSTONE	NONE	N
14268103	TOP OF SALT	-227	227	227	ANHYDRITE, DOLOMITE, SILTSTONE	NATURAL GAS, OIL	N
14268108	BASE OF SALT	-450	450	450	ANHYDRITE, DOLOMITE, SILTSTONE	NATURAL GAS, OIL	N
14268109	YATES	-499	499	499	ANHYDRITE, DOLOMITE, SILTSTONE	NATURAL GAS, OIL	N
14268105	SEVEN RIVERS	-730	730	730	ANHYDRITE, DOLOMITE, SILTSTONE	NATURAL GAS, OIL	N
14268106	QUEEN	-1210	1210	1210	ANHYDRITE, DOLOMITE, SILTSTONE	NATURAL GAS, OIL	Y
14268107	GRAYBURG	-1617	1617	1617	ANHYDRITE, DOLOMITE, SILTSTONE	NATURAL GAS, OIL	Y
14268102	SAN ANDRES	-1940	1940	1940	ANHYDRITE, DOLOMITE, SILTSTONE	NATURAL GAS, OIL	Y

Section 2 - Blowout Prevention

Pressure Rating (PSI): 3M **Rating Depth:** 8842

Equipment: Rotating Head, Mud Gas Separator

Requesting Variance? NO

Variance request:

Testing Procedure: The BOP/BOPE test shall include low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. The estimated Bottom Hole at TD is 120 degrees and estimated maximum bottom hole pressure is 1453 psig (0.052*3038'TVD*9.2ppg) less than bottom hole pressure. Based on calculations we test BOP/BOPE to 2000 psi.

Choke Diagram Attachment:

choke_manifold_diagram_20240617112713.pdf

choke_manifold_20240617112713.pdf

BOP Diagram Attachment:

Operator Name: MACK ENERGY CORPORATION

Well Name: MEDICINE HAT STATE COM

Well Number: 3H

choke_manifold_diagram_20240617112713.pdf

choke_manifold_20240617112713.pdf

bop_diagram_20240617112732.pdf

Section 3 - Casing

Casing ID	String Type	Hole Size	Csg Size	Condition	Standard	Tapered String	Top Set MD	Bottom Set MD	Top Set TVD	Bottom Set TVD	Top Set MSL	Bottom Set MSL	Calculated casing length MD	Grade	Weight	Joint Type	Collapse SF	Burst SF	Joint SF Type	Joint SF	Body SF Type	Body SF
1	SURFACE	17.5	13.375	NEW	API	N	0	220	0	220	3516	3296	220	J-55	48	ST&C	6.738	4.697	BUOY	4.74	BUOY	48.063
2	INTERMEDIATE	12.25	9.625	NEW	API	N	0	1500	0	1500	3516	2016	1500	J-55	36	ST&C	2.59	7.04	BUOY	7.04	BUOY	8.614
3	PRODUCTION	8.75	7.0	NEW	API	N	0	2000	0	2000	3516	1516	2000	HCP-110	26	LT&C	7.191	3.317	BUOY	3.317	BUOY	7.979
4	PRODUCTION	8.75	7.0	NEW	API	N	2000	3100	2000	3100	1516	416	1100	HCP-110	26	BUTT	4.691	3.317	BUOY	3.317	BUOY	6.87
5	PRODUCTION	8.75	5.5	NEW	API	N	3100	8842	3100	8842	416	-5326	5742	HCP-110	17	BUTT	5.431	3.547	BUOY	3.547	BUOY	6.483

Casing Attachments

Casing ID: 1 **String** SURFACE

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

Medicine_Hat_State_Com_3H__Surface_20240617113258.pdf

Operator Name: MACK ENERGY CORPORATION

Well Name: MEDICINE HAT STATE COM

Well Number: 3H

Casing Attachments

Casing ID: 2 **String** INTERMEDIATE

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

Medicine_Hat_State_Com_3H___Intermediate_20240617113734.pdf

Casing ID: 3 **String** PRODUCTION

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

Medicine_Hat_State_Com_3H___Production_20240617114253.pdf

Casing ID: 4 **String** PRODUCTION

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

Medicine_Hat_State_Com_3H___Production_20240617114349.pdf

Operator Name: MACK ENERGY CORPORATION

Well Name: MEDICINE HAT STATE COM

Well Number: 3H

Casing Attachments

Casing ID: 5 **String** PRODUCTION

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

Section 4 - Cement

String Type	Lead/Tail	Stage Tool Depth	Top MD	Bottom MD	Quantity(sx)	Yield	Density	Cu Ft	Excess%	Cement type	Additives
SURFACE	Lead	220	0	220	250	1.61	14.4	153		RFC +12% PF53+2%PF1+5ppsPF42+.125ppsPF29	20 bbls Gelled Water. 50 sx of 11# Scavenger cmt.
SURFACE	Tail		0	220	200	1.34	14.8	153	100	Class C+1%PF1	20 bbls Gelled Water. 50 sx of 11# Scavenger cmt.
INTERMEDIATE	Lead	1500	0	1500	285	1.72	13.5	573	100	Class C+4% PF20+.4pps+.125ppsPF29	20 bbls gelled water. 50 sx of 11# Scavenger cmt.
INTERMEDIATE	Tail		0	1500	250	1.34	14.8	573	100	Class C+1%PF1	20 bbls gelled water. 50 sx of 11# Scavenger cmt.
PRODUCTION	Lead	8842	0	8842	220	2.82	11.5	2234	35	50/50 Poz/C+10%PF20 +5% PF44+.5%PF79+ 3pps PF42+.4ppsPF45 +. 125ppsPF29	20 bbls gelled water. 50 sx of 11# Scavenger cmt.
PRODUCTION	Tail		0	8842	2000	1.34	14.2	2234	50	50/50 Poz/C 5%PF44+2% PF20+.2%PF13+. 2% PF65+.2% PF606+.4pps PF45	20 bbls gelled water. 50 sx of 11# Scavenger cmt.

Operator Name: MACK ENERGY CORPORATION

Well Name: MEDICINE HAT STATE COM

Well Number: 3H

Section 5 - Circulating Medium

Mud System Type: Closed

Will an air or gas system be Used? NO

Description of the equipment for the circulating system in accordance with Onshore Order #2:

Diagram of the equipment for the circulating system in accordance with Onshore Order #2:

Describe what will be on location to control well or mitigate other conditions: BOPE Brine Water

Describe the mud monitoring system utilized: Pason PVT with Pit Volume Recorder

Circulating Medium Table

Top Depth	Bottom Depth	Mud Type	Min Weight (lbs/gal)	Max Weight (lbs/gal)	Density (lbs/cu ft)	Gel Strength (lbs/100 sqft)	PH	Viscosity (CP)	Salinity (ppm)	Filtration (cc)	Additional Characteristics
0	220	SPUD MUD	8.5	10	74.8	0.1	11		15	15	
220	1500	LSND/GEL	8.3	10	74.8	0.1	11		12000	15	
1500	8842	LSND/GEL	8.3	9.2	74.8	0.1	11		12000	15	The estimated bottom hole at TD is 120 degrees and estimated maximum bottom hole pressure is 1453 psig (0.052*3038*TVD*9.2) less than 2900 bottom hole pressure.

Operator Name: MACK ENERGY CORPORATION

Well Name: MEDICINE HAT STATE COM

Well Number: 3H

Section 6 - Test, Logging, Coring

List of production tests including testing procedures, equipment and safety measures:

None

List of open and cased hole logs run in the well:

CNL/FDC,GAMMA RAY LOG,FORMATION DENSITY COMPENSATED LOG,

Coring operation description for the well:

Will evaluate after logging to determine the necessity for sidewall coring.

Section 7 - Pressure

Anticipated Bottom Hole Pressure: 1453

Anticipated Surface Pressure: 1453

Anticipated Bottom Hole Temperature(F): 95

Anticipated abnormal pressures, temperatures, or potential geologic hazards? NO

Describe:

Contingency Plans geohazards description:

Contingency Plans geohazards

Hydrogen Sulfide drilling operations plan required? NO

Hydrogen sulfide drilling operations

Section 8 - Other Information

Proposed horizontal/directional/multi-lateral plan submission:

Medicine_Hat_State_Com_3H___Horizontal_Spacing_20240617141627.pdf

Medicine_Hat_State_Com__3H_Preliminary_Horizontal_Well_Plan__1_20240617141635.pdf

Medicine_Hat_State_Com_3H___Escape_Route_20240617141641.pdf

Medicine_Hat_State_Com_3H___Drilling_Program_20240617141758.pdf

Medicine_Hat_State_Com_3H___H2S_20240617141804.pdf

Natural_Gas_Management_Plan_20240626134042.pdf

Other proposed operations facets description:

Mack Energy Corporation requests the option to run a DV tool @ 1400' +/- if an air pocket is encountered.
Cmt Stage 1-2050 sx 50/50 POZ/C+5% (BWOW) PF44+2%PF20+0.2% PF13+0.2% PF606+0.1%
FP153+0.4pps PF45, yld 1.34, density 14.2, mix H2O gals/sx 6085, 50% excess, Slurry Top 1400' cmt State
2-200 sx C+2% PF1, yld 1.34, density 14.8, 0% excess, Slurry Top Surface. 2,205.1 Cy/Ft. per Line/Ft.

Other proposed operations facets attachment:

Other Variance attachment:

Operator Name: MACK ENERGY CORPORATION

Well Name: MEDICINE HAT STATE COM

Well Number: 3H

Cactus_Wellhead_installation_Procedure_20240617141838.pdf

Variance_request_20240617141845.pdf

Flex_Hose_Cert_20240617141850.pdf

CCC__Rig_6_20240617141858.pdf

CONFIDENTIAL



Installation Procedure Prepared For:

Mack Energy Corporation
13-3/8" x 9-5/8" x 7" 10M
MBU-LR Wellhead System With
CTH-DBLHPS Tubing Head

Publication # IP0228

May, 2014


INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC .

Table of Contents

	System Drawing -----	1
	Bill of Materials -----	2
Stage 1 —	Install the MBU-LR Wellhead Housing -----	4
Stage 2 —	Test the BOP Stack -----	5
Stage 3 —	Run the Lower Wear Bushing -----	6
	Run the Wear Bushing Before Drilling-----	6
	Retrieve the Wear Bushing After Drilling-----	6
Stage 4 —	Hang Off the 9-5/8” Casing -----	7
	Running the 13-5/8” Wash Tool -----	7
	Seal Test -----	11
	Engaging the Lockring-----	12
	Retrieving The Casing Hanger -----	13
Stage 4A —	Hang Off the 9-5/8” Casing (Emergency) -----	15
Stage 4B —	Install the 9-5/8” MBU-LR Emergency Packoff -----	17
	Landing the Packoff -----	19
	Seal Test -----	19
	Engaging the Lockring-----	20
	Retrieving the Packoff -----	21
Stage 5 —	Test the BOP Stack -----	22
Stage 6 —	Run the Upper Wear Bushing -----	23
	Run the Wear Bushing Before Drilling-----	23
	Retrieve the Wear Bushing After Drilling-----	23
Stage 7 —	Hang Off the 7” Casing -----	24
Stage 8 —	Install the Tubing Head -----	26
	Seal Test -----	27
	Flange Test -----	28
	Recommended Procedure for Field Welding Pipe to Wellhead Parts for Pressure Seal -----	29


INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

System Drawing

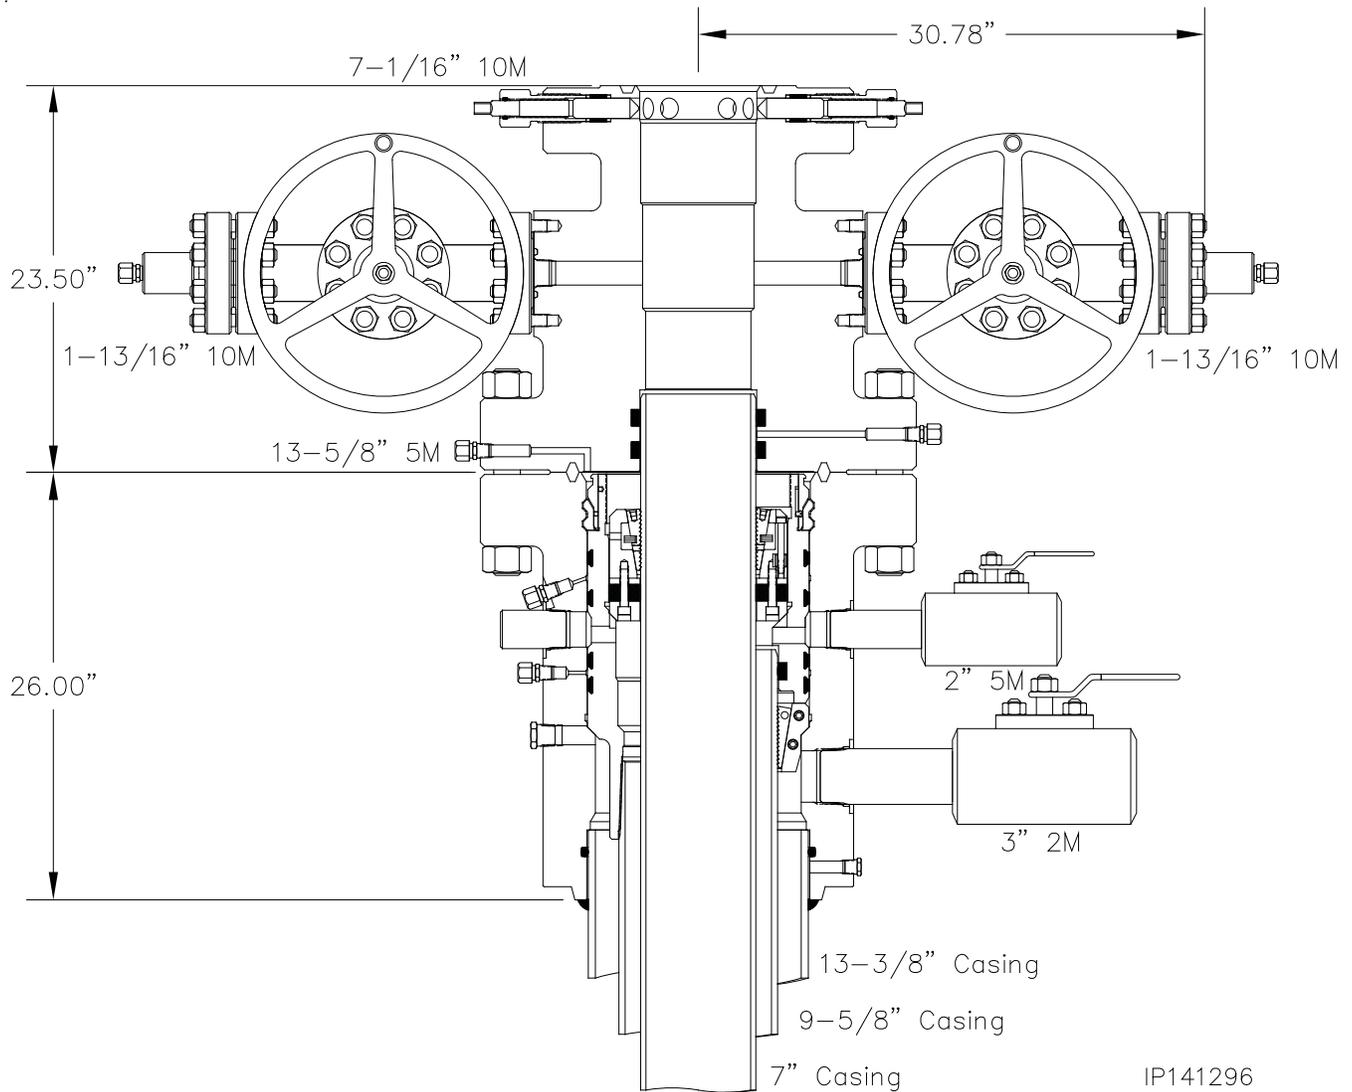

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Bill of Materials

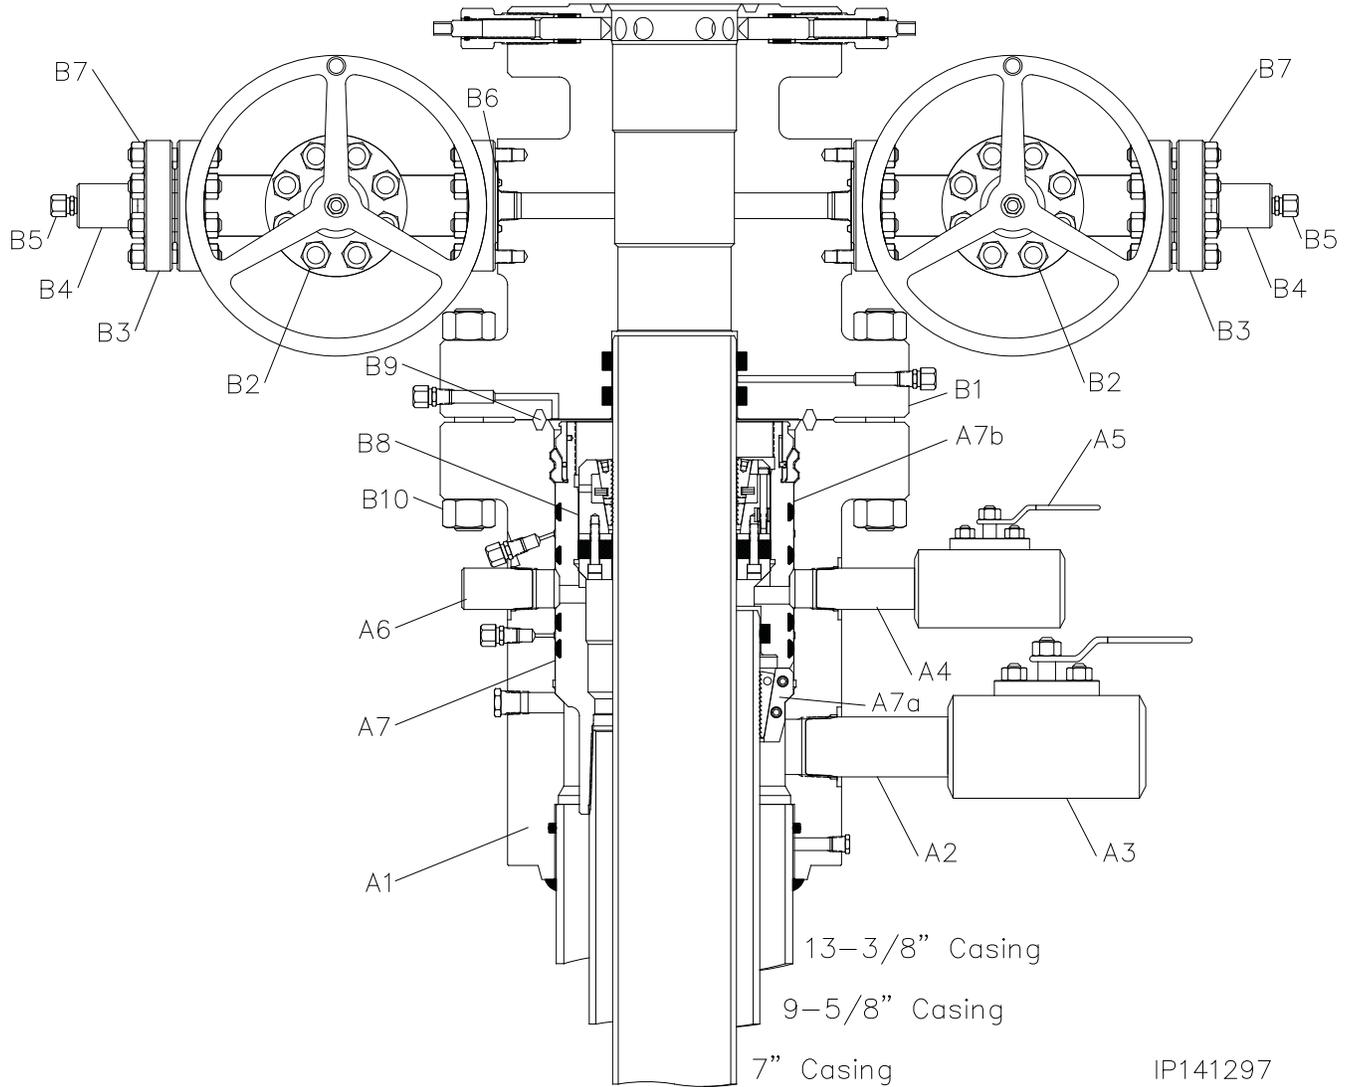

IP141297

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC .

MBU-LR HOUSING ASSEMBLY		
Item	Qty	Description
A1	1	Housing, CW, MBU-LR, 13-5/8" 5M x 13-3/8" SOW, with two 2" line pipe upper outlets and one 3" line pipe lower outlet, one piece, 6A-PU-AA-1-1 Part # 102513
A2	1	Nipple, 3" line pipe x 12" long, XH Part # 101610
A3	1	Ball Valve, KF, AH, 3 RP 2M LP, DI: Body, CS: Trim, nylon seats, HNBR: seals, with handle standard non-nace service Part # 100535
A4	1	Nipple, 2" line pipe x 6" long, XH Part # NP6A
A5	1	Ball Valve, 2" RP, 5M LP x 2" LP, WCB body, 304SS ball, CR13 stem, RPTFE seats, API 596 Part # 103877
A6	1	Bull Plug, 2" line pipe solid, 4130 60K Part # BP2P
A7	1	Casing Hanger, CW, MBU-LR, 13-5/8" x 9-5/8" LC box bottom x 11.250" 4 Stub Acme 2G LH box top, mandrel, 6A-U-AA-1-1 Part # 100482

EMERGENCY EQUIPMENT		
Item	Qty	Description
A7a	1	Casing Hanger, CW, MBU-LR, 13-5/8" x 9-5/8" 6A-PU-DD-3-1 Part # 100569
A7b	1	Packoff, CW, MBU-LR Emergency, 13-5/8" x 11" x 9-5/8" with 11.250" 4 Stub Acme 2G LH top, slotted for CL outlets, 6A-PU-AA-1-1 Part # 100538

TUBING HEAD ASSEMBLY		
Item	Qty	Description
B1	1	Tubing Head, CW, CTH-DBLHPS, 7, 13-5/8" 5M x 7-1/16" 10M, with two 1-13/16" 10M studded outlets 6A-PU-EE-0,5-2-1 Part #
B2	2	Gate Valve, DSG-22, 1-13/16" 10M, flanged end, EE-0,5 trim, (6A-PU-EE-0,5-3-1) Part # 102284
B3	2	Companion Flange, 1-13/16" 10M x 2" line pipe (5,000 psi max WP), (6A-PU-EE-NL-1) Part # 200010
B4	2	Bull Plug, 2" line pipe x 1/2" line pipe, API 6A-DD-NL Part # BP2T
B5	2	Fitting, Grease, Vented Cap, 1/2" NPT, Alloy Non-Nace Part # FTG1
B6	4	Ring Gasket, 151, 1-13/16" 10M Part # BX151
B7	16	Studs, all thread with two nuts, black, 3/4" x 5-1/2" long, B7/2H Part # 780080
B8	1	Casing Hanger, C22, 11" x 7" Part # 50020
B9	1	Ring Gasket, 160, 13-5/8" 5M Part # BX160
B10	16	Studs, all thread with two nuts, black, 1-5/8" x 12-3/4" long, B7/2H Part # 780087

RECOMMENDED SERVICE TOOLS		
Item	Qty	Description
ST1	1	Test Plug/Retrieving Tool, CW, 13-5/8" x 4-1/2" IF, 1-1/4" LP bypass and spring loaded lift dogs Part # 800002
ST2	1	Wear Bushing, CW, MBU-LR-LWR, 13-5/8" x 12.38" ID x 20.31" long Part # 100546
ST3	1	Casing Hanger Running Tool, CW, MBU-LR, 13-5/8" x 9-5/8" long casing box top x 11.250" 4 Stub Acme LH pin bottom, 4140 110K Part # 102304
ST4	1	Packoff Running Tool, CW, MBU-LR, 13-5/8" x 4-1/2" IF box bottom and top, with 11.250" 4 Stub Acme 2G LH pin bottom Part # 100556
ST5	1	Test Plug/Retrieving Tool, CW, 11" x 4-1/2" IF, 1-1/4" LP bypass and spring loaded lift dogs Part # 800001
ST6	1	Wear Bushing, MBU-LR-UPR, 13-5/8" x 11" x 9.00" I.D. x 16.0" long Part # 102789
ST7	1	Wash Tool, CW, Casing Hanger, MBU-LR/MBS2, fluted, 13-5/8" x 4-1/2" IF box top threads, fabricated Part # 102787

TA CAP ASSEMBLY		
Item	Qty	Description
C1	1	Flange, Blind, 7-1/16" 10M X 1/2 LP, With Two 3/4" Part # 101464
C2	1	Needle Valve, MFA, 1/2" Line Pipe, 10M Part # NVA
C3	12	Studs, All Thread With Two Nuts, Black, 1-1/2" X 11-3/4" Long, B7/H2 Part # 780082



Mack Energy Corporation.
13-3/8" x 9-5/8" x 7" 10M MBU-LR Wellhead System
With CTH-DBLHPS Tubing Head

IP 0228
Page 3

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 1 — Install the MBU-LR Wellhead Housing

1. Run the conductor and 13-3/8" surface casing to the required depth and cement as required.
2. Determine the correct elevation for the MBU-LR Wellhead Assembly.
3. Cut the 13-3/8" at 53.5" below the cellar to accommodate the wellhead. Grind stub level with the horizon and place an 1/8" x 1/8" bevel on the OD of the stub.

Note: The slip on and weld preparation is 4.25" in depth.

4. Examine the **13-5/8" 5M x 13-3/8" SOW MBU-LR Wellhead Assembly (Item A1)**. Verify the following:
 - bore is clean and undamaged
 - weld socket is clean and free of grease and debris and o-ring is in place and in good condition
 - all seal areas are clean and undamaged
 - valves are intact and in good condition

5. Align and level the Wellhead Assembly over the casing stub, orienting the outlets so they will be compatible with the drilling equipment.



6. Remove the pipe plug from the port on the bottom of the Head.

7. Slowly and carefully lower the assembly over the casing stub, weld and test the MBU-LR housing to the surface casing.

8. Replace the pipe plug in the port on the bottom of the housing.

Note: The weld should be a fillet-type weld with legs no less than the wall thickness of the casing. Legs of 1/2" to 5/8" are adequate for most jobs.

Refer to the back of this publication for the **Recommended Procedure for Field Welding Pipe to Wellhead Parts for Pressure Seal** and for field testing of the weld connection.

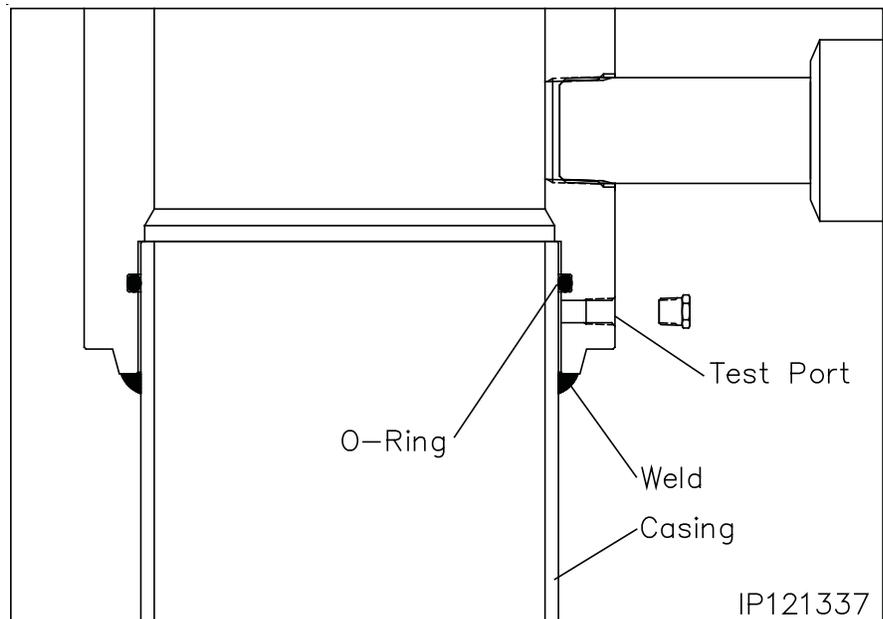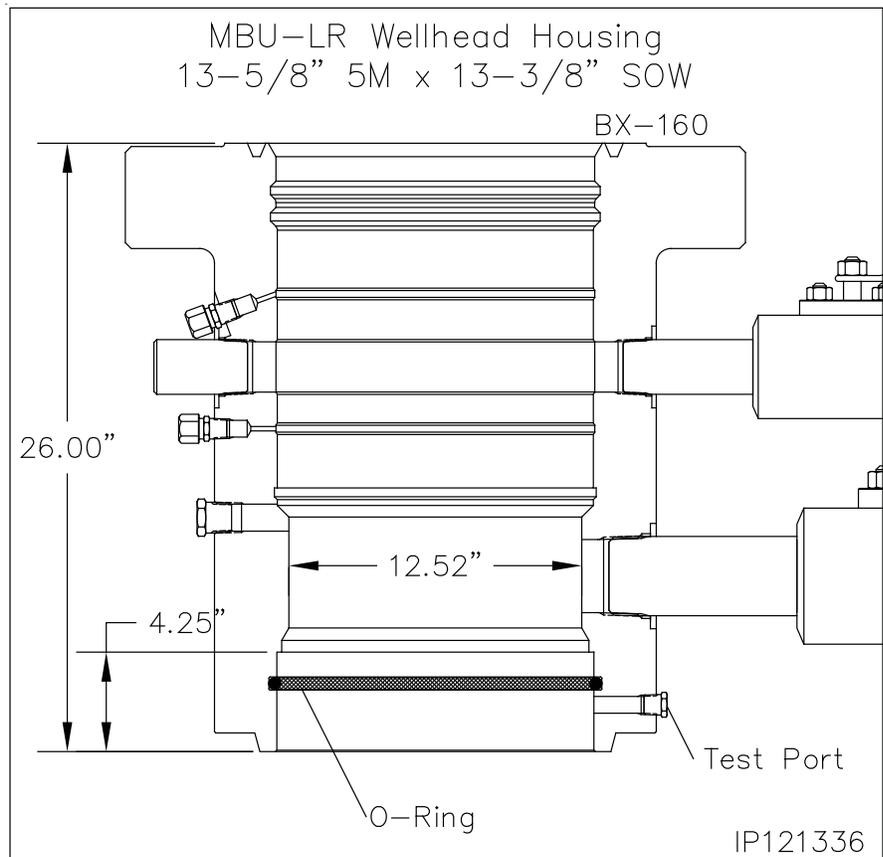


INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 2 — Test the BOP Stack

Immediately after making up the BOP stack and periodically during the drilling of the well for the next casing string the BOP stack (connections and rams) must be tested.

1. Examine the **13-5/8" Nominal x 4-1/2" IF CW Test Plug/Retrieving Tool (Item ST1)**. Verify the following:
 - 1-1/4" VR plug and weep hole plug are in place and tightened securely
 - elastomer seal is in place and in good condition
 - retractable lift lugs are in place, clean, and free to move
 - drill pipe threads are clean and in good condition

Note: Prior to installing the BOP it is recommended to attain an accurate RKB dimension for future use for accurately landing test plugs and casing hangers. This dimension is attained by dropping a tape measure from the rig floor to the top of the wellhead flange. Pull tape taut and record the dimension from the wellhead to the top of the rig floor or kelly bushings. Ensure this dimension is placed on the BOP board in the dog house and on the drillers daily report sheet.

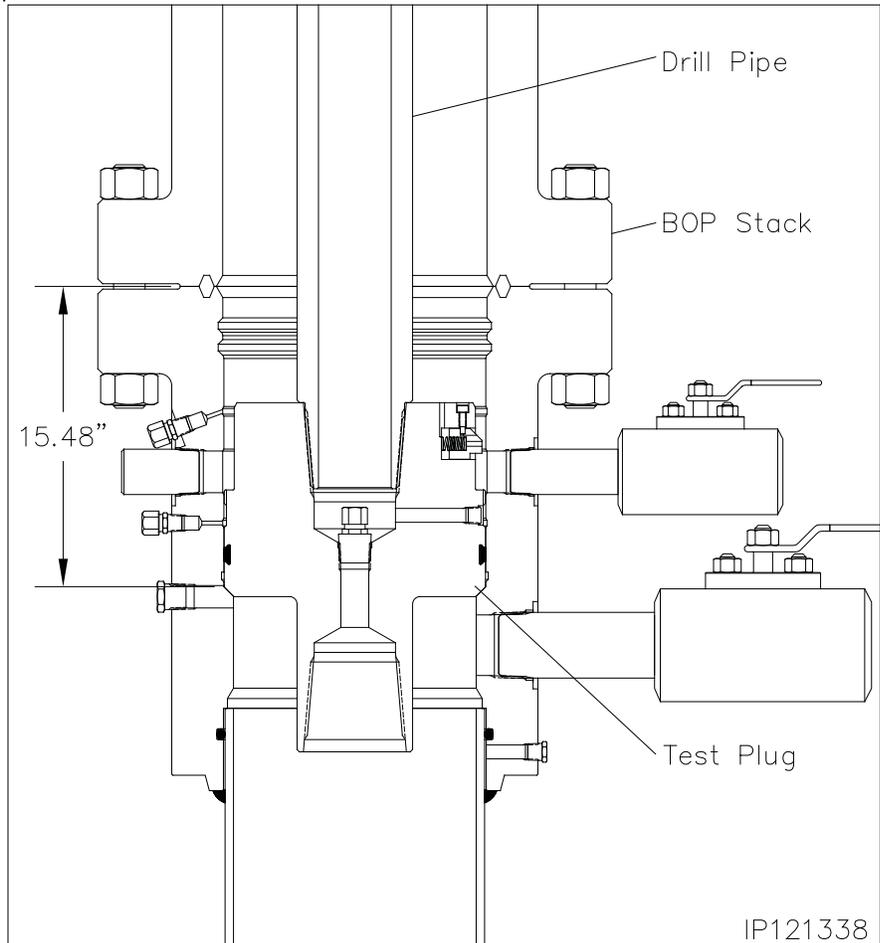

2. Position the test plug with the elastomer seal down and the lift lugs up and make up the tool to a joint of drill pipe.
3. Remove the 1/2" NPT pipe plug from the weep hole if pressure is to be supplied through the drill pipe.
4. Open the housing side outlet valve.
5. Lightly lubricate the test plug seal with oil or light grease.
6. Carefully lower the test plug through the BOP and land it on the load shoulder in the housing, 15.48" below the top of the housing.
7. Close the BOP rams on the pipe and test the BOP to 5,000 psi.

Note: Any leakage past the test plug will be clearly visible at the open side outlet valve.
8. After a satisfactory test is achieved, release the pressure and open the rams.
9. Remove as much fluid as possible from the BOP stack and the retrieve the test plug with a straight vertical lift.
10. Repeat this procedure as required during the drilling of the hole section.

Note: When performing the BOP blind ram test it is highly recommended to suspend a stand of drill pipe below the test plug to ensure the plug stays in place while disconnecting from it with the drill pipe.

WARNING: Ensure that the lift lugs are up and the elastomer seal is down

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 3 — Run the Lower Wear Bushing

Note: Always use a Wear Bushing while drilling to protect the load shoulders from damage by the drill bit or rotating drill pipe. The Wear Bushing **must be retrieved** prior to running the casing.

1. Examine the **13-5/8" Nominal MBU-LR-LWR Wear Bushing (Item ST2)**. Verify the following
 - internal bore is clean and in good condition
 - o-ring is in place and in good condition
 - shear o-ring cord is in place and in good condition
 - paint anti-rotation lugs white and allow paint to dry


Run the Wear Bushing Before Drilling

2. Orient the **13-5/8" Nominal x 4-1/2" IF CW Test Plug/Retrieving Tool (Item ST1)** with drill pipe connection up.
3. Attach the Retrieving Tool to a joint of drill pipe.
4. Align the retractable lift lugs of the tool with the retrieval holes of the bushing and the carefully lower the tool into the Wear Bushing until the lugs snap into place.

Note: If the lugs did not align with the holes, rotate the tool in either direction until they snap into place.

5. Apply a heavy coat of grease, not dope, to the OD of the bushing.
6. Slowly lower the Tool/Bushing Assembly through the BOP stack and land it on the load shoulder in the housing, 15.48" below the top of the housing.
7. Rotate the drill pipe clockwise (right) to locate the stop lugs in their mating notches in the head. When properly aligned the bushing will drop an additional 1/2".
8. Remove one of the 1" sight port pipe plugs from the OD of the housing and look through the hole to verify the lug has engaged the slot. The painted lug will be clearly visible through the port. Reinstall the pipe plug and tighten securely.

Note: The Shear O-Ring on bottom of the bushing will locate in a groove above the load shoulder in the head to act as a retaining device for the bushing.

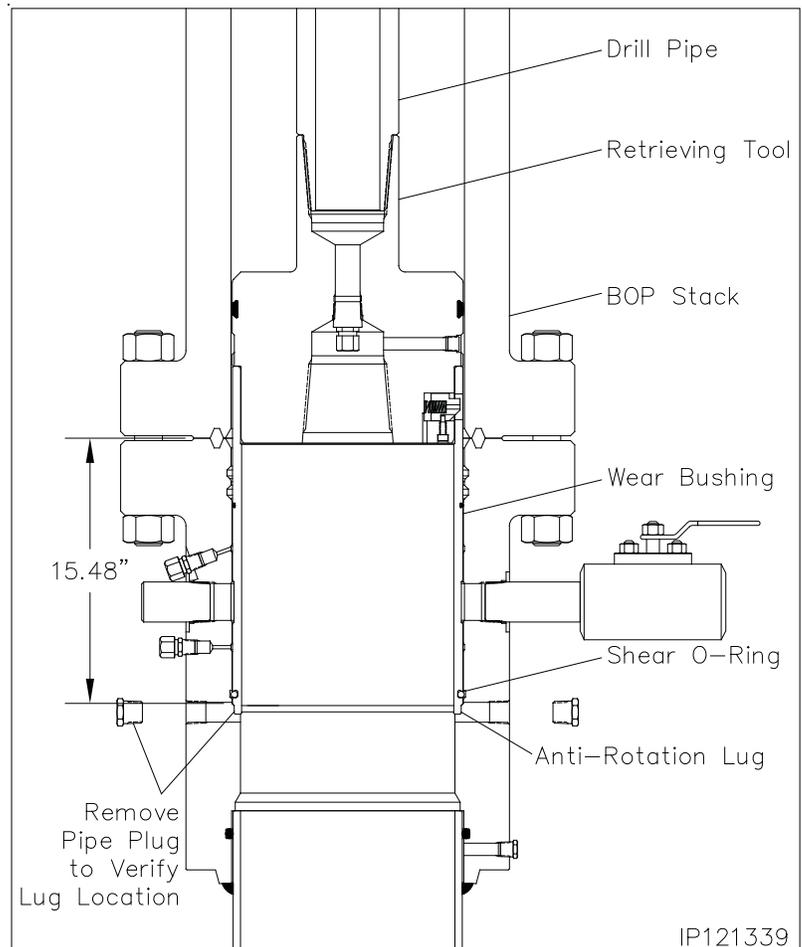

9. Remove the Tool from the Wear Bushing by rotating the drill pipe counter clockwise (left) 1/4 turn and lifting straight up.
10. Once set is highly recommended to inject a minimum of two full tubes of grease through the housing test ports To keep trash from accumulating behind the bushing.
11. Drill as required.

Note: It is highly recommended to retrieve, clean, inspect, grease, and reset the wear bushing each time the hole is tripped during the drilling of the hole section.

Retrieve the Wear Bushing After Drilling

12. Make up the Retrieving Tool to the drill pipe .
13. Slowly lower the Tool into the Wear Bushing.
14. Pick up and balance the riser weight.
15. Rotate the Retrieving Tool clockwise until a positive stop is felt. This indicates the lugs have snapped into the holes in the bushing.
16. Retrieve the Wear Bushing, and remove it and the Retrieving Tool from the drill string.


INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 4 — Hang Off the 9-5/8" Casing

Due to the possible build up of debris in the bore and locking groove of the MBU-LR wellhead it is recommended to run the 13-5/8" Wash Tool prior to running the 9-5/8 casing.

Running the 13-5/8" Wash Tool

- Examine the **13-5/8" x 4-1/2" IF Wash Tool (Item ST7)**. Verify the following:
 - drill pipe threads and bore are clean and in good condition
 - all ports are open and free of debris
 - brushes are securely attached and in good condition
 - Orient the Wash Tool with drill pipe box up. Make up a joint of drill pipe to the tool.
 - Carefully lower the Wash Tool through the BOP and land it on top of the 9-5/8" casing hanger, 15.48" below the top flange of the housing.
 - Place a paint mark on the drill pipe level with the rig floor and then pick up on the tool approximately 1".
 - Attach a high pressure water line to the end of the drill pipe and pump water through the tool and up the Diverter stack.
 - While flushing, raise and lower the tool the full length of the wellhead and BOP stack. The drill pipe should be slowly rotate while raising and lowering to wash the inside of the housing and BOP stack to remove all caked on debris.
 - Once washing is complete, shut down pumps and then open the housing lower outlet valve and drain the BOP stack.
- Note:** If returns are not clean, continue flushing until they are.
- Once the returns are clean and free of debris, retrieve the tool to the rig floor.

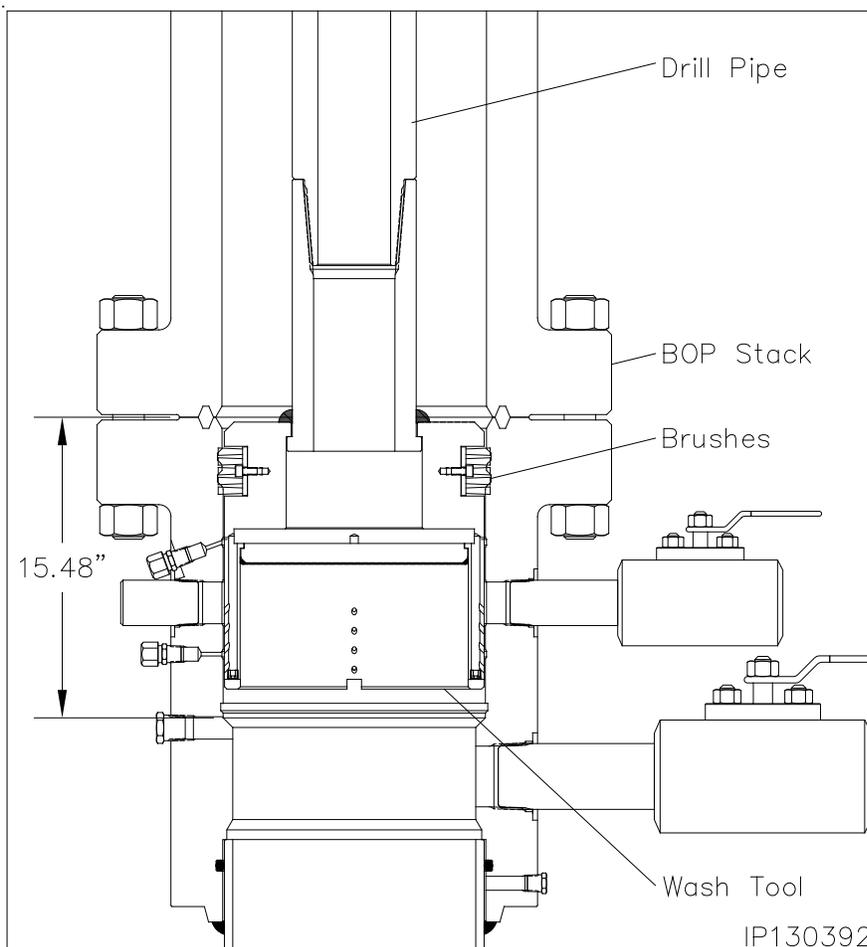


INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 4 — Hang Off the 9-5/8” Casing

The 9-5/8” MBU-LR casing hanger and running and retrieving tool should be shipped to location pre assembled as a full joint. If not, follow steps 1 through for assembling on the pipe rack.

1. Examine the **13-5/8” x 9-5/8” LC MBU-LR Casing Hanger (Item A7)**. Verify the following:
 - bore and internal Acme threads are clean and in good condition
 - lockring is in place and free to rotate
 - energizing ring is in its upper most position and secured with shear pins
 - dovetail seals are clean and in good condition
 - pup joint is in good condition and properly made up. Thoroughly clean, inspect, and lubricate pin threads
 - paint the 45° load shoulder white as indicated

2. Examine the **13-5/8” x 9-5/8” LC MBU-LR Casing Hanger Running and Retrieving Tool (Item ST3)**. Verify the following:
 - bore is clean and free of debris
 - O.D. Acme threads are clean and in good condition
 - o-ring is in place and in good condition
 - proper length landing joint is made up in top of the tool with thread lock compound

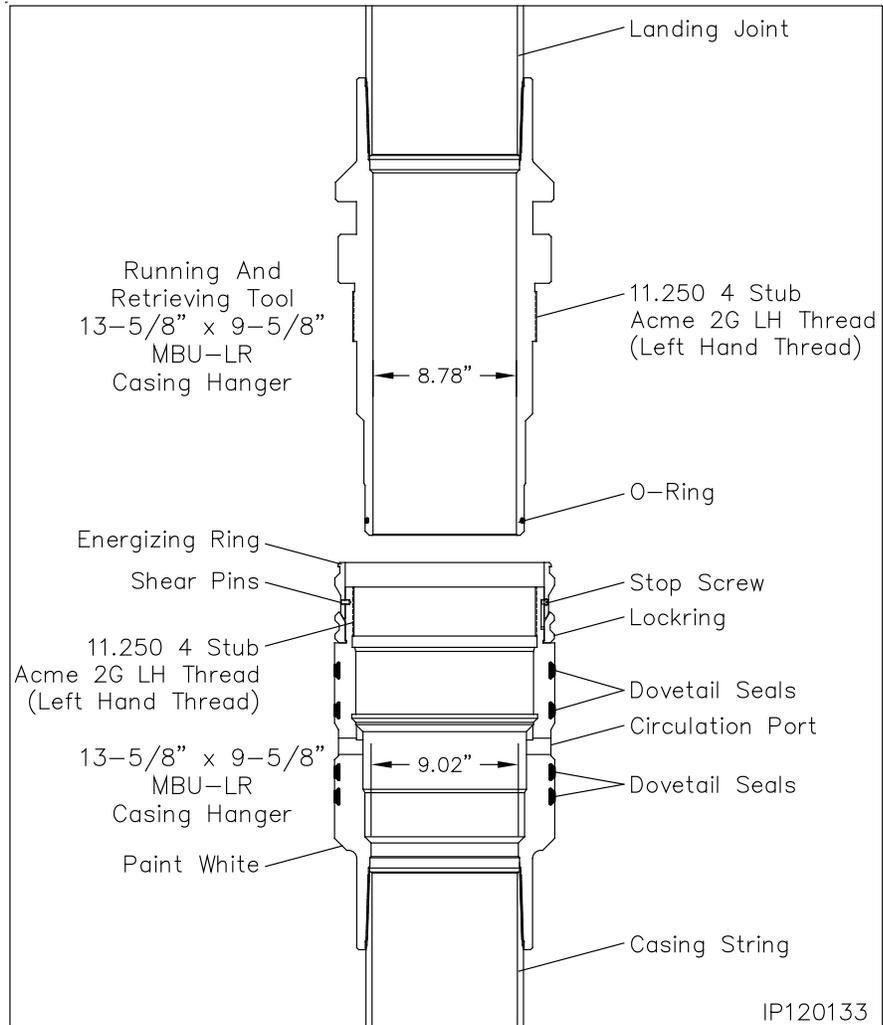

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 4 — Hang Off the 9-5/8” Casing

3. Thoroughly clean and lightly lubricate the mating Acme threads and seal surfaces of the hanger and running tool.
4. Carefully slide the running tool into the hanger and then rotate the tool clockwise (Right) to locate the thread start and then counter clockwise (Left) approximately 8 turns or until the tool makes contact with the top of the energizing ring.


WARNING: Do Not apply torque to the Hanger/Tool connection.

5. Run the 9-5/8” casing as required and space out appropriately for the mandrel casing hanger.

Note: If the 9-5/8” casing becomes stuck and the mandrel casing hanger can not be landed, Refer to **Stage 4A** for the emergency procedure.

6. Set the last joint of casing run in the floor slips.
7. Pick up the casing hanger/running tool assembly and make it up in the casing string. Torque connection to thread manufacturer's optimum make up torque.
8. **Using chain tongs only**, back off the running tool with clockwise rotation (Right) one full turn to verify ease of operation and then re make the connection with counter clockwise rotation (Left) just until contact with the energizing ring is.


WARNING: Do Not apply torque to the Hanger/Tool connection.

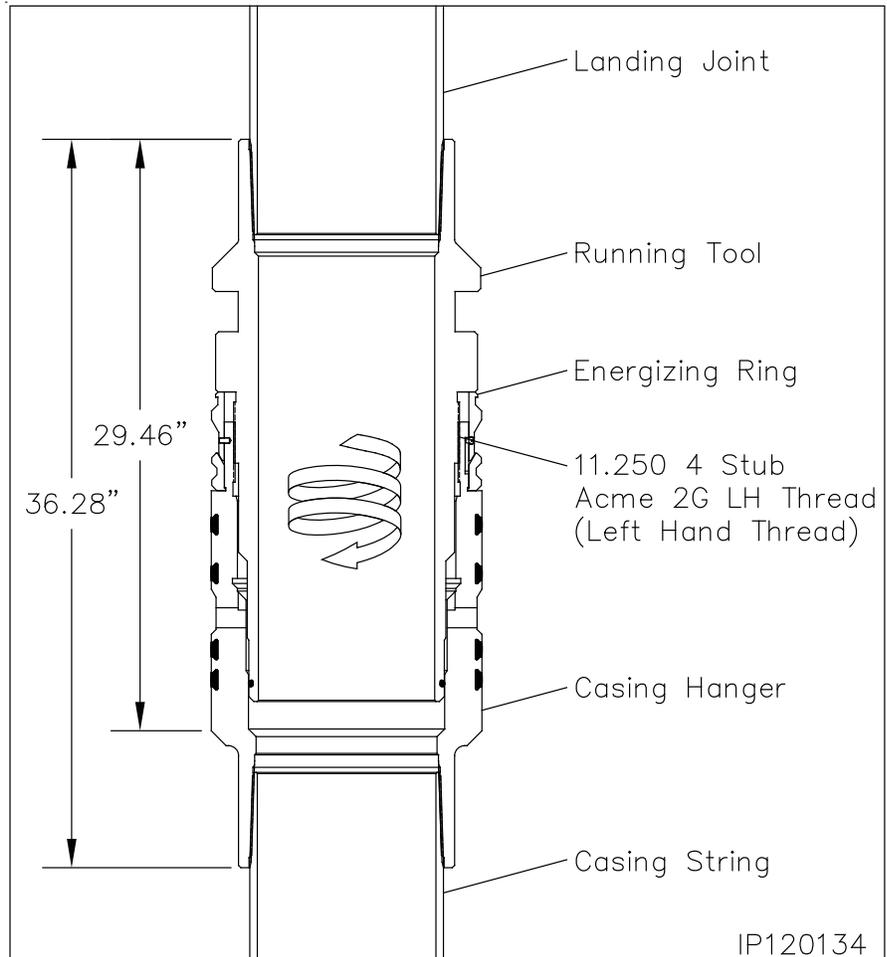

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 4 — Hang Off the 9-5/8” Casing

9. Calculate the total landing dimension by adding the previously attained RKB dimension and 15.48”, the depth of the wellhead.
10. Drain the BOP stack and wellhead through the 3” ball valve.
11. Starting at the top of the 45° angle load shoulder of the casing hanger measure up 5 feet and place a horizontal paint mark on the landing joint and write 5 next to the mark.
12. Using the 5 foot stick, slowly and carefully lower the Hanger through the BOP, marking the landing joint at five foot increments until you come to the calculated total landing dimension. Place a paint mark on the landing joint at that dimension and write the landing dimension next to the mark. Place an additional mark on the landing joint 1-1/2” above the first mark and write engaged.
13. Continue carefully lowering the hanger through the BOP stack and land it on the load shoulder in the housing, 15.48” below the top of the MBU-LR housing and slack off all weight and verify that the landing dimension paint mark has aligned with the rig floor.
14. Locate the 1” LP sight port on the lower O.D. of the housing and remove the pipe plug.
15. Look through the port to verify the hanger is properly landed. The white painted load shoulder will be clearly visible in the open port.
16. Reinstall the 1” pipe plug and tighten securely.

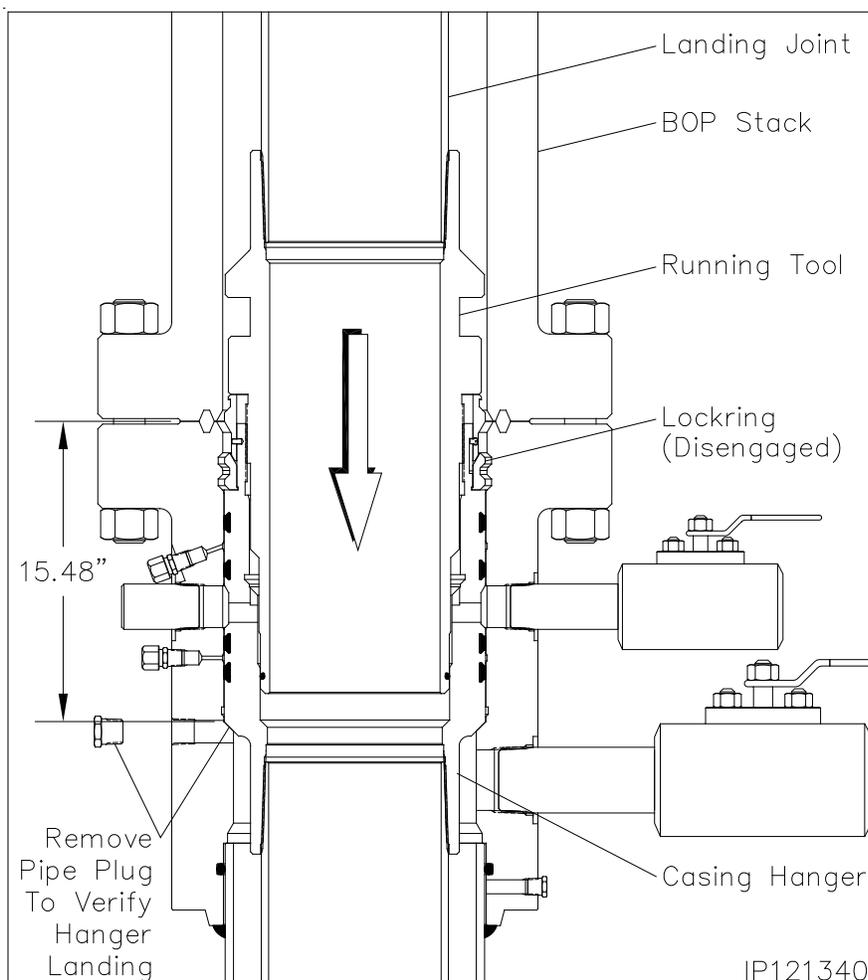


IP121340

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 4 — Hang Off the 9-5/8” Casing

Seal Test

17. Locate the upper and lower seal test fittings on the O.D. of the housing and remove the dust caps from both fittings.
18. Attach a test pump to one of the open fittings and pump clean test fluid between the seals until a stable test pressure of 5,000 psi is attained.
19. If a leak develops, bleed off test pressure, remove the hanger from the wellhead and replace the leaking seals.
20. Repeat steps 17 through 19 for the remaining seal test.
21. After satisfactory test are achieved, bleed off all test pressure, remove test pump and reinstall the dust caps on the open fittings

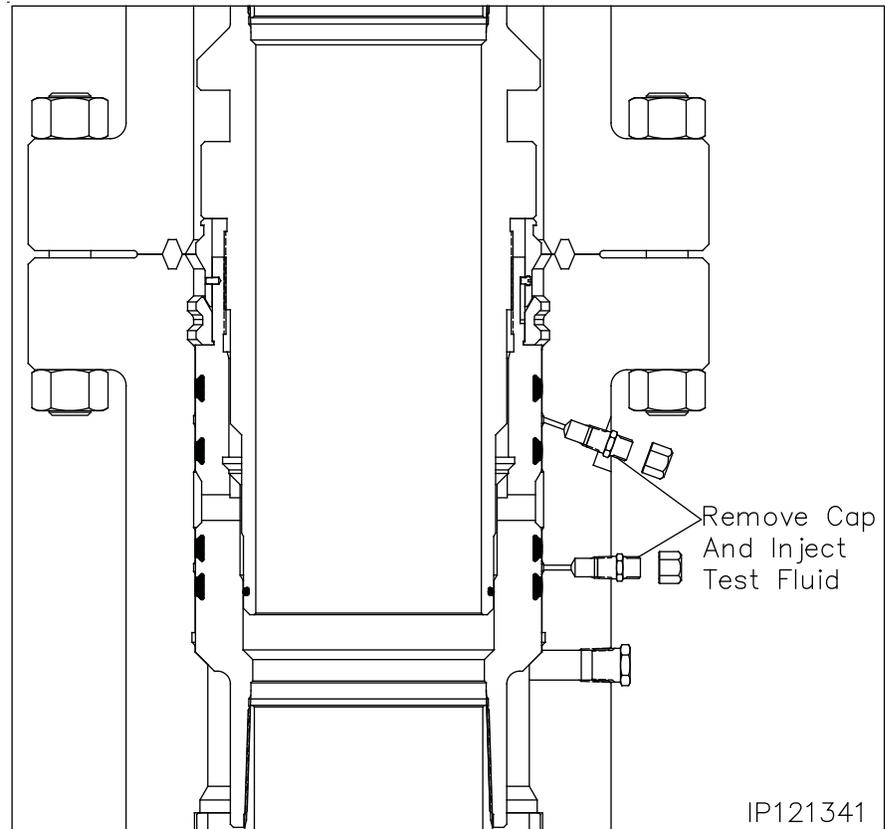

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 4 — Hang Off the 9-5/8” Casing

Engaging the Lockring

22. **Using Chain Tongs Only located 180° apart**, rotate the landing joint approximately 6 turns counter clockwise (Left) to engage the casing hanger locking in its mating groove in the bore of the MBU-LR housing.

Note: Approximately 800 to 900 ft. lbs. of torque will be required to break over the shear pins in the hanger. The torque will drop off and then increase slightly when the energizing ring pushes the locking out. A positive stop will be encountered when the locking is fully engaged.

Note: When properly engaged the second paint mark on the landing joint will align with the rig floor.

WARNING: It is imperative that the landing joint remain concentric with the well bore when rotating to engage the locking. This can be accomplished with the use of the air hoist.


WARNING: If the required turns to engage the locking or not met or excessive torque is encountered, remove the casing hanger and call Houston Engineering.

23. Back off the landing joint/running tool approximately three turns clockwise (Right). Using the elevators, exert a 30,000 lbs. over string weight pull on the landing joint to confirm positive locking engagement.

24. Slack off all weight and place a vertical paint mark on the landing joint to verify if the casing string rotates during the cementing process.

Note: It is not necessary to remake the casing hanger running tool connection after the over pull. If desired two counter clockwise rotations may be made but full make up is not required.

25. Cement the casing as required, taking returns through the lower 3” outlet.

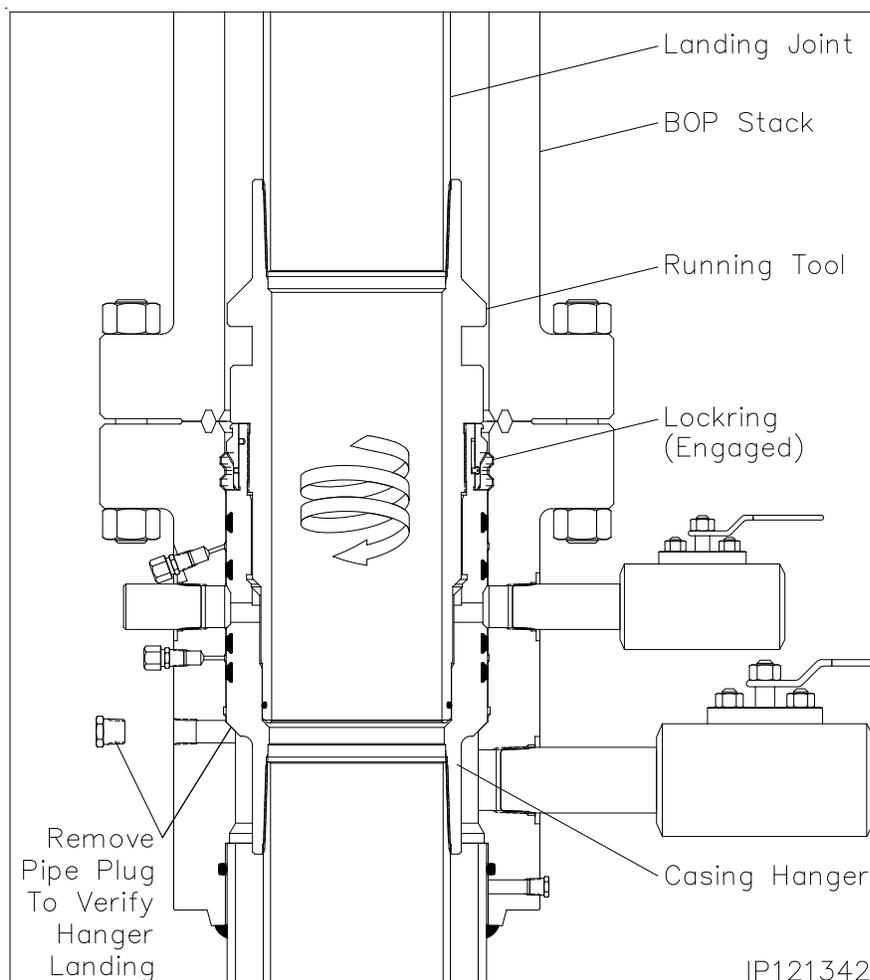

26. With cement in place, bleed off cement pressure and remove cementing equipment.

27. If well condition permit, remove the 1” sight port pipe plug to observe if the hanger rotates during the removal of the running tool.

28. **Using Chain Tongs Only located 180° apart**, retrieve the Running Tool and landing joint by rotating the landing joint clockwise (Right) an additional 11 turns or until the tool comes free of the hanger. Retrieve the tool with a straight vertical lift.

29. Reinstall the 1” pipe plug and tighten securely.

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 4 — Hang Off the 9-5/8" Casing

Retrieving The Casing Hanger

In the event that the casing hanger needs to be removed the 13-5/8" x 9-5/8" MBU-LR Casing Hanger Running and retrieving tool can be fitted with a retrieval latch that will lift the casing hanger energizing ring and allow the locking to disengage.

- Examine the **13-5/8" x 9-5/8" LC MBU-LR Casing Hanger Running and Retrieving Tool (Item ST3)**. Verify the following:
 - bore is clean and free of debris
 - O.D. Acme threads are clean and in good condition
 - o-ring is in place and in good condition
 - proper length landing joint is made up in top of the tool with thread lock compound
 - retrieval latch is available and in good condition
- Thoroughly clean and lightly the latch groove of the tool with oil or light grease.
- Remove the (4) 1/2" cap screws retaining the two halves of the retrieval latch.
- Install the retrieval latch around the Retrieving Tool body as indicated and reinstall the 1/2" cap screws. Tighten screws securely.



WARNING: Ensure the latch rotates freely on the tool. If not remove and check the latch and tool for burrs or imperfections in the groove.

- Thoroughly clean and lightly lubricate the seal surfaces and Acme threads of the tool with oil or a light grease.
- Using the casing elevators, carefully lower the tool through the BOP stack and into the casing hanger bore until the tool contacts the top of the hanger Acme threads

Note: Contact should be made at previously attained RKB dimension.

- Using chain tongs only located **180° apart**, rotate the landing joint clockwise (Right) to locate the thread start then counter clockwise (Left) approximately 13 turns.

WARNING: Slowly make the last two revolutions. The torque will increase slightly as the latch passes over the top of the energizing ring and snaps into position under the lip of the ring.

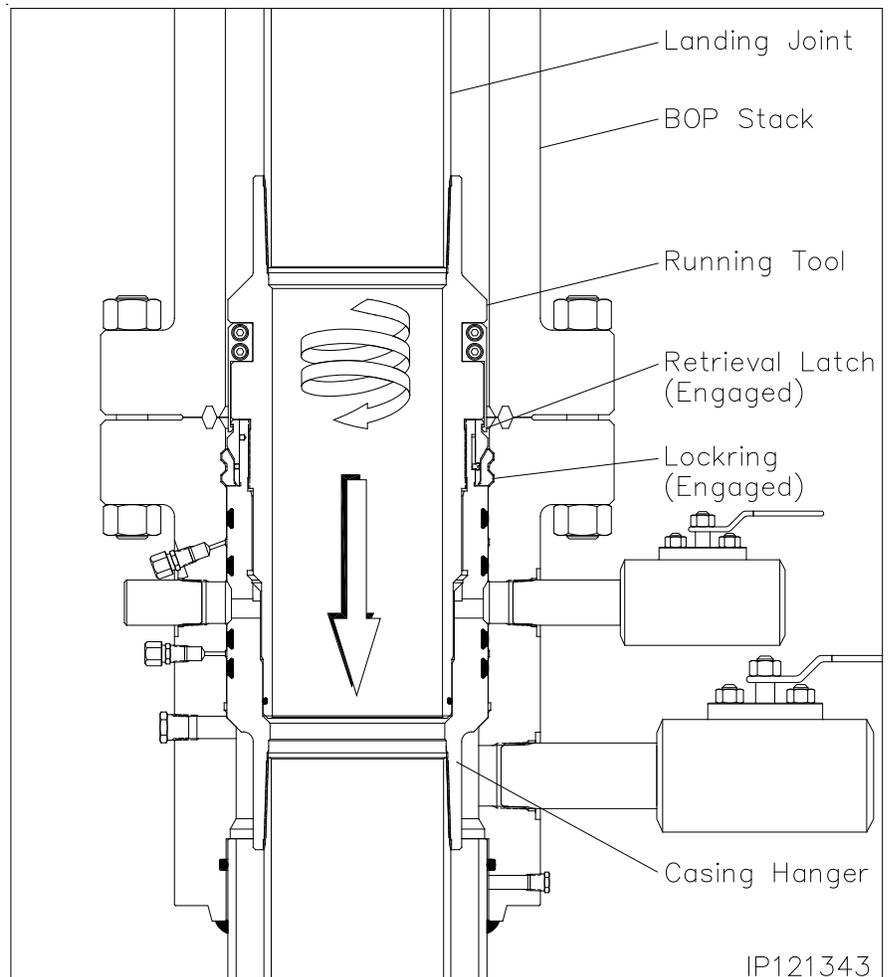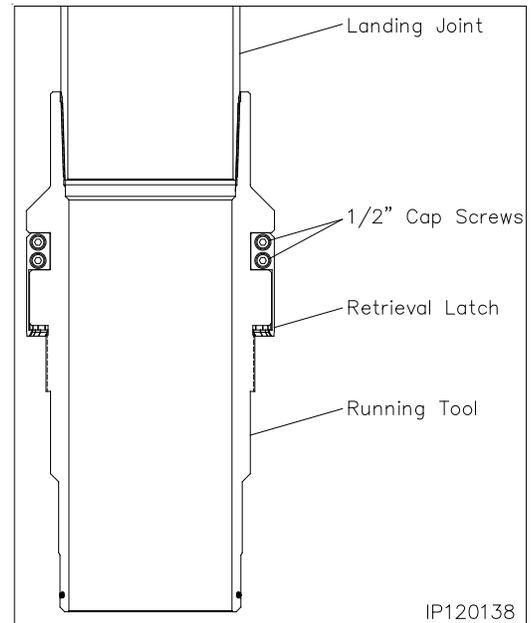

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.


Stage 4 — Hang Off the 9-5/8” Casing

WARNING: The landing joint must remain concentric with the well bore when screwing into the hanger.

8. With positive engagement attained, reposition the tongs for clockwise (Right) rotation and then rotate the landing joint approximately 6 turns to lift the energizing ring and release the lockring.

Note: The landing joint should rise approximately 1-1/2” and come to a positive stop against the stop screws.

9. Halt rotation and remove the chain tongs.
10. Using the drill pipe elevators, slowly pick up on the casing hanger and retrieve it from the wellhead.
11. With the tool and hanger at the rig floor, set the casing in the floor slips and slack off.
12. Rotate the landing joint counter clockwise (Left) one turn.
13. Remove the (4) 1/2” cap screws from the retrieval latch and remove the latch assembly from the tool.
14. Remove the casing hanger and running tool from the casing string.

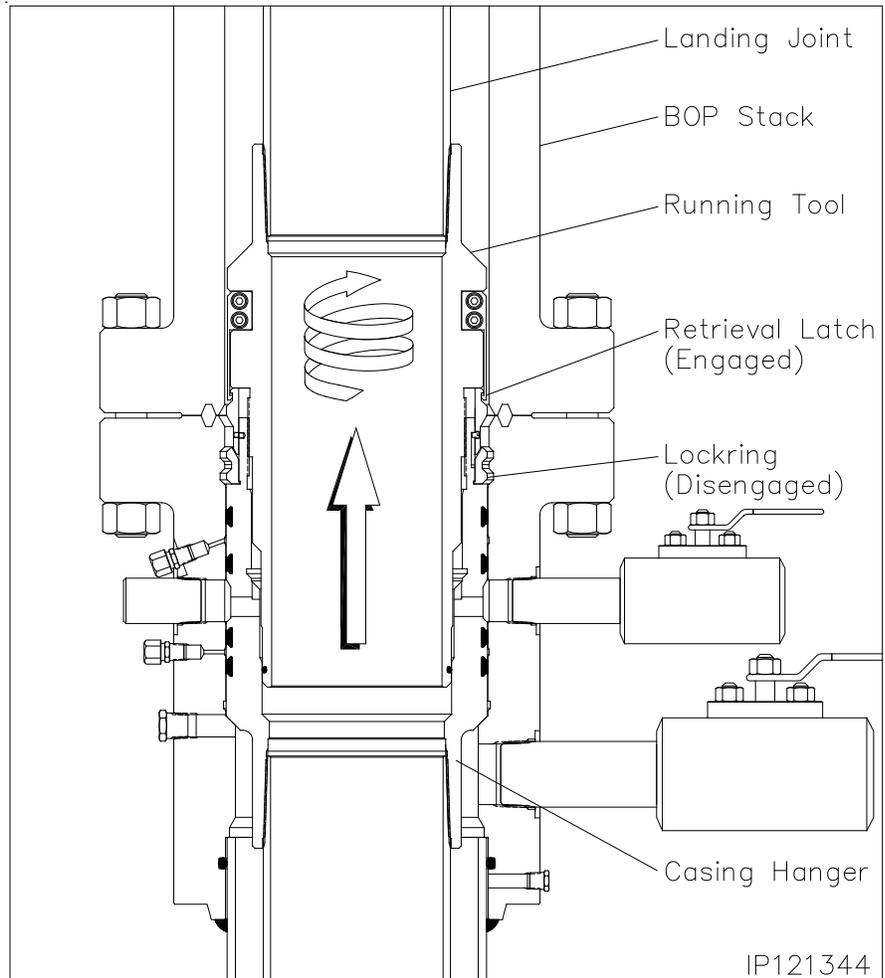



IP121344

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 4A — Hang Off the 9-5/8" Casing (Emergency)

Note: The following procedure should be followed **ONLY** if the 9-5/8" casing should become stuck in the hole. If the casing did not get stuck and is hung off with the Mandrel Casing Hanger, skip this stage.

1. Cement the hole as required.
2. Drain the BOP stack through the housing side outlet valve.
3. Separate the connection between the BOP and the MBU-LR housing.
4. Pick up on the BOP stack a minimum of 12" and secure with safety slings.
5. Washout as required.
6. Examine the **13-5/8" x 9-5/8" MBU Slip Casing Hanger (Item A7a)**. Verify the following:
 - slips and internal bore are clean and in good condition
 - all screws are in place
7. There are two latch screws located in the top of the casing hanger. Using a 5/16" Allen wrench, remove the two latch screws located 180° apart and separate the hanger into two halves.
8. Place two boards on the housing flange against the casing to support the Hanger.
9. Pick up one half of the hanger and place it around the casing and on top of the boards.
10. Pick up the second hanger half and place it around the casing adjacent the first half.
11. Slide the two hanger halves together ensuring the slip alignment pins properly engage the opposing hanger half.
12. Reinstall the latch screws and tighten securely.

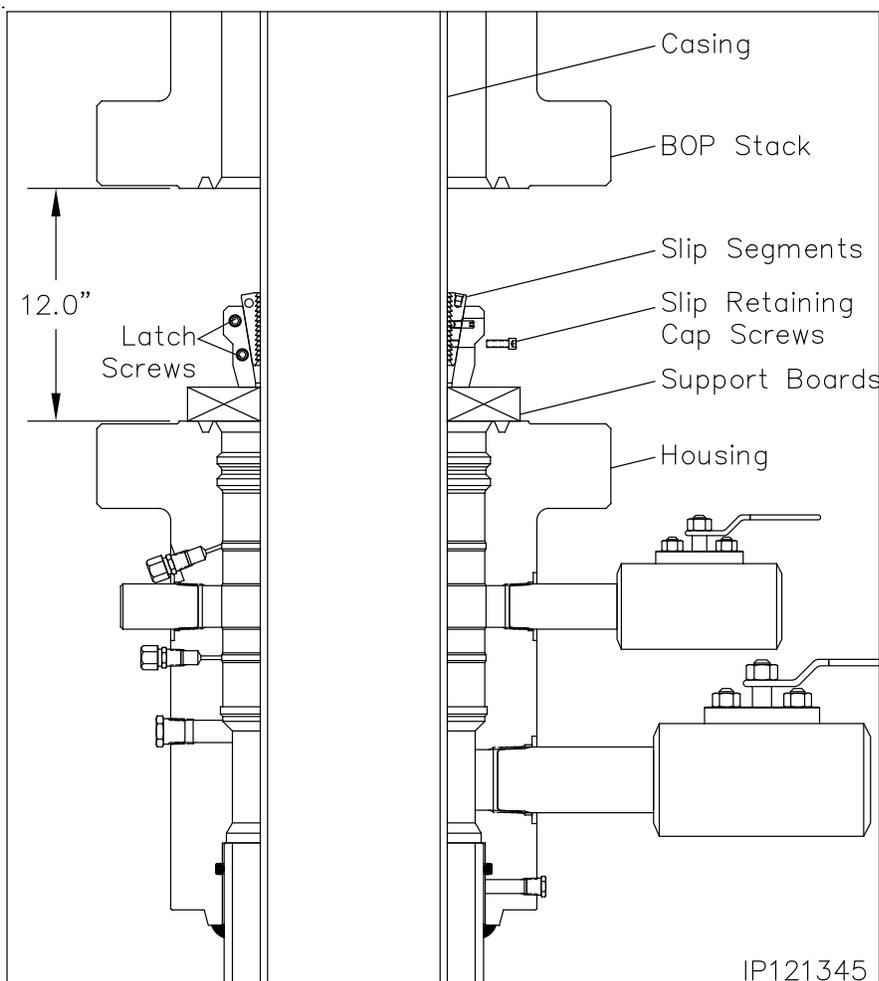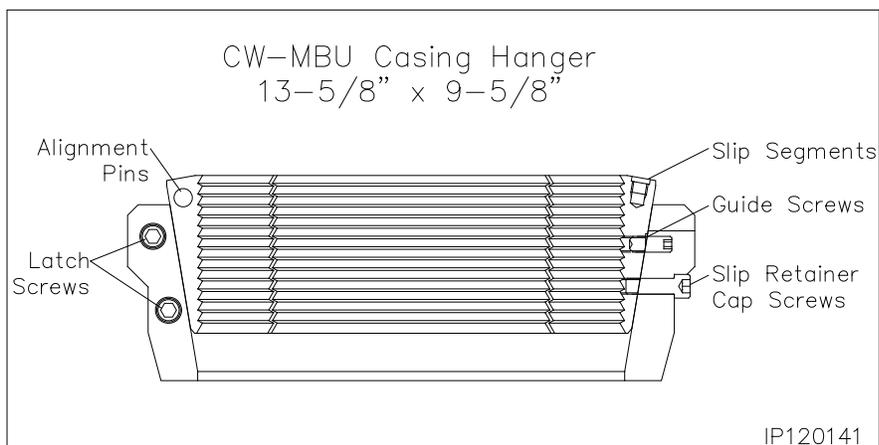

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 4A — Hang Off the 9-5/8" Casing (Emergency)

13. Prepare to lower the Hanger into the housing bowl.

WARNING: Do Not Drop the Casing Hanger!

14. Grease the Casing Hanger's body and remove the slip retaining screws.
15. Remove the boards and allow the Hanger to slide into the housing bowl. When properly positioned the top of the hanger will be approximately 14.05" below the top of the housing.
16. Pull tension on the casing to the desired hanging weight and then slack off.


Note: A sharp decrease on the weight indicator will signify that the Hanger has taken weight and at what point, If this does not occur, pull tension again and slack off once more.

WARNING: Because of the potential fire hazard and the risk of loss of life and property, It is highly recommended to check the casing annulus and pipe bore for gas with an approved sensing device prior to cutting off the casing. If gas is present, do not use an open flame torch to cut the casing. It will be necessary to use a air driven mechanical cutter which is spark free.

17. Rough cut the casing approximately 2" above the top flange and move the excess casing out of the way.

WARNING: Install the long wear bushing in the housing to ensure the housing bore is not damaged with the torch or cutting debris.

18. Final cut the casing at 10.79" \pm 1/8" below the housing flange or 3.25" \pm 1/8" above the hanger body.
19. Grind the casing stub level and then place a 3/16" x 3/8" bevel on the O.D. and a I.D. chamfer to match the minimum bore of the packoff to be installed.

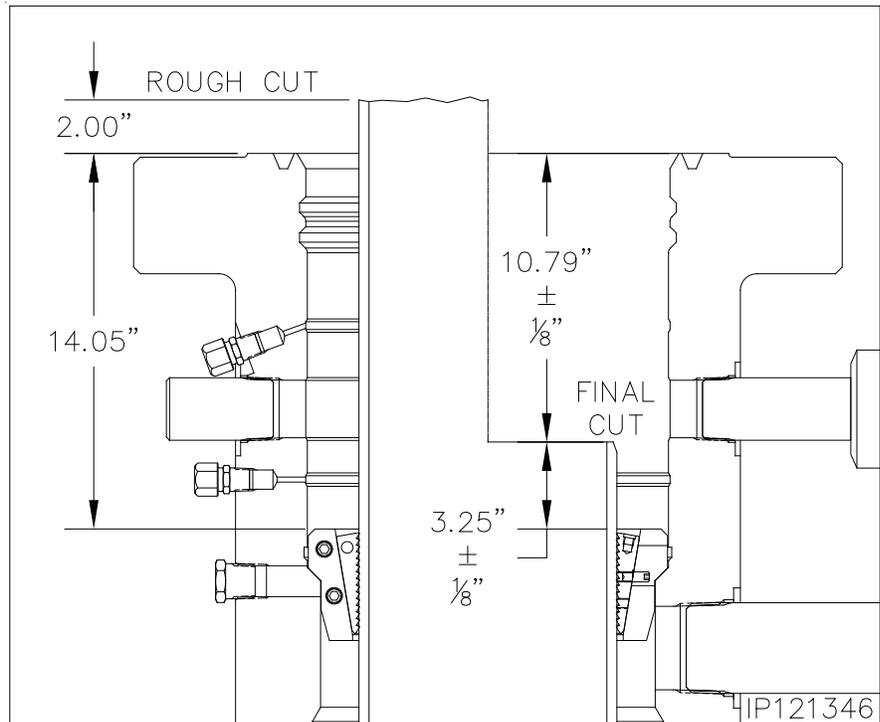

Note: There must not be any rough edges on the casing or the seals of the Packoff will be damaged.

20. Remove the wear bushing and then thoroughly clean the housing bowl, removing all cement and cutting debris.

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.


Stage 4B — Install the 9-5/8” MBU-LR Emergency Packoff

The following steps detail the installation of the CW MBU-LR Packoff Assembly for the emergency casing hanger.

1. Examine the **13-5/8” Nominal x 9-5/8” x 11.250” 4 Stub Acme 2G LH box top MBU-LR Packoff Assembly (Item A7b)**. Verify the following:
 - all elastomer seals are in place and undamaged
 - internal bore, and ports, are clean and in good condition
 - lockring is fully retracted
 - energizer ring is in its upper most position and retained with shear pins
 - anti-rotation plunger is in place, free to move

2. Lubricate the ID of the ‘HPS’ seal and the OD of the dovetail seals liberally with a light oil or grease.


3. Examine the **13-5/8” Nominal x 4-1/2” IF x 11.250” 4 Stub Acme 2G LH box top MBU-LR Packoff Running Tool (Item ST4)**. Verify the following:
 - Acme threads are clean and in good condition
 - actuation sleeve is clean, in good condition and rotates freely
 - retrieval latch is removed and stored in safe place

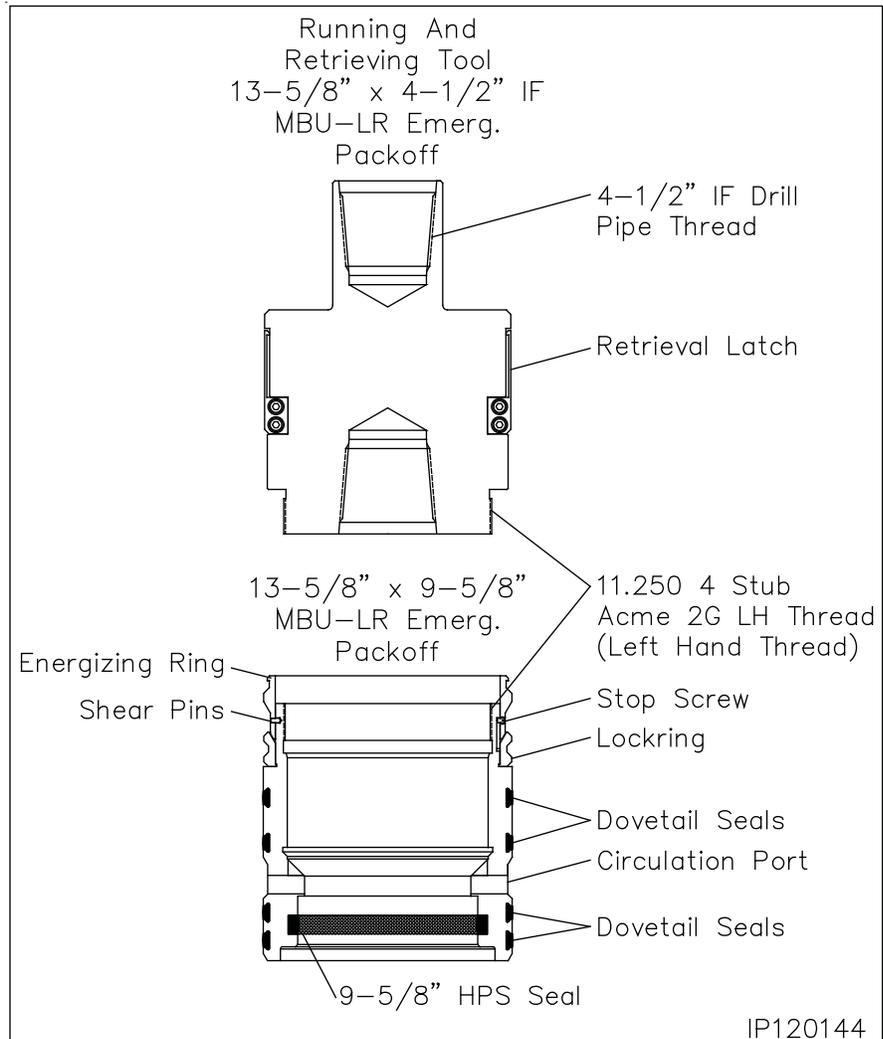

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 4B — Install the 9-5/8" MBU-LR Emergency Packoff

4. Make up a 4-1/2" IF drill collar to the top of the Running Tool and tighten connection to thread manufacturer's maximum make up torque.
5. Run in the hole with two stands of drill pipe and set in floor slips.
6. Thoroughly clean and lightly lubricate the mating Acme threads of the running tool and packoff with oil or light grease.
7. Pick up the packoff and carefully pass it over the drill pipe and set it on top of the floor slips.
8. Pick up the Running Tool with landing joint and make it up to the drill pipe in the floor slips.
9. Pick up the packoff and thread it onto the running tool with clockwise (Right) rotation until the Energizing Ring makes contact with the bottom shoulder of the tool. Approximately 4 turns.
10. Thoroughly clean and lightly lubricate the packoff ID 'HPS' seal and the OD dovetail seals with oil or light grease.

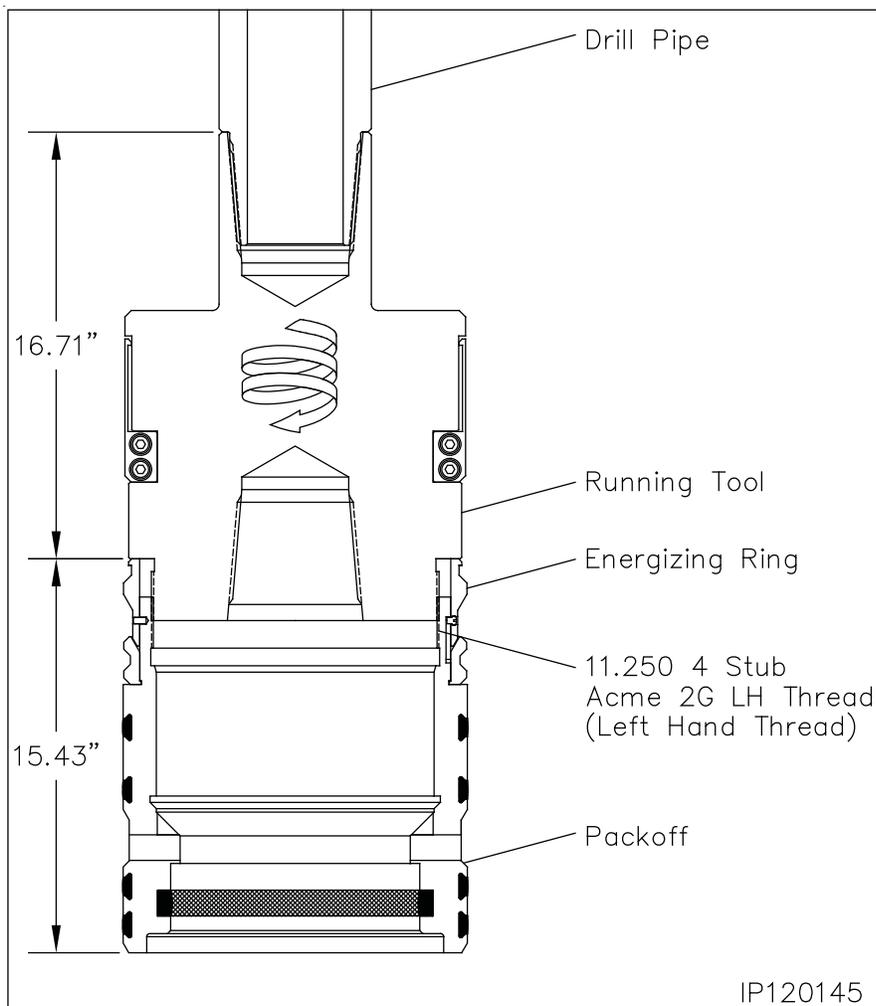

IP120145

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 4B — Install the 9-5/8" MBU-LR Emergency Packoff



Landing the Packoff

1. Pick up the drill string and remove the floor slips.
2. Carefully lower the packoff through the rig floor and into the housing until it lands on top of the slip hanger.

Note: When properly positioned the top of the running tool will be approximately 18.10" above the top of the MBU-LR Housing

Seal Test

3. Locate the upper and lower seal test fittings on the O.D. of the housing and remove the dust caps from both fittings.
4. Attach a test pump to one of the open fittings and pump clean test fluid between the seals until a stable test pressure of 5,000 psi is attained.
5. If a leak develops, bleed off test pressure, remove the hanger from the wellhead and replace the leaking seals.
6. Repeat steps 3 through 5 for the remaining seal test.
7. After satisfactory test are achieved, bleed off all test pressure, remove test pump and reinstall the dust caps on the open fittings

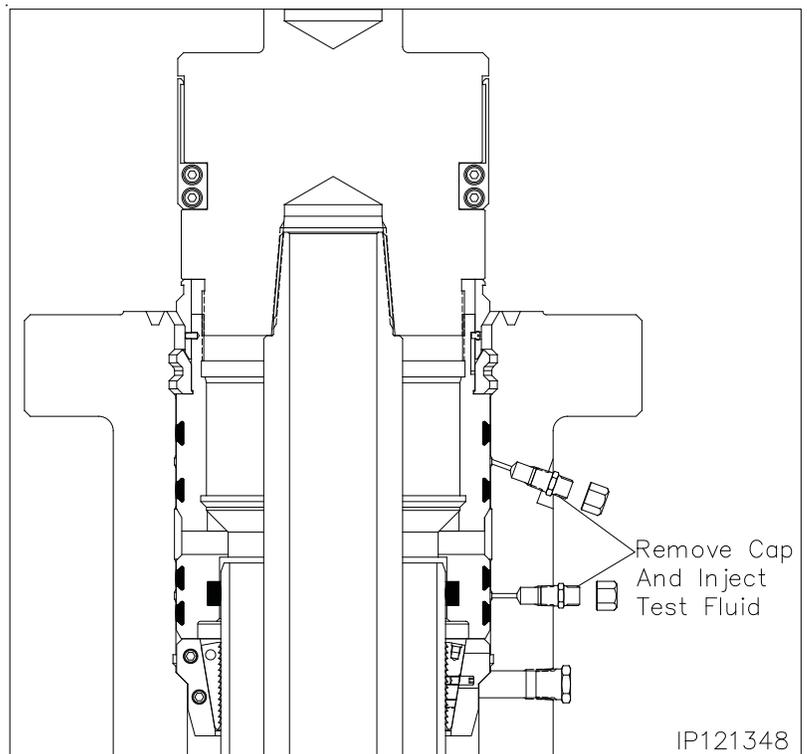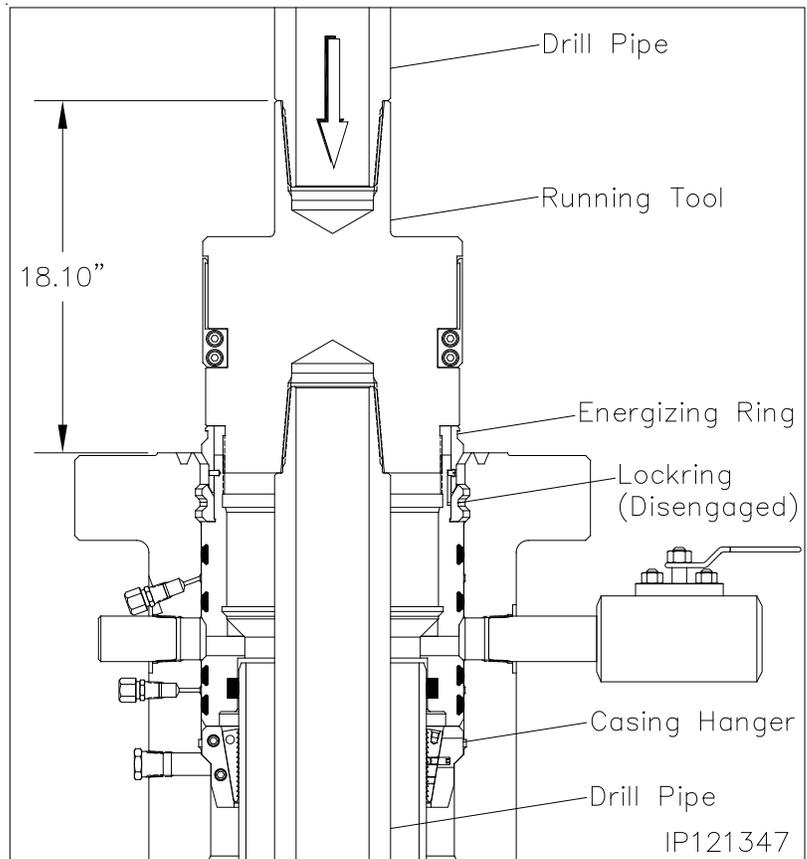

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 4B — Install the 9-5/8" MBU-LR Emergency Packoff

Engaging the Lockring


8. Using only chain tongs, rotate the landing joint approximately 6 turns counter clockwise (Left) to engage the packoff locking in its mating groove in the bore of the MBU-LR housing.

Note: Approximately 800 to 900 ft. lbs. of torque will be required to break over the shear pins in the packoff. The torque will drop off and then increase slightly when the energizing ring pushes the locking out. A positive stop will be encountered when the locking is fully engaged.

WARNING: It is imperative that the drill pipe landing joint remain concentric with the well bore when rotating to engage the locking. This can be accomplished with the use of the air hoist.

WARNING: If the required turns to engage the locking or not met or excessive torque is encountered, remove the packoff and call Houston Engineering.

9. Back off the landing joint/running tool approximately three turns. Using the drill pipe elevators, exert a 20,000 lbs. pull on the landing joint.
10. Using only chain tongs, rotate the landing joint clockwise until the tool comes free of the packoff (approximately 9 turns) and then retrieve the tool with a straight vertical lift.

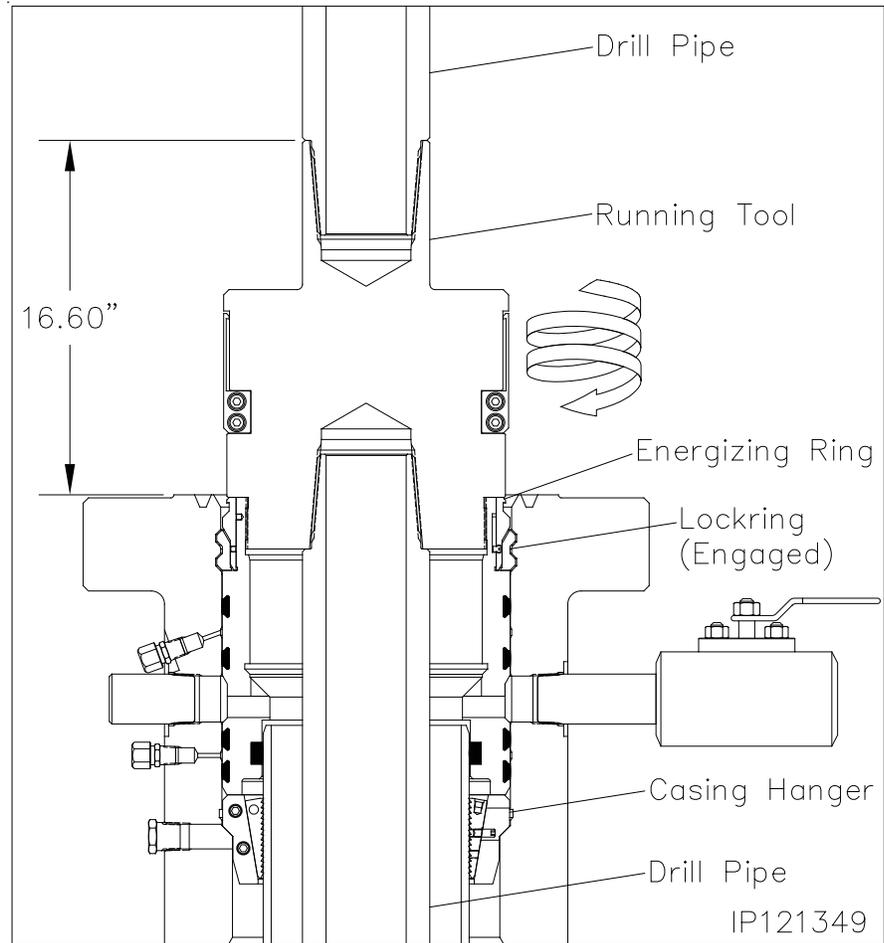

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 4B — Install the 9-5/8" MBU-LR Emergency Packoff

In the event the packoff is required to be removed after the lockring is engaged the following procedure is to be followed.

Retrieving the Packoff


1. Locate the retrieval latch assembly with (4) 1/2" cap screws
2. Install the retrieval latch onto the running tool with the latch fingers facing down and install the cap screws and tighten them securely.
3. Ensure the retrieval latch freely rotates on the running tool actuation sleeve.
4. Carefully lower the running tool into the packoff.
5. Rotate the drill pipe clockwise (Right) to locate the thread start and then counter clockwise (Left) (approximately 10 turns) to a positive stop.

Note: At this point the retrieval latches will have passed over the energizing ring and snapped into place.

6. Rotate the drill pipe clockwise (approximately 6-1/2 turns) to a positive stop. The drill pipe should rise approximately 1-1/2".

Warning: Do not exceed the 6-1/2 turns or the packoff may be seriously damaged.

7. Carefully pick up on the drill pipe and remove the packoff from the MBU-LR wellhead with a straight vertical lift.
8. Redress the Packoff and reset as previously outlined.

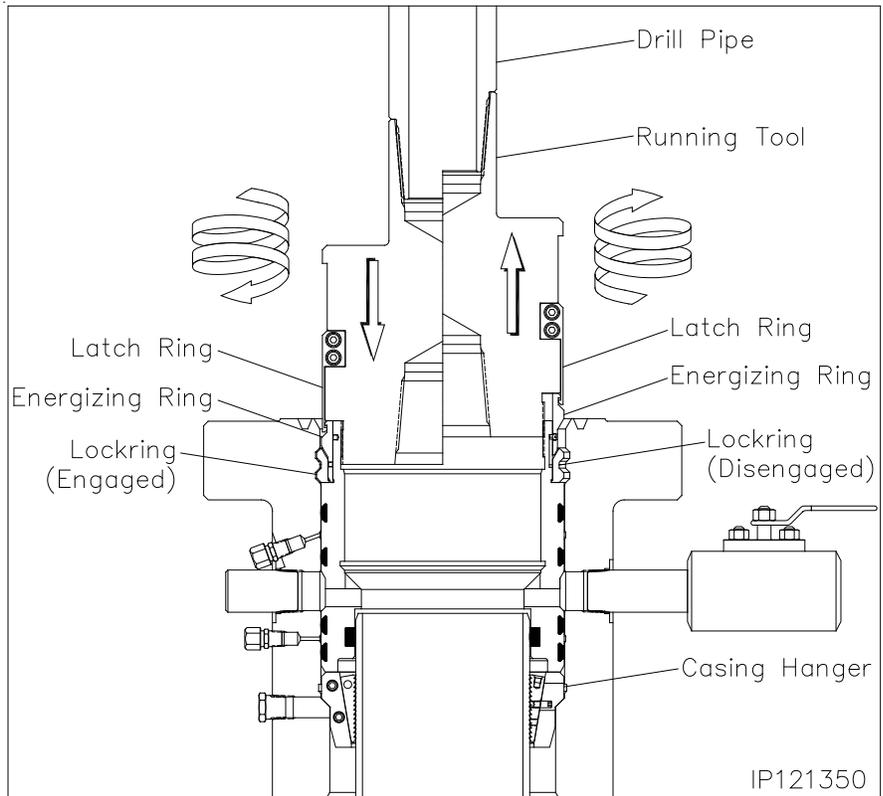

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 5 — Test the BOP Stack

Immediately after making up the BOP stack and periodically during the drilling of the well for the next casing string the BOP stack (connections and rams) must be tested.


1. Examine the **11" Nominal x 4-1/2" IF CW Test Plug/Retrieving Tool (Item ST5)**. Verify the following:
 - 1-1/4" VR plug and weep hole plug are in place and tightened securely
 - elastomer seal is in place and in good condition
 - retractable lift lugs are in place, clean, and free to move
 - drill pipe threads are clean and in good condition

Note: Prior to installing the BOP it is recommended to attain an accurate RKB dimension for future use for accurately landing test plugs and casing hangers. This dimension is attained by dropping a tape measure from the rig floor to the top of the wellhead flange. Pull tape taut and record the dimension from the wellhead to the top of the rig floor or kelly bushings. Ensure this dimension is placed on the BOP board in the dog house and on the drillers daily report sheet.

2. Position the test plug with the elastomer seal down and the lift lugs up and make up the tool to a joint of drill pipe.

WARNING: Ensure that the lift lugs are up and the elastomer seal is down

3. Remove the 1/2" NPT pipe plug from the weep hole if pressure is to be supplied through the drill pipe.

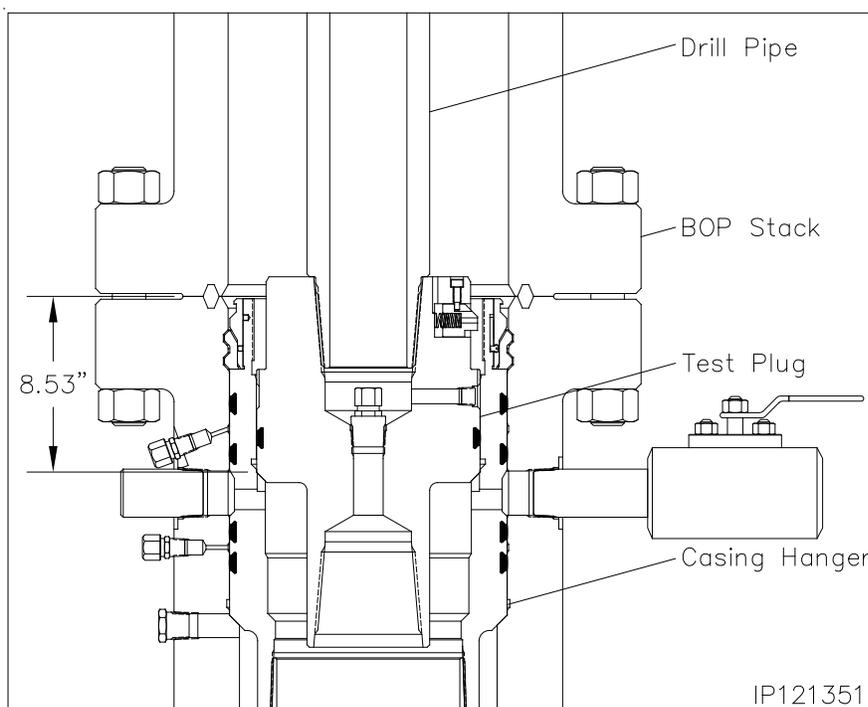

4. Open the housing upper side outlet valve.
5. Lightly lubricate the test plug seal with oil or light grease.
6. Carefully lower the test plug through the BOP and land it on the load shoulder in the packoff, 8.53" below the top of the housing.
7. Close the BOP rams on the pipe and test the BOP to 5,000 psi.
8. After a satisfactory test is achieved, release the pressure and open the rams.
9. Remove as much fluid as possible from the BOP stack and the retrieve the test plug with a straight vertical lift.
10. Repeat this procedure as required during the drilling of the hole section.

Note: When performing the BOP blind ram test it is highly recommended to suspend a stand of drill pipe below the test plug to ensure the plug stays in place while disconnecting from it with the drill pipe.

Note: Any leakage past the test plug will be clearly visible at the open side outlet valve.

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 6 — Run the Upper Wear Bushing

Note: Always use a Wear Bushing while drilling to protect the load shoulders from damage by the drill bit or rotating drill pipe. The Wear Bushing **must be retrieved** prior to running the casing.


1. Examine the **13-5/8" x 11" x 9.00" ID MBU-LR-UPR Wear Bushing (Item ST6)**. Verify the following
 - internal bore is clean and in good condition
 - o-ring is in place and in good condition
 - shear o-ring cord is in place and in good condition
 - paint anti-rotation lugs white and allow paint to dry

Run the Wear Bushing Before Drilling

2. Orient the **13-5/8" Nominal x 4-1/2" IF CW Test Plug/Retrieving Tool (Item ST1)** with drill pipe connection up.
3. Attach the Retrieving Tool to a joint of drill pipe.
4. Align the retractable lift lugs of the tool with the retrieval holes of the bushing and the carefully lower the tool into the Wear Bushing until the lugs snap into place.

Note: If the lugs did not align with the holes, rotate the tool in either direction until they snap into place.

5. Apply a heavy coat of grease, not dope, to the OD of the bushing.
6. Slowly lower the Tool/Bushing Assembly through the BOP stack and land it on the load shoulder in the packoff, 8.53" below the top of the housing.
7. Rotate the drill pipe clockwise (right) to locate the stop lugs in their mating notches in the packoff. When properly aligned the bushing will drop an additional 1/2".

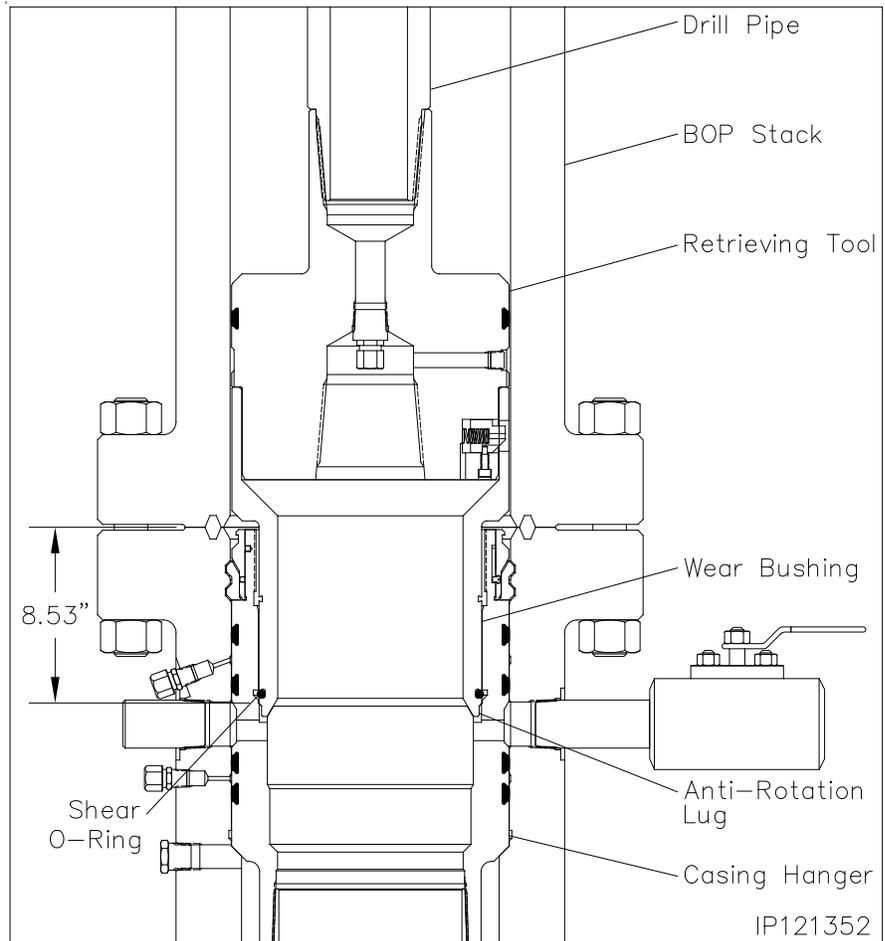

Note: The Shear O-Ring on bottom of the bushing will locate in a groove above the load shoulder in the head to act as a retaining device for the bushing.

8. Remove the Tool from the Wear Bushing by rotating the drill pipe counter clockwise (left) 1/4 turn and lifting straight up
9. Drill as required.

Note: It is highly recommended to retrieve, clean, inspect, grease, and reset the wear bushing each time the hole is tripped during the drilling of the hole section.

Retrieve the Wear Bushing After Drilling

10. Make up the Retrieving Tool to the drill pipe .
11. Slowly lower the Tool into the Wear Bushing.
12. Pick up and balance the riser weight.
13. Rotate the Retrieving Tool clockwise until a positive stop is felt. This indicates the lugs have snapped into the holes in the bushing.
14. Retrieve the Wear Bushing, and remove it and the Retrieving Tool from the drill string.

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 7 — Hang Off the 7” Casing



1. Run the 7” casing string as required and cement in place.
2. Drain the housing bowl through the upper side outlet.
3. Separate the BOP from the MBU-LR housing and lift the BOP approximately 14” above the housing and secure BOP with safety slings.
4. Using a fresh water hose, thoroughly wash out the packoff bowl.

Note: Casing Head side outlet valve to remain open while setting the casing hanger.

5. Examine the **11” X 7” C22 Casing Hanger (Item B9)**. Verify the following:
 - slips and internal bore are clean and in good condition
 - all screws are in place
 - seal element is in good condition

Note: Ensure that the packoff rubber does not protrude beyond the O.D. of the casing hanger body. If it is, loosen the compression cap screws in the top of the hanger.

6. Remove the latch screw to open the Hanger.
7. Place two boards on the Casing Head flange against the casing to support the Hanger.
8. Wrap the Hanger around the casing and replace the latch screw.
9. Prepare to lower the Hanger into the Casing Head bowl.
10. Grease the Casing Hanger's body and remove the slip retaining cap screws.

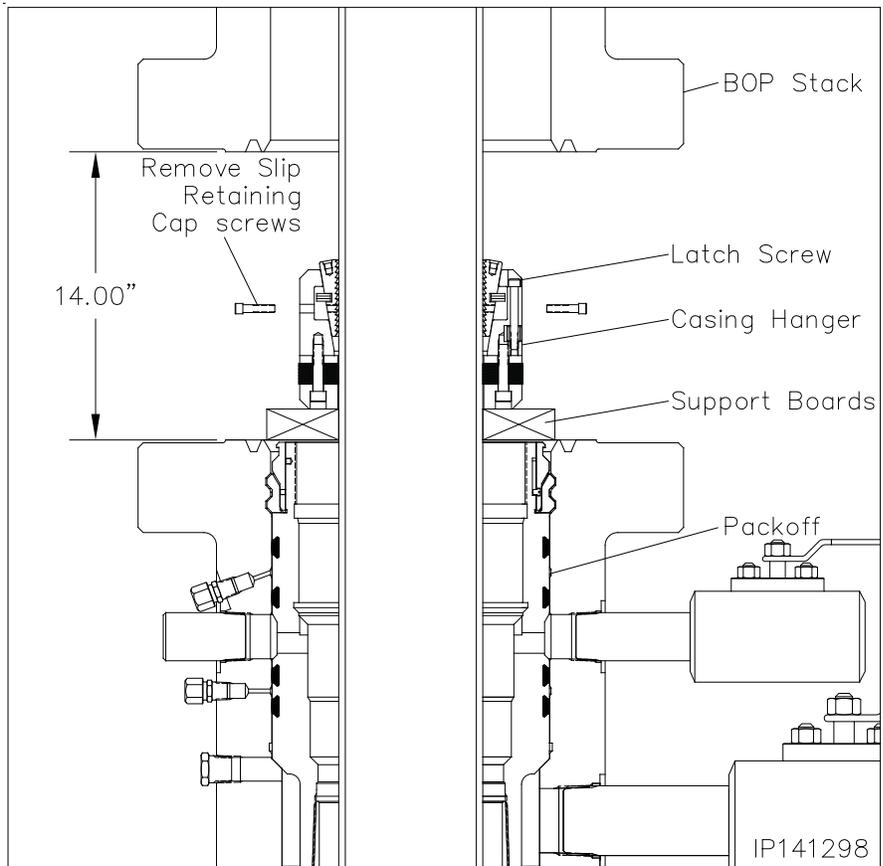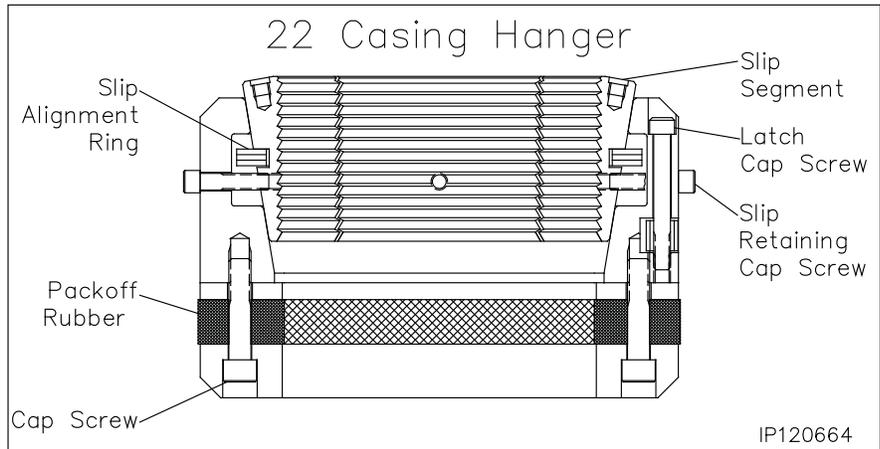

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 7 — Hang Off the 7” Casing


- Remove the boards and allow the Hanger to slide into the packoff bowl. When the Hanger is down, the top of the hanger body will be approximately 2.27” below the top of the housing, pull tension on the casing to the desired hanging weight and then slack off..

Note: A sharp decrease on the weight indicator will signify that the Hanger has taken weight and at what point, If this does not occur, pull tension again and slack off once more.

WARNING: Because of the potential fire hazard and the risk of loss of life and property, It is highly recommended to check the casing annulus and pipe bore for gas with an approved sensing device prior to cutting off the casing. If gas is present, do not use an open flame torch to cut the casing. It will be necessary to use a air driven mechanical cutter which is spark free.

- Rough cut the casing approximately 12” above the top flange and move the excess casing and BOP out of the way.
- Final cut the casing at $4.75" \pm 1/8"$ above the top flange of the housing.
- Grind the casing stub level and then place a $3/16" \times 3/8"$ bevel on the O.D. and a I.D. chamfer to match the minimum bore of the tubing head to be installed.
- Using a high pressure water hose thoroughly clean the top of the casing hanger and void area above the hanger. Ensure all cutting debris are removed .
- Fill the void above the hanger with clean test fluid to the top of the flange.

WARNING: Do Not over fill the void with test fluid - trapped fluid under the ring gasket may prevent a good seal from forming

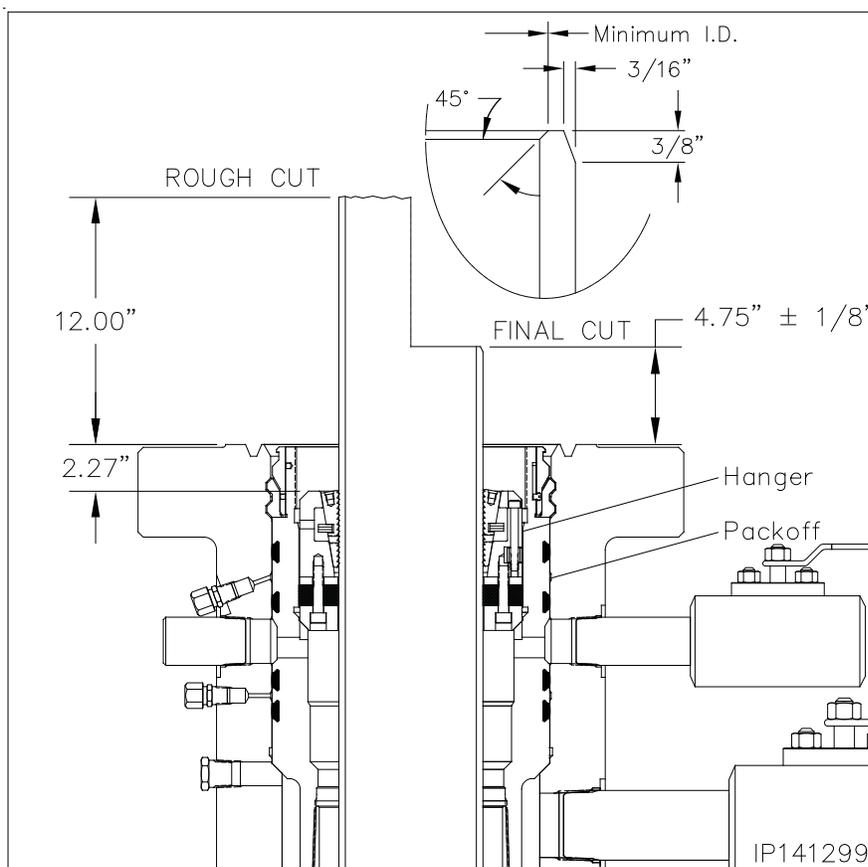

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 8 — Install the Tubing Head



- Examine the **13-5/8" 5M x 7-1/16" 10M CW, CTH-DBLHPS Tubing Head (Item B1)**. Verify the following:
 - seal area and bore are clean and in good condition
 - HPS Secondary Seals** are in place and in good condition
 - all peripheral equipment is intact and undamaged
- Clean the mating ring grooves of the MBU-LR and Tubing Head.
- Lightly lubricate the ID of the Tubing Head HPS Seals, and the casing stub with a light grease.

Note: Excessive grease may prevent a good seal from forming!

- Install a new **BX-160 Ring Gasket (Item B14)** in the ring groove of the MBU-LR Housing.
- Pick up the Tubing Head and suspend it above the MBU-LR Housing and casing stub.
- Orient the Tubing Head so the outlets are in the proper position and then carefully lower the head and DSPA over the casing stub and land it on the ring gasket.

Warning: Do Not damage the HPS Seal or their sealing ability will be impaired!

- Make up the flange connection using the DSPA studs and nuts, tightening them in an alternating cross pattern.

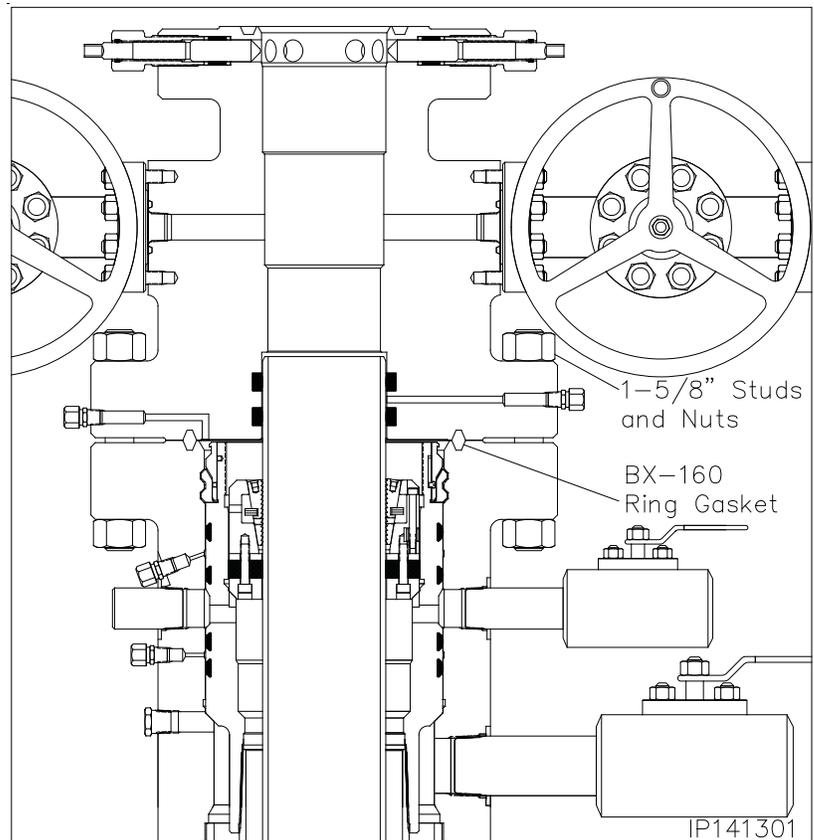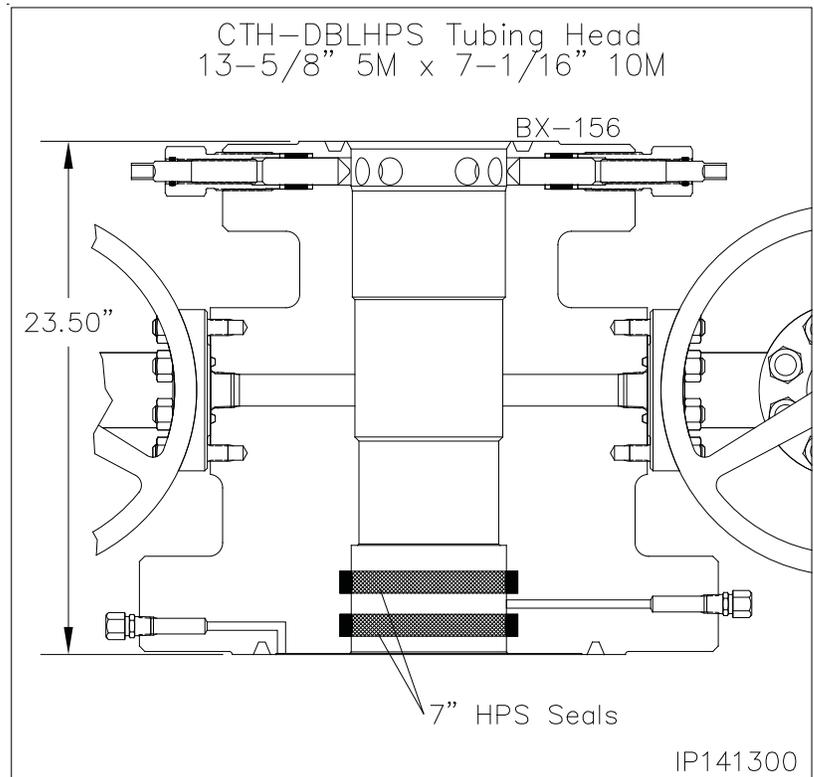


INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 8 — Install the Tubing Head

Seal Test

1. Locate the "SEAL TEST" fitting and one of the "FLG TEST" fittings on the Tubing Head and remove the dust cap from both fittings.
2. Attach a Bleeder Tool to the open "FLG TEST" fitting and open the Tool.
3. Attach a Hydraulic Test Pump to the "SEAL TEST" fitting and pump clean test fluid between the HPS Seals until a test pressure of **10,000 psi. or 80% of casing collapse — whichever is less**
4. Hold the test pressure for fifteen (15) minutes or as desired by the drilling supervisor.
5. If pressure drops a leak has developed. Take the appropriate action in the table below.
6. Repeat steps 1 - 5 until a satisfactory test is achieved.
7. When a satisfactory test is achieved, remove Test Pump, drain test fluid, and reinstall the dust cap on the open "SEAL TEST" fitting.

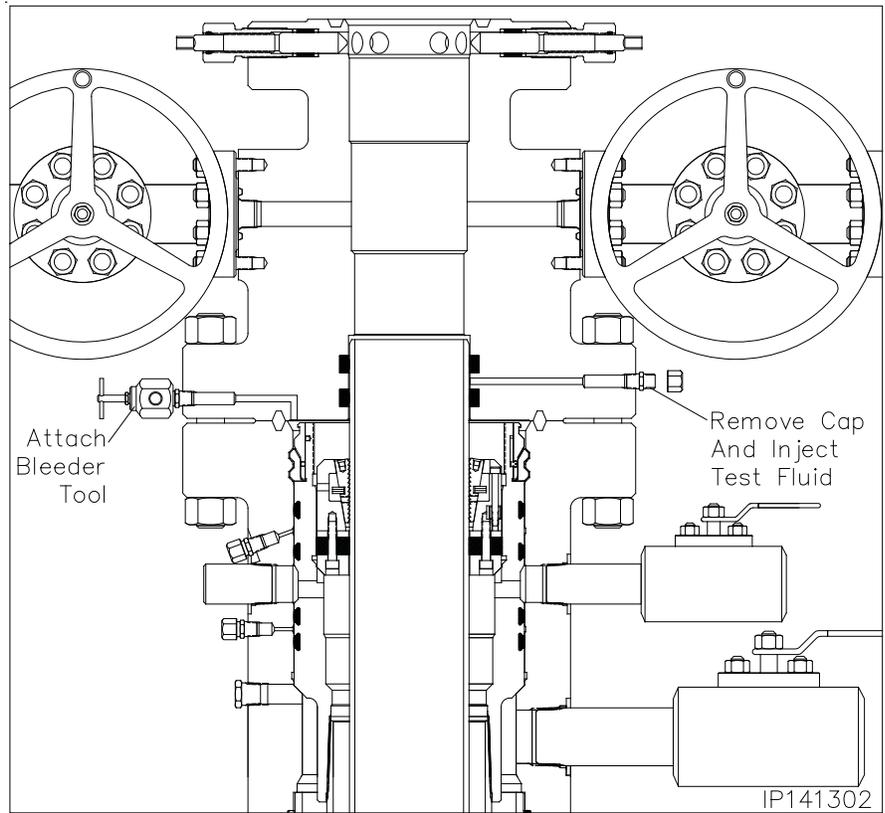


Seal Test	
Leak Location	Appropriate Action
Open bleeder tool - Lower HPS seal leaking	Remove Tubing Head and replace leaking seals. Re land and retest seals
Into the Tubing Head bore- Upper HPS Seal is Leaking	

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Stage 8 — Install the Tubing Head

Flange Test

1. Locate the remaining "FLG TEST" fitting on the Tubing Head and remove the dust cap from the fitting.
2. Attach a test pump to the open "FLG TEST" fitting and pump clean test fluid into the flange connection until a continuous stream flows from the open "FLG TEST" bleeder tool.
3. Close the bleeder tool and continue pumping test fluid to **5,000 psi. or 80% of casing collapse — whichever is less.**
4. Hold the test pressure for fifteen (15) minutes or as desired by the drilling supervisor.
5. If pressure drops a leak has developed. Take the appropriate action from the adjacent chart.
6. Repeat steps 1 through 6 until a satisfactory test is achieved.
7. Once a satisfactory test is achieved, remove the test pump and "FLG TEST" bleeder tool, drain test fluid, and reinstall the dust caps on the open fittings.

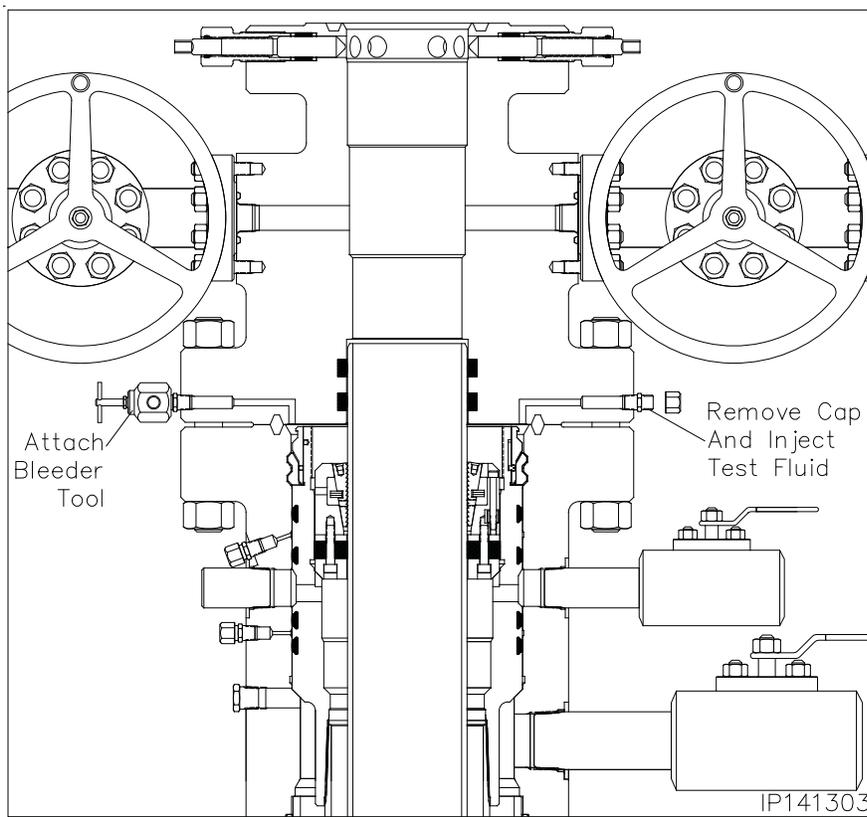

Flange Test	
Leak Location	Appropriate Action
Into casing annulus - casing hanger seal element is leaking	Remove tubing head, spear casing and reset the casing hanger. Redress the casing, reinstall the Tubing Head and retest
Flange connection - Ring gasket is leaking	Further tighten the flange connection

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Recommended Procedure for Field Welding Pipe to Wellhead Parts for Pressure Seal

1. **Introduction and Scope.** The following recommended procedure has been prepared with particular regard to attaining pressure-tight weld when attaching casing heads, flanges, etc., to casing. Although most of the high strength casing used (such as N-80) is not normally considered field weldable, some success may be obtained by using the following or similar procedures.

Caution: In some wellheads, the seal weld is also a structural weld and can be subjected to high tensile stresses. Consideration must therefore be given by competent authority to the mechanical properties of the weld and its heat affected zone.

 - a. The steels used in wellhead parts and in casing are high strength steels that are susceptible to cracking when welded. It is imperative that the finished weld and adjacent metal be free from cracks. The heat from welding also affects the mechanical properties. This is especially serious if the weld is subjected to service tension stresses.
 - b. This procedure is offered only as a recommendation. The responsibility for welding lies with the user and results are largely governed by the welder's skill. Weldability of the several makes and grades of casing varies widely, thus placing added responsibility on the welder. Transporting a qualified welder to the job, rather than using a less-skilled man who may be at hand, will, in most cases, prove economical. The responsible operating representative should ascertain the welder's qualifications and, if necessary, assure himself by instruction or demonstration, that the welder is able to perform the work satisfactorily.
2. **Welding Conditions.** Unfavorable welding conditions must be avoided or minimized in every way possible, as even the most skilled welder cannot successfully weld steels that are susceptible to cracking under adverse working conditions, or when the work is rushed. Work above the welder on the drilling floor should be avoided. The weld should be protected from dripping mud, water, and oil and from wind, rain, or other adverse weather conditions. The drilling mud, water, or other fluids must be lowered in the casing and kept at a low level until the weld has properly cooled. It is the responsibility of the user to provide supervision that will assure favorable working conditions, adequate time, and the necessary cooperation of the rig personnel.
3. **Welding.** The welding should be done by the shielded metal-arc or other approved process.
4. **Filler Metal.** Filler Metals. For root pass, it's recommended to use E6010, E6011 (AC), E6019 or equivalent electrodes. The E7018 or E7018-A1 electrodes may also be used for root pass operations but has the tendency to trap slag in tight grooves. The E6010, E6011 and E6019 offer good penetration and weld deposit ductility with relatively high intrinsic hydrogen content. Since the E7018 and E7018-A1 are less susceptible to hydrogen induced cracking, it is recommended for use as the filler metal for completion of the weld groove after the root pass is completed. The E6010, E6011 (AC), E6019, E7018 and E7018-A1 are classified under one of the following codes AWS A5.1 (latest edition): Mild Steel covered electrodes or the AWS A5.5 (latest edition): Low Alloy Steel Covered Arc-Welding Electrodes. The low hydrogen electrodes, E7018 and E7018-A1, should not be exposed to the atmosphere until ready for use. It's recommended that hydrogen electrodes remain in their sealed containers. When a job arises, the container shall be opened and all unused remaining electrodes to be stored in heat electrode storage ovens. Low hydrogen electrodes exposed to the atmosphere, except water, for more than two hours should be dried 1 to 2 hours at 600°F to 700 °F (316°C to 371 °C) just before use. It's recommended for any low hydrogen electrode containing water on the surface should be scrapped.
5. **Preparation of Base Metal.** The area to be welded should be dry and free of any paint, grease/oil and dirt. All rust and heat-treat surface scale shall be ground to bright metal before welding.

INFORMATION CONTAINED HEREIN IS THE PROPERTY OF CACTUS WELLHEAD, LLC. REPRODUCTION, DISCLOSURE, OR USE THEREOF IS PERMISSIBLE ONLY AS PROVIDED BY CONTRACT OR AS EXPRESSLY AUTHORIZED BY CACTUS WELLHEAD, LLC.

Recommended Procedure for Field Welding Pipe to Wellhead Parts for Pressure Seal

6. **Preheating.** Prior to any heating, the wellhead member shall be inspected for the presence of any o-rings or other polymeric seals. If any o-rings or seals are identified then preheating requires close monitoring as noted in paragraph 6a. Before applying preheat, the fluid should be bailed out of the casing to a point several inches (>6" or 150 mm) below the weld joint/location. Preheat both the casing and wellhead member for a minimum distance of three (3) inches on each side of the weld joint using a suitable preheating torch in accordance with the temperatures shown below in a and b. The preheat temperature should be checked by the use of heat sensitive crayons. Special attention must be given to preheating the thick sections of wellhead parts to be welded, to insure uniform heating and expansion with respect to the relatively thin casing.
 - a. Wellhead members containing o-rings and other polymeric seals have tight limits on the preheat and interpass temperatures. Those temperatures must be controlled at 200°F to 325°F or 93 °C to 160°C and closely monitored to prevent damage to the o-ring or seals.
 - b. Wellhead members not containing o-rings and other polymeric seals should be maintained at a preheat and interpass temperature of 400°F to 600°F or 200°C to 300°C.
7. **Welding Technique.** Use a 1/8 or 5/32-inch (3.2 or 4.0 mm) E6010 or E7018 electrode and step weld the first bead (root pass); that, weld approximately 2 to 4 inches (50 to 100 mm) and then move diametrically opposite this point and weld 2 to 4 inches (50 to 100 mm) halfway between the first two welds, move diametrically opposite this weld, and so on until the first pass is completed. This second pass should be made with a 5/32-inch (4.0 mm) low hydrogen electrode of the proper strength and may be continuous. The balance of the welding groove may then be filled with continuous passes without back stepping or lacing, using a 3/16-inch (4.8 mm) low hydrogen electrode. All beads should be stringer beads with good penetration. There should be no undercutting and weld shall be workmanlike in appearance.
 - a. Test ports should be open when welding is performed to prevent pressure buildup within the test cavity.
 - b. During welding the temperature of the base metal on either side of the weld should be maintained at 200 to 300°F (93 to 149°C).
 - c. Care should be taken to insure that the welding cable is properly grounded to the casing, but ground wire should not be welded to the casing or the wellhead. Ground wire should be firmly clamped to the casing, the wellhead, or fixed in position between pipe slips. Bad contact may cause sparking, with resultant hard spots beneath which incipient cracks may develop. The welding cable should not be grounded to the steel derrick, nor to the rotary-table base.
8. **Cleaning.** All slag or flux remaining on any welding bead should be removed before laying the next bead. This also applies to the completed weld.
9. **Defects.** Any cracks or blow holes that appear on any bead should be removed to sound metal by chipping or grinding before depositing the next bead.
10. **Postheating.** Post-heating should be performed at the temperatures shown below and held at that temperature for no less than one hour followed by a slow cooling. The post-heating temperature should be in accordance with the following paragraphs.
 - a. Wellhead members containing o-rings and other polymeric seals have tight limits on the post-heating temperatures. Those temperatures must be controlled at 250°F to 300°F or 120 °C to 150°C and closely monitored to prevent damage to the o-ring or seals.
 - b. Wellhead members not containing o-rings and other polymeric seals should be post-heated at a temperature of 400°F to 600°F or 200°C to 300°C.
11. **Cooling. *Rapid cooling must be avoided.*** To assure slow cooling, welds should be protected from extreme weather conditions (cold, rain, high winds, etc.) by the use of suitable insulating material. (Specially designed insulating blankets are available at many welding supply stores.) Particular attention should be given to maintaining uniform cooling of the thick sections of the wellhead parts and the relatively thin casing, as the relatively thin casing will pull away from the head or hanger if allowed to cool more rapidly. The welds should cool in air to less than 200°F (93°C) (measured with a heat sensitive crayon) prior to permitting the mud to rise in the casing.
12. **Test the Weld.** After cooling, test the weld. The weld must be cool otherwise the test media will crack the weld. The test pressure should be no more than 80% of the casing collapse pressure.

Attached to Form 5160-3

Mack Energy Corporation

Medicine Hat State Com 3H NMNM-132939

SHL : 707 FSL & 310 FEL, SESE, Sec. 27 T15S R28E

BHL : 1 FSL & 330 FWL, SWSW, Sec. 35 T15S R28E

Chaves County, NM

DRILLING PROGRAM

1. Geologic Name of Surface Formation

Quaternary

2. Estimated Tops of Important Geologic Markers:

Top Salt	227'
Base Salt	450'
Yates	499'
Seven Rivers	730'
Queen	1,210'
Grayburg	1,617'
San Andres	1,940'

3. Estimated Depths of Anticipated Fresh Water, Oil and Gas:

Water Sand	150'	Fresh Water
Yates	499'	Oil/Gas
Seven Rivers	730'	Oil/Gas
Queen	1,210'	Oil/Gas
Grayburg	1,617'	Oil/Gas
San Andres	1,940'	Oil/Gas

No other formations are expected to give up oil, gas or fresh water in measurable quantities. Setting 13 3/8" casing to 220' and circulating cement back to surface will protect the surface fresh water sand. Salt section and shallower zones above TD, which contain commercial quantities of oil and/or gas, will have cement circulated across them by cementing 5 1/2" production casing, sufficient cement will be pumped to circulate back to surface.

4. Casing Program:

Hole Size	Interval	OD Casing	Wt, Grade, Jt, cond, collapse/burst/tension
17 1/2"	0-220'	13 3/8"	48#, J-55, ST&C, New, 6.738054/4.697013/4.74
12 1/4"	0-1500'	9 5/8"	36#, J-55, ST&C, New, 2.589744/7.04/7.04
8 3/4"	0-2000'	7"	26#, HCP-110, LT&C, New, 7.190612/3.316667/3.316667
8 3/4"	2000-3100'	7"	26#, HCP-110, Buttress, New, 4.690954/3.316667/3.316667
8 3/4"	3100-8842'	5 1/2"	17#, HCP-110, Buttress, New, 5.5431205/3.546667/3.546667

Variance request: A variance is requested to use a Multi Bowl System and Flex Hose as the choke line from the BOP to the Choke Manifold. If this hose is used, a copy of the manufacturer's certification and pressure test will be kept on the rig.

Perforations 3653 TD 3038 TVD 8700 TD TVD 3038

Mack Energy Corporation
Medicine Hat State Com 3H NMNM-132939
SHL : 707 FSL & 310 FEL, SESE, Sec. 27 T15S R28E
BHL : 1 FSL & 330 FWL, SWSW, Sec. 35 T15S R28E
Chaves County, NM

5. Cement Program:

13 3/8" Surface Casing: Lead 250sx, RFC+12%PF53+2%PF1+5ppsPF42+.125ppsPF29, yld 1.61, wt 14.4 ppg, 7.357gals/sx Tail: 200sx, Class C+1% PF1, yld 1.34, wt 14.8 ppg, 6.323 gals/sx, excess 100%

9 5/8" Intermediate Casing: Lead 285sx, Class C +4 PF20 + .4pps PF44 + .125 PF29, yld 1.72, wt 13.5 ppg, excess 100% Tail: 250sx, Class C+1% PF1, yld 1.34, wt 14.8, 6.323 gals/sx, excess 100%

7" & 5 1/2" Production Casing: Lead 220sx 50/50 Poz/C +10% PF20+5% PF44+.5%PF79 + 3pps PF42+.4pps PF45+.125ppsPF29, yld 2.82, wt 11.5 ppg, 16.421 gals/sx, excess 35%, Slurry Top-Surface Tail 2000sx, 50/50 Poz C 5%PF44 +2%PF20 +.2% PF13 +.2% PF65+.2%PF606+.4pps PF45 yield 1.34, wt 14.2, 6.091 gals/sx, 35% excess, Slurry Top 1,800'

Option 2 – Run a DV tool @1400' +/- if an air pocket is encountered. Cmt Stage 1-2050 sx 50/50 POZ/C +5% (BWOW) PF44+2% PF20+0.2% PF13+0.2% PF606 +0.1% FP 153+0.4pps PF45, yld 1.34, density 14.2, mix H2O gals/sx 6085, 50% access, Slurry Top 1400' cmt State 2-200 sx C+2% PF1, yld 1.34, density 14.8, 0% excess, Slurry Top Surface. 2,205.1 Cy/Ft per Line/Ft.

6. Minimum Specifications for Pressure Control:

The blowout preventer equipment (BOP) shown in Exhibit #10 will consist of a double ram-type (3000 psi WP) minimum preventer. This unit will be hydraulically operated and the ram type preventer will be equipped with blind rams on top of 4 1/2" drill pipe rams on bottom. The 11" BOP will be nipped up on the 8 5/8" surface casing and tested by a 3rd party to 2000 psi used continuously until TD is reached. All BOP's and accessory equipment will be tested to 2000 psi before drilling out of intermediate casing. Pipe rams will be operationally checked each 24-hour period. Blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets. Other accessories to the BOP equipment (Exhibit #10) will include a Kelly cock and floor safety valve and choke lines and choke manifold (Exhibit #11) with a minimum 3000 psi WP rating

7. Types and Characteristics of the Proposed Mud System:

The well will be drilled to TD with a combination of fresh and cut brine mud system. The applicable depths and properties of this system are as follows:

DEPTH	TYPE	WEIGHT	VISCOSITY	WATERLOSS
0-220'	Fresh Water	8.5	28	N.C.
220'-1,500'	Cut Brine	9.1	29	N.C.
1,500-TD	Cut Brine	9.1	29	N.C.

Mack Energy Corporation
Medicine Hat State Com 3H NMNM-132939
SHL : 707 FSL & 310 FEL, SESE, Sec. 27 T15S R28E
BHL : 1 FSL & 330 FWL, SWSW, Sec. 35 T15S R28E
Chaves County, NM

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept at the well site at all times.

8. Auxiliary Well Control and Monitoring Equipment:

- A. Kelly cock will be kept in the drill string at all times.
- B. A full opening drill pipe-stabbing valve with proper drill pipe connections will be on the rig floor at all times.

9. Logging, Testing and Coring Program:

- A. The electric logging program will consist of GR-Dual Laterolog, Spectral Density, Dual Spaced Neutron, CSNG Log from T.D. to 8 5/8 casing shoe.
- B. Drill Stem test is not anticipated.
- C. No conventional coring is anticipated.
- D. Further testing procedures will be determined at TD.

10. Abnormal Conditions, Pressures, Temperatures and Potential Hazards:

No abnormal pressures or temperatures are anticipated. The estimated bottom hole at TD is 120 degrees and estimated maximum bottom hole pressure is **1453 psig (0.052*3038'TVD*9.2)**. Low levels of Hydrogen sulfide have been monitors in producing wells in the area, so H2S may be present while drilling of the well; a plan is attached to the Drilling program. No major loss of circulation zones has been reported in offsetting wells.

11. Anticipated Starting Date and Duration of Operations:

Road and location work will not begin until approval has been received from the BLM. The anticipated spud date is **November 1, 2024**. Once commenced, the drilling operation should be finished in approximately 20 days. If the well is productive, an additional 30 days will be required for completion and testing before a decision is made to install permanent facilities.

Attachment to Exhibit #10
NOTES REGARDING THE BLOWOUT PREVENTERS
Medicine Hat State Com 3H
Chaves County, New Mexico

1. Drilling nipple to be so constructed that it can be removed without use of a welder through rotary table opening, with minimum I.D. equal to preventer bore.
2. Wear ring to be properly installed in head.
3. Blow out preventer and all fittings must be in good condition, 2000 psi WP minimum.

Attached to Form 5160-3

Mack Energy Corporation

Medicine Hat State Com 3H NMNM-132939

SHL : 707 FSL & 310 FEL, SESE, Sec. 27 T15S R28E

BHL : 1 FSL & 330 FWL, SWSW, Sec. 35 T15S R28E


Chaves County, NM

4. All fittings to be flanged.
5. Safety valve must be available on rig floor at all times with proper connections, valve to be full 2000 psi WP minimum.
6. All choke and fill lines to be securely anchored especially ends of choke lines.
7. Equipment through which bit must pass shall be at least as large as the diameter of the casing being drilled through.
8. Kelly cock on Kelly.
9. Extension wrenches and hands wheels to be properly installed.
10. Blow out preventer control to be located as close to driller's position as feasible.
11. Blow out preventer closing equipment to include minimum 40-gallon accumulator, two independent sources of pump power on each closing unit installation all API specifications.

Mack Energy Corporation
Minimum Blowout Preventer Requirements
3000 psi Working Pressure
13 3/8 inch- 3 MWP
11 Inch - 3 MWP
EXHIBIT #10

Stack Requirements

NO.	Items	Min. I.D.	Min. Nominal
1	Flowline		2"
2	Fill up line		2"
3	Drilling nipple		
4	Annular preventer		
5	Two single or one dual hydraulically operated rams		
6a	Drilling spool with 2" min. kill line and 3" min choke line outlets		2" Choke
6b	2" min. kill line and 3" min. choke line outlets in ram. (Alternate to 6a above)		
7	Valve Gate Plug	3 1/8	
8	Gate valve-power operated	3 1/8	
9	Line to choke manifold		3"
10	Valve Gate Plug	2 1/16	
11	Check valve	2 1/16	
12	Casing head		
13	Valve Gate Plug	1 13/16	
14	Pressure gauge with needle valve		
15	Kill line to rig mud pump manifold		2"

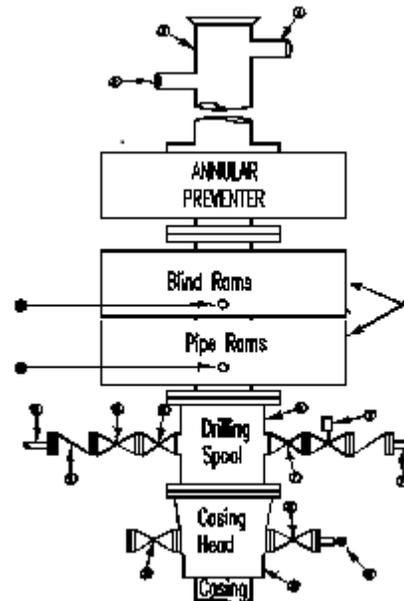

OPTIONAL

16	Flanged Valve	1 13/16	
----	---------------	---------	--

CONTRACTOR'S OPTION TO FURNISH: 10. ME

- All equipment and connections above bradenhead or casinghead. Working pressure of preventers to be 2000 psi minimum.
- Automatic accumulator (80 gallons, minimum) capable of closing BOP in 30 seconds or less and, holding them closed against full rated working pressure.
- BOP controls, to be located near drillers' position.
- Kelly equipped with Kelly cock.
- Inside blowout preventer or its equivalent on derrick floor at all times with proper threads to fit pipe being used.
- Kelly saver-sub equipped with rubber casing protector at all times.
- Plug type blowout preventer tester.
- Extra set pipe rams to fit drill pipe in use on location at all times.
- Type RX ring gaskets in place of Type R.

MEC TO FURNISH:

- Bradenhead or casing head and side valves.
- Wear bushing. If required.

GENERAL NOTES:

- Deviations from this drawing may be made only with the express permission of MEC's Drilling Manager.
- All connections, valves, fittings, piping, etc., subject to well or pump pressure must be flanged (suitable clamp connections acceptable) and have minimum working pressure equal to rated working pressure of preventers up through choke valves must be full opening and suitable for high pressure mud service.
- Controls to be of standard design and each marked, showing opening and closing position
- Chokes will be positioned so as not to hamper or delay changing of choke beans.

- Replaceable parts for adjustable choke, or bean sizes, retainers, and choke wrenches to be conveniently located for immediate use.
- All valves to be equipped with hand-wheels or handles ready for immediate use.
- Choke lines must be suitably anchored.
- Handwheels and extensions to be connected and ready for use.
- Valves adjacent to drilling spool to be kept open. Use outside valves except for emergency.
- All seamless steel control piping (2000 psi working pressure) to have flexible joints to avoid stress. Hoses will be permitted.
- Casinghead connections shall not be used except in case of emergency.
- Does not use kill line for routine fill up operations.

Mack Energy Corporation


Exhibit #11

MINIMUM CHOKE MANIFOLD

3,000, 5,000, and 10,000 PSI Working Pressure

3M will be used

3 MWP - 5 MWP - 10 MWP

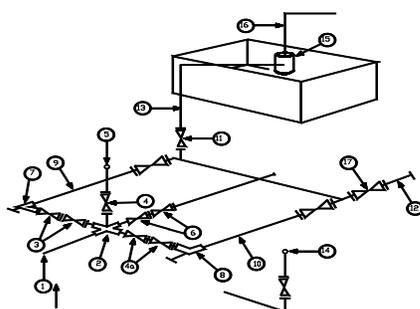

Mud Pit

Reserve Pit

* Location of separator optional

Below Substructure

Minimum requirements

No.		3,000 MWP			5,000 MWP			10,000 MWP		
		I.D.	Nominal	Rating	I.D.	Nominal	Rating	I.D.	Nominal	Rating
1	Line from drilling Spool		3"	3,000		3"	5,000		3"	10,000
2	Cross 3" x 3" x 3" x 2"			3,000			5,000			
2	Cross 3" x 3" x 3" x 2"									10,000
3	Valve Gate Plug	3 1/8"		3,000	3 1/8"		5,000	3 1/8"		10,000
4	Valve Gate Plug	1 13/16"		3,000	1 13/16"		5,000	1 13/16"		10,000
4a	Valves (1)	2 1/16"		3,000	2 1/16"		5,000	2 1/16"		10,000
5	Pressure Gauge			3,000			5,000			10,000
6	Valve Gate Plug	3 1/8"		3,000	3 1/8"		5,000	3 1/8"		10,000
7	Adjustable Choke (3)	2"		3,000	2"		5,000	2"		10,000
8	Adjustable Choke	1"		3,000	1"		5,000	2"		10,000
9	Line		3"	3,000		3"	5,000		3"	10,000
10	Line		2"	3,000		2"	5,000		2"	10,000
11	Valve Gate Plug	3 1/8"		3,000	3 1/8"		5,000	3 1/8"		10,000
12	Line		3"	1,000		3"	1,000		3"	2,000
13	Line		3"	1,000		3"	1,000		3"	2,000
14	Remote reading compound Standpipe pressure gauge			3,000			5,000			10,000
15	Gas Separator		2' x5'			2' x5'			2' x5'	
16	Line		4"	1,000		4"	1,000		4"	2,000
17	Valve Gate Plug	3 1/8"		3,000	3 1/8"		5,000	3 1/8"		10,000

- (1) Only one required in Class 3M
- (2) Gate valves only shall be used for Class 10 M
- (3) Remote operated hydraulic choke required on 5,000 psi and 10,000 psi for drilling.

EQUIPMENT SPECIFICATIONS AND INSTALLATION INSTRUCTION

1. All connections in choke manifold shall be welded, studded, flanged or Cameron clamp of comparable rating.
2. All flanges shall be API 6B or 6BX and ring gaskets shall be API RX or BX. Use only BX for 10 MWP.
3. All lines shall be securely anchored.
4. Chokes shall be equipped with tungsten carbide seats and needles, and replacements shall be available.
5. alternate with automatic chokes, a choke manifold pressure gauge shall be located on the rig floor in conjunction with the standpipe pressure gauge.
6. Line from drilling spool to choke manifold should be as straight as possible. Lines downstream from chokes shall make turns by large bends or 90 degree bends using bull plugged tees


Mack Energy Corporation

MANIFOLD SCHEMATIC

Exhibit #12

Drilling Operations Choke Manifold 3M Service

Exhibit12 – Choke Manifold Diagram

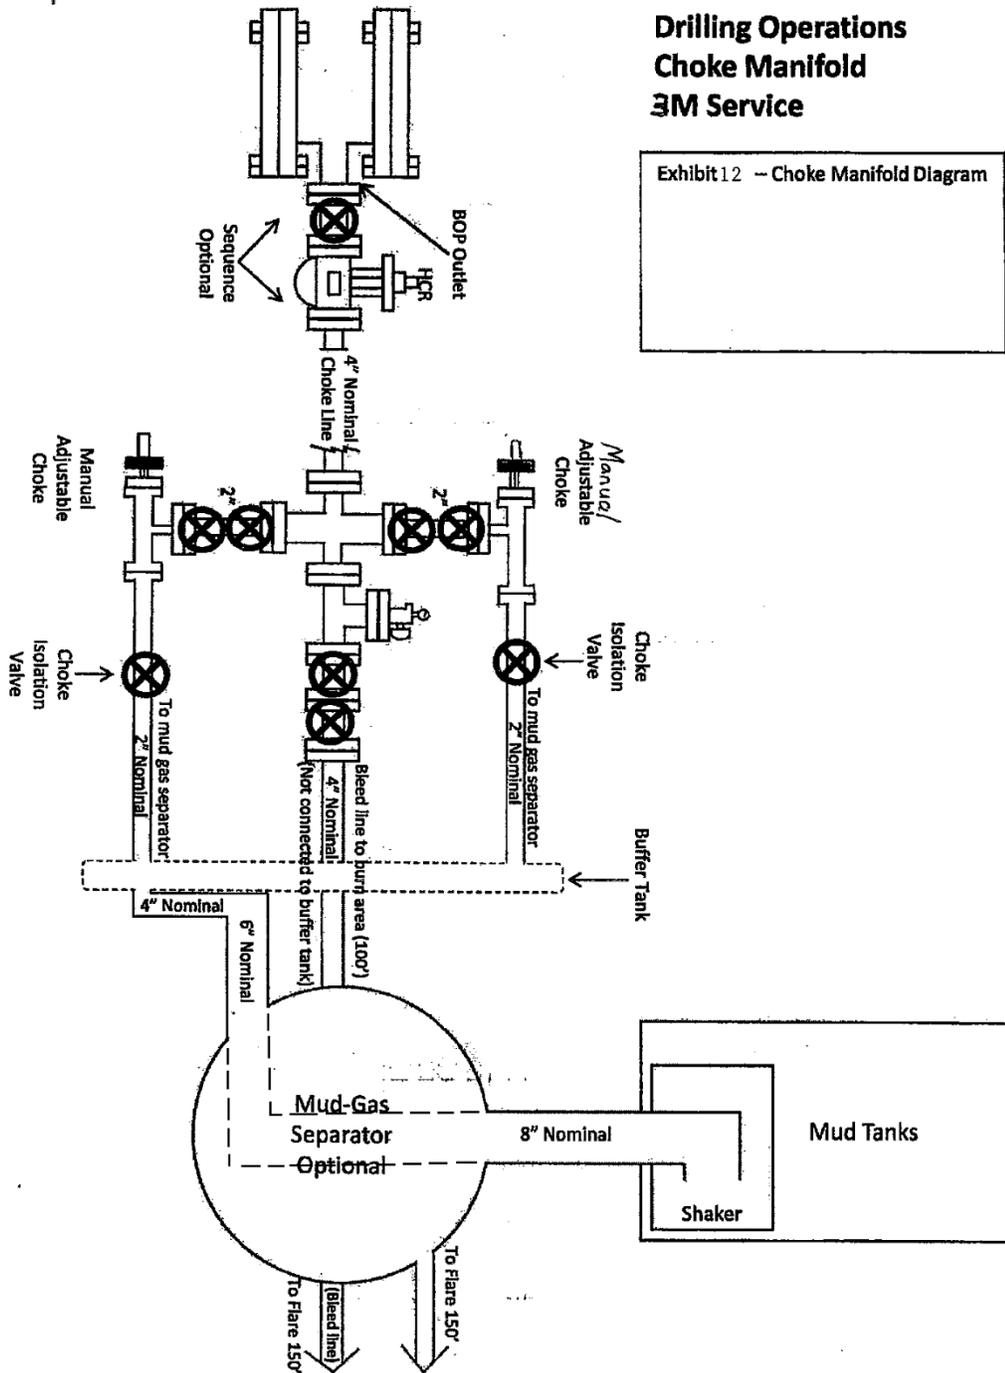

Medicine Hat State Com #3H, Plan 1

Operator Mack Energy Corp	Units feet, °/100ft	13:43 Monday, April 1, 2024 Page 1 of 4
Field Round Tank	County Chaves	Vertical Section Azimuth 179.28
Well Name Medicine Hat State Com #3H	State New Mexico	Survey Calculation Method Minimum Curvature
Plan 1	Country USA	Database Access

Location SL: 330 FSL & 330 FEL Sec 23-T15S-R28E BHL: 1220 FSL & 330 FEL Sec 35-T15S-R28E	Map Zone UTM	Lat Long Ref
Site	Surface X 1912715	Surface Long
Slot Name	Surface Y 11973115.5	Surface Lat
Well Number 3H	Surface Z 3633.3	Global Z Ref KB
Project	Ground Level 3615.8	Local North Ref Grid

DIRECTIONAL WELL PLAN

MD*	INC*	AZI*	TVD*	N*	E*	DLS*	V. S.*	MapE*	MapN*	SysTVD*
ft	deg	deg	ft	ft	ft	%/100ft	ft	ft	ft	ft
*** TIE (at MD = 2035.00)										
2035.00	0.00	0.0	2035.00	0.00	0.00		0.00	1912715.00	11973115.50	1598.30
2050.00	0.00	0.0	2050.00	0.00	0.00	0.00	0.00	1912715.00	11973115.50	1583.30
2100.00	0.00	0.0	2100.00	0.00	0.00	0.00	0.00	1912715.00	11973115.50	1533.30
*** KOP 8 DEGREE (at MD = 2135.00)										
2135.00	0.00	0.0	2135.00	0.00	0.00	0.00	0.00	1912715.00	11973115.50	1498.30
2150.00	1.20	122.9	2150.00	-0.09	0.13	8.00	0.09	1912715.13	11973115.41	1483.30
2200.00	5.20	122.9	2199.91	-1.60	2.47	8.00	1.63	1912717.47	11973113.90	1433.39
2250.00	9.20	122.9	2249.51	-5.00	7.74	8.00	5.10	1912722.74	11973110.50	1383.79
2300.00	13.20	122.9	2298.54	-10.28	15.89	8.00	10.48	1912730.89	11973105.22	1334.76
2350.00	17.20	122.9	2346.79	-17.40	26.89	8.00	17.73	1912741.89	11973098.10	1286.51
2400.00	21.20	122.9	2393.99	-26.33	40.70	8.00	26.84	1912755.70	11973089.17	1239.31
2450.00	25.20	122.9	2439.94	-37.02	57.23	8.00	37.74	1912772.23	11973078.48	1193.36
2500.00	29.20	122.9	2484.40	-49.44	76.42	8.00	50.39	1912791.42	11973066.06	1148.90
2550.00	33.20	122.9	2527.16	-63.50	98.16	8.00	64.73	1912813.16	11973052.00	1106.14
2600.00	37.20	122.9	2568.01	-79.15	122.35	8.00	80.69	1912837.35	11973036.35	1065.29
2650.00	41.20	122.9	2606.75	-96.32	148.88	8.00	98.18	1912863.88	11973019.18	1026.55
2700.00	45.20	122.9	2643.19	-114.90	177.61	8.00	117.13	1912892.61	11973000.60	990.11
2750.00	49.20	122.9	2677.16	-134.83	208.41	8.00	137.43	1912923.41	11972980.67	956.14
2800.00	53.20	122.9	2708.48	-155.99	241.12	8.00	159.01	1912956.12	11972959.51	924.82
*** 55 DEGREE TANGENT (at MD = 2822.50)										
2822.50	55.00	122.9	2721.67	-165.89	256.42	8.00	169.10	1912971.42	11972949.61	911.63
2850.00	55.00	122.9	2737.45	-178.12	275.34	0.00	181.57	1912990.34	11972937.38	895.85
2900.00	55.00	122.9	2766.13	-200.37	309.73	0.00	204.25	1913024.73	11972915.13	867.17
2950.00	55.00	122.9	2794.81	-222.62	344.11	0.00	226.92	1913059.11	11972892.88	838.49
3000.00	55.00	122.9	2823.48	-244.86	378.50	0.00	249.60	1913093.50	11972870.64	809.82
*** 10 DEGREE BUILD (at MD = 3022.50)										
3022.50	55.00	122.9	2836.39	-254.88	393.98	0.00	259.81	1913108.98	11972860.62	796.91
3050.00	56.02	126.0	2851.96	-267.70	412.66	10.00	272.86	1913127.66	11972847.80	781.34
3100.00	58.06	131.4	2879.18	-293.94	445.36	10.00	299.51	1913160.36	11972821.56	754.12
3150.00	60.33	136.6	2904.79	-323.79	476.20	10.00	329.75	1913191.20	11972791.71	728.51
3200.00	62.79	141.6	2928.62	-357.02	504.95	10.00	363.34	1913219.95	11972758.48	704.68
3250.00	65.41	146.3	2950.47	-393.38	531.39	10.00	400.03	1913246.39	11972722.12	682.83
3300.00	68.18	150.8	2970.17	-432.59	555.33	10.00	439.53	1913270.33	11972682.91	663.13
3350.00	71.07	155.2	2987.59	-474.35	576.56	10.00	481.56	1913291.56	11972641.15	645.71
3400.00	74.05	159.4	3002.58	-518.35	594.95	10.00	525.78	1913309.95	11972597.15	630.72
3450.00	77.11	163.5	3015.03	-564.24	610.34	10.00	571.87	1913325.34	11972551.26	618.27
3500.00	80.24	167.5	3024.86	-611.69	622.62	10.00	619.47	1913337.62	11972503.81	608.44

Medicine Hat State Com #3H, Plan 1

Operator Mack Energy Corp	Units feet, °/100ft	13:43 Monday, April 1, 2024 Page 2 of 4
Field Round Tank	County Chaves	Vertical Section Azimuth 179.28
Well Name Medicine Hat State Com #3H	State New Mexico	Survey Calculation Method Minimum Curvature
Plan 1	Country USA	Database Access

Location SL: 330 FSL & 330 FEL Sec 23-T15S-R28E BHL: 1220 FSL & 330 FEL Sec 35-T15S-R28E	Map Zone UTM	Lat Long Ref
Site	Surface X 1912715	Surface Long
Slot Name	Surface Y 11973115.5	Surface Lat
Well Number 3H	Surface Z 3633.3	Global Z Ref KB
Project	Ground Level 3615.8	Local North Ref Grid

DIRECTIONAL WELL PLAN

MD*	INC*	AZI*	TVD*	N*	E*	DLS*	V. S.*	MapE*	MapN*	SysTVD*
ft	deg	deg	ft	ft	ft	°/100ft	ft	ft	ft	ft
3550.00	83.41	171.4	3031.97	-660.33	631.69	10.00	668.21	1913346.69	11972455.17	601.33
3600.00	86.61	175.2	3036.33	-709.78	637.49	10.00	717.74	1913352.49	11972405.72	596.97
3650.00	89.82	179.1	3037.89	-759.68	639.97	10.00	767.66	1913354.97	11972355.82	595.42
*** LANDING POINT (at MD = 3652.78)										
3652.78	90.00	179.3	3037.89	-762.46	640.01	10.00	770.44	1913355.01	11972353.04	595.41
3700.00	90.00	179.3	3037.89	-809.67	640.60	0.00	817.66	1913355.60	11972305.83	595.41
3750.00	90.00	179.3	3037.89	-859.67	641.23	0.00	867.66	1913356.23	11972255.83	595.41
3800.00	90.00	179.3	3037.89	-909.67	641.86	0.00	917.66	1913356.86	11972205.83	595.41
3850.00	90.00	179.3	3037.89	-959.66	642.49	0.00	967.66	1913357.49	11972155.84	595.41
3900.00	90.00	179.3	3037.89	-1009.66	643.12	0.00	1017.66	1913358.12	11972105.84	595.41
3950.00	90.00	179.3	3037.89	-1059.66	643.75	0.00	1067.66	1913358.75	11972055.84	595.41
4000.00	90.00	179.3	3037.89	-1109.65	644.37	0.00	1117.66	1913359.37	11972005.85	595.41
4050.00	90.00	179.3	3037.89	-1159.65	645.00	0.00	1167.66	1913360.00	11971955.85	595.41
4100.00	90.00	179.3	3037.89	-1209.64	645.63	0.00	1217.66	1913360.63	11971905.86	595.41
4150.00	90.00	179.3	3037.89	-1259.64	646.26	0.00	1267.66	1913361.26	11971855.86	595.41
4200.00	90.00	179.3	3037.89	-1309.64	646.89	0.00	1317.66	1913361.89	11971805.86	595.41
4250.00	90.00	179.3	3037.89	-1359.63	647.52	0.00	1367.66	1913362.52	11971755.87	595.41
4300.00	90.00	179.3	3037.89	-1409.63	648.14	0.00	1417.66	1913363.14	11971705.87	595.41
4350.00	90.00	179.3	3037.89	-1459.62	648.77	0.00	1467.66	1913363.77	11971655.88	595.41
4400.00	90.00	179.3	3037.89	-1509.62	649.40	0.00	1517.66	1913364.40	11971605.88	595.41
4450.00	90.00	179.3	3037.89	-1559.62	650.03	0.00	1567.66	1913365.03	11971555.88	595.41
4500.00	90.00	179.3	3037.89	-1609.61	650.66	0.00	1617.66	1913365.66	11971505.89	595.41
4550.00	90.00	179.3	3037.89	-1659.61	651.29	0.00	1667.66	1913366.29	11971455.89	595.41
4600.00	90.00	179.3	3037.89	-1709.60	651.91	0.00	1717.66	1913366.91	11971405.90	595.41
4650.00	90.00	179.3	3037.89	-1759.60	652.54	0.00	1767.66	1913367.54	11971355.90	595.41
4700.00	90.00	179.3	3037.89	-1809.60	653.17	0.00	1817.66	1913368.17	11971305.90	595.41
4750.00	90.00	179.3	3037.89	-1859.59	653.80	0.00	1867.66	1913368.80	11971255.91	595.41
4800.00	90.00	179.3	3037.89	-1909.59	654.43	0.00	1917.66	1913369.43	11971205.91	595.41
4850.00	90.00	179.3	3037.89	-1959.58	655.06	0.00	1967.66	1913370.06	11971155.92	595.41
4900.00	90.00	179.3	3037.89	-2009.58	655.68	0.00	2017.66	1913370.68	11971105.92	595.41
4950.00	90.00	179.3	3037.89	-2059.58	656.31	0.00	2067.66	1913371.31	11971055.92	595.41
5000.00	90.00	179.3	3037.89	-2109.57	656.94	0.00	2117.66	1913371.94	11971005.93	595.41
5050.00	90.00	179.3	3037.89	-2159.57	657.57	0.00	2167.66	1913372.57	11970955.93	595.41
5100.00	90.00	179.3	3037.89	-2209.56	658.20	0.00	2217.66	1913373.20	11970905.94	595.41
5150.00	90.00	179.3	3037.89	-2259.56	658.83	0.00	2267.66	1913373.83	11970855.94	595.41
5200.00	90.00	179.3	3037.89	-2309.56	659.45	0.00	2317.66	1913374.45	11970805.94	595.41
5250.00	90.00	179.3	3037.89	-2359.55	660.08	0.00	2367.66	1913375.08	11970755.95	595.41

Medicine Hat State Com #3H, Plan 1

Operator Mack Energy Corp	Units feet, °/100ft	13:43 Monday, April 1, 2024	Page 3 of 4
Field Round Tank	County Chaves	Vertical Section Azimuth 179.28	
Well Name Medicine Hat State Com #3H	State New Mexico	Survey Calculation Method Minimum Curvature	
Plan 1	Country USA	Database Access	

Location SL: 330 FSL & 330 FEL Sec 23-T15S-R28E BHL: 1220 FSL & 330 FEL Sec 35-T15S-R28E	Map Zone UTM	Lat Long Ref
Site	Surface X 1912715	Surface Long
Slot Name	Surface Y 11973115.5	Surface Lat
Well Number 3H	Surface Z 3633.3	Global Z Ref KB
Project	Ground Level 3615.8	Local North Ref Grid

DIRECTIONAL WELL PLAN

MD*	INC*	AZI*	TVD*	N*	E*	DLS*	V. S.*	MapE*	MapN*	SysTVD*
ft	deg	deg	ft	ft	ft	%/100ft	ft	ft	ft	ft
5300.00	90.00	179.3	3037.89	-2409.55	660.71	0.00	2417.66	1913375.71	11970705.95	595.41
5350.00	90.00	179.3	3037.89	-2459.54	661.34	0.00	2467.66	1913376.34	11970655.96	595.41
5400.00	90.00	179.3	3037.89	-2509.54	661.97	0.00	2517.66	1913376.97	11970605.96	595.41
5450.00	90.00	179.3	3037.89	-2559.54	662.59	0.00	2567.66	1913377.59	11970555.96	595.41
5500.00	90.00	179.3	3037.89	-2609.53	663.22	0.00	2617.66	1913378.22	11970505.97	595.41
5550.00	90.00	179.3	3037.89	-2659.53	663.85	0.00	2667.66	1913378.85	11970455.97	595.41
5600.00	90.00	179.3	3037.89	-2709.52	664.48	0.00	2717.66	1913379.48	11970405.98	595.41
5650.00	90.00	179.3	3037.89	-2759.52	665.11	0.00	2767.66	1913380.11	11970355.98	595.41
5700.00	90.00	179.3	3037.89	-2809.52	665.74	0.00	2817.66	1913380.74	11970305.98	595.41
5750.00	90.00	179.3	3037.89	-2859.51	666.36	0.00	2867.66	1913381.36	11970255.99	595.41
5800.00	90.00	179.3	3037.89	-2909.51	666.99	0.00	2917.66	1913381.99	11970205.99	595.41
5850.00	90.00	179.3	3037.89	-2959.51	667.62	0.00	2967.66	1913382.62	11970155.99	595.41
5900.00	90.00	179.3	3037.89	-3009.50	668.25	0.00	3017.66	1913383.25	11970106.00	595.41
5950.00	90.00	179.3	3037.89	-3059.50	668.88	0.00	3067.66	1913383.88	11970056.00	595.41
6000.00	90.00	179.3	3037.89	-3109.49	669.51	0.00	3117.66	1913384.51	11970006.01	595.41
6050.00	90.00	179.3	3037.89	-3159.49	670.13	0.00	3167.66	1913385.13	11969956.01	595.41
6100.00	90.00	179.3	3037.89	-3209.49	670.76	0.00	3217.66	1913385.76	11969906.01	595.41
6150.00	90.00	179.3	3037.89	-3259.48	671.39	0.00	3267.66	1913386.39	11969856.02	595.41
6200.00	90.00	179.3	3037.89	-3309.48	672.02	0.00	3317.66	1913387.02	11969806.02	595.41
6250.00	90.00	179.3	3037.89	-3359.47	672.65	0.00	3367.66	1913387.65	11969756.03	595.41
6300.00	90.00	179.3	3037.89	-3409.47	673.28	0.00	3417.66	1913388.28	11969706.03	595.41
6350.00	90.00	179.3	3037.89	-3459.47	673.90	0.00	3467.66	1913388.90	11969656.03	595.41
6400.00	90.00	179.3	3037.89	-3509.46	674.53	0.00	3517.66	1913389.53	11969606.04	595.41
6450.00	90.00	179.3	3037.89	-3559.46	675.16	0.00	3567.66	1913390.16	11969556.04	595.41
6500.00	90.00	179.3	3037.89	-3609.45	675.79	0.00	3617.66	1913390.79	11969506.05	595.41
6550.00	90.00	179.3	3037.89	-3659.45	676.42	0.00	3667.66	1913391.42	11969456.05	595.41
6600.00	90.00	179.3	3037.89	-3709.45	677.05	0.00	3717.66	1913392.05	11969406.05	595.41
6650.00	90.00	179.3	3037.89	-3759.44	677.67	0.00	3767.66	1913392.67	11969356.06	595.41
6700.00	90.00	179.3	3037.89	-3809.44	678.30	0.00	3817.66	1913393.30	11969306.06	595.41
6750.00	90.00	179.3	3037.89	-3859.43	678.93	0.00	3867.66	1913393.93	11969256.07	595.41
6800.00	90.00	179.3	3037.89	-3909.43	679.56	0.00	3917.66	1913394.56	11969206.07	595.41
6850.00	90.00	179.3	3037.89	-3959.43	680.19	0.00	3967.66	1913395.19	11969156.07	595.41
6900.00	90.00	179.3	3037.89	-4009.42	680.82	0.00	4017.66	1913395.82	11969106.08	595.41
6950.00	90.00	179.3	3037.89	-4059.42	681.44	0.00	4067.66	1913396.44	11969056.08	595.41
7000.00	90.00	179.3	3037.89	-4109.41	682.07	0.00	4117.66	1913397.07	11969006.09	595.41
7050.00	90.00	179.3	3037.89	-4159.41	682.70	0.00	4167.66	1913397.70	11968956.09	595.41
7100.00	90.00	179.3	3037.89	-4209.41	683.33	0.00	4217.66	1913398.33	11968906.09	595.41

Medicine Hat State Com #3H, Plan 1

Operator Mack Energy Corp	Units feet, °/100ft	13:43 Monday, April 1, 2024 Page 4 of 4
Field Round Tank	County Chaves	Vertical Section Azimuth 179.28
Well Name Medicine Hat State Com #3H	State New Mexico	Survey Calculation Method Minimum Curvature
Plan 1	Country USA	Database Access

Location SL: 330 FSL & 330 FEL Sec 23-T15S-R28E BHL: 1220 FSL & 330 FEL Sec 35-T15S-R28E	Map Zone UTM	Lat Long Ref
Site	Surface X 1912715	Surface Long
Slot Name	Surface Y 11973115.5	Surface Lat
Well Number 3H	Surface Z 3633.3	Global Z Ref KB
Project	Ground Level 3615.8	Local North Ref Grid

DIRECTIONAL WELL PLAN

MD*	INC*	AZI*	TVD*	N*	E*	DLS*	V. S.*	MapE*	MapN*	SysTVD*
ft	deg	deg	ft	ft	ft	%/100ft	ft	ft	ft	ft
7150.00	90.00	179.3	3037.89	-4259.40	683.96	0.00	4267.66	1913398.96	11968856.10	595.41
7200.00	90.00	179.3	3037.89	-4309.40	684.59	0.00	4317.66	1913399.59	11968806.10	595.41
7250.00	90.00	179.3	3037.89	-4359.39	685.21	0.00	4367.66	1913400.21	11968756.11	595.41
7300.00	90.00	179.3	3037.89	-4409.39	685.84	0.00	4417.66	1913400.84	11968706.11	595.41
7350.00	90.00	179.3	3037.89	-4459.39	686.47	0.00	4467.66	1913401.47	11968656.11	595.41
7400.00	90.00	179.3	3037.89	-4509.38	687.10	0.00	4517.66	1913402.10	11968606.12	595.41
7450.00	90.00	179.3	3037.89	-4559.38	687.73	0.00	4567.66	1913402.73	11968556.12	595.41
7500.00	90.00	179.3	3037.89	-4609.37	688.36	0.00	4617.66	1913403.36	11968506.13	595.41
7550.00	90.00	179.3	3037.89	-4659.37	688.98	0.00	4667.66	1913403.98	11968456.13	595.41
7600.00	90.00	179.3	3037.89	-4709.37	689.61	0.00	4717.66	1913404.61	11968406.13	595.41
7650.00	90.00	179.3	3037.89	-4759.36	690.24	0.00	4767.66	1913405.24	11968356.14	595.41
7700.00	90.00	179.3	3037.89	-4809.36	690.87	0.00	4817.66	1913405.87	11968306.14	595.41
7750.00	90.00	179.3	3037.89	-4859.36	691.50	0.00	4867.66	1913406.50	11968256.14	595.41
7800.00	90.00	179.3	3037.89	-4909.35	692.13	0.00	4917.66	1913407.13	11968206.15	595.41
7850.00	90.00	179.3	3037.89	-4959.35	692.75	0.00	4967.66	1913407.75	11968156.15	595.41
7900.00	90.00	179.3	3037.89	-5009.34	693.38	0.00	5017.66	1913408.38	11968106.16	595.41
7950.00	90.00	179.3	3037.89	-5059.34	694.01	0.00	5067.66	1913409.01	11968056.16	595.41
8000.00	90.00	179.3	3037.89	-5109.34	694.64	0.00	5117.66	1913409.64	11968006.16	595.41
8050.00	90.00	179.3	3037.89	-5159.33	695.27	0.00	5167.66	1913410.27	11967956.17	595.41
8100.00	90.00	179.3	3037.89	-5209.33	695.89	0.00	5217.66	1913410.89	11967906.17	595.41
8150.00	90.00	179.3	3037.89	-5259.32	696.52	0.00	5267.66	1913411.52	11967856.18	595.41
8200.00	90.00	179.3	3037.89	-5309.32	697.15	0.00	5317.66	1913412.15	11967806.18	595.41
8250.00	90.00	179.3	3037.89	-5359.32	697.78	0.00	5367.66	1913412.78	11967756.18	595.41
8300.00	90.00	179.3	3037.89	-5409.31	698.41	0.00	5417.66	1913413.41	11967706.19	595.41
8350.00	90.00	179.3	3037.89	-5459.31	699.04	0.00	5467.66	1913414.04	11967656.19	595.41
8400.00	90.00	179.3	3037.89	-5509.30	699.66	0.00	5517.66	1913414.66	11967606.20	595.41
8450.00	90.00	179.3	3037.89	-5559.30	700.29	0.00	5567.66	1913415.29	11967556.20	595.41
8500.00	90.00	179.3	3037.89	-5609.30	700.92	0.00	5617.66	1913415.92	11967506.20	595.41
8550.00	90.00	179.3	3037.89	-5659.29	701.55	0.00	5667.66	1913416.55	11967456.21	595.41
8600.00	90.00	179.3	3037.89	-5709.29	702.18	0.00	5717.66	1913417.18	11967406.21	595.41
8650.00	90.00	179.3	3037.89	-5759.28	702.81	0.00	5767.66	1913417.81	11967356.22	595.41
8700.00	90.00	179.3	3037.89	-5809.28	703.43	0.00	5817.66	1913418.43	11967306.22	595.41
8750.00	90.00	179.3	3037.89	-5859.28	704.06	0.00	5867.66	1913419.06	11967256.22	595.41
8800.00	90.00	179.3	3037.89	-5909.27	704.69	0.00	5917.66	1913419.69	11967206.23	595.41
*** TD (at MD = 8841.78)										
8841.78	90.00	179.3	3037.89	-5951.05	705.22	0.00	5959.44	1913420.22	11967164.45	595.41

PECOS DISTRICT DRILLING OPERATIONS CONDITIONS OF APPROVAL

OPERATOR'S NAME:	Mack Energy Corporation
LEASE NO.:	NMNM-132939 – SHL only
WELL NAME & NO.:	Medicine Hat State Com 3H
SURFACE HOLE FOOTAGE:	0707' FSL & 0310' FEL
BOTTOM HOLE FOOTAGE:	0001' FSL & 0330' FWL Sec. 35, T. 15 S., R 28 E.
LOCATION:	Section 27, T. 15 S., R 28 E., NMPM
COUNTY:	Chaves County, New Mexico

The Gamma Ray and Neutron well logs must be run from total depth to surface and e-mailed to Mckitri Wier at mwier@blm.gov hard copy mailed to 2909 West Second Street Roswell, NM 88201 to his attention.

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)

Chaves and Roosevelt Counties

Call the Roswell Field Office, 2909 West Second St., Roswell NM 88201.
During office hours call (575) 627-0272.
After hours call (575) 627-0205.

A. Hydrogen Sulfide

1. **Hydrogen Sulfide (H2S) monitors shall be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the Hydrogen Sulfide area shall meet Onshore Order 6 requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, provide measured values and formations to the BLM.**
2. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval. **If the drilling rig is removed without approval – an Incident of Non-Compliance will be written and will be a “Major” violation.**
3. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works is located, this does not include the dog house or stairway area.

4. The record of the drilling rate along with the GR/N well log run from TD to surface (horizontal well – vertical portion of hole) shall be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies. The Rustler top and top and bottom of Salt are to be recorded on the Completion Report.

B. CASING

Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.

Wait on cement (WOC) for Water Basin:

After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least **8 hours**. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements.

Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.

No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.

Medium Cave/Karst

Possibility of water flows in the Rustler, Queen, Salado, and Artesia Group.

Possibility of lost circulation in the Rustler, Artesia Group, and San Andres.

1. The **13-3/8** inch surface casing shall be set at approximately **180** feet (a minimum of 25 feet into the Rustler Anhydrite and above the salt) and cemented to the surface. **If salt is encountered, set casing at least 25 feet above the salt.**
 - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.

- b. **Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry.**
 - c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
 - d. If cement falls back, remedial cementing will be done prior to drilling out that string.
2. The minimum required fill of cement behind the **9-5/8** inch intermediate casing is:
 - Cement to surface. If cement does not circulate see B.1.a, c-d above.

Centralizers required on horizontal leg, must be type for horizontal service and a minimum of one every other joint.

3. The minimum required fill of cement behind the **7 X 5-1/2** inch production casing is:
 - Cement to surface. If cement does not circulate, contact the appropriate BLM office.
4. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.

C. PRESSURE CONTROL

1. Variance approved to use flex line from BOP to choke manifold. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. **Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.** If the BLM inspector questions the straightness of the hose, a BLM engineer will be contacted and will review in the field or via picture supplied by inspector to determine if changes are required (operator shall expect delays if this occurs).

2. **Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 3000 (3M) psi (testing to 2,000 psi).**
 - a. **Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.**
 - b. **If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.**
 - c. **Manufacturer representative shall install the test plug for the initial BOP test.**
 - d. **Operator shall perform the intermediate casing integrity test to 70% of the casing burst. This will test the multi-bowl seals.**
 - e. **If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.**
3. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
 - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead when specified), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
 - b. The tests shall be done by an independent service company utilizing a test plug **not a cup or J-packer.**
 - c. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.
 - d. The results of the test shall be reported to the appropriate BLM office.
 - e. All tests are required to be recorded on a calibrated test chart. **A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.**

- f. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.

D. DRILL STEM TEST

If drill stem tests are performed, Onshore Order 2.III.D shall be followed.

E. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

JAM 09042024

Mack Energy Corporation
Medicine Hat State Com 3H NMNM-132939
SHL : 707 FSL & 310 FEL, SESE, Sec. 27 T15S R28E
BHL : 1 FSL & 330 FWL, SWSW, Sec. 35 T15S R28E
Chaves County, NM

Mack Energy Corporation

Onshore Order #6

Hydrogen Sulfide Drilling Operation Plan

I. HYDROGEN SULFIDE TRAINING

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on this well:

1. The hazards and characteristics of hydrogen sulfide (H₂S)
2. The proper use and maintenance of personal protective equipment and life support systems.
3. The proper use of H₂S detectors alarms warning systems, briefing areas, evacuation procedures, and prevailing winds.
4. The proper techniques for first aid and rescue procedures.

In addition, supervisory personnel will be trained in the following areas:

1. The effects of H₂S on metal components. If high tensile tubular are to be used, personnel will be trained in their special maintenance requirements.
2. Corrective action and shut-in procedures when drilling or reworking a well and blowout prevention and well control procedures.
3. The contents and requirements of the H₂S Drilling Operations Plan and Public Protection Plan.

There will be an initial training session just prior to encountering a known or probable H₂S zone (within 3 days or 500 feet) and weekly H₂S and well control drills for all personnel in each crew. The initial training session shall include a review of the site specific H₂S Drilling Operations Plan and the Public Protection Plan. **The concentrations of H₂S of wells in this area from surface to TD are low enough that a contingency plan is not required.**

II. H₂S SAFETY EQUIPMENT AND SYSTEMS

Note: All H₂S safety equipment and systems will be installed, tested, and operational when drilling reaches a depth of 500 feet above, or three days prior to penetrating the first zone containing or reasonable expected to contain H₂S.

1. Well Control Equipment:

- A. Flare line.
- B. Choke manifold.
- C. Blind rams and pipe rams to accommodate all pipe sizes with properly sized closing unit.
- D. Auxiliary equipment may include if applicable: annular preventer & rotating head.

Mack Energy Corporation
Medicine Hat State Com 3H NMNM-132939
SHL : 707 FSL & 310 FEL, SESE, Sec. 27 T15S R28E
BHL : 1 FSL & 330 FWL, SWSW, Sec. 35 T15S R28E
Chaves County, NM

2. Protective equipment for essential personnel:

- A. Mark II Survive air 30-minute units located in the doghouse and at briefing areas, as indicated on well site diagram.

3. H2S detection and monitoring equipment:

- A. 1 portable H2S monitors positioned on location for best coverage and response. These units have warning lights and audible sirens when H2S levels of 20 PPM are reached.

4. Visual warning systems:

- A. Wind direction indicators as shown on well site diagram (Exhibit #8).
- B. Caution/Danger signs (Exhibit #7) shall be posted on roads providing direct access to location. Signs will be painted a high visibility yellow with black lettering of sufficient size to be readable at a reasonable distance from the immediate location. Bilingual signs will be used, when appropriate. See example attached.

5. Mud program:

- A. The mud program has been designed to minimize the volume of H2S circulated to surface. Proper mud weight, safe drilling practices and the use of H2S scavengers will minimize hazards when penetrating H2S bearing zones.

6. Metallurgy:

- A. All drill strings, casings, tubing, wellhead, blowout preventer, drilling spool, kill lines, choke manifold and lines, and valves shall be suitable for H2S service.
- B. All elastomers used for packing and seals shall be H2S trim.

7. Communication:

- A. Radio communications in company vehicles including cellular telephone and 2-way radio.
- B. Land line (telephone) communication at Office.

8. Well testing:

- A. Drill stem testing will be performed with a minimum number of personnel in the immediate vicinity, which are necessary to safely and adequately conduct the test. The drill stem testing will be conducted during daylight hours and formation fluids will not be flowed to the surface. All drill-stem-testing operations conducted in an H2S environment will use the closed chamber method of testing.

Attached to Form 5160-3
Mack Energy Corporation
Medicine Hat State Com 3H NMNM-132939
SHL : 707 FSL & 310 FEL, SESE, Sec. 27 T15S R28E
BHL : 1 FSL & 330 FWL, SWSW, Sec. 35 T15S R28E
Chaves County, NM


B. There will be no drill stem testing.

EXHIBIT #7

WARNING
YOU ARE ENTERING AN H2S
AUTHORIZED PERSONNEL ONLY


1. BEARDS OR CONTACT LENSES NOT ALLOWED
2. HARD HATS REQUIRED
3. SMOKING IN DESIGNATED AREAS ONLY
4. BE WIND CONSCIOUS AT ALL TIMES
5. CHECK WITH MACK ENERGY FOREMAN AT OFFICE

MACK ENERGY CORPORATION
1-575-748-1288

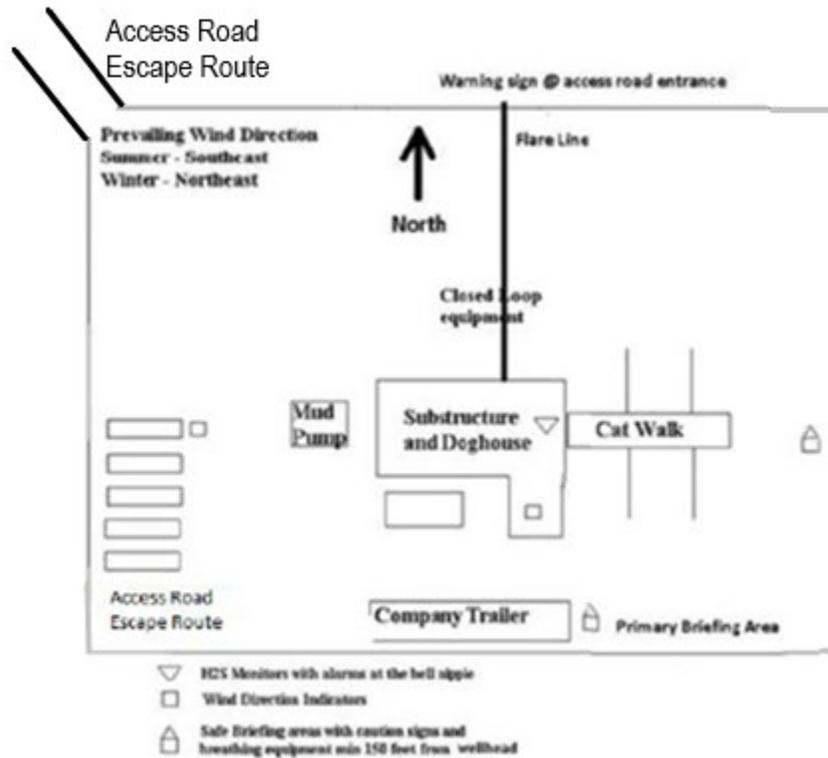

DRILLING LOCATION H2S SAFTY EQUIPMENT Exhibit # 8

Location Layout

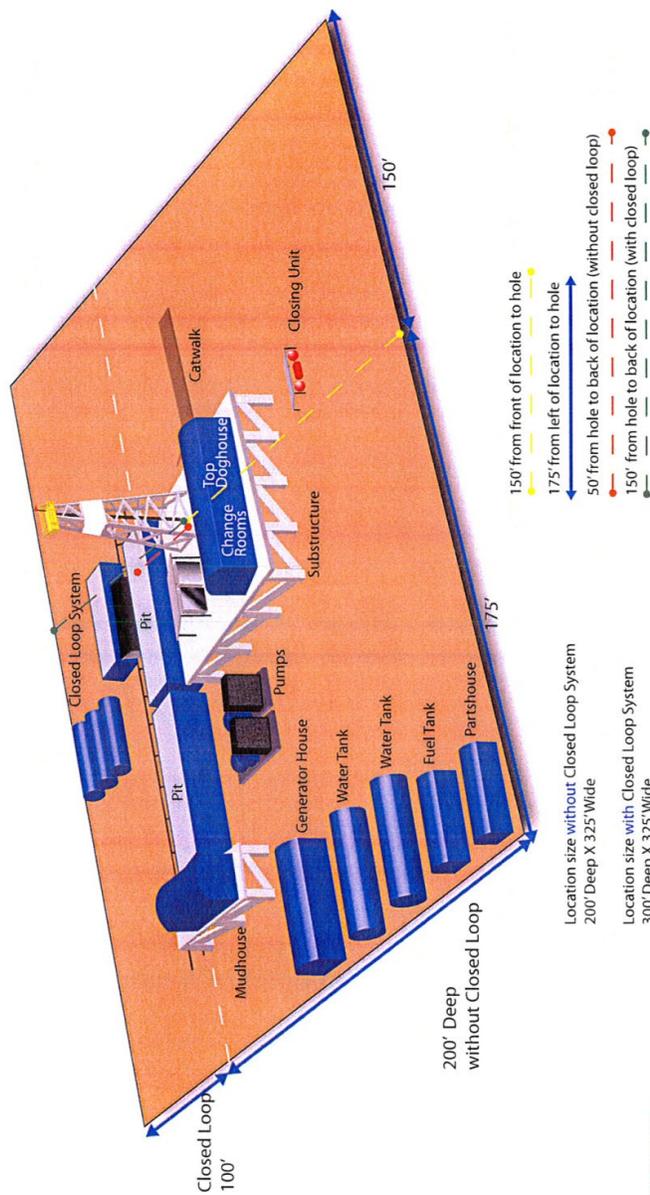

Silver Oak Drilling ~ 10 Bilco Road, Artesia, NM 88210 ~ 575.746.4405
 info@silveroakdrilling.com ~ www.silveroakdrilling.com

Mack Energy Corporation Call List, Chaves County

Artesia (575)	Cellular	Office
Jim Krogman.....	432-934-1596.....	748-1288
Emilio Martinez.....	432-934-7586.....	748-1288

Agency Call List (575)

Roswell

State Police.....	622-7200
City Police.....	624-6770
Sheriff's Office.....	624-7590
Ambulance.....	624-7590
Fire Department.....	624-7590
LEPC (Local Emergency Planning Committee.....	624-6770
NMOCD.....	748-1283
Bureau of Land Management.....	627-0272

Emergency Services


Boots & Coots IWC.....	1-800-256-9688 or (281)931-8884
Cudd pressure Control.....	(915)699-0139 or (915)563-3356
Halliburton.....	746-2757
Par Five.....	748-9539
Flight For Life-Lubbock, TX.....	(806)743-9911
Aerocare-Lubbock, TX.....	(806)747-8923
Med Flight Air Amb-Albuquerque, NM.....	(505)842-4433
Lifeguard Air Med Svc. Albuquerque, NM.....	(505)272-3115

Mack Energy Corporation

MANIFOLD SCHEMATIC
Exhibit #12


Drilling Operations Choke Manifold 3M Service

Exhibit 12 - Choke Manifold Diagram

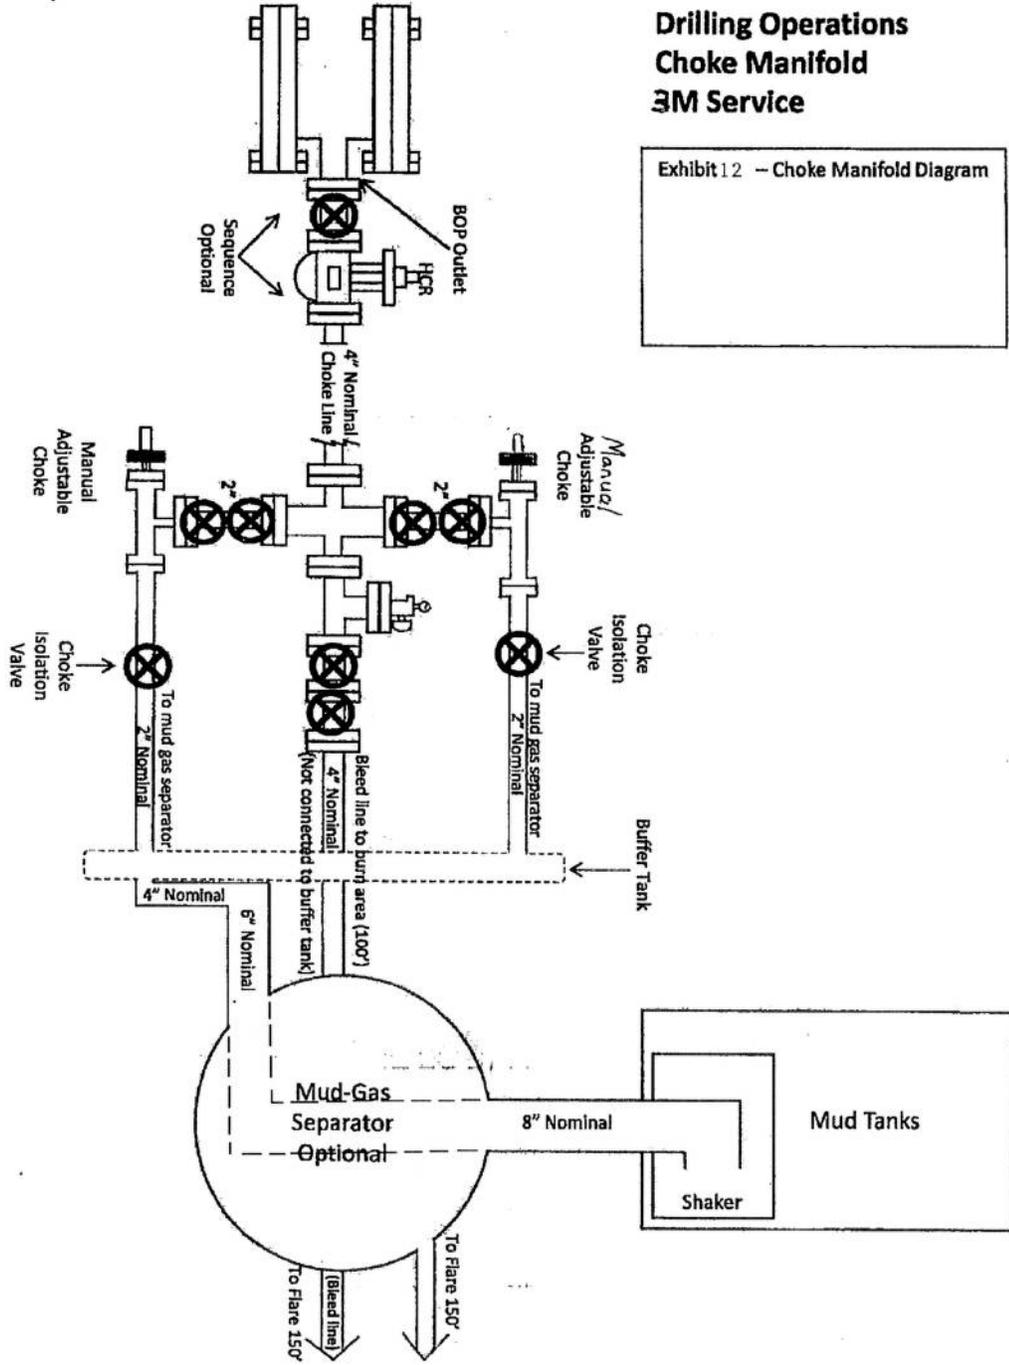

Mack Energy Corporation

Exhibit #11
 MINIMUM CHOKE MANIFOLD
 3,000, 5,000, and 10,000 PSI Working Pressure
 3M will be used
 3 MWP - 5 MWP - 10 MWP

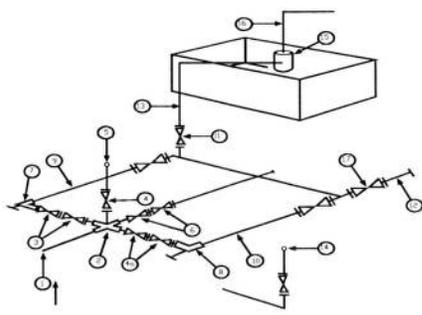

Mud Pit

Reserve Pit

* Location of separator optional

Below Substructure

Minimum requirements

No.		3,000 MWP			5,000 MWP			10,000 MWP		
		I.D.	Nominal	Rating	I.D.	Nominal	Rating	I.D.	Nominal	Rating
1	Line from drilling Spool		3"	3,000		3"	5,000		3"	10,000
2	Cross 3" x 3" x 3" x 2"			3,000			5,000			
2	Cross 3" x 3" x 3" x 2"									10,000
3	Valve Gate Plug	3 1/8		3,000	3 1/8		5,000	3 1/8		10,000
4	Valve Gate Plug	1 13/16		3,000	1 13/16		5,000	1 13/16		10,000
4a	Valves (1)	2 1/16		3,000	2 1/16		5,000	2 1/16		10,000
5	Pressure Gauge			3,000			5,000			10,000
6	Valve Gate Plug	3 1/8		3,000	3 1/8		5,000	3 1/8		10,000
7	Adjustable Choke (3)	2"		3,000	2"		5,000	2"		10,000
8	Adjustable Choke	1"		3,000	1"		5,000	2"		10,000
9	Line		3"	3,000		3"	5,000		3"	10,000
10	Line		2"	3,000		2"	5,000		2"	10,000
11	Valve Gate Plug	3 1/8		3,000	3 1/8		5,000	3 1/8		10,000
12	Line		3"	1,000		3"	1,000		3"	2,000
13	Line		3"	1,000		3"	1,000		3"	2,000
14	Remote reading compound Standpipe pressure quage			3,000			5,000			10,000
15	Gas Separator		2' x 5'			2' x 5'			2' x 5'	
16	Line		4"	1,000		4"	1,000		4"	2,000
17	Valve Gate Plug	3 1/8		3,000	3 1/8		5,000	3 1/8		10,000

- (1) Only one required in Class 3M
- (2) Gate valves only shall be used for Class 10 M
- (3) Remote operated hydraulic choke required on 5,000 psi and 10,000 psi for drilling.


EQUIPMENT SPECIFICATIONS AND INSTALLATION INSTRUCTION

1. All connections in choke manifold shall be welded, studded, flanged or Cameron clamp of comparable rating.
2. All flanges shall be API 6B or 6BX and ring gaskets shall be API RX or BX. Use only BX for 10 MWP.
3. All lines shall be securely anchored.
4. Chokes shall be equipped with tungsten carbide seats and needles, and replacements shall be available.
5. alternate with automatic chokes, a choke manifold pressure gauge shall be located on the rig floor in conjunction with the standpipe pressure gauge.
6. Line from drilling spool to choke manifold should be as straight as possible. Lines downstream from chokes shall make turns by large bends or 90 degree bends using bull plugged tees

Mack Energy Corporation
Minimum Blowout Preventer Requirements
5000 psi Working Pressure
13 5/8 inch- 5 MWP
11 Inch - 5 MWP

Stack Requirements

NO.	Items	Min. I.D.	Min. Nominal
1	Flowline		2"
2	Fill up line		2"
3	Drilling nipple		
4	Annular preventer		
5	Two single or one dual hydraulically operated rams		
6a	Drilling spool with 2" min. kill line and 3" min choke line outlets		2" Choke
6b	2" min. kill line and 3" min. choke line outlets in ram. (Alternate to 6a above)		
7	Valve Gate Plug	3 1/8	
8	Gate valve-power operated	3 1/8	
9	Line to choke manifold		3"
10	Valve Gate Plug	2 1/16	
11	Check valve	2 1/16	
12	Casing head		
13	Valve Gate Plug	1 13/16	
14	Pressure gauge with needle valve		
15	Kill line to rig mud pump manifold		2"

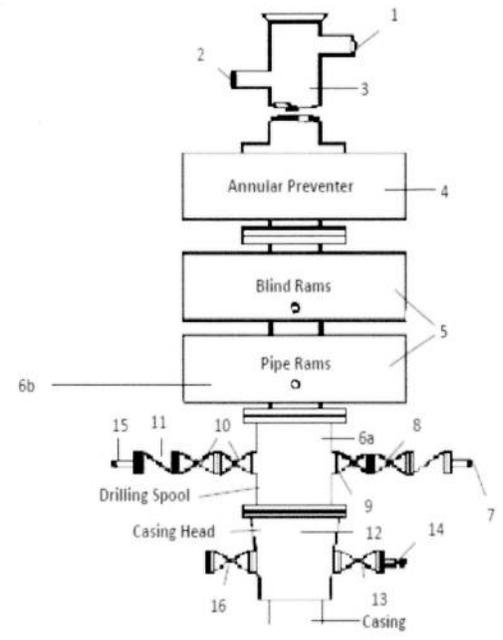

OPTIONAL

16	Flanged Valve	1 13/16	
----	---------------	---------	--

CONTRACTOR'S OPTION TO FURNISH: 10. ME

1. All equipment and connections above bradenhead or casinghead. Working pressure of preventers to be 2000 psi minimum.
2. Automatic accumulator (80 gallons, minimum) capable of closing BOP in 30 seconds or less and, holding them closed against full rated working pressure.
3. BOP controls, to be located near drillers' position.
4. Kelly equipped with Kelly cock.
5. Inside blowout preventer or its equivalent on derrick floor at all times with proper threads to fit pipe being used.
6. Kelly saver-sub equipped with rubber casing protector at all times.
7. Plug type blowout preventer tester.
8. Extra set pipe rams to fit drill pipe in use on location at all times.
9. Type RX ring gaskets in place of Type R.

MEC TO FURNISH:

1. Bradenhead or casing head and side valves.
2. Wear bushing. If required.

GENERAL NOTES:

1. Deviations from this drawing may be made only with the express permission of MEC's Drilling Manager.
2. All connections, valves, fittings, piping, etc., subject to well or pump pressure must be flanged (suitable clamp connections acceptable) and have minimum working pressure equal to rated working pressure of preventers up through choke valves must be full opening and suitable for high pressure mud service.
3. Controls to be of standard design and each marked, showing opening and closing position
4. Chokes will be positioned so as not to hamper or delay changing of choke beans.

5. Replaceable parts for adjustable choke, or bean sizes, retainers, and choke wrenches to be conveniently located for immediate use.
6. All valves to be equipped with hand-wheels or handles ready for immediate use.
7. Choke lines must be suitably anchored.
8. Handwheels and extensions to be connected and ready for use.
9. Valves adjacent to drilling spool to be kept open. Use outside valves except for emergency.
10. All seamless steel control piping (2000 psi working pressure) to have flexible joints to avoid stress. Hoses will be permitted.
11. Casinghead connections shall not be used except in case of emergency.
12. Does not use kill line for routine fill up operations.

District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720
District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720
District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 390627

CONDITIONS

Operator: MACK ENERGY CORP P.O. Box 960 Artesia, NM 882110960	OGRID:	13837
	Action Number:	390627
	Action Type:	[C-101] BLM - Federal/Indian Land Lease (Form 3160-3)

CONDITIONS

Created By	Condition	Condition Date
ward.rikala	Notify the OCD 24 hours prior to casing & cement.	11/6/2024
ward.rikala	File As Drilled C-102 and a directional Survey with C-104 completion packet.	11/6/2024
ward.rikala	Once the well is spud, to prevent ground water contamination through whole or partial conduits from the surface, the operator shall drill without interruption through the fresh water zone or zones and shall immediately set in cement the water protection string.	11/6/2024
ward.rikala	Cement is required to circulate on both surface and intermediate1 strings of casing.	11/6/2024
ward.rikala	If cement does not circulate on any string, a Cement Bond Log (CBL) is required for that string of casing.	11/6/2024
ward.rikala	Oil base muds are not to be used until fresh water zones are cased and cemented providing isolation from the oil or diesel. This includes synthetic oils. Oil based mud, drilling fluids and solids must be contained in a steel closed loop system.	11/6/2024