# REC'D NMOCD 10/20/2020

Submit 1 Copy To Appropriate District Office	State of New Me	REMANDERED UIT	20/2020	Form C-103
District I - (575) 393-6161	Energy, Minerals and Nati	ıral Resources	WELL API NO.	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	OIL CONCEDUATION DIVISION		30-015-25433	
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178	OIL CONSERVATION DIVISION 1220 South St. Francis Dr.		5. Indicate Type of Lo	
1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe, NM 87505		STATE	FEE 🛛
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Salita PC, INIVI 8	7303	6. State Oil & Gas Le	ase No.
87505	TIGES AND DEPONDS ON THE LA	v.		
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A			7. Lease Name or Un	t Agreement Name
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			Belco State	
1. Type of Well: Oil Well Gas Well Other SWD			8. Well Number	
2. Name of Operator			#2 SWD	
Basic Energy Services			9. OGRID Number 246368	
3. Address of Operator			10. Pool name or Wildcat	
P.O. Box 10460 Midland TX 79702			Delaware	
4. Well Location				
The second secon	310feet from theNorth	line and198		Westline
Section 20 Township 23S Range 28E NMPM County Eddy				
	11. Elevation (Show whether DR 3057)	P) (A) (B) (B)		
3037 GR				
12. Check	Appropriate Box to Indicate N	ature of Notice 1	Report or Other Dat	a
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data				
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐ REMEDIAL WORK ☐ ALTERING CASING ☐				
TEMPORARIUM IS AND IS A				
PULL OR ALTER CASING  MULTIPLE COMPL  CASING/CEMENT JOB				
DOWNHOLE COMMINGLE				
CLOSED-LOOP SYSTEM  OTHER:		071155		
	pleted operations (Clearly state all	OTHER:	give pertinent dates in	cluding actimated data
<ol> <li>Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of</li> </ol>				
menaged association of the control o			tify OCD 24 hrs. prior to any work	
		dor	ne	
1. MIRU. ND W	VH, NU BOP. POOH Prod Equip			
2. RIH WL – Set CIBP @ 2,440'				
3. RIH Tbg – Tag BP. Circ hole w/ MLF. Pressure test casing. Cap BP w/ 35sx cmt to 2,139'. WOC-Tag  4. Spot 25sx cmt @ 1,570' 1,450'. WOC-Tag (Spot cmt 1620' 1500')				
4. Spot 25sx cmt @ 1,570' 1,450'. WOC-Tag (Spot cmt 1620' - 1500')  5. Spot 25sx cmt @ 525' 405'. WOC-Tag (Perf @ 525' and attempt to sqz)				
6. Perf/Circ 30sx cmt (#\frac{60^{-3}}{60^{-3}}. Perf @ 100' and circ cmt to surface				
7. POOH. Top off well. RDMO. Clean location, install P&A marker.				
Smud Data	5: 5: 5	67		
Spud Date:	Rig Release Da	ite:		
****SEE ATTACHED CO	A's****	MUST BE PLU	GGED BY 10/20/2	2021
I hereby certify that the information				
	3	ar ar my mio meage	und bener.	
SIGNATURE	ζ		20 MO20 M	
SIGNATURE	TITLE	Agent	DATE10	/19/20
Type or print nameGreg Brya	nt E-mail address:		PHONE: 4	32-563-3355
For State Use Only				
APPROVED BY:	TITLE	Staff Manag	er DATE	10/23/2020
Conditions of Approval (if any):	IIILE	Soul Francisco	er date_	. 5, 25, 2525


## BASIC ENERGY SERVICES LP

## BELCO ST. # 2

## API # 3001525433

## 2310' FNL & 1980' FWL Unit F, Sec 20, T 23S, R 28E Eddy County

#### WELL BORE DIAGRAM

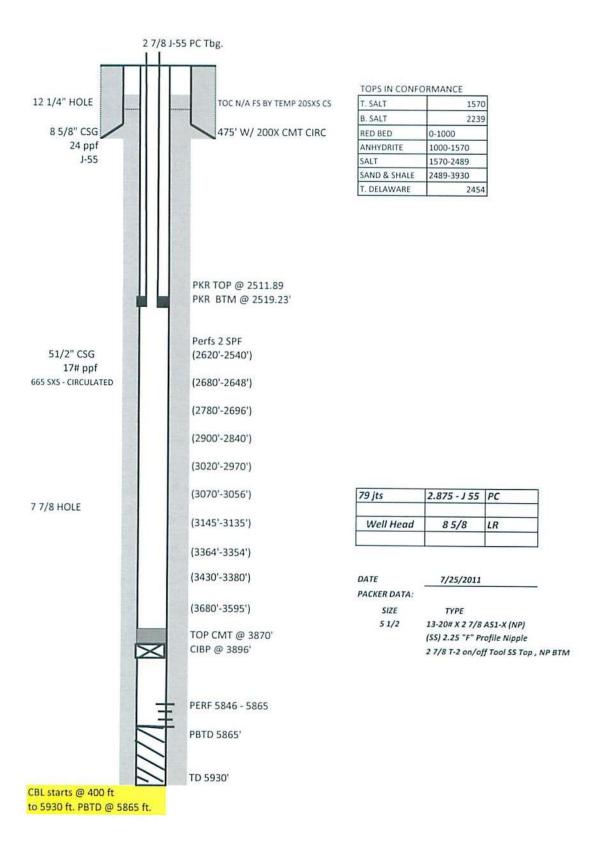


## **BASIC ENERGY SERVICES LP**

## BELCO ST. # 2

# API # 3001525433 2310' FNL & 1980' FWL Unit F, Sec 20, T 23S, R 28E Eddy County

#### WELL BORE DIAGRAM

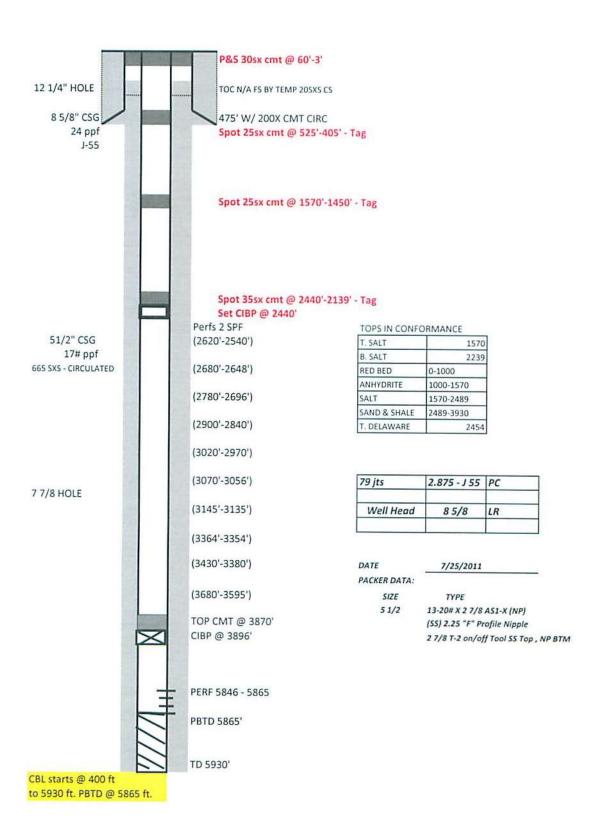

#### CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
  - A) Fusselman
  - B) Devonian
  - C) Morrow
  - D) Wolfcamp
  - E)Bone Springs
  - F) Delaware
  - G) Any salt sections
  - H) Abo
  - I) Glorieta
  - J) Yates.
  - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

#### **DRY HOLE MARKER REQUIRMENTS**

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)