

Submit 1 Copy To Appropriate District Office
 District I - (575) 393-6161
 1625 N. French Dr., Hobbs, NM 88240
 District II - (575) 748-1283
 811 S. First St., Artesia, NM 88210
 District III - (505) 334-6178
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV - (505) 476-3460
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-05099
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator HUNTINGTON ENERGY, LLC		6. State Oil & Gas Lease No.
3. Address of Operator 908 N.W. 71 st ST., OKLAHOMA CITY, OK 73116		7. Lease Name or Unit Agreement Name STATE
4. Well Location Unit Letter <u>K</u> : <u>1983</u> feet from the <u>S</u> line and <u>1954</u> feet from the <u>W</u> line Section <u>36</u> Township <u>13S</u> Range <u>37E</u> NMPM County <u>LEA</u>		8. Well Number <u>1</u>
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3838' GR		9. OGRID Number <u>208706</u>
		10. Pool name or Wildcat KING, WOLFCAMP

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL. <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

MI-R&EQUIP - ND TREE - NU BOP - RU FLOOR & TONGS
 RIH CIBP & SET AT 9212' - RIH TBG - COND. HOLE WITH 9.5# WBM
 SPOT 25 SX CL H FROM 9212' - 9002'
 SPOT 25 SX CL C FROM 7000' - 6750' WOC & TAG
 CUT 5.5" CSG AT 4960'
 SPOT 35 SX CL C FROM 4960' - 4860' WOC & TAG
 SPOT 35 SX CL C FROM 4705' - 4605' WOC & TAG
 SPOT 35 SX CL C FROM 2500' - 2400' WOC & TAG
 SPOT 35 SX CL C FROM 433' - 333' WOC & TAG
 SPOT 70 SX CL C FROM 200' - SURFACE, TOP OFF WELL, CUT & CAP

See Attached
 Conditions of Approval

Verify cement to surface all strings Install 4" diameter 4' tall above ground marker

Spud Date: Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Agent For DATE 11/10/20
 Type or print name KEVIN PERANTON E-mail address: KPERANTON@AAAANWELLSERVICE.US PHONE: 832-585-5285
For State Use Only
 APPROVED BY: [Signature] TITLE Compliance Officer A DATE 11/17/20
 Conditions of Approval (if any)

CURRENT

State #1

Completion

Sec 36-T13S-R37E

Lea County, New Mexico

1983 FSL 1954 FWL

API 30-025-05099
Today's Date Jan 16, 2014
Spud Dec 3, 2013
Completed

KB NA
GL 3838'

Rods
4.315' 3/4" Noms 97
4.587' 5/8" Noms 97
300' 1" Sinker bars
2-1/2" x 1-1/2" x 20' pump

305' gap Called NMOCD 12/19/13
OK w/ Paul Kautz w/ NMOCD

San Andres 4594'
Wolfcamp 9360'

Liner hanger @ 9212'

50 sack plug @ 9613-9663

13-3/8" set at 383'
Cemented w/400 sacks to surface

9-5/8" 40# set at 4655'
Cemented w/1500 sacks to surface

TOC 5 1/2" @ 4960'

5-1/2" 17# P-110 set @ 9,340'
Cement with 550 sacks 50/50 POZ lead and
Tail in with 425 sacks Super H

9,382'-9,416' 4 SPF 96 holes

3-1/2" 8.38 P-110 from 9212.44 - 9610'
120 ss Cls H, 15 # ppg, 1 18 yds. Dropped plug
Displ 49 bbl KCL wtr. Bump plug. Set plr. Circ 5
bbl cml to pit. Test liner top to 1000 psi


LANDING COLLAR @ 9577' (PBTD)

PBTD 9,663'
TD 10,250'

PROPOSED

State #1
Completion
Sec 36-T13S-R37E
Lea County, New Mexico
1963 FSL 1954 FWL

APT 30-025-05099
Today's Date: Jan 16, 2014
Spud Dec 3, 2013
Completed:

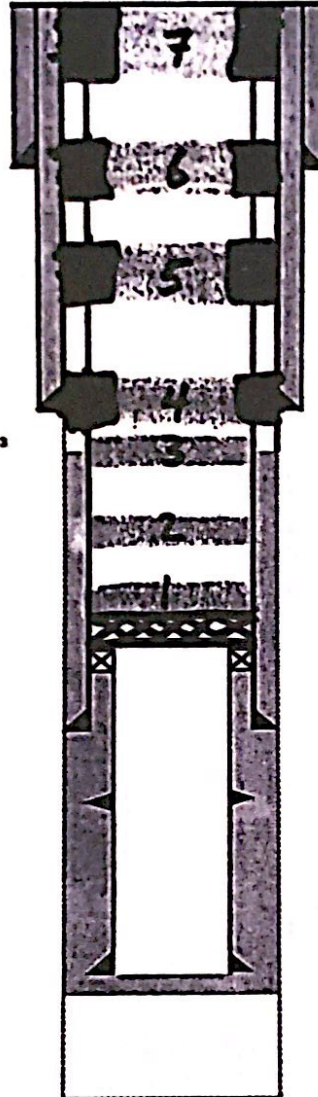

KB NA
GL 3838'

12-3/4" out at 383'
Cemented w/400 sacks to surface

Rods
4,213 3/4" Mono 97
4,887 5/8" Mono 97
305' 1" Sinker bars
2-1/2" x 1-1/2" x 20' pump

305' gap Called NMOC 12/18/13
OK w/ Paul Kautz w/NMOC

San Andres: 4894'
Wolfcamp: 6380'

9-5/8" 408 out at 4855'
Cemented w/1500 sacks to surface

TDC: 5 1/2" @ 4980'

Linear hanger @ 5212'

60 sack plug @ 9813-9863

PBTD 9,663'
TD 10,250'

CIBP SET @ 9212'
1. 9212'-9002' 25H
2. 7000'-6750' 25C
3. 4960'-4860' 35C
4. 4705'-4605' 35C
5. 2500'-2400' 35C
6. 433'-333' 35C
7. 100'-3' 35C
* = WOC + TAB

**CONDITIONS OF APPROVAL
FOR PLUGGING AND ABANDONMENT
OCD - Southern District**

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify **NMOCD District Office I (Hobbs) at (575)-263-6633** at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
3. Trucking companies being used to haul oilfield waste fluids to a disposal - commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
8. Produced water will not be used during any part of the plugging operation.
9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
11. Class 'C' cement will be used above 7500 feet.
12. Class 'H' cement will be used below 7500 feet.
13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) **Fusselman**
 - B) **Devonian**
 - C) **Morrow**
 - D) **Wolfcamp**
 - E) **Bone Springs**
 - F) **Delaware**
 - G) **Any salt sections**
 - H) **Abo**
 - I) **Glorieta**
 - J) **Yates.**
 - K) **Potash---(In the R-111-P Area (Potash Mine Area),**

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be SO' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, woe and tagged. These plugs will be set SO' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least 1/4" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name
2. Lease and Well Number
3. API Number
4. Unit letter
5. Quarter Section (feet from the North, South, East or West)
6. Section, Township and Range
7. Plugging Date
8. County

SPECIAL CASES -----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION