UNITED STATES

OCD Hobbs

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

Lease Serial No. NMNM2379

(June 2015) DE	UNITED STATES PARTMENT OF THE INT	TERIOR		-c nd	OMB NO	1004-0137 1004-0137 1004-0137	•	
	JREAU OF LAND MANAGE		HOB	Ba	5. Lease Serial No.	nuary 31, 20	10	
UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals. Comparison of the Name of the N								
abandoned wel	II. Use form 3160-3 (APD)	for such pi	oposals. MA		6. If Indian, Affortee of	Inde Name	;	
SUBMIT IN TRIPLICATE - Other instructions on page 2								
1. Type of Well Gas Well Other					8. Well Name and No. COVINGTON A FEDERAL 14			
Name of Operator Contact: DAVID STEWART OXY USA WTP LP E-Mail: david_stewart@oxy.com					9. API Well No. 30-025-33399			
3a. Address P.O. BOX 50250 MIDLAND, TX 79710 3b. Phone No. (include area code) Ph: 432-685-5717					10. Field and Pool or Exploratory Area RED TANK DELAWARE, WEST			
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State			
Sec 25 T22S R32E SWNE 1650FNL 1650FEL 32.365482 N Lat, 103.625191 W Lon					LEA COUNTY, NM			
12. CHECK THE AF	PPROPRIATE BOX(ES) T	O INDICAT	E NATURE OI	F NOTICE,	REPORT, OR OTH	ER DATA	A	
TYPE OF SUBMISSION TYPE OF ACTION								
▶ Notice of Intent		☐ Deep	☐ Deepen		☐ Production (Start/Resume)		☐ Water Shut-Off	
	☐ Alter Casing 1	☐ Hydr	aulic Fracturing	☐ Reclama	ation	☐ Well Integrity		
		_	Construction		lete	☐ Other		
☐ Final Abandonment Notice ☐ Change Plans		Plug and Abando		☐ Temporarily Abandon				
	Convert to Injection	Plug		☐ Water D		·		
13. Describe Proposed or Completed Ope If the proposal is to deepen directiona Attach the Bond under which the wor following completion of the involved testing has been completed. Final Ab determined that the site is ready for final	ally or recomplete horizontally, girk will be performed or provide the operations. If the operation results and onment Notices must be filed	ve subsurface l e Bond No. on ts in a multiple	ocations and measur file with BLM/BIA completion or reco	red and true ve . Required sub mpletion in a r	rtical depths of all pertinosequent reports must be new interval, a Form 3160	ent markers : filed within : 0-4 must be 1	and zones. 30 days filed once	
TD-8966' PBTD-8800' Perfs- CIBP-8800'	4950-5020',6228-6366',804	16-8066',852	8-8548'	CET I	ATTAQUED E	. D		
10-3/4" 40.5# csg @ 800' w/ 8 7-5/8" 29.7# csg @ 4670' w/ 1 4-1/2" 11.6# csg @ 8966' DVT	SEE ATTACHED FOR -3202' CONDITIONS OF APPROVAL							
1. RIH & tag CIBP @ 8800' Ma 2. M&P 25sx cmt @ 6785-651 3. RIH & set CIBP @ 4900' w/ 4. Perf @ 2760' sqz 40sx cmt 5. Perf @ 850' sqz 185sx cmt	0' WOC-Tag '35sx cmt to 4520' to 2610' WOC-Tag to surface	ı				c		
Below grow		104	hole m	Lær Ka	c regueil	ed		
14. I hereby certify that the foregoing is true and correct. Electronic Submission #441122 verified by the BLM Well Information System								
For OXY USA WTP LP, sent to the Hobbs Committed to AFMSS for processing by DEBORAH MCKINNEY on 10/25/2018 ()								
Name (Printed/Typed) DAVID STEWART			Title SR. REGULATORY ADVISOR					
Signature (Electronic S	_ 		Date 10/25/20					
	THIS SPACE FOR	RFEDERA	L OR STATE (OFFICE U	SE			
Approved By James C. Comos			Title SAGT			Z Date	-22-19	
Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to condu	Office e f	40						
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s	U.S.C. Section 1212, make it a crestatements or representations as to	ime for any per any matter wi	son knowingly and hin its jurisdiction.	willfully to ma	ike to any department or	agency of the	e United	

(Instructions on page 2)

** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED **

X7 NMOCD 3-22-19


Additional data for EC transaction #441122 that would not fit on the form

32. Additional remarks, continued

10# MLF between plugs - Above ground steel tanks will be utilized

OXY USA Inc. - Proposed Covington A Federal #14 API No. 30-025-33399

185sx @ 850'-Surface 14-3/4" hole @ 800' 10-3/4" csg @ 800' w/ 800sx-TOC-Surf-Circ Perf @ 850' 40sx @ 2760-2610' WOC-Tag Perf @ 2760' 9-7/8" hole @ 4670' CIBP @ 4900' w/ 35sx to 4520' WOC-Tag 7-5/8" csg @ 4670" w/ 1150sx-TOC-Surf-Circ Perfs @ 4950-5020' Perfs @ 6228-6366' 25sx @ 6785-6510' - WOC-Tag 6-3/4" hole @ 8966' 4-1/2" csg @ 8966' w/ 1100sx-TOC-3202' DVT @ 6681' Perfs @ 8046-8066' 25sx @ 8800-8525' Perfs @ 8528-8548' CIBP @ 8800' Perfs @ 8836-8855' PB-8919' TD-8966'

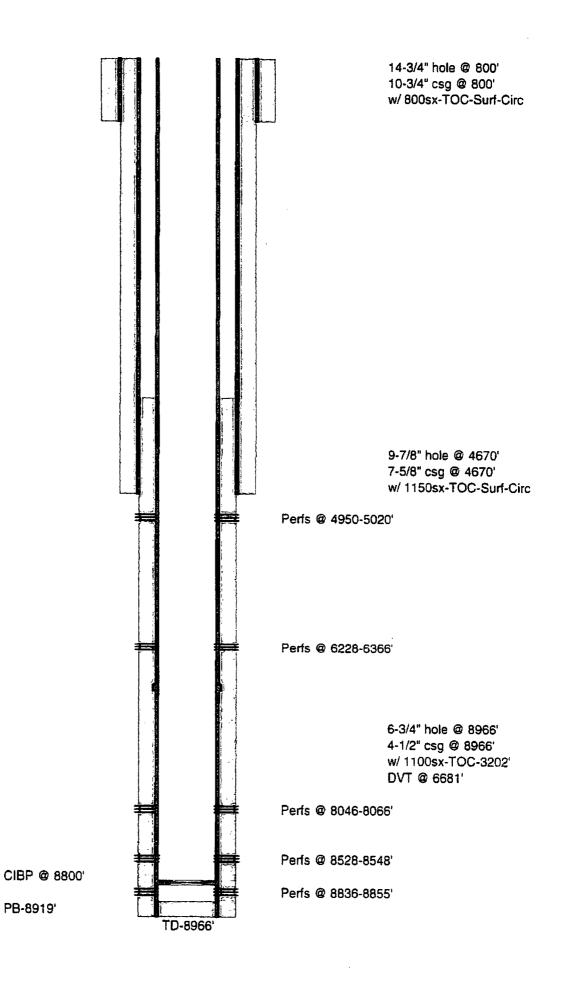

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted