# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB No. 1004-0137 Expires: January 31, 2018

HOBBS Of Chase Serial No.

APPLICATION FOR PERMIT TO D	RILL (	ORI	REENTEREB	<b>1 9</b> 202	6. If Indian, Allotee	or Tribe Name
1b. Type of Well:	EENTER Other ingle Zor		REC  Multiple Zone	EIVE	7. If Unit or CA Agn  8. Lease Name and V  MESA 8105 1-12-F  42H	
2. Name of Operator BTA OIL PRODUCERS LLC (260 297)					9. API-Well No.	46 705
3a. Address 104 S. Pecos Midland TX 79701	3b. Pho (432)6		o. (include area code 753	7	10. Field and Pool, o	
<ol> <li>Location of Well (Report location clearly and in accordance of At surface NWNW / 280 FNL / 990 FWL / LAT 32.0789</li> <li>At proposed prod. zone SESW / 50 FSL / 1650 FWL / LA</li> </ol>	966 / LO	NG -	103.634129		11. Sec., T. R. M. or SEC 1 1265 / R32	Blk. and Survey or Area 2E / NMP
14. Distance in miles and direction from nearest town or post offi 12 miles	fice*				12. County or Parish LEA	13. State NM
15. Distance from proposed* location to nearest property or lease line, ft. (Also to nearest drig. unit line, if any)	16. No	of ac	res in lease	17. Spacin	B. Unit dedicated to the	nis well
18. Distance from proposed location* to nearest well, drilling, completed, applied for, on this lease, ft.  540 feet	1	./	/. / ~	20,/BLM/I FED: NM	BIA Bond No. in file B001711	
21. Elevations (Show whether DF, KDB, RT, GL, etc.) 3336 feet	01/14/2	2020	nate date work will s	start*	23. Estimated duration 30 days	on
The following, completed in accordance with the requirements of (as applicable)	<del></del>			, and the H	ydraulic Fracturing ru	ıle per 43 CFR 3162.3-3
Well plat certified by a registered surveyor.     A Drilling Plan.     A Surface Use Plan (if the location is on National Forest System SUPO must be filed with the appropriate Forest Service Office.)		, the	Item 20 above). 5. Operator certifica 6. Such other site spe	ation.		existing bond on file (see
25. Signature (Electronic Submission)			BLM. (Printed/Typed) y Hajar / Ph: (432)6	682-3753		Date 10/10/2019
Title Regulatory Analyst	•					
Approved by (Signature) (Electronic Submission)			(Printed/Typed) _ayton / Ph: (575)2	34-5959		Date 02/14/2020
Title Assistant Field Manager Lands & Minerals		Office ARLS	SBAD			-
Application approval does not warrant or certify that the applican applicant to conduct operations thereon. Conditions of approval, if any, are attached.	nt holds l	egal o	r equitable title to the	ose rights i	n the subject lease wh	nich would entitle the
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, m of the United States any false, fictitious or fraudulent statements of						ny department or agency
GCP Rec 02/19/2020	<del> </del>				1/4	land

APPROVED WITH CONDITIONS

\*(Instructions on page 2) &

(Continued on page 2)

#### INSTRUCTIONS

GENERAL: This form is designed for submitting proposals to perform certain well operations, as indicated on Federal and Indian lands and leases for action by appropriate Federal agencies, pursuant to applicable Federal laws and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from local Federal offices.

ITEM I: If the proposal is to redrill to the same reservoir at a different subsurface location or to a new reservoir, use this form with appropriate notations. Consult applicable Federal regulations concerning subsequent work proposals or reports on the well.

ITEM 4: Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local Federal offices for specific instructions.

ITEM 14: Needed only when location of well cannot readily be found by road from the land or lease description. A plat, or plats, separate or on the reverse side, showing the roads to, and the surveyed location of, the wen, and any other required information, should be furnished when required by Federal agency offices.

ITEMS 15 AND 18: If well is to be, or has been directionany drilled, give distances for subsurface location of hole in any present or objective productive zone.

ITEM 22: Consult applicable Federal regulations, or appropriate officials, concerning approval of the proposal before operations are started.

ITEM 24: If the proposal will involve hydraulic fracturing operations, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

#### NOTICES

The Privacy Act of 1974 and regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 25 U.S.C. 396; 43 CFR 3160

PRINCIPAL PURPOSES: The information will be used to: (1) process and evaluate your application for a permit to drill a new oil, gas, or service wen or to reenter a plugged and abandoned well; and (2) document, for administrative use, information for the management, disposal and use of National Resource Lands and resources including (a) analyzing your proposal to discover and extract the Federal or Indian resources encountered; (b) reviewing procedures and equipment and the projected impact on the land involved; and (c) evaluating the effects of the proposed operation on the surface and subsurface water and other environmental impacts.

ROUTINE USE: Information from the record and/or the record win be transferred to appropriate Federal, State, and local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecution, in connection with congressional inquiries and for regulatory responsibilities.

EFFECT OF NOV PROVIDING INFORMATION: Filing of this application and disclosure of the information is mandatory only if you elect to initiate a drilling or reentry operation on an oil and gas lease.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM conects this information to anow evaluation of the technical, safety, and environmental factors involved with drilling for oil and/or gas on Federal and Indian oil and gas leases. This information will be used to analyze and approve applications. Response to this request is mandatory only if the operator elects to initiate drilling or reentry operations on an oil and gas lease. The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT: Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Conection Clearance Officer (WO-630), 1849 C Street, N.W., Mail Stop 401 LS, Washington, D.C. 20240.

(Form 3160-3, page 2)



# Application for Permit to Drill

U.S. Department of the Interior Bureau of Land Management

# **APD Package Report**

APD ID: 10400049114

APD Received Date: 10/10/2019 02:45 PM

Operator: BTA OIL PRODUCERS LLC

Date Printed: 02/18/2020 07:48 AM

Well Status: AAPD

Well Name: MESA 8105 1-12 FED

Well Number: 42H

#### **APD Package Report Contents**

- Form 3160-3
- Operator Certification Report
- Application Report
- Application Attachments
  - -- Well Plat: 1 file(s)
- Drilling Plan Report
- Drilling Plan Attachments
  - -- Blowout Prevention Choke Diagram Attachment: 25le(\$)
  - -- Blowout Prevention BOP Diagram Attachment: 1 file(s)
  - -- Casing Taperd String Specs: 2 file(s)
  - -- Casing Design Assumptions and Workshee(s): 17 file(s)
  - -- Hydrogen sulfide drilling operations plan: 3 file(s)
  - -- Proposed horizontal/directional/multi-lateral plan submission: 3 file(s)
  - -- Other Variances: 3 file(s)
- SUPO Report
- SUPO Attachments
  - -- Existing Road Map: 1 file(s)
  - -- New Road Map: 1 file(s)
  - -- Attach Well map: 1 file(s)
  - -- Production Facilities map: 1 file(s)
  - -- Water source and transportation map: 1 file(s)
  - -- Well Site Layout Diagram: 3 file(s)
- PWD Report
- PWD Attachments
  - -- None
- Bond Report
- Bond Attachments



-- None

# **Additional Operator Remarks**

#### **Location of Well**

1. SHL: NWNW / 280 FNL / 990 FWL / TWSP: 26S / RANGE: 32E / SECTION: 1 / LAT: 32.078966 / LONG: -103.634129 ( TVD: 0 feet, MD: 0 feet, MD: 0 feet, MD: 0 feet, MD: 9338 feet )

PPP: NENW / 100 FNL / 1650 FWL / TWSP: 26S / RANGE: 32E / SECTION: 1 / LAT: 32.079476 / LONG: -103.6250F4 ( TVD: 9018 feet, MD: 9338 feet )

BHL: SESW / 50 FSL / 1650 FWL / TWSP: 26S / RANGE: 32E / SECTION: 12 / LAT: 32.050471 / LONG: -103.631675 ( TVD: 9018 feet, MD: 19484 feet )

# **BLM Point of Contact** Name: Title: Phone: Email:

(Form 3160-3, page 3)

# **Review and Appeal Rights**

A person contesting a decision shall request a State Director review. This request must be filed within 20 working days of receipt of the Notice with the appropriate State Director (see 43 CFR 3165.3). The State Director review decision may be appealed to the Interior Board of Land Appeals, 801 North Quincy Street, Suite 300, Arlington, VA 22203 (see 43 CFR 3165.4). Contact the above fisted Bureau of Land Management office for further information.



(Form 3160-3, page 4)

# **Engineer Worksheet**

# Carlsbad Field Office

620 E. Greene St. Carlsbad, NM 88220-6292

Tracking Number:	ATS-20	)-107			_ County:	Lea	
Company:	вта о	il Producers			Well Name and Number:	MESA 8105	1-12 FED-42H
Surface Hole Location:	280'/N.	& 990'/W. SEC001 T026S, R032E			Bottom Hole Location:	50'/S.& 1650' R032E	/W. SEC012 T026S,
Lease Number:	NMNM	114492	Prod Statu	ıs:		Effective:	
Bond:	Individ	ual	Bond #:		NMB001711	Potash:	No
NOS Received:	NO		APD Rece	eived:	10-10-2019	10-Day LTR Sent:	
Acreage:			Orthodox:		Yes	COM Agr Required:	No
Deficiencies Noted	i:					<del> </del>	
Form 3160-	_	Survey Plat Drilling Plan	Surface Plan	n Bonding	Original Signature	Operator (	Cert Statement
Other Deficiencies	: 🔲						
Adjudication Comments:							
GEO Report	11-19-20	019					
Completed			-				
			Toobai	cal Checklist			
Plat:	Okay		Elevation:			·	
Proposed Depth:	TVD:	9018	MD:	19484	<del></del>	Targeted	Avalon Shale
Anticipated Water	-Oil, Gas	Fresh Water: 804ft; Oil/Gas: Delaware, Bell	- Canyon, Ch	erry Canyon, Brush	y Canyon, Bone Spring and U	_ Formation:  [pper Avalon Share]	ale.
Etc.: Casing/Cement Pro	ogram:	Okay / Okay					
Bottom Hole Mud Weight	_		BHP:	4361.1048	MASP: 2377.1448	_	
-		(iii) Horizonta	- al	tional Vertical	Re-entry	_	
Well Control Prog ETC)	(BOP,	2M below surface, 3M below intermediate evariance.	•	•		Ok	
Test-Log-Cores Pr	ogram:	MUD LOG/GEOLOGICAL LITHOLOGY	LOG,GAM	MA RAY LOG,CEN	- MENT BOND LOG,		-
H2S or Other Haza	ards:	No hydrogen sulfide within a mile of location Water Flows: Castile, Salado.				stler, Red Beds	& Delaware; Possible
Water Basin:	Carlsbac						· · · · · ·
Casings to Witness:		<b>✓</b> Suri	face 🗾 In	termediate Pr	roduction CIT Required	I	
		Other Witness					
Comments:	MEDIU	M CAVE/KARST WITNESS SURFACE AN	JD INTERM	EDIATE CASING		_	
Olabode Aj	ihola	2-6-2020					
	10014			G:	APP P 2 P		Adiodicaco F 121 A
Engineer		Date		Siganture	Adjudication Da	te	Adjudicator Initials

# PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

**OPERATOR'S NAME: | BTA OIL PRODUCTION COMPANY** 

**LEASE NO.: | NMNM014492** 

**WELL NAME & NO.:** | MESA 8105 1-12 FED 42H

**SURFACE HOLE FOOTAGE:** 280'/N & 990'/W **BOTTOM HOLE FOOTAGE** 50'/S & 1650'/W

LOCATION: | Section 1, T.26 S., R.32 E., NMP

**COUNTY:** Lea County, New Mexico

COA

H2S	← Yes	€ No	
Potash	• None	○ Secretary	← R-111-P
Cave/Karst Potential	C Low		← High
Cave/Karst Potential	Critical		
Variance	None	Flex Hose	← Other
Wellhead	Conventional	Multibowl	← Both
Other	□ 4 String Area	Capitan Reef	<b>□</b> WIPP
Other	Fluid Filled	☐ Cement Squeeze	☐ Pilot Hole
Special Requirements	■ Water Disposal	「 COM	□ Unit

Break Testing	€ Yes	ℂ No

#### A. HYDROGEN SULFIDE

Hydrogen Sulfide (H2S) monitors shall be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the Hydrogen Sulfide area shall meet Onshore Order 6 requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, provide measured values and formations to the BLM.

#### **B. CASING**

# **Casing Design:**

- 1. The 13-3/8 inch surface casing shall be set at approximately 1100 feet (a minimum of 25 feet (Lea County) into the Rustler Anhydrite and above the salt) and cemented to the surface.
  - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature

Page 1 of 7

- survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
- b. Wait on cement (WOC) time for a primary cement job will be a minimum of <u>8</u> hours or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
- c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
- d. If cement falls back, remedial cementing will be done prior to drilling out that string.

# Intermediate casing must be kept fluid filled to meet BLM minimum collapse requirement.

- 2. The 9-5/8 inch intermediate casing shall be set at approximately 4717 feet. The minimum required fill of cement behind the 9-5/8 inch intermediate casing is:
  - Cement to surface. If cement does not circulate see B.1.a, c-d above.
     Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.
  - ❖ In Medium Cave/Karst Areas if cement does not circulate to surface on the first two casing strings, the cement on the 3rd casing string must come to surface.
- 3. The minimum required fill of cement behind the 5-1/2 inch production casing is:
  - Cement should tie-back at least **200 feet** into previous casing string. Operator shall provide method of verification.

#### C. PRESSURE CONTROL

- 1. Variance approved to use flex line from BOP to choke manifold.

  Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).'
- 2. Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 3000 (3M) psi.
  - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.

Page 2 of 7

- b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- c. Manufacturer representative shall install the test plug for the initial BOP test.
- d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- e. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.

#### D. SPECIAL REQUIREMENT (S)

#### **BOP Break Testing Variance (Note: For 5M BOP or less)**

- While in transfer between wells, the BOPE shall be secured by the hydraulic carrier or cradle.
- Any well control event while drilling require notification to the BLM Petroleum Engineer prior to the commencement of any BOP Break Testing operations.
- A full BOP test is required prior to drilling the first deep intermediate hole section. If any subsequent hole interval is deeper than the first, a full BOP test will be required.

# **GENERAL REQUIREMENTS**

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)
  - ☑ Eddy CountyCall the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (575) 361-2822
  - Lea County
    Call the Hobbs Field Station, 414 West Taylor, Hobbs NM 88240, (575)
    393-3612
- 1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
  - a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure

rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).

- b. When the operator proposes to set surface casing with Spudder Rig
  - Notify the BLM when moving in and removing the Spudder Rig.
  - Notify the BLM when moving in the 2<sup>nd</sup> Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
  - BOP/BOPE test to be conducted per Onshore Oil and Gas Order No. 2 as soon as 2nd Rig is rigged up on well.
- 2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.
- 3. The record of the drilling rate along with the GR/N well log run from TD to surface (horizontal well vertical portion of hole) shall be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies. The Rustler top and top and bottom of Salt are to be recorded on the Completion Report.

#### A. CASING

- 1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.
- 2. Wait on cement (WOC) for Potash Areas: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends, 2) until cement has been in place at least 24 hours. WOC time will be recorded in the driller's log. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 3. Wait on cement (WOC) for Water Basin: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least 8 hours. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.

Page 4 of 7

- 4. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.
- 5. No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.
- 6. On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.
- 7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.
- 8. Whenever a casing string is cemented in the R-111-P potash area, the NMOCD requirements shall be followed.

#### B. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.
- 3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.
- 4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:
  - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.

Page 5 of 7

- b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- c. Manufacturer representative shall install the test plug for the initial BOP test.
- d. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.
- e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
  - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead when specified), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
  - b. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the plug. However, **no tests** shall commence until the cement has had a minimum of 24 hours setup time, except the casing pressure test can be initiated immediately after bumping the plug (only applies to single stage cement jobs).
  - c. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to Onshore Order 2 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for water basin (8 hours) or potash (24 hours) or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
  - d. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall

Page 6 of 7

have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.

- e. The results of the test shall be reported to the appropriate BLM office.
- f. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- g. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- h. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per Onshore Order No. 2.

#### C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

#### D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

OTA02062020

Page 7 of 7

# PECOS DISTRICT SURFACE USE CONDITIONS OF APPROVAL

OPERATOR'S NAME: BTA Oil Producers LLC
LEASE NO.: NMNM014492
COUNTY: Lea County, NM

#### Wells:

#### Mesa 8105 1-12 Fed 42H

Surface Hole Location: 280' FNL & 990' FWL, Section 1, T. 26 S., R. 32 E. Bottom Hole Location: 50' FSL & 1650' FWL, Section 12, T. 26 S, R 32 E.

#### Mesa 8105 1-12 Fed 43H

Surface Hole Location: 280' FNL & 960' FWL, Section 1, T. 26 S., R. 32 E. Bottom Hole Location: 50' FSL & 350' FWL, Section 12, T. 26 S, R 32 E.

#### **TABLE OF CONTENTS**

Standard Conditions of Approval (COA) apply to this APD. If any deviations to these standards exist or special COAs are required, the section with the deviation or requirement will be checked below.

☐ General Provisions
Permit Expiration
Archaeology, Paleontology, and Historical Sites
■ Noxious Weeds
Watershed
☐ Construction
Notification
Topsoil
Closed Loop System
Federal Mineral Material Pits
Well Pads
Roads
Road Section Diagram
☐ Production (Post Drilling)
Well Structures & Facilities
☐ Interim Reclamation
☐ Final Abandonment & Reclamation

#### I. GENERAL PROVISIONS

The approval of the Application For Permit To Drill (APD) is in compliance with all applicable laws and regulations: 43 Code of Federal Regulations 3160, the lease terms, Onshore Oil and Gas Orders, Notices To Lessees, New Mexico Oil Conservation Division (NMOCD) Rules, National Historical Preservation Act As Amended, and instructions and orders of the Authorized Officer. Any request for a variance shall be submitted to the Authorized Officer on Form 3160-5, Sundry Notices and Report on Wells.

#### II. PERMIT EXPIRATION

If the permit terminates prior to drilling and drilling cannot be commenced within 60 days after expiration, an operator is required to submit Form 3160-5, Sundry Notices and Reports on Wells, requesting surface reclamation requirements for any surface disturbance. However, if the operator will be able to initiate drilling within 60 days after the expiration of the permit, the operator must have set the conductor pipe in order to allow for an extension of 60 days beyond the expiration date of the APD. (Filing of a Sundry Notice is required for this 60 day extension.)

# III. ARCHAEOLOGICAL, PALEONTOLOGY & HISTORICAL SITES

Any cultural resource (historic or prehistoric site or object) discovered by the holder, or any person working on the holder's behalf, on public or Federal land shall be immediately reported to the Authorized Officer. The holder shall suspend all operations in the immediate area of such discovery until written authorization to proceed is issued by the Authorized Officer. An evaluation of the discovery will be made by the Authorized Officer to determine appropriate actions to prevent the loss of significant cultural or scientific values. The holder will be responsible for the cost of evaluation and any decision as to the proper mitigation measures will be made by the Authorized Officer after consulting with the holder.

OR

If the entire project is covered under the Permian Basin Programmatic Agreement (cultural resources only):

The proponent has contributed funds commensurate to the undertaking into an account for offsite mitigation. Participation in the PA serves as mitigation for the effects of this project on cultural resources. If any human skeletal remains, funerary objects, sacred objects, or objects of cultural patrimony are discovered at any time during construction, all construction activities shall halt and the BLM will be notified as soon as possible within 24 hours. Work shall not resume until a

Page 2 of 13

Notice to Proceed is issued by the BLM. See information below discussing NAGPRA.

If the proposed project is split between a Class III inventory and a Permian Basin Programmatic Agreement contribution, the portion of the project covered under Class III inventory should default to the first paragraph stipulations.

The holder is hereby obligated to comply with procedures established in the Native American Graves Protection and Repatriation Act (NAGPRA) to protect such cultural items as human remains, associated funerary objects, sacred objects, and objects of cultural patrimony discovered inadvertently during the course of project implementation. In the event that any of the cultural items listed above are discovered during the course of project work, the proponent shall immediately halt the disturbance and contact the BLM within 24 hours for instructions. The proponent or initiator of any project shall be held responsible for protecting, evaluating, reporting, excavating, treating, and disposing of these cultural items according to the procedures established by the BLM in consultation with Indian Tribes."

Any paleontological resource (historic or prehistoric site or object) discovered by the holder, or any person working on the holder's behalf, on public or Federal land shall be immediately reported to the Authorized Officer. The holder shall suspend all operations in the immediate area of such discovery until written authorization to proceed is issued by the Authorized Officer. An evaluation of the discovery will be made by the Authorized Officer to determine appropriate actions to prevent the loss of significant cultural or scientific values. The holder will be responsible for the cost of evaluation and any decision as to the proper mitigation measures will be made by the Authorized Officer after consulting with the holder.

#### IV. NOXIOUS WEEDS

The operator shall be held responsible if noxious weeds become established within the areas of operations. Weed control shall be required on the disturbed land where noxious weeds exist, which includes the roads, pads, associated pipeline corridor, and adjacent land affected by the establishment of weeds due to this action. The operator shall consult with the Authorized Officer for acceptable weed control methods, which include following EPA and BLM requirements and policies.

Page 3 of 13

# V. SPECIAL REQUIREMENT(S)

#### Watershed:

The entire well pad(s) will be bermed to prevent oil, salt, and other chemical contaminants from leaving the well pad. The compacted berm shall be constructed at a minimum of 12 inches with impermeable mineral material (e.g. caliche). Topsoil shall not be used to construct the berm. No water flow from the uphill side(s) of the pad shall be allowed to enter the well pad. The integrity of the berm shall be maintained around the surfaced pad throughout the life of the well and around the downsized pad after interim reclamation has been completed. Any water erosion that may occur due to the construction of the well pad during the life of the well will be quickly corrected and proper measures will be taken to prevent future erosion. Stockpiling of topsoil is required. The top soil shall be stockpiled in an appropriate location to prevent loss of soil due to water or wind erosion and not used for berming or erosion control. If fluid collects within the bermed area, the fluid must be vacuumed into a safe container and disposed of properly at a state approved facility.

#### VI. CONSTRUCTION

#### A. NOTIFICATION

The BLM shall administer compliance and monitor construction of the access road and well pad. Notify the Carlsbad Field Office at (575) 234-5909 at least 3 working days prior to commencing construction of the access road and/or well pad.

When construction operations are being conducted on this well, the operator shall have the approved APD and Conditions of Approval (COA) on the well site and they shall be made available upon request by the Authorized Officer.

#### B. TOPSOIL

The operator shall strip the top portion of the soil (root zone) from the entire well pad area and stockpile the topsoil along the edge of the well pad as depicted in the APD. The root zone is typically six (6) inches in depth. All the stockpiled topsoil will be redistributed over the interim reclamation areas. Topsoil shall not be used for berming the pad or facilities. For final reclamation, the topsoil shall be spread over the entire pad area for seeding preparation.

Other subsoil (below six inches) stockpiles must be completely segregated from the topsoil stockpile. Large rocks or subsoil clods (not evident in the surrounding terrain) must be buried within the approved area for interim and final reclamation.

#### C. CLOSED LOOP SYSTEM

Page 4 of 13

Tanks are required for drilling operations: No Pits.

The operator shall properly dispose of drilling contents at an authorized disposal site.

#### D. FEDERAL MINERAL MATERIALS PIT

Payment shall be made to the BLM prior to removal of any federal mineral materials. Call the Carlsbad Field Office at (575) 234-5972.

#### E. WELL PAD SURFACING

Surfacing of the well pad is not required.

If the operator elects to surface the well pad, the surfacing material may be required to be removed at the time of reclamation. The well pad shall be constructed in a manner which creates the smallest possible surface disturbance, consistent with safety and operational needs.

# F. EXCLOSURE FENCING (CELLARS & PITS)

#### **Exclosure Fencing**

The operator will install and maintain exclosure fencing for all open well cellars to prevent access to public, livestock, and large forms of wildlife before and after drilling operations until the pit is free of fluids and the operator initiates backfilling. (For examples of exclosure fencing design, refer to BLM's Oil and Gas Gold Book, Exclosure Fence Illustrations, Figure 1, Page 18.)

#### G. ON LEASE ACCESS ROADS

#### **Road Width**

The access road shall have a driving surface that creates the smallest possible surface disturbance and does not exceed fourteen (14) feet in width. The maximum width of surface disturbance, when constructing the access road, shall not exceed twenty-five (25) feet.

#### Surfacing

Surfacing material is not required on the new access road driving surface. If the operator elects to surface the new access road or pad, the surfacing material may be required to be removed at the time of reclamation.

Where possible, no improvements should be made on the unsurfaced access road other than to remove vegetation as necessary, road irregularities, safety issues, or to fill low areas that may sustain standing water.

The Authorized Officer reserves the right to require surfacing of any portion of the access road at any time deemed necessary. Surfacing may be required in the event the road deteriorates, erodes, road traffic increases, or it is determined to be beneficial for future field development. The surfacing depth and type of material will be determined at the time of notification.

#### Crowning

Crowning shall be done on the access road driving surface. The road crown shall have a grade of approximately 2% (i.e., a 1" crown on a 14' wide road). The road shall conform to Figure 1; cross section and plans for typical road construction.

#### **Ditching**

Ditching shall be required on both sides of the road.

#### **Turnouts**


Vehicle turnouts shall be constructed on the road. Turnouts shall be intervisible with interval spacing distance less than 1000 feet. Turnouts shall conform to Figure 1; cross section and plans for typical road construction.

#### **Drainage**

Drainage control systems shall be constructed on the entire length of road (e.g. ditches, sidehill outsloping and insloping, lead-off ditches, culvert installation, and low water crossings).

A typical lead-off ditch has a minimum depth of 1 foot below and a berm of 6 inches above natural ground level. The berm shall be on the down-slope side of the lead-off ditch.

#### Cross Section of a Typical Lead-off Ditch

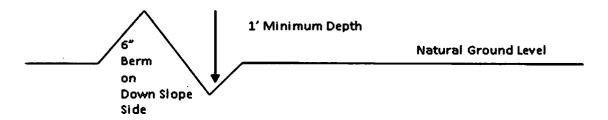

All lead-off ditches shall be graded to drain water with a 1 percent minimum to 3 percent maximum ditch slope. The spacing interval are variable for lead-off ditches and shall be determined according to the formula for spacing intervals of lead-off ditches, but may be amended depending upon existing soil types and centerline road slope (in %);

Page 6 of 13

#### Formula for Spacing Interval of Lead-off Ditches

Example - On a 4% road slope that is 400 feet long, the water flow shall drain water into a lead-off ditch. Spacing interval shall be determined by the following formula:

400 foot road with 4% road slope:  $\frac{400'}{4\%}$  + 100' = 200' lead-off ditch interval

#### Cattle guards

An appropriately sized cattle guard sufficient to carry out the project shall be installed and maintained at fence/road crossings. Any existing cattle guards on the access road route shall be repaired or replaced if they are damaged or have deteriorated beyond practical use. The operator shall be responsible for the condition of the existing cattle guards that are in place and are utilized during lease operations.

#### **Fence Requirement**

Where entry is granted across a fence line, the fence shall be braced and tied off on both sides of the passageway prior to cutting. The operator shall notify the private surface landowner or the grazing allotment holder prior to crossing any fences.

#### **Public Access**

Public access on this road shall not be restricted by the operator without specific written approval granted by the Authorized Officer.

Page 7 of 13

## **Construction Steps**

- 1. Salvage topsoil
- 3. Redistribute topsoil
- 2. Construct road 4. Revegetate slopes

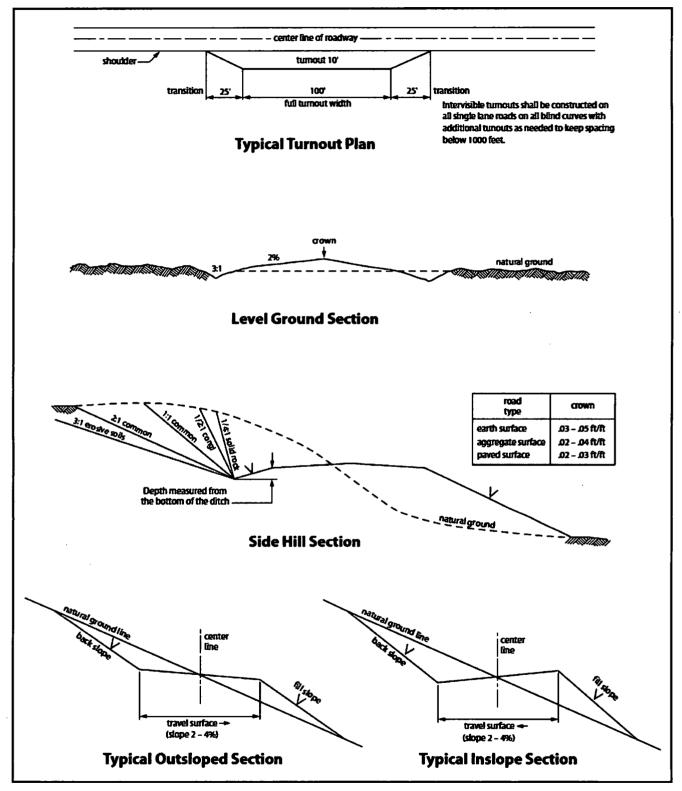


Figure 1. Cross-sections and plans for typical road sections representative of BLM resource or FS local and higher-class roads.

# VII. PRODUCTION (POST DRILLING)

#### A. WELL STRUCTURES & FACILITIES

#### **Placement of Production Facilities**

Production facilities should be placed on the well pad to allow for maximum interim recontouring and revegetation of the well location.

#### **Exclosure Netting (Open-top Tanks)**

Immediately following active drilling or completion operations, the operator will take actions necessary to prevent wildlife and livestock access, including avian wildlife, to all open-topped tanks that contain or have the potential to contain salinity sufficient to cause harm to wildlife or livestock, hydrocarbons, or Resource Conservation and Recovery Act of 1976-exempt hazardous substances. At a minimum, the operator will net, screen, or cover open-topped tanks to exclude wildlife and livestock and prevent mortality. If the operator uses netting, the operator will cover and secure the open portion of the tank to prevent wildlife entry. The operator will net, screen, or cover the tanks until the operator removes the tanks from the location or the tanks no longer contain substances that could be harmful to wildlife or livestock. Use a maximum netting mesh size of 1½ inches. The netting must not be in contact with fluids and must not have holes or gaps.

# Chemical and Fuel Secondary Containment and Exclosure Screening

The operator will prevent all hazardous, poisonous, flammable, and toxic substances from coming into contact with soil and water. At a minimum, the operator will install and maintain an impervious secondary containment system for any tank or barrel containing hazardous, poisonous, flammable, or toxic substances sufficient to contain the contents of the tank or barrel and any drips, leaks, and anticipated precipitation. The operator will dispose of fluids within the containment system that do not meet applicable state or U. S. Environmental Protection Agency livestock water standards in accordance with state law; the operator must not drain the fluids to the soil or ground. The operator will design, construct, and maintain all secondary containment systems to prevent wildlife and livestock exposure to harmful substances. At a minimum, the operator will install effective wildlife and livestock exclosure systems such as fencing, netting, expanded metal mesh, lids, and grate covers. Use a maximum netting mesh size of 1 ½ inches.

## **Open-Vent Exhaust Stack Exclosures**

The operator will construct, modify, equip, and maintain all open-vent exhaust stacks on production equipment to prevent birds and bats from entering, and to discourage perching, roosting, and nesting. (Recommended exclosure structures on open-vent exhaust stacks are in the shape of a cone.) Production

Page 9 of 13

equipment includes, but may not be limited to, tanks, heater-treaters, separators, dehydrators, flare stacks, in-line units, and compressor mufflers.

#### **Containment Structures**

Proposed production facilities such as storage tanks and other vessels will have a secondary containment structure that is constructed to hold the capacity of 1.5 times the largest tank, plus freeboard to account for precipitation, unless more stringent protective requirements are deemed necessary.

#### **Painting Requirement**

All above-ground structures including meter housing that are not subject to safety requirements shall be painted a flat non-reflective paint color, **Shale Green** from the BLM Standard Environmental Color Chart (CC-001: June 2008).

#### VIII. INTERIM RECLAMATION

During the life of the development, all disturbed areas not needed for active support of production operations should undergo interim reclamation in order to minimize the environmental impacts of development on other resources and uses.

Within six (6) months of well completion, operators should work with BLM surface management specialists (Jim Amos: 575-234-5909) to devise the best strategies to reduce the size of the location. Interim reclamation should allow for remedial well operations, as well as safe and efficient removal of oil and gas.

During reclamation, the removal of caliche is important to increasing the success of revegetating the site. Removed caliche that is free of contaminants may be used for road repairs, fire walls or for building other roads and locations. In order to operate the well or complete workover operations, it may be necessary to drive, park and operate on restored interim vegetation within the previously disturbed area. Disturbing revegetated areas for production or workover operations will be allowed. If there is significant disturbance and loss of vegetation, the area will need to be revegetated. Communicate with the appropriate BLM office for any exceptions/exemptions if needed.

All disturbed areas after they have been satisfactorily prepared need to be reseeded with the seed mixture provided below.

Upon completion of interim reclamation, the operator shall submit a Sundry Notices and Reports on Wells, Subsequent Report of Reclamation (Form 3160-5).

Page 10 of 13

#### IX. FINAL ABANDONMENT & RECLAMATION

At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land are restored.

Earthwork for final reclamation must be completed within six (6) months of well plugging. All pads, pits, facility locations and roads must be reclaimed to a satisfactory revegetated, safe, and stable condition, unless an agreement is made with the landowner or BLM to keep the road and/or pad intact.

After all disturbed areas have been satisfactorily prepared, these areas need to be revegetated with the seed mixture provided below. Seeding should be accomplished by drilling on the contour whenever practical or by other approved methods. Seeding may need to be repeated until revegetation is successful, as determined by the BLM.

Operators shall contact a BLM surface protection specialist prior to surface abandonment operations for site specific objectives (Jim Amos: 575-234-5909).

Ground-level Abandoned Well Marker to avoid raptor perching: Upon the plugging and subsequent abandonment of the well, the well marker will be installed at ground level on a plate containing the pertinent information for the plugged well.

# Seed Mixture 2, for Sandy Sites

The holder shall seed all disturbed areas with the seed mixture listed below. The seed mixture shall be planted in the amounts specified in pounds of pure live seed (PLS)\* per acre. There shall be no primary or secondary noxious weeds in the seed mixture. Seed will be tested and the viability testing of seed will be done in accordance with State law (s) and within nine (9) months prior to purchase. Commercial seed will be either certified or registered seed. The seed container will be tagged in accordance with State law(s) and available for inspection by the authorized officer.

Seed will be planted using a drill equipped with a depth regulator to ensure proper depth of planting where drilling is possible. The seed mixture will be evenly and uniformly planted over the disturbed area (smaller/heavier seeds have a tendency to drop the bottom of the drill and are planted first). The holder shall take appropriate measures to ensure this does not occur. Where drilling is not possible, seed will be broadcast and the area shall be raked or chained to cover the seed. When broadcasting the seed, the pounds per acre are to be doubled. The seeding will be repeated until a satisfactory stand is established as determined by the authorized officer. Evaluation of growth will not be made before completion of at least one full growing season after seeding.

Species to be planted in pounds of pure live seed\* per acre:

Species	lb/acre
Sand dropseed (Sporobolus cryptandrus)	1.0
Sand love grass (Eragrostis trichodes)	1.0
Plains bristlegrass (Setaria macrostachya)	2.0

<sup>\*</sup>Pounds of pure live seed:

Pounds of seed x percent purity x percent germination = pounds pure live seed

## **Seed Mixture 3, for Shallow Sites**

The holder shall seed all disturbed areas with the seed mixture listed below. The seed mixture shall be planted in the amounts specified in pounds of pure live seed (PLS)\* per acre. There shall be <u>no</u> primary or secondary noxious weeds in the seed mixture. Seed will be tested and the viability testing of seed will be done in accordance with State law(s) and within nine (9) months prior to purchase. Commercial seed will be either certified or registered seed. The seed container will be tagged in accordance with State law(s) and available for inspection by the authorized officer.

Seed will be planted using a drill equipped with a depth regulator to ensure proper depth of planting where drilling is possible. The seed mixture will be evenly and uniformly planted over the disturbed area (smaller/heavier seeds have a tendency to drop the bottom of the drill and are planted first). The holder shall take appropriate measures to ensure this does not occur. Where drilling is not possible, seed will be broadcast and the area shall be raked or chained to cover the seed. When broadcasting the seed, the pounds per acre are to be doubled. The seeding will be repeated until a satisfactory stand is established as determined by the authorized officer. Evaluation of growth will not be made before completion of at least one full growing season after seeding.


Species to be planted in pounds of pure live seed\* per acre:

Species	<u>lb/acre</u>
Plains Bristlegrass (Setaria macrostachya)	1.0
Green Sprangletop (Leptochloa dubia)	2.0
Sideoats Grama (Bouteloua curtipendula)	5.0

<sup>\*</sup>Pounds of pure live seed:

Pounds of seed x percent purity x percent germination = pounds pure live seed

# U.S. Department of the Interior BUREAU OF LAND MANAGEMENT



# **Operator Certification**

I hereby certify that I, or someone under my direct supervision, have inspected the drill site and access route proposed herein; that I am familiar with the conditions which currently exist; that I have full knowledge of state and Federal laws applicable to this operation; that the statements made in this APD package are, to the best of my knowledge, true and correct; and that the work associated with the operations proposed herein will be performed in conformity with this APD package and the terms and conditions under which it is approved. I also certify that I, or the company I represent, am responsible for the operations conducted under this application. These statements are subject to the provisions of 18 U.S.C. 1001 for the filing of false statements.

NAME: Sammy Hajar Signed on: 10/10/2019

Title: Regulatory Analyst

Street Address: 104 S. Pecos

City: Midland State: TX Zip: 79701

Phone: (432)682-3753

Email address: shajar@btaoil.com

#### Field Representative

Representative Name:

Street Address: 104 S. Pecos

City: Midland State: TX Zip: 79701

Phone: (432)682-3753

Email address: shajar@btaoil.com

#### U.S. Department of the Interior BUREAU OF LAND MANAGEMENT



**APD ID:** 10400049114

Submission Date: 10/10/2019

**Operator Name: BTA OIL PRODUCERS LLC** 

Well Name: MESA 8105 1-12 FED

Well Number: 42H

**Show Final Text** 

Well Type: OIL WELL

Well Work Type: Drill

#### Section 1 - General

APD ID:

10400049114

Tie to previous NOS?

Submission Date: 10/10/2019

**BLM Office: CARLSBAD** 

**User:** Sammy Hajar

Title: Regulatory Analyst

Federal/Indian APD: FED

Is the first lease penetrated for production Federal or Indian? FED

Lease number: NMNM014492

Lease Acres: 1960

Surface access agreement in place?

Allotted?

Reservation:

Agreement in place? NO

Federal or Indian agreement:

Agreement number:

Agreement name:

Keep application confidential? Y

**Permitting Agent? NO** 

APD Operator: BTA OIL PRODUCERS LLC

Operator letter of designation:

#### Operator Info

**Operator Organization Name: BTA OIL PRODUCERS LLC** 

**Operator Address: 104 S. Pecos** 

**Zip:** 79701

**Operator PO Box:** 

**Operator City: Midland** 

State: TX

**Operator Phone:** (432)682-3753

**Operator Internet Address:** 

#### **Section 2 - Well Information**

Well in Master Development Plan? NO

Master Development Plan name:

Well in Master SUPO? NO

Master SUPO name:

Well in Master Drilling Plan? NO

Master Drilling Plan name:

Well Name: MESA 8105 1-12 FED

Well Number: 42H

Well API Number:

Field/Pool or Exploratory? Field and Pool

Field Name: PURPLE SAGE

**Pool Name: WOLFCAMP** 

Is the proposed well in an area containing other mineral resources? NONE

Operator maine. DIA OIL FINODOCENS LEG

Well Name: MESA 8105 1-12 FED

Well Number: 42H

Is the proposed well in an area containing other mineral resources? NONE

Is the proposed well in a Helium production area? N Use Existing Well Pad? N

New surface disturbance?

Type of Well Pad: MULTIPLE WELL

Multiple Well Pad Name: MESA Number: 42H and 43H

8105

Number of Legs: 1

Well Work Type: Drill

Well Class: HORIZONTAL

Well Type: OIL WELL

**Describe Well Type:** 

Well sub-Type: INFILL

Describe sub-type:

Distance to nearest well: 540 FT **Distance to town: 12 Miles** 

Distance to lease line: 280 FT

Reservoir well spacing assigned acres Measurement: 320 Acres

Well plat:

Mesa\_8105\_42H\_C102\_20191010133058.pdf

Well work start Date: 01/14/2020

**Duration: 30 DAYS** 

#### **Section 3 - Well Location Table**

Survey Type: RECTANGULAR

**Describe Survey Type:** 

Datum: NAD83

Vertical Datum: NGVD29

Survey number:

**Reference Datum: GROUND LEVEL** 

Wellbore	NS-Foot	NS Indicator	EW-Foot	EW Indicator	Twsp	Range	Section	Aliquot/Lot/Tract	Latitude	Longitude	County	State	Meridian	Lease Type	Lease Number	Elevation	MD	ΟVI	Will this well produce from this lease?
SHL Leg #1	280	FNL	990	FW L	26S	32E	1	Aliquot NWN W	32.07896 6	- 103.6341 29		NEW MEXI CO	NEW MEXI CO			333 6	0	0	N
KOP Leg #1	100	FNL	165 0	FW L	26S	32E	l *	Aliquot NENW	32.07947 6	- 103.6230 11	LEA	NEW MEXI CO	NEW MEXI CO		NMNM 014492	- 520 4	858 8	854 0	Υ
PPP Leg #1-1	100	FNL	165 0	FW L	26S	32E		Aliquot NENW	32.07947 6	- 103.6230 11	LEA	NEW MEXI CO	NEW MEXI CO		NMNM 014492	- 568 2	933 8	901 8	Y

#### U.S. Department of the Interior **BUREAU OF LAND MANAGEMENT**

02/18/2020

APD ID: 10400049114

Submission Date: 10/10/2019

**Operator Name: BTA OIL PRODUCERS LLC** 

Well Name: MESA 8105 1-12 FED

Well Number: 42H

Show Final Text

Well Type: OIL WELL

Well Work Type: Drill

# **Section 1 - Geologic Formations**

Formation Name	Flevation		l I	Lithologies	Mineral Resources	Producing
QUATERNARY	3336	0	0	ALLUVIUM	NONE	N
RUSTLER	2579	757	757	ANHYDRITE	NONE	N
TOP SALT	2210	1126	1126	SALT	NONE	N
BASE OF SALT	-873	4209	4209	SALT	NONE	N
DELAWARE	-1382	4718	4718	LIMESTONE	NATURAL GAS, OIL	N
BELL CANYON	-1413	4749	4749	SANDSTONE	NONE	N
CHERRY CANYON	-2678	6014	6014	SANDSTONE	NATURAL GAS, OIL	N
BRUSHY CANYON	-4043	7379	7379	SANDSTONE	NATURAL GAS, OIL	N
BONE SPRING	-5630	8966	8966	LIMESTONE, SANDSTONE	CO2, NATURAL GAS, OIL	N
UPPER AVALON SHALE	-5682	9018	9018	SHALE	NATURAL GAS, OIL	Y
	RUSTLER  TOP SALT  BASE OF SALT  DELAWARE  BELL CANYON  CHERRY CANYON  BRUSHY CANYON  BONE SPRING	QUATERNARY         3336           RUSTLER         2579           TOP SALT         2210           BASE OF SALT         -873           DELAWARE         -1382           BELL CANYON         -1413           CHERRY CANYON         -2678           BRUSHY CANYON         -4043           BONE SPRING         -5630	Formation Name         Elevation         Depth           QUATERNARY         3336         0           RUSTLER         2579         757           TOP SALT         2210         1126           BASE OF SALT         -873         4209           DELAWARE         -1382         4718           BELL CANYON         -1413         4749           CHERRY CANYON         -2678         6014           BRUSHY CANYON         -4043         7379           BONE SPRING         -5630         8966	QUATERNARY       3336       0       0         RUSTLER       2579       757       757         TOP SALT       2210       1126       1126         BASE OF SALT       -873       4209       4209         DELAWARE       -1382       4718       4718         BELL CANYON       -1413       4749       4749         CHERRY CANYON       -2678       6014       6014         BRUSHY CANYON       -4043       7379       7379         BONE SPRING       -5630       8966       8966	Formation Name         Elevation         Depth         Depth         Lithologies           QUATERNARY         3336         0         0         ALLUVIUM           RUSTLER         2579         757         757         ANHYDRITE           TOP SALT         2210         1126         1126         SALT           BASE OF SALT         -873         4209         4209         SALT           DELAWARE         -1382         4718         4718         LIMESTONE           BELL CANYON         -1413         4749         4749         SANDSTONE           CHERRY CANYON         -2678         6014         6014         SANDSTONE           BRUSHY CANYON         -4043         7379         7379         SANDSTONE           BONE SPRING         -5630         8966         8966         LIMESTONE, SANDSTONE	Formation Name         Elevation         Depth         Depth         Lithologies         Mineral Resources           QUATERNARY         3336         0         0         ALLUVIUM         NONE           RUSTLER         2579         757         757         ANHYDRITE         NONE           TOP SALT         2210         1126         1126         SALT         NONE           BASE OF SALT         -873         4209         4209         SALT         NONE           DELAWARE         -1382         4718         4718         LIMESTONE         NATURAL GAS, OIL           BELL CANYON         -1413         4749         4749         SANDSTONE         NATURAL GAS, OIL           CHERRY CANYON         -2678         6014         6014         SANDSTONE         NATURAL GAS, OIL           BRUSHY CANYON         -4043         7379         7379         SANDSTONE         NATURAL GAS, OIL           BONE SPRING         -5630         8966         8966         LIMESTONE, SANDSTONE         CO2, NATURAL GAS, OIL

# **Section 2 - Blowout Prevention**

Pressure Rating (PSI): 5M

Rating Depth: 11000

Equipment: The blowout preventer equipment (BOP) shown in Exhibit A will consist of a (5M system) double ram type (5,000 psi WP) preventer and a bag-type (Hydril) preventer (5000 psi WP). Both units will be hydraulically operated and the ram type preventer will be equipped with blind rams on top and 5" drill pipe rams on bottom. The BOPs will be installed on the 13-3/8" surface casing and utilized continuously until total depth is reached. A 2" kill line and 3" choke line will be incorporated in the drilling spool below the ram-type BOP. A remote kill line will be used for the 5M system as per onshore order #2. Other accessory BOP equipment will include a Kelly cock, floor safety valve, choke lines, and choke manifold having a 5,000 psi WP rating. The 5M annular will be tested as per BLM drilling Operations Order No. 2.

Requesting Variance? NO

#### Variance request:

Testing Procedure: Pipe rams will be operated and checked each 24-hour period and each time the drill pipe is out of the hole. These functional tests will be documented on the daily drillers log. All BOPs and associated equipment will be tested as per BLM drilling Operations Order No. 2.

1	erator na ell Name: I						(S LL	C		,	Well I	Numb	er: 42	Н								
	5M <sub>.</sub> Diagram	ke_l _cho Atta	Hose_ ke_ma	Tes	ld_20	1907	72308	32749. <sub> </sub>	pdf	907230	)8274	2.pdf									_	
		Se	ctior	13-	Cas	sing	J															
Casing ID	String Type	Hole Size	Csg Size	Condition	Standard	Tapered String	Top Set MD	Bottom Set MD	Top Set TVD	Bottom Set TVD	Top Set MSL	Bottom Set MSL	Calculated casing length MD	Grade	Weight	Joint Type	Collapse SF	Burst SF	Joint SF Type	Joint SF	Body SF Type	Body SF
	SURFACE		13.375	1		N	0		0	1100	3336	2236	1100			ST&C	2.4	5.8	DRY		DRY	14.2
2	INTERMED IATE	12.2 5	9.625	NEW	API	N	0	4731	0	4717	3018	-1381	4731	J-55	40	LT&C	2	1.7	DRY	2.7	DRY	3.3
3	PRODUCTI ON	8.75	5.5	NEW	API	N	0	19484	0	9018	3018	-5682	19484	P- 110	17	витт	1.7	2.4	DRY	1.7	DRY	1.6
Cas	casing III Inspection	n Do	ocume	nt:	Stri	ng T	ype:	SURFA	ACE												_	
	Tapered S	Strin	g Spe	c:																		
	Casing D	_	n <b>Assı</b> 2H_ca:	_						5242.JI	PG											

**Operator Name: BIA OIL PRODUCERS LLC** 

Well Name: MESA 8105 1-12 FED

Well Number: 42H

#### **Casing Attachments**

Casing ID: 2

**String Type:**INTERMEDIATE

**Inspection Document:** 

**Spec Document:** 

**Tapered String Spec:** 

vaca\_draw\_5.5\_tapered\_string\_spec\_20190723093759.JPG

Casing Design Assumptions and Worksheet(s):

Mesa\_42H\_casing\_assumption\_20191010135325.JPG

Casing ID: 3

String Type: PRODUCTION

**Inspection Document:** 

**Spec Document:** 

**Tapered String Spec:** 

Casing Design Assumptions and Worksheet(s):

Mesa\_42H\_casing\_assumption\_20191010135355.JPG

# **Section 4 - Cement**

String Type	Lead/Tail	Stage Tool Depth	Top MD	Bottom MD	Quantity(sx)	Yield	Density	Cu Ft	Excess%	Cement type	Additives
SURFACE	Lead		0	905	730	1.73	13.5	1262. 9	100	Class C	2% CaCl2
SURFACE	Tail		905	1100	200	1.35	14.8	270	100	Class C	2% CaCl2
INTERMEDIATE	Lead		0	4175	1230	2.46	12.8	3025. 8	100	Class C	0.5% CaCl2
INTERMEDIATE	Tail		4175	4731	200	1.34	14.8	268	25	Class C	1% CaCl2
PRODUCTION	Lead		3731	9910	605	3.9	10.5	2359. 5	60	25% Poz 75% Class C	0.4% Fluid Loss

**Operator Name:** BTA OIL PRODUCERS LLC

Well Name: MESA 8105 1-12 FED

Well Number: 42H

	String Type	Lead/Tail	Stage Tool Depth	Top MD	Bottom MD	Quantity(sx)	Yield	Density	Cu Ft	Excess%	Cement type	Additives
PRO	DUCTION	Tail		9910	1948 4	2420	1.25	14.4	3025	25	Class H	0.2% LT Retarder

# **Section 5 - Circulating Medium**

Mud System Type: Closed

Will an air or gas system be Used? NO

Description of the equipment for the circulating system in accordance with Onshore Order #2:

Diagram of the equipment for the circulating system in accordance with Onshore Order #2:

Describe what will be on location to control well or mitigate other conditions: Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept on location at all times.

Describe the mud monitoring system utilized: PVT/Pason/Visual Monitoring

# **Circulating Medium Table**

Top Depth	Bottom Depth	Mud Type	Min Weight (Ibs/gal)	Max Weight (lbs/gal)	Density (lbs/cu ft)	Gel Strength (lbs/100 sqft)	ЬН	Viscosity (CP)	Salinity (ppm)	Filtration (cc)	Additional Characteristics
0	1100	OTHER : FW SPUD	8.3	8.4							
1100	4717	OTHER : BRINE	9.8	10							
4717	9018	OTHER : CUT BRINE	8.7	9.3							

**Operator Name: BIA OIL PRODUCERS LLC** 

Well Name: MESA 8105 1-12 FED

Well Number: 42H

# Section 6 - Test, Logging, Coring

List of production tests including testing procedures, equipment and safety measures:

Drill Stem Tests will be based on geological sample shows.

List of open and cased hole logs run in the well:

MUD LOG/GEOLOGICAL LITHOLOGY LOG, GAMMA RAY LOG, CEMENT BOND LOG,

Coring operation description for the well:

None planned

#### Section 7 - Pressure

**Anticipated Bottom Hole Pressure: 4408** 

**Anticipated Surface Pressure: 2424** 

**Anticipated Bottom Hole Temperature(F): 152** 

Anticipated abnormal pressures, temperatures, or potential geologic hazards? NO

**Describe:** 

**Contingency Plans geoharzards description:** 

Contingency Plans geohazards attachment:

Hydrogen Sulfide drilling operations plan required? YES

Hydrogen sulfide drilling operations plan:

BTA\_Oil\_Producers\_LLC\_\_\_EMERGENCY\_CALL\_LIST\_20190723161502.pdf H2S\_Equipment\_Schematic\_20190723161502.pdf H2S\_Plan\_20190723161502.pdf

#### **Section 8 - Other Information**

#### Proposed horizontal/directional/multi-lateral plan submission:

Mesa\_42H\_Wall\_plot\_20191010135808.pdf

Mesa\_42H\_directional\_plan\_20191010135808.pdf

Mesa\_8105\_42H\_Gas\_Capture\_Plan\_20191010135818.pdf

Other proposed operations facets description:


Other proposed operations facets attachment:

#### Other Variance attachment:

Casing\_Head\_Running\_Procedure\_20190723163249.pdf

Multi\_Bowl\_Diagram\_for\_Mesa\_8105\_1\_12\_Fed\_40H\_46H\_20200131081719.pdf

BOP\_Break\_Testing\_Variance\_20200131081920.pdf





Contifech

**CONTITECH RUBBER** Industrial Kft.

No:QC-DB- 599/ 2014

Page:

16 / 176

ONTITION ORDER N°: 539225 HOSE TYPE: 3" ID Cholte & Kill Hose  OSE SERIAL N°: NOMINAL / ACTUAL LENGTH: 7,62 m / 7,66 m  V.P. 68,9 MPa 10000 psi T.P. 103,4 MPa 15000 psi Duration: 60 min.  Prossure test with water at minimal temperature  "See attachment. (1 page)  "See attachment. (1 page)								
1			CATE	CERT.	Nº:	1592		
PURCHASER:	ContiTech C	Oil & Marine C	orp.	P.O. N°		45004617	753	
CONTITECH ORDER N°:	539225	HOSE TYPE:	3" ID	- <del>L</del>	Choke	& Kill Hose		
HOSE SERIAL N°:		NOMINAL / AC	TUAL LENGI	H:	7,62 m	/ 7,68 m		
W.P. 68,9 MPa 1	10000 psi	T.P. 103,4	MPa 15	000 psi	Duration:	60	min.	
> 10 Min		'See attach	ment. ( 1 p	page )				
	-	Serial	N°	Qua	ality	Heat	N <sub>c</sub>	
3" coupling with	,	2574	5533	AISI	1130	A1582N	H8672	
4 1/16" 10K API Swivel F	lange end			AISI	4130	5885	5	
Hub				AISI 4	4130	A1199N /	A1423N	
Not Designed For V	Vell Testinç	3				API Spec 1	6 C	
Fire Rated					Tem	perature r	ate:"B"	
All metal parts are flawless								
			ED IN ACCOR	DANCE WITH	THE TERM	S OF THE ORD	ER	
conditions and specifications of	of the above Purch	the reproperate	a! these items/	equipment we	re fabricated	l inspected and t	ested in	
Date:	Inspector	Committee of the Commit	Quality Con	luoj Marana	1	A PARTY NAME OF THE PARTY NAME	7 17 : Andrews 12.	
04. September 2014.			18 Jem	្តីក្រព័ត	arl, Kubbi strint Kti, Control De	. 1	174	

ATTACHMENT OF QUALITY CONTROL INSPECTION AND TEST CERTIFICATE No: 1588, 1590, 1592

Page: 1/1

10min/ch

11-

File Name File Mossage Device Type Serail No. Data Count


Print Group Print Range \* Commen!

. 000220\_68543.68545+547.GEV.....000236\_68543,68545+547.GEV 68543.68545.88547 : GX10

: S5P606399 : 9946

Press-Temp . 2014/09/04 01:53:54.000 - 2014/09/04 04:39:39.000


	Cursor A	Cursor B	ರಿಷೇರ್ಯ:
Data No	3432.	7032	3600
Absolute Time	2014/09/04 02:51:06.000	2014/05/04 03:51:06.000	01.00/XU.000
Tog Comment	Value A i	Value B	V-€ cute∨
?recsure[brn]	1082,93	:048.57	-14,39
Ambient Temperatura[*C]	23.24	23.14	-0.10

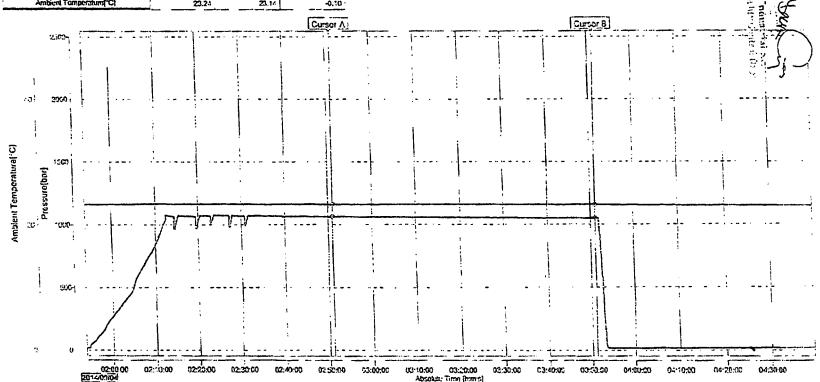

1.

Sampling Int. Start Time Stop Time

. 1,000 sec : 2014/09/04 01:53:54,000 : 2014/09/04 04:39:39,000

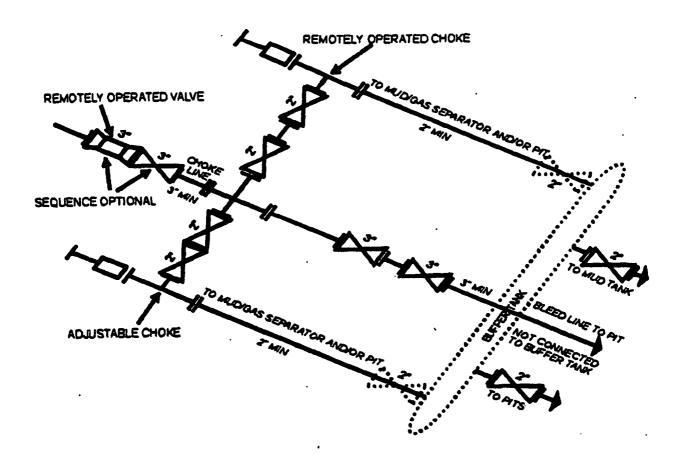


## 5M CHOKE MANIFOLD EQUIPMENT - CONFIGURATION OF CHOKES MAY VARY

Although not required for any of the choke manifold systems, buffer tanks are sometimes installed downstream of the choke essemblies for the purpose of manifolding the bleed lines together. When buffer tanks are employed, valves shall be installed upstream to isolate a failure or malfunction without interrupting flow control. Though not shown on 2M, 3M, 10M, OR 15M drawings, it would also be applicable to those situations.


[54 FR 39528, Sept. 27, 1989]

# 13-5/8" 5,000 PSI BOP

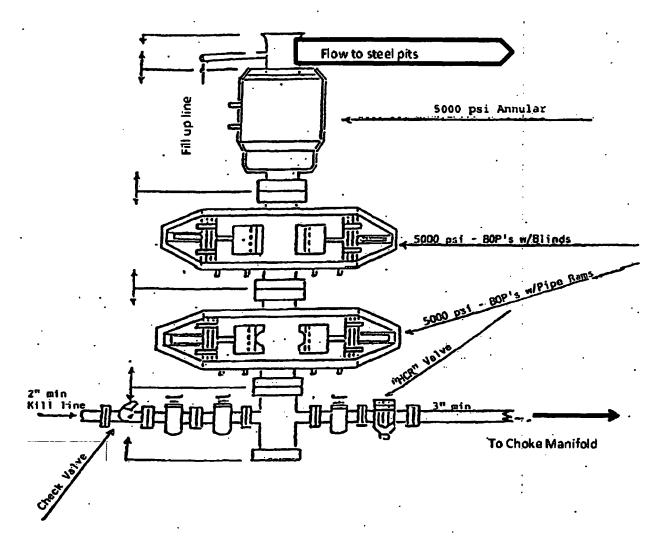

T	1	Wì,		Thread	& Cpig	Extre	me Line			·, .	J,	12	temal Yle	Pressure	OF C	ASING	3		
1		Per Ft	Inside		D.D. of	Drift	000	Collese Resis	-	-	<b>■</b> i	Pfain	7		T	Body	<u> </u>	Jaint S	Ծ <b>ցույլի</b> • 1
1	Grade	With Cola_	Dia In.	Drift Dia	Colo	Din.	Eox	tance	-	••		End or	Kon	d Thread	But-	Yold	Three	ded & Cpt	. Jom:
1		Lb.	l ""	to,	In In	In	In	P\$I			•	Ext.	Short	Long	Tha	Stgth.	Rour	d Thread	But-
t	C-75°	20 30	4.184	t=		4 059	5 094	11,240		44				20.79	1/10	Los	Short	Long	iress
	C-75°	23.20	4 044	<b> -</b> -	-	3 919	5 094‡	12,970			ž	10,710	-	_			369†		The
	HCL-80+	15 00	4 408	4 283	<b> </b> –	<b> </b>	<b>i</b>	9.360		2	F - ≽4,	8.290	=		-	[ -	389t	=	1 -
	HCL-80+	19.00	4.275	4.151	-		<b> </b> –	11,880		~	_	10,140	=	8,290 10,140	8,290	-		311	405
	HCL-80+ HCN-80+	23 20 15 00	4 404	3 919 4 283			=	15 820 9.380	1			13.380	_	10.910	9.910 9.910	422	l –	396	492
	HCN-80+	18 00	4 276	4 151	<u> </u> _	に	! _	11,680		*	ľ	8,290		8,290	8.290	543	- 1	540	515
	HCN-80+	23 20	4 044	3 919	_	_	<del>-</del>	15 820				10,140	-	10,140	9.910	350 422	-	311	408
	L-80	15 00	4.408	4.283	I —	[-		7,250		7	1	13,380	~	10 810	9.910	543	_	396	492
	L-80	24 10	4 000	3 875	-	<b>i</b> —		14,400		*		8,290 14,000	-	8,290	8,290	350	_	540	537
	L-80	18 00	4 276	4.151	-	-	1 –	10.500	ĺ			10,140	-	10.810	9,910	566	_	295 538	379
	L-80	21 40	4 126	4 001	-		-	12,760				12,240		10,140	9,910	422	_	377	510 457
	L-80	23 20	4 044	3 9 1 9	- 550	4 151	5 360	13 B30 7,250			_ =	13.380	]	10,810 10,810	9,910	501	_	466	510
	N-80 N-80	15.00	4 408	4 283	5.563 5.563	4.151	5 360	10,490			- 4	8,290	_ [	8,290	9,910 8 290	543	_	513	510
	N-80	20 30	4 184	4 '5'	5.503	4 059	5 250	11,990	170°	*	_	10,140	]	10,140	9,910	350	-	311	388
	N-8C	23.20	4 044	<u> </u>	_	3 919	5 0941	13.830	ł			11.420	~		****	422	200-	396	477
	N-80	21 40	4 126	4 001	_	_	_ ```	12 760				13,380	~ [				1865	284††	363‡
ì	N-80	24 10	4 000	3 875	<b> </b>	<u> </u>	<b>-</b>	14,400				12,240	-	10,810	9,910	501	3881	284 11	363‡
	C-90	15.60	4 408	4 233	i —	⊢	l –	7,840			<b>\$</b> 6.	9.320		10,810	8 910	566	[	490 558	537
	C-90	18,00	4,276	4.151	-	<del> </del>		11,530		#		11,400	= 1	9.320	9.320	394	_ [	317	\$37 404
	C-90	21 40	4.128	4.001	-	-	[-	14,360 15,560				13,770			1,150	475	- 1	396	484
	C-90   C-90	23,20 24 10	4 044	3 919	1=		1 =	16.200				15,060			1,150	564	[	490	537
	C-95	15 00	4 40B	4.263	5 563	4 151	5 360	8 090	_	1	-	15.750			1,150	611 636	- 1	540	537
	C.95	18 00	4 276	4 151	5 563	4.151	5.360	12,010			34	9840	- 1	9,840	9,840	416	- 1	567	537
	C-95	20 30	4 184		<b>–</b>	4 059	5.250	14,250	_	'E		12.040 13.580			1,770	501	=	326	424
	C-95	23 20	4,044	1	<b>-</b>	3 9 1 9	5 094					15,890	= 1	-1	- [	_	1	416	512
	C-95	21 40	4 126	4 001	<b> </b> -	<b>-</b>	<b> </b> –	15.160				14 530		. ا مو		1	- 1	<i>- 1</i>	_
	C-95	24 10	4 000	3 875	-	-	-	17.100 9,380	_			16,630			1.770	595	- 1	515	563
	S-95+ S-95+	15 00	4 408 4 278	4.151	!=	Ľ	<b> </b>	12.030				9,840			1.770 1.840	672	- 1	595	563
	S-95+ S-95+	23.20	4044	3.919	=		1=	15,430			144	12.040			770	418 501	- [	342	441
	T-95	15 00	4 408	4 283	1-	_	_	8 110	Ī	<b>'EST</b>		15.890	_ [12		.770	645	~	436	532
	T-95	18 00	4 276	4.151	J	<u> </u> _	<b>I</b> —	12 030				9,840		,840	840	416		594	590
ı	T-95	21.40	4 126	4 001	l —	<del> </del>		15.160				12.040 14.530		.040 11	770	501	= 1	326	424
	T-95	23 20	4 044	3.919	<b> </b>	<del> -</del>	<b>!</b> —	15 430		_		15.893			.770	595	= 1	418 515	512
	T-95	24 10	4 000	3 875	<b> -</b>	<b>!</b>	-	17,100			24	16.630			770	645	=	567	563 563
h	P-110	15.00	4 408	4.283	5 563	4.151	5.780	8,830	· -		- 1	11 400			770 400	672	~ [	595	563

-	ne Line	Extren	6 Cplg.	Thread		yyı .		
Col'pse Resis- tance PSI	O D. of Box In	Đrifi Dia. In	O D. of Colg. (n.	Doft Dar. In	inskie Dia In.	Per Fl. With Colg Lb	Grado	Size O D In.
17,430		1	_	4 251	4 376	29 70	T-95	57 <u>.</u>
19,140	1	-	-	4 125	4,250	32.50	T-95	
20,760			-	4,001	4 126	35 30	1-95	
22,380		-	-	3,975	4,000	38 00	7.95	
23,920	- 1	-		3 751	3 676	40 50	T-95	!
25,400	-			3,625	3,750	43 10	T-95	
8.580		-	i — i	4 767	4 892	17 00	HCP-1104	
7,460	5 860	4.653	6 050	4.767	4 892	17 00	P-110	
14.520	5 860			_			:	
17,390	5.6561	4 545 4 423	8.050	4 545	4 670	23 00	P-110	
8.580	3,6301	4 423	-	~	4 548	26 00	P-110°	
7.890	_	_	-	4 767	4.892	17,00	HCC-125+	
12.080	_	_		4 767 4 653	4 892 4 778	17.00	Q-125+	
16,070	_			4 545	4 670	20 00	Q-125+	
19,770	[-			4 423	4.548	23 00 26 00	Q-125	
8.580			_	4 787	4.892	17.80	0-125+ LS-140+	
12.950		_	_	4.653	4.092 4.77B	20.00	LS-140+	
17.500				4.545	4.670	23.00	LS-140+	
13,460		<u> </u>	_	4.653	4 778	20 00	V-150	
13.48D	l	_	6 050	4 653	4.778	20 00	V-150	
18,390	[_	_	6 050	4 545	4 670	23 00	V-150'	
23,720	l		6 050	4.423	4.548	25 00	V-150	

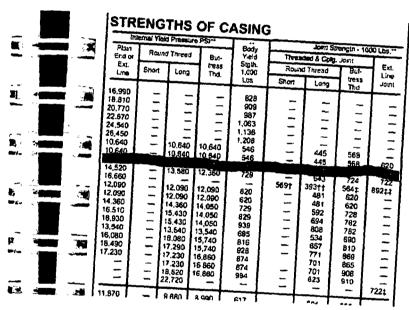

BTA Oil Producers, LLC 104 S Pecos Midland, TX 79701

WELL: Harroun Ranch 20702 20-17 #6H

TVD: 10768 MD: 21151 MD:

### Casing Program

Hole Size	Cog.Size	From (MD)	To (MD)	From (TVD)	To (TVD)	Tapered String	Weight (lbs)	Grade	Conn.	Collapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
14 3/4	10 3/4	0	1050	0	1050	No	40.5	J <del>-</del> 55	STC	3.5	8.9	14.8	9.9	Dr <b>y</b>	8.3
9 7/8	7 5/8	0	10260	0	10232	No	29.7	P110	Buttress	1.9	1.9	3.1	3.2	Dry	9.4
6 3/4	5 1/2	0	10060	0	10032	Yes	20	P110	Buttress	1.5	1.7	3.2	3.3	Dry	13
6 3/4	5	10080	21151	10032	10768	Yes	18	P110	Buttress	1.7	1.7	1.5	1.8	Dry	13

■7 5/8° has DV Tool @

BTA Oil Producers, LLC 104 S Pecos Midland, TX 79701

WELL: Harroun Ranch 20702 20-17 #6H

**TVD**: 10768

MD: 21151

### DRILLING PLAN

### Casing Program

Casing Pro	ogram										· · · -				
Hole Size	Cag.Size	From (MD)	То (МД)	From (TVD)	To (TVD)	Tapered String	Weight (lbs)	Grade	Conn.	Collapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
14 3/4	10 3/4	0	1050	0	1050	No	40.5	J-55	STC	3.5	8.9	14.8	9.9	Dry	8.3
9 7/8	7 5/8	0	10280	0	10232	No	29.7	P110	Buttress	1.9	1.9	3.1	3.2	Dry	9.4
6 3/4	5 1/2	0	10080	o	10032	Yes	20	P110	Buttress	1.5	1.7	3.2	3.3	Dry	13
6 3/4	5	10060	21151	10032	10768	Yes	18	P110	Buttress	1.7	1.7	1.5	1.6	Dry	13

<sup>≈7 5/8°</sup> has DV Tool @

2865

BTA Oil Producers, LLC 104 S Pecos Midland, TX 79701

WELL: Harroun Ranch 20702 20-17 #6H

TVD: 10768 MD:

21151

DRILLING PLAN

Casing Program

Hole Size	Cag.Size	From (MD)	To (MO)	From (TVD)	To (TVD)	Tapered String	Weight (Iba)	Grade	Conn.	Collapse	Buret	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
14 3/4	10 3/4	0	1050	o	1050	No	40.5	J <del>-</del> 55	STC	3.5	8.9	14.8	9.9	Dry	8.3
9 7/8	7 5/8	0	10260	0	10232	No	29.7	P110	Buttress	1.9	1.9	3.1	3.2	Dry	9.4
6 3/4	5 1/2	0	10060	o	10032	Yes	20	P110	Buttress	1.5	1.7	3.2	3.3	Dry	13
6 3/4	5	10080	21151	10032	10768	Yes	18	P110	Buttress	1.7	1.7	1.5	1.8	Dry	13

≠7 5/8" has DV Tool @

2865

BTA Oil Producers, LLC 104 S Pecos Midland, TX 79701

WELL: Harroun Ranch 20702 20-17 #6H

**TVD**: 10768 MD:

21151

DRILLING PLAN

Casing Program

Hole Size	Cag.Size	Prom (MD)	To (MD)	From (TVD)	To (TVD)	Tapered String	Weight (lbs)	Grade	Conn.	Collapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
14 3/4	10 3/4	o	1050	0	1050	No	40.5	J <del>-5</del> 5	STC	3.5	8.9	14.8	9.9	Dry	8.3
9 7/8	7 5/8	0	10280	o	10232	No	29.7	P110	Buttress	1.9	1.9	3.1	3.2	Dry	9.4
6 3/4	5 1/2	0	10080	o	10032	Yes	20	P110	Buttress	1.5	1.7	3.2	3.3	Dry	13
6 3/4	5	10080	21151	10032	10768	Yes	18	P110	Buttress	1.7	1.7	1.5	1.6	Dry	13

\*7 5/8" has DV Tool @

TEC.	ŪX:	104 S Pe	Producers, LLC cos TX 79701	·	-	וח	RILLING PLA			WELL: TVD: MD:	Harrou 10952 21173				
	,						MAANU LIA			:		:			
Casing Pr	rogram	•		: · · · · · · · · · · · · · · · · · · ·	-	f '	•	!		:		-			;
Hale Size	Csg.Size	From (MD)	To (MD)	From (TVD)	To (TVD)	Tapered String	Weight (Ibs)	Grade	Conn.	Collapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
14 3/4	10 3/4	0	500	0	500	No	40.5	J-56	src	7.3	14.5	31.1	20.7	Dry	8.3
97/9	7 5/8	0	10448	0	10424	No	29.7	P110	Buttress	1.9	1.9	3.0	3.1	Dry	8.4
6 3/4	5 1/2	0	10248	0	10224	Yes	20	P110	Buttress	1.5	1.7	3.1	33	Dry	12.5
6 3/4	5	10249	21173	10224	10952	Yes	18	P110	Buttress	1.7	1.7	1.5	1.6	Dry	12.5

•7 5/8\* has DV Tool @ 2952\*

गहरिगिक्ररू

BTA Oil Producers, LLC 104 S Pecos Midland, TX 79701 WELL: Harroun #5H

TVD: 10952 MD: 21173

DRILLING PLAN

Hole Size	Csg.Size	From (MD)	To (MD)	From (TVD)	To (TVD)	Tapered String	Weight (lbs)	Grade	Conn.	Collapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
14 3/4	10 3/4	0	500	0	500	No	40.5	J-55	src	7.3	14.5	31.1	20.7	Dry	8.3
9 7/8	7 5/8	0	10448	0	10424	No	29.7	P110	Buttress	1.9	1.9	3.0	31	Dry	9.4
6 3/4	5 1/2	0	10249	0	10224	Yes	20	P110	Buttress	1.5	1.7	3.1	3.3	Dry	12.5
6 3/4	5	10249	21173	10224	10952	Yes	18	P110	Buttress	1.7	1.7	1.5	1.6	Dry	12.5

<sup>•7 5/8&</sup>quot; has DV Tool @ 2952"

BTA Oil Producers, LLC 104 S Pecos Midland, TX 79701

 WELL:
 Harroun #5H

 TVD:
 10952

 MD:
 21173

### DRILLING PLAN

Hole Size	Csg.Size	From (MD)	To (MD)	Fram (TVD)	To (TVD)	Tapered String	Weight (lbs)	Grade	Conn.	Collapse	Burst	Body Tension	Jaint Tension	Dry/ Buoyant	Mfud Weight (ppg)
14 3/4	10 3/4	0	500	o	500	No	40.5	1-55	src	7.3	14.5	31.1	20.7	Dry	B. 3
9 7/8	7 5/8	0	10448	0	10424	No	29.7	P110	Buttress	1.9	1.9	3.0	3.1	Dry	9.4
6 3/4	5 1/2	o o	10248	0	10224	Yes	20	P110	Buttress	1.5	1.7	3.1	3.3	Dry	12.5
B 3/4	5	10248	21173	10224	10952	Yes	19	P110	Buttress	1.7	1.7	1.5	1.6	Dry	12.5

<sup>•7 5/8°</sup> has DV Tool @ 2952'

TE TEX

BTA Oil Producers, LLC 104 S Pecos Midland, TX 79701

WELL: Harroun #5H

**TVD**: 10952

MD: 21173

DRILLING PLAN

Hole Size	Csg.Size	From (MD)	То (МО)	Prom (TVD)	To (TVD)	Tapered String	Weight (lbs)	Grade	Conn.	Callapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
14 3/4	10 3/4	0	500	0	500	No	40.5	1-22	src	7.3	14.5	31.1	20.7	Dry	8.3
9 7/8	7 5/8	0	10448	0	10424	No	29.7	P110	Buttress	1.9	1.9	3.0	3.1	Dry	8.4
6 3/4	5 1/2	0	10248	0	10224	Yes	20	P110	Buttress	1.5	1.7	3.1	3.3	Dry	12.5
6 3/4	5	10248	21173	10224	10952	Yes	18	P110	Buttress	1.7	1.7	1.5	1.6	Dry	12.5

<sup>•7 5/8°</sup> has DV Tool @ 2952'

BTA Oil Producers, LLC 104 S Pecos

WELL: Mesa 8105 1-12 FED #40H (AUAP)
TVD: 9091
MD: 19581

Midland, TX 79701

DRILLING PLAN

Hole Size	Csg.Size	From (MD)	To (MD)	From (TVD)	To (TVD)	Tapered String	Weight (lbs)	Grade	Conn.	Collapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
17 1/2	13 3/8	0	1100	0	1100	No	54.5	1-86	src	24	5.0	14.2	8.6	Dry	8.3
12 1/4	9 5/8	0	4848	0	4813	No	40	1-85	LTC	20	1.7	3.2	27	Dıy	9.4
8 3/4	5.5	0	19581	0	9091	No	17	P110	Buttress	1.7	2.4	1.6	1.7	Dry	9.4



BTA Oil Producers, LLC 104 S Pecos Midland, TX 79701

WELL: Mesa 8105 1-12 FED #40H (AUAP)

**TVD:** 9091 **MD:** 19581

DRILLING PLAN

Casing Pr	rogram								• •	-					
Hale Size	Csg.Size	From (MD)	To (MD)	From (TVD)	To (TVD)	Tapered String	Weight (lbs)	Grade	Conn.	Collapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
17 1/2	13 3/9	0	1100	0	1100	No	54.5	1-82	STC	2.4	5.8	14.2	8.6	Dry	8.3
12 1/4	9 5/8	0	4848	0	4913	No	40	1-22	LTC	20	1.7	3.2	2.7	Dry	9.4
8 3/4	5.5	0	19581	0	9091	No	17	P110	Buttress	1.7	24	1.6	1.7	Dry	9.4

BTA Oil Producers, LLC\_ 104 S Pecos

Midland, TX 79701

WELL: Mesa 8105 1-12 FED #40H (AUAP)
TVD: 9091
MD: 19581

DRILLING PLAN

Hole Size	Csg.Size	From (MD)	To (MD)	From (TVD)	To (TVD)	Tapered String	Weight (lbs)	Grade	Conn.	Collapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
17 1/2	13 3/8	o	1100	0	1100	No	54.5	J-55	src	24	5.8	14.2	8.6	Dry	8.3
12 1/4	9 5/8	0	4848	0	4813	No	40	1-22	LTC	2.0	1.7	3.2	27	Dry	9.4
8 3/4	5.5	0	19581	0	9091	No	17	P110	Buttress	1.7	24	1.6	1.7	Dry	9.4

BTA Oil Producers, LLC

104 S Pecos

Midland, TX 79701

WELL: Mesa 8105 1-12 FED #41H (AUBO) TVD: 9090 MD: 19537

MD:

19537

### DRILLING PLAN

Hole Size	Csg.Size	From (MD)	To (MD)	From (TVD)	To (TVD)	Tapered String	Weight (lbs)	Grade	Conn.	Collapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
17 1/2	13 3/8	0	1100	0	1100	No	54.5	1-22	src	24	5.8	14.2	8.6	Dry	8.3
12 1/4	9 5/8	0	4837	0	4813	No	40	J-55	LTC	20	1.7	3.3	2.7	Dry	9.4
8 3/4	5.5	0	19537	0	9090	No	17	P110	Buttress	1.7	24	1.6	1.7	Dry	9.4

BTA Oil Producers, LLC 104 S Pecos Midland, TX 79701

WELL: Mesa 8105 1-12 FED #41H (AUBO)
TVD: 9090
MD: 19537

19537

DRILLING PLAN

Hole Size	Csg.Size	From (MD)	To (MD)	From (TVD)	To (TVD)	Tapered String	Weight (Ibs)	Grade	Conn.	Collapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
17 1/2	13 3/9	0	1100	0	1100	No	54.5	J-55	src	24	5.8	14.2	8.6	Dry	8.3
12 1/4	9 5/8	0	4837	0	4813	No	40	J- <del>5</del> 5	LTC	2.0	1.7	33	2.7	Dry	9.4
8 3/4	5.5	0	19537	0	9090	No	17	P110	Buttress	1.7	2.4	1.6	1.7	Dry	9.4

TETUX

BTA Oil Producers, LLC 104 S Pecos Midland, TX 79701

WELL: Mesa 8105 1-12 FED #41H (AUBO)

TVD: 9090 MD: 19537

DRILLING PLAN

Casing Program \_\_\_\_\_

Hole Size	Csg.Size	From (MD)	To (MD)	From (TVD)	To (TVD)	Tapered String	Weight (Ibs)	Grade	Conn.	Collapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
17 1/2	13 3/8	0	1100	o	1100	No	54.5	J-55	src	24	5.0	14.2	8.6	Dry	8.3
12 1/4	9 5/8	0	4837	0	4913	No .	40	J-55	LTC	2.0	1.7	3.3	27	Dry	9.4
8 3/4	5.5	0	19537	0	9090	No	17	P110	Buttress	1.7	24	1.8	1.7	Dry	9.4

BTA Oil Producers, LLC 104 S Pecos Midland, TX 79701

WELL: Mesa 8105 1-12 FED #42H (AUCN)
TVD: 9018
MD: 19484

Cashik Li	Ogran		÷ · · -	•					:		•			•	
Hale Size	Csg.Size	From (MD)	To (MD)	Fram (TVD)	To (TVD)	Tapered String	Weight (lbs)	Grade	Conn.	Collapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mad Weight (ppg)
17 1/2	13 3/8	0	1100	0	1100	No	54.5	1-55	arc	24	5.8	14.2	8.6	Dry	<b>8.</b> 3
12 1/4	9 5/8	D	4731	0	4717	No	40	1-22	LTC	2.0	1.7	3.3	2.7	Dry	9.4
8 3/4	5.5	0	19484	0	9018	No	17	P110	Buttress	1.7	24	1.6	1.7	Dry	9.4

BTA Oil Producers, LLC

104 S Pecos Midland, TX 79701

WELL: Mesa 8105 1-12 FED #42H (AUCN) 9018 19484

TVD:

### DRILLING PLAN

Ci	Da
Cashr	Program

Hole Size	Cag.Size	From (MO)	To (MD)	Fram (TVD)	To (TVD)	Tapered String	Weight (lbs)	Grade	Conn.	Collapse	Burst	Body Tension	Joint Tension	Dry/ Buoyant	Mud Weight (ppg)
17 1/2	13 3/8	0	1100	0 .	1100	No	54.5	1-22	src	24	5.9	14.2	0.6	Dry	8.3
12 1/4	9 5/8	0	4731	0	4717	No	40	1-55	LTC	20	1.7	3.3	2.7	Dry	9.4
B 3/4	5.5	0	19484	0	9018	No	17	P110	Buttress	1.7	24	1.8	1.7	Dry	9.4

BTA Oil Producers, LLC
104 S Pecos

Midland, TX 79701

WELL: Mesa 8105 1-12 FED #42H (AUCN)

TVD: 9018 MD:

19484

•	Casing	Program
	Сазии	IIVXIAII

Casing Pr	rogram		• •	· ·	,	· · · ·	· · · ·	<del></del>	· ·		-				
Hole Size	Csg.Size	From (MD)	To (MD)	From (TVD)	To (TVD)	Tapered String	Weight (lbs)	Grade	Conn.	Collapse	Burst	Body Tension	Jaint Tension	Dry/ Buoyant	Mud Weight (ppg)
17 1/2	13 3/8	a	1100	0	1100	No	54.5	J- <del>5</del> 5	STC	24	5.0	14.2	<b>a.</b> 6	Dry	8.3
12 1/4	9 5/8	0	4731	0	4717	No	40	1-55	LTC	2.0	1.7	33	2.7	עזע	9.4
8 3/4	5.5	0	19484	0	9018	No	17	P110	Buttress	1.7	24	1.6	1.7	Dry	9.4

# **EMERGENCY CALL LIST**

 OFFICE
 MOBILE

 BTA Oil Producers LLC OFFICE
 432-682-3753


 BEN GRIMES, Operations
 432-682-3753
 432-559-4309

 NICK EATON, Drilling
 432-682-3753
 432-260-7841

 TRACE WOHLFAHRT, Completions
 432-682-3753

# **EMERGENCY RESPONSE NUMBERS**

	<u>OFFICE</u>
STATE POLICE	575-748-9718
EDDY COUNTY SHERIFF	575-746-2701
EMERGENCY MEDICAL SERVICES (AMBULANCE)	911 or 575-746-2701
EDDY COUNTY EMERGENCY MANAGEMENT (HARRY BURGESS)	575-887-9511
STATE EMERGENCY RESPONSE CENTER (SERC)	575-476-9620
CARLSBAD POLICE DEPARTMENT	575-885-2111
CARLSBAD FIRE DEPARTMENT	575-885-3125
NEW MEXICO OIL CONSERVATION DIVISION	575-748-1283
INDIAN FIRE & SAFETY	800-530-8693
HALLIBURTON SERVICES	800-844-8451

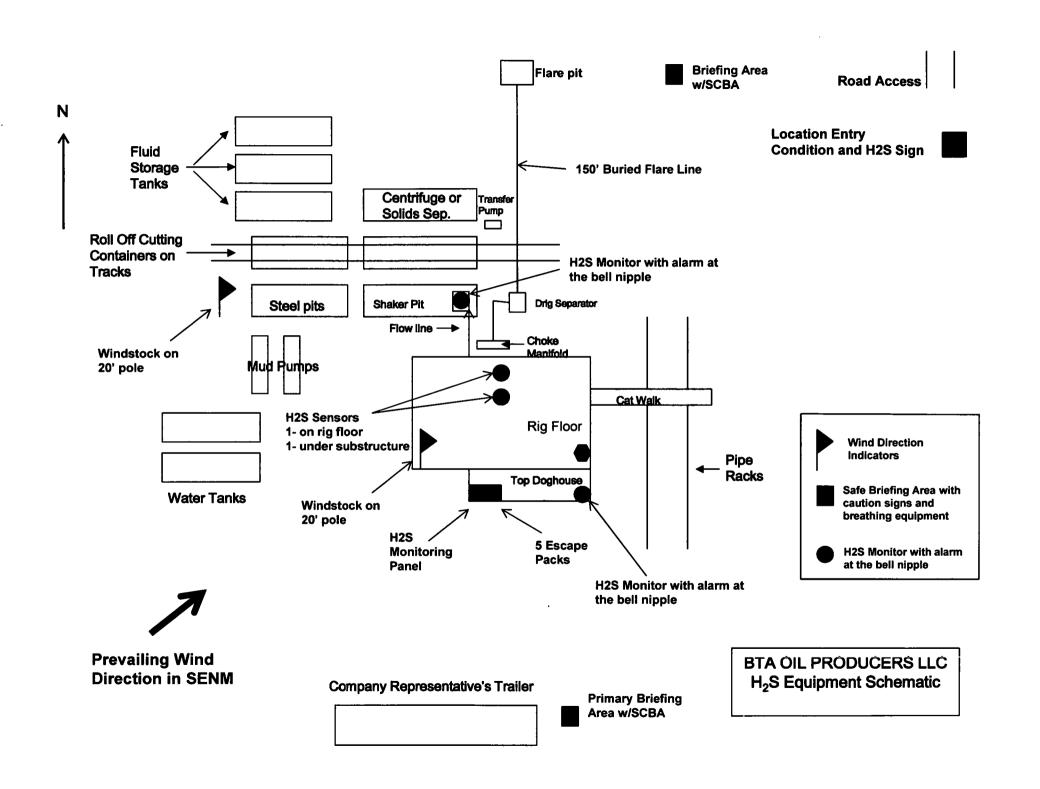

### **BTA OIL PRODUCERS LLC**



### **HYDROGEN SULFIDE DRILLING OPERATIONS PLAN**

### 1. HYDROGEN SULFIDE TRAINING

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on this well:

- a. The hazards and characteristics of hydrogen sulfide (H<sub>2</sub>S).
- b. The proper use and maintenance of personal protective equipment and life support systems.
- c. The proper use of H<sub>2</sub>S detectors, alarms, warning systems, briefing areas, evacuation procedures, and prevailing winds.
- d. The proper techniques for first aid and rescue procedures.

In addition, supervisory personnel will be trained in the following areas:

- a. The effects of H2S on metal components. If high tensile tubulars are to be used, personnel will be trained in their special maintenance requirements.
- b. Corrective action and shut-in procedures when drilling or reworking a well and blowout prevention and well control procedures.
- c. The contents and requirements of the H<sub>2</sub>S Drilling Operations Plan and the Public Protection Plan.

There will be an initial training session just prior to encountering a known or probable H2S zone (within 3 days or 500 feet) and weekly H2S and well control drills for all personnel in each crew. The initial training session shall include a review of the site specific H2S Drilling Operations Plan and the Public Protection Plan. This plan shall be available at the well site. All personnel will be required to carry documentation that they have received the proper training.

### 2. <u>H<sub>2</sub>S SAFETY EQUIPMENT AND SYSTEMS</u>

Note: All H<sub>2</sub>S safety equipment and systems will be installed, tested, and operational when drilling reaches a depth of 500 feet above, or three days prior to penetrating the first zone containing or reasonably expected to contain H2S. If H2S greater than 100 ppm is encountered in the gas stream we will shut in and install H2S equipment.

- a. Well Control Equipment:
  - Flare line.
  - Choke manifold with remotely operated choke.
  - Blind rams and pipe rams to accommodate all pipe sizes with properly sized closing unit.
  - Auxiliary equipment to include: annular preventer, mud-gas separator, rotating head.
- b. Protective equipment for essential personnel:

  Mark II Surviveair 30-minute units located in the dog house and at briefing areas.
- c. H2S detection and monitoring equipment:

- 2 portable H2S monitor positioned on location for best coverage and response. These units have warning lights and audible sirens when H2S levels of 20 ppm are reached.
- d. Visual warning systems: Caution/Danger signs shall be posted on roads providing direct access to location. Signs will be painted a high visibility yellow with black lettering of sufficient size to be readable at a reasonable distance from the immediate location. Bilingual signs will be used, when appropriate. See example attached.
- e. Mud Program:

  The mud program has been designed to minimize the volume of H2S circulated to the surface.
- f. Metallurgy:
  All drill strings, casings, tubing, wellhead, blowout preventers, drilling spool, kill lines, choke manifold and lines, and valves shall be suitable for H2S service.
- g. Communication:
  Company vehicles equipped with cellular telephone.


# WARNING

# YOU ARE ENTERING AN H<sub>2</sub>S AREA AUTHORIZED PERSONNEL ONLY

- 1. BEARDS OR CONTACT LENSES NOT ALLOWED
- 2. HARD HATS REQUIRED
- 3. SMOKING IN DESIGNATED AREAS ONLY
- 4. BE WIND CONSCIOUS AT ALL TIMES
- 5. CK WITH BTA OIL PRODUCERS LLC FOREMAN AT MAIN OFFICE

BTA OIL PRODUCERS LLC

1-432-682-3753

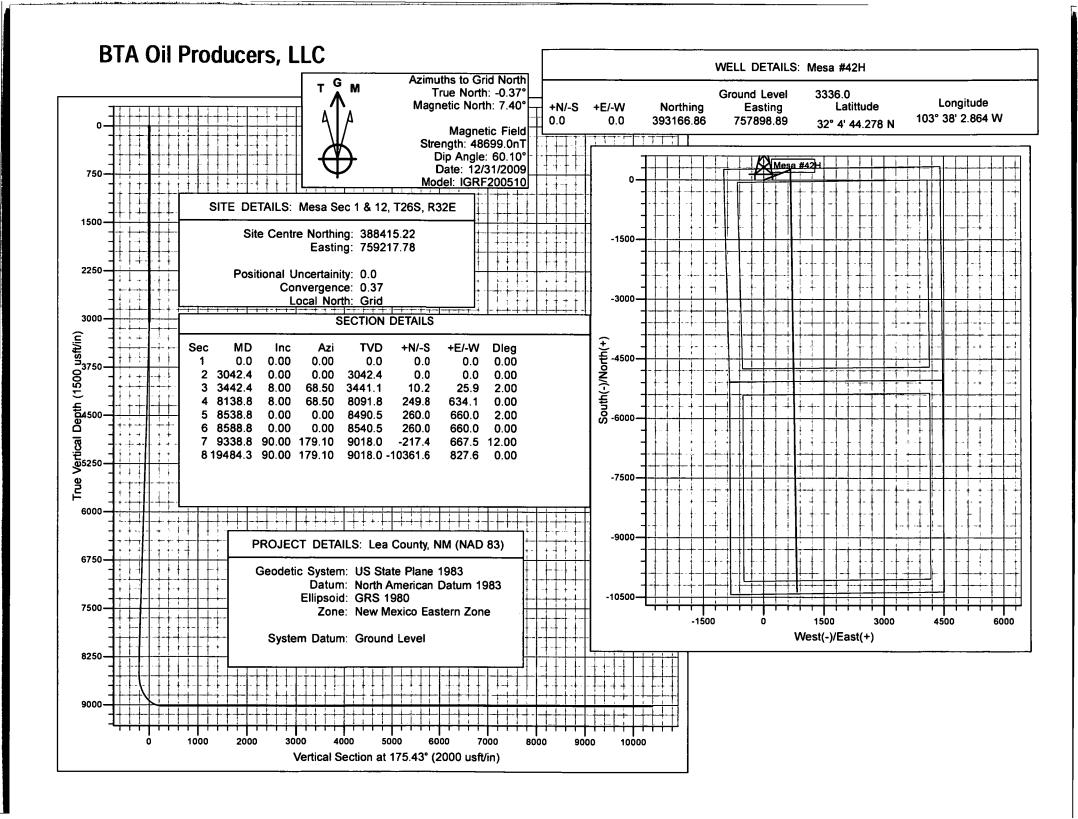

# **BTA Oil Producers, LLC**

Lea County, NM (NAD 83) Mesa Sec 1 & 12, T26S, R32E Mesa #42H

Wellbore #1

Plan: Design #1

# **Standard Planning Report - Geographic**

10 October, 2019

#### Planning Report - Geographic

Database:

Old

Company:

BTA Oil Producers, LLC

Project:

Lea County, NM (NAD 83)

Site: Well: Mesa Sec 1 & 12, T26S, R32E

Wellbore: Design:

Mesa #42H Wellbore #1 Design #1

Local Co-ordinate Reference:

**Survey Calculation Method:** 

Well Mesa #42H

TVD Reference:

MD Reference: North Reference: WELL @ 3336.0usft (Original Well Elev) WELL @ 3336.0usft (Original Well Elev)

Grid

Minimum Curvature

Project

Lea County, NM (NAD 83), Lea County, NM

Map System: Geo Datum:

Map Zone:

US State Plane 1983

North American Datum 1983 New Mexico Eastern Zone

System Datum:

**Ground Level** 

Using geodetic scale factor

Site

Mesa Sec 1 & 12, T26S, R32E

Site Position:

Northing:

388,415.22 usft

Latitude:

32° 3' 57.173 N

From:

Мар

Easting:

759,217.78 usft

Longitude:

**Position Uncertainty:** 

0.0 usft

Slot Radius:

13-3/16"

103° 37' 47.896 W

**Grid Convergence:** 

0.37°

Well

Mesa #42H

Well Position

+N/-S +E/-W 0.0 usft 0.0 usft Northing: Easting:

393,166,86 usft 757,898.89 usft

Latitude:

32° 4' 44,278 N

**Position Uncertainty** 

0.0 usft

Wellhead Elevation:

Longitude: Ground Level: 103° 38' 2.864 W 3,336.0 usft

Wellbore

Wellbore #1

Magnetics

**Model Name** 

Sample Date

Declination (°)

Dip Angle (°)

Field Strength

(nT)

IGRF200510

12/31/2009

7.77

60.10

48,699.02684464

Design

Design #1

Audit Notes:

Version:

Phase:

**PROTOTYPE** 

Tie On Depth:

Depth From (TVD) (usft)

+N/-S (usft) 0.0

+E/-W (usft)

0.0

0.0 Direction

**(°)** 

175.43

Vertical Section:

0.0 10/10/2019

**Plan Survey Tool Program** Depth From (usft)

Depth To

(usft)

Survey (Wellbore)

**Tool Name** 

Remarks

0.0

19,484.3 Design #1 (Wellbore #1)

Date

Weasured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Dogleg Rate (*/100usft)	Build Rate (°/100usft)	Turn Rate (°/100usft)	TFO (°)	Target
0.0	0.00	0.00	0.0	0.0	0.0	0.00	0.00	0.00	0.00	
3,042.4	0.00	0.00	3,042.4	0.0	0.0	0.00	0.00	0.00	0.00	
3,442.4	8.00	68.50	3,441.1	10.2	25.9	2.00	2.00	0.00	68.50	
8,138.8	8.00	68.50	8,091.8	249.8	634.1	0.00	0.00	0.00	0.00	
8,538.8	0.00	0.00	8,490.5	260.0	660.0	2.00	-2.00	0.00	180.00	
8,588.8	0.00	0.00	8,540.5	260.0	660.0	0.00	0.00	0.00	0.00	
9,338.8	90.00	179.10	9,018.0	-217.4	667.5	12.00	12.00	0.00	179.10	
19,484.3	90.00	179.10	9,018.0	-10,361.6	827.6	0.00	0.00	0.00	0.00	Mesa #42H BHL

### Planning Report - Geographic

Database:

Old

BTA Oil Producers, LLC

Company: Project:

Lea County, NM (NAD 83) Mesa Sec 1 & 12, T26S, R32E

Site: Well:

Mesa #42H

Wellbore: Design: Wellbore #1 Design #1 Local Co-ordinate Reference:

Well Mesa #42H

WELL @ 3336.0usft (Original Well Elev)

TVD Reference: MD Reference:

North Reference: Survey Calculation Method: WELL @ 3336.0usft (Original Well Elev)

Grid

Minimum Curvature

anned Survey	1								
Measured Depth (usft)	Inclination	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Map Northing (usft)	Map Easting (usft)	Latitude	Longitude
		0.00		0.0	0.0		757,898.89		103° 38' 2.864 W
0.0 100.0		0.00	0.0 100.0	0.0	0.0	393,166.86 393,166.86	757,898.89	32° 4′ 44.278 N 32° 4′ 44.278 N	103° 38' 2.864 W
200.0		0.00	200.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
300.0		0.00	300.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
400.0		0.00	400.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
500.0		0.00	500.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
600.0		0.00	600.0	0.0	0.0	393,166.86	757,898.89		103° 38′ 2.864 W
700.0		0.00	700.0	0.0	0.0	393,166.86	757,898.89	32° 4′ 44.278 N 32° 4′ 44.278 N	103° 38' 2.864 W
800.0		0.00	800.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
900.0		0.00	900.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
1,000.0		0.00	1,000.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
1,100.0		0.00	1,000.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
1,100.0		0.00	1,200.0	0.0	0.0	393,166.86	757,898.89		
1,300.0		0.00	1,300.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
-				0.0	0.0		757,898.89	32° 4' 44.278 N	103° 38' 2.864 W 103° 38' 2.864 W
1,400.0		0.00	1,400.0	0.0	0.0	393,166.86	•	32° 4' 44.278 N	
1,500.0		0.00	1,500.0			393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
1,600.0		0.00	1,600.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
1,700.0		0.00	1,700.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
1,800.0		0.00	1,800.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
1,900.0		0.00	1,900.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
2,000.0		0.00	2,000.0	0.0	0.0	393,166.86	757,898.89	32° 4′ 44.278 N	103° 38' 2.864 W
2,100.0		0.00	2,100.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
2,200.0		0.00	2,200.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
2,300.0		0.00	2,300.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
2,400.0		0.00	2,400.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
2,500.0	0.00	0.00	2,500.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
2,600.0		0.00	2,600.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
2,700.0		0.00	2,700.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
2,800.0		0.00	2,800.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
2,900.0		0.00	2,900.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
3,000.0		0.00	3,000.0	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
3,042.4		0.00	3,042.4	0.0	0.0	393,166.86	757,898.89	32° 4' 44.278 N	103° 38' 2.864 W
3,100.0		68.50	3,100.0	0.2	0.5	393,167.07	757,899.43	32° 4' 44.280 N	103° 38' 2.858 W
3,200.0		68.50	3,199.9	1.6	4.0	393,168.44	757,902.92	32° 4' 44.293 N	103° 38' 2.817 W
3,300.0		68.50	3,299.7	4.2	10.8	393,171.10	757,909.65	32° 4' 44.319 N	103° 38' 2.739 W
3,400.0		68.50	3,399.1	8.2	20.7	393,175.02	757,919.62	32° 4' 44.357 N	103° 38' 2.623 W
3,442.4	8.00	68.50	3,441.1	10.2	25.9	393,177.07	757,924.83	32° 4' 44.377 N	103° 38' 2.562 W
3,500.0		68.50	3,498.1	13.2	33.4	393,180.01	757,932.28	32° 4' 44,406 N	103° 38' 2.475 W
3,600.0		68.50	3,597.2	18.3	46.3	393,185.11	757,945.23	32° 4' 44.456 N	103° 38' 2.324 W
3,700.0		68.50	3,696.2	23.4	59.3	393,190.21	757,958.18	32° 4' 44.505 N	103° 38' 2.174 W
3,800.0	8.00	68.50	3,795.2	28.5	72.2	393,195.31	757,971.13	32° 4' 44.555 N	103° 38' 2.023 W
3,900.0		68.50	3,894.2	33.6	85.2	393,200.41	757,984.07	32° 4' 44.605 N	103° 38' 1.872 W
4,000.0		68.50	3,993.3	38.7	98.1	393,205.51	757,997.02	32° 4' 44.654 N	103° 38' 1.721 W
4,100.0		68.50	4,092.3	43.8	111.1	393,210.62	758,009.97	32° 4' 44.704 N	103° 38' 1.570 W
4,200.0		68.50	4,191.3	48.9	124.0	393,215.72	758,022.92	32° 4' 44.754 N	103° 38' 1.419 W
4,300.0		68.50	4,290.4	54.0	137.0	393,220.82	758,035.87	32° 4' 44.803 N	103° 38' 1.268 W
4,400.0		68.50	4,389.4	59.1	149.9	393,225.92	758,048.82	32° 4' 44.853 N	103° 38' 1.117 W
4,500.0		68.50	4,488.4	64.2	162.9	393,231.02	758,061.76	32° 4' 44.902 N	103° 38' 0.967 W
4,600.0	8.00	68.50	4,587.4	69.3	175.8	393,236.12	758,074.71	32° 4′ 44.952 N	103° 38' 0.816 W
4,700.0	8.00	68.50	4,686.5	74.4	188.8	393,241.22	758,087.66	32° 4' 45.002 N	103° 38' 0.665 W
4,800.0	8.00	68.50	4,785.5	79.5	201.7	393,246.32	758,100.61	32° 4' 45.051 N	103° 38' 0.514 W
4,900.0	8.00	68.50	4,884.5	84.6	214.7	393,251.42	758,113.56	32° 4′ 45.101 N	103° 38' 0.363 W
5,000.0	8.00	68.50	4,983.5	89.7	227.6	393,256.52	758,126.51	32° 4′ 45,151 N	103° 38' 0.212 W
5,100.0	8.00	68,50	5,082.6	94.8	240.6	393,261.62	758,139.45	32° 4' 45.200 N	103° 38' 0.061 W
5,200.0	8.00	68.50	5,181.6	99.9	253.5	393,266.72	758,152.40	32° 4' 45.250 N	103° 37' 59.910 W

### Planning Report - Geographic

Database:

Old

BTA Oil Producers, LLC Company:

Project:

Lea County, NM (NAD 83) Mesa Sec 1 & 12, T26S, R32E

Site: Well:

Mesa #42H

Wellbore:

Wellbore #1

Local Co-ordinate Reference:

TVD Reference: MD Reference:

North Reference:

**Survey Calculation Method:** 

Well Mesa #42H

WELL @ 3336.0usft (Original Well Elev)

WELL @ 3336.0usft (Original Well Elev)

Grid

Minimum Curvature

/ellbore: esign:	Desig	ore #1 gn #1					<u> </u>		
lanned Survey									
Measured Depth (usft)	inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Map Northing (usft)	Map Easting (usft)	Latitude	Longitude
5,300.0	8.00	68.50	5,280.6	105.0	266.5	393,271.83	758,165.35	32° 4' 45.300 N	103° 37' 59.760 W
5,400.0	8.00	68.50	5,379.7	110.1	279.4	393,276.93	758,178.30	32° 4' 45.349 N	103° 37' 59.609 W
5,500.0	8.00	68.50	5,478.7	115.2	292.4	393,282.03	758,191.25	32° 4' 45.399 N	103° 37' 59.458 W
5,600.0	8.00	68.50	5,577.7	120.3	305.3	393,287.13	758,204.19	32° 4' 45.449 N	103° 37' 59,307 W
5,700.0	8.00	68.50	5,676.7	125.4	318.3	393,292.23	758,217.14	32° 4' 45.498 N	103° 37' 59.156 W
5,800.0	8.00	68.50	5,775.8	130.5	331.2	393,297.33	758,230.09	32° 4' 45.548 N	103° 37' 59.005 W
5,900.0	8.00	68.50	5,874.8	135.6	344.2	393,302.43	758,243.04	32° 4' 45.597 N	103° 37' 58.854 V
6,000.0	8.00	68.50	5,973.8	140.7	357.1	393,307.53	758,255.99	32° 4' 45.647 N	103° 37' 58.703 V
6,100.0	8.00	68.50	6,072.8	145.8	370.1	393,312.63	758,268.94	32° 4' 45,697 N	103° 37' 58,553 V
6,200.0	8.00	68.50	6,171.9	150.9	383.0	393,317.73	758,281.88	32° 4' 45.746 N	103° 37' 58,402 V
6,300.0	8.00	68.50	6,270.9	156.0	396.0	393,322.83	758,294.83	32° 4' 45.796 N	103° 37' 58.251 V
6,400.0	8.00	68.50	6,369.9	161.1	408.9	393,327.94	758,307.78	32° 4' 45.846 N	103° 37' 58.100 V
6,500.0	8.00	68.50	6,468.9	166.2	421.9	393,333.04	758,320.73	32° 4' 45.895 N	103° 37' 57.949 V
6,600.0	8.00	68.50	6,568.0	171.3	434.8	393,338,14	758,333.68	32° 4' 45.945 N	103° 37' 57.798 V
6,700.0	8.00	68.50	6,667.0	176.4	447.8	393,343.24	758,346.63	32° 4′ 45.995 N	103° 37' 57.647 W
6,800.0	8.00	68.50	6,766.0	181.5	460.7	393,348.34	758,359.57	32° 4' 46.044 N	103° 37' 57.496 W
6,900.0	8.00	68.50	6,865.1	186.6	473.7	393,353.44	758,372.52	32° 4' 46.094 N	103° 37' 57.346 V
7,000.0	8.00	68.50	6,964.1	191.7	486.6	393,358.54	758,385.47	32° 4' 46.144 N	103° 37' 57.195 V
7,100.0	8.00	68.50	7,063.1	196.8	499.5	393,363.64	758,398.42	32° 4' 46.193 N	103° 37' 57.044 V
7,200.0	8.00	68.50	7,162.1	201.9	512.5	393,368.74	758,411.37	32° 4' 46.243 N	103° 37' 56.893 V
7,300.0	8.00	68.50	7,261.2	207.0	525.4	393,373.84	758,424.32	32° 4' 46.292 N	103° 37' 56.742 V
7,400.0	8.00	68.50	7,360.2	212.1	538.4	393,378.94	758,437.26	32° 4' 46.342 N	103° 37' 56.591 V
7,500.0	8.00	68.50	7,459.2	217.2	551.3	393,384.04	758,450.21	32° 4' 46.392 N	103° 37' 56.440 V
7,600.0	8.00	68.50	7,558.2	222.3	564.3	393,389.15	758,463.16	32° 4' 46.441 N	103° 37' 56.289 V
7,700.0	8.00	68.50	7,657.3	227.4	577.2	393,394.25	758,476.11	32° 4' 46.491 N	103° 37' 56.139 V
7,800.0	8.00	68.50	7,756.3	232.5	590.2	393,399.35	758,489.06	32° 4' 46.541 N	103° 37' 55,988 V
7,900.0	8.00	68.50	7,855.3	237.6	603.1	393,404.45	758,502.01	32° 4' 46.590 N	103° 37' 55.837 V
8,000.0	8.00	68.50	7,954.3	242.7	616.1	393,409.55	758,514.95	32° 4' 46.640 N	103° 37' 55.686 V
8,100.0	8.00	68.50	8,053.4	247.8	629.0	393,414.65	758,527.90	32° 4' 46,690 N	103° 37' 55.535 V
8,138.8	8.00	68.50	8,091.8	249.8	634.1	393,416.63	758,532.93	32° 4' 46.709 N	103° 37' 55.476 V
8,200.0	6.78	68.50	8,152.5	252.7	641.4	393,419.51	758,540.25	32° 4′ 46.737 N	103° 37' 55.391 V
8,300.0	4.78	68.50	8,252.0	256.4	650.7	393,423.20	758,549.61	32° 4′ 46.773 N	103° 37' 55.282 V
8,400.0	2.78	68.50	8,351.8	258.8	656.9	393,425.61	758,555.74	32° 4′ 46.796 N	103° 37' 55.211 V
8,500.0	0.78	68.50	8,451.7	259.9	659.8	393,426.75	758,558.62	32° 4′ 46.807 N	103° 37' 55.177 V
8,538.8	0.00	0.00	8,490.5	260.0	660.0	393,426.85	758,558.87	32° 4' 46.808 N	103° 37' 55.174 V
8,588.8	0.00	0.00	8,540.5	260.0	660.0	393,426.85	758,558.87	32° 4' 46,808 N	103° 37' 55.174 V
8,600.0	1.34	179.10	8,551.7	259.9	660.0	393,426.72	758,558.87	32° 4' 46.807 N	103° 37' 55.174 V
8,700.0	13,34	179.10	8,650.7	247.1	660.2	393,413.97	758,559.07	32° 4' 46.681 N	103° 37' 55.173 V
8,800.0	25.34	179.10	8,744.9	214.1	660.7	393,380.92	758,559.59	32° 4′ 46.354 N	103° 37' 55.169 V
8,900.0	37.34	179.10	8,830.1	162.2	661.5	393,329.01	758,560.41	32° 4' 45.840 N	103° 37' 55.164 V
9,000.0	49.34	179.10	8,902.7	93.7	662.6	393,260.51	758,561.49	32° 4′ 45.162 N	103° 37' 55.156 V
9,100.0	61,34	179,10	8,959.5	11.6	663.9	393,178.42	758,562.79	32° 4' 44.350 N	103° 37' 55.147 V
9,200.0	73.34	179.10	8,998.0	-80.5	665.4	393,086.33	758,564.24	32° 4' 43.438 N	103° 37' 55.137 V
9,300.0	85.34	179.10	9,016.4	-178.6	666.9	392,988.25	758,565.79	32° 4' 42.468 N	103° 37′ 55.127 V
9,338.8	90.00	179.10	9,018.0	-217.4	667.5	392,949.46	758,566.40	32° 4′ 42.084 N	103° 37' 55.123 V
9,400.0	90.00	179.10	9,018.0	-278.6	668.5	392,888.31	758,567.36	32° 4′ 41.479 N	103° 37' 55.116 V
9,500.0	90.00	179.10	9,018.0	-378.5	670.1	392,788.32	758,568.94	32° 4' 40.489 N	103° 37' 55.105 V
9,600.0	90.00	179.10	9,018.0	-478.5	671.7	392,688.34	758,570.52	32° 4' 39.500 N	103° 37' 55.095 V
9,700.0	90.00	179.10	9,018.0	-578.5	673.2	392,588.35	758,572.10	32° 4′ 38.510 N	103° 37' 55.084 V
9,800.0	90.00	179.10	9,018.0	-678.5	674.8	392,488.37	758,573.68	32° 4' 37.521 N	103° 37' 55.073 V
9,900.0	90.00	179.10	9,018.0	-778.5	676.4	392,388.39	758,575.26	32° 4' 36.531 N	103° 37' 55.062 V
10,000.0	90.00	179.10	9,018.0	-878.5	678.0	392,288.40	758,576.83	32° 4' 35.542 N	103° 37' 55.051 V
10,100.0	90.00	179.10	9,018.0	-978.5	679.5	392,188.42	758,578.41	32° 4' 34.552 N	103° 37' 55.041 V
10,200.0	90.00	179.10	9,018.0	-1,078.5	681.1	392,088.44	758,579.99	32° 4' 33.563 N	103° 37' 55.030 V
10,300.0	90.00	179.10	9,018.0	-1,178.4	682.7	391,988.45	758,581.57	32° 4' 32.573 N	103° 37' 55.019 V

### Planning Report - Geographic

Database: Company:

Old

BTA Oil Producers, LLC Lea County, NM (NAD 83)

Project: Site:

Mesa Sec 1 & 12, T26S, R32E

Well: Wellbore: Mesa #42H Wellbore #1

Design:

Design #1

Local Co-ordinate Reference:

TVD Reference:

MD Reference:

North Reference: Survey Calculation Method: Well Mesa #42H

WELL @ 3336.0usft (Original Well Elev) WELL @ 3336.0usft (Original Well Elev)

Minimum Curvature

Planned Survey	
----------------	--

nned Survey	'								
Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Map Northing (usft)	Map Easting (usft)	Latitude	Longitude
10,400.0	90.00	179.10	9,018.0	-1,278.4	684.3	391,888.47	758,583,15	32° 4' 31.584 N	103° 37' 55,008
10,500.0	90.00	179.10	9,018.0	-1,378.4	685.9	391,788.48	758 584 72	32° 4' 30.594 N	103° 37' 54.997
10,600.0	90.00	179.10	9,018.0	-1,478.4	687.4	391,688.50	758,586.30	32° 4' 29.605 N	103° 37' 54.987
10,700.0	90.00	179.10	9,018.0	-1,578.4	689.0	391,588.52	758,587.88	32° 4' 28.615 N	103° 37' 54.976
10,800.0	90.00	179.10	9,018.0	-1,678.4	690.6	391,488.53	758,589.46	32° 4' 27.626 N	103° 37' 54.965
10,900.0	90.00	179,10	9,018.0	-1,778.4	692.2	391,388.55	758,591.04	32° 4' 26.636 N	103° 37' 54.954
11,000.0	90.00	179.10	9,018.0	-1,878.4	693.7	391,288.56	758,592.61	32° 4' 25.647 N	103° 37' 54.944
11,100.0	90.00	179.10	9,018.0	-1,978.3	695.3	391,188.58	758,594.19	32° 4' 24.657 N	103° 37' 54.933
11,200.0	90.00	179.10	9,018.0	-2,078.3	696.9	391,088.60	758,595.77	32° 4' 23.668 N	103° 37' 54.922
11,300.0	90.00	179.10	9,018.0	-2,178.3	698.5	390,988.61	758,597.35	32° 4' 22.678 N	103° 37' 54.911
11,400.0	90.00	179.10	9,018.0	-2,278.3	700.1	390,888.63	758,598.93	32° 4' 21.689 N	103° 37' 54.900
11,500.0	90.00	179.10	9,018.0	-2,378.3	701.6	390,788.65	758,600.50	32° 4' 20.699 N	103° 37' 54.890
11,600.0	90.00	179.10	9,018.0	-2,478.3	703.2	390,688.66	758,602.08	32° 4' 19,710 N	103° 37' 54.879
11,700.0	90.00	179.10	9,018.0	-2,578.3	704.8	390,588.68	758,603.66	32° 4' 18,720 N	103° 37' 54.868
11,800.0	90.00	179.10	9,018.0	-2,678.3	706.4	390,488.69	758,605.24	32° 4' 17.731 N	103° 37' 54.857
11,900.0	90.00	179.10	9,018.0	-2,778.2	708.0	390,388.71	758,606.82	32° 4' 16.741 N	103° 37' 54.846
12,000.0	90.00	179.10	9,018.0	-2,878.2	709.5	390,288.73	758,608.39	32° 4' 15.752 N	103° 37' 54,836
12,100.0	90.00	179.10	9,018.0	-2,978.2	711.1	390,188.74	758,609.97	32° 4' 14.762 N	103° 37' 54.825
12,200.0	90.00	179.10	9,018.0	-3,078.2	712.7	390,088.76	758,611.55	32° 4' 13.773 N	103° 37' 54.814
12,300.0	90.00	179.10	9,018.0	-3,178.2	714.3	389,988.77	758,613.13	32° 4' 12.783 N	103° 37' 54.803
12,400.0	90.00	179.10	9,018.0	-3,278.2	715.8	389,888.79	758,614.71	32° 4' 11.794 N	103° 37' 54.793
12,500.0	90.00	179.10	9,018.0	-3,378.2	717.4	389,788.81	758,616.28	32° 4' 10.804 N	103° 37' 54.782
12,600.0	90.00	179.10	9,018.0	-3,478.2	719.0	389,688.82	758,617.86	32° 4' 9.815 N	103° 37' 54.77
12,700.0	90.00	179.10	9,018.0	-3,578.2	720.6	389,588.84	758,619.44	32° 4' 8.825 N	103° 37' 54.760
12,800.0	90.00	179.10	9,018.0	-3,678.1	722.2	389,488.86	758,621.02	32° 4' 7.836 N	103° 37' 54,749
12,900.0	90.00	179.10	9,018.0	-3,778.1	723.7	389,388.87	758,622.60	32° 4' 6.846 N	103° 37' 54,739
13,000.0	90.00	179.10	9,018.0	-3,878.1	725.3	389,288.89	758,624.17	32° 4′ 5.857 N	103° 37' 54.728
13,100.0	90.00	179.10	9,018.0	-3,978.1	726.9	389,188.90	758,625.75	32° 4' 4.867 N	103° 37' 54.717
13,200.0	90.00	179.10	9,018.0	-4,078.1	728.5	389,088.92	758,627.33	32° 4' 3,878 N	103° 37' 54,706
13,300.0	90.00	179,10	9,018.0	-4,178.1	730.0	388,988.94	758,628.91	32° 4' 2.888 N	103° 37' 54.695
13,400.0	90.00	179.10	9,018.0	-4,278.1	731.6	388,888.95	758,630.49	32° 4' 1.899 N	103° 37' 54.685
13,500.0	90.00	179.10	9,018.0	-4,378.1	733.2	388,788.97	758,632.06	32° 4' 0.909 N	103° 37' 54.674
13,600.0	90.00	179.10	9,018.0	-4,478.0	734.8	388,688.98	758,633.64	32° 3' 59.920 N	103° 37' 54,66
13,700.0	90.00	179.10	9,018.0	-4,578.0	736.4	388,589.00	758,635.22	32° 3' 58.930 N	103° 37' 54.652
13,800.0	90.00	179.10	9,018.0	-4,678.0	737.9	388,489.02	758,636.80	32° 3′ 57.941 N	103° 37' 54.64
13,900.0	90.00	179.10	9,018.0	-4,778.0	739.5	388,389.03	758,638.38	32° 3' 56.951 N	103° 37' 54.63
14,000.0	90.00	179.10	9,018.0	-4,878.0	741,1	388,289.05	758,639.95	32° 3' 55.962 N	103° 37' 54.620
14,100.0	90.00	179.10	9,018.0	-4,978.0	742.7	388,189.07	758,641.53	32° 3′ 54.972 N	103° 37' 54.60
14,200.0	90.00	179.10	9,018.0	-5,078.0	744.2	388,089.08	758,643.11	32° 3′ 53.983 N	103° 37' 54.598
14,300.0	90.00	179.10	9,018.0	-5,178.0	745.8	387,989.10	758,644.69	32° 3′ 52.993 N	103° 37' 54.588
14,400.0	90.00	179.10	9,018.0	-5,277.9	747.4	387,889.11	758,646.27	32° 3′ 52.004 N	103° 37' 54.57
14,500.0	90.00	179.10	9,018.0	-5,377.9	749.0	387,789.13	758,647.84	32° 3′ 51.014 N	103° 37' 54.566
14,600.0	90.00	179.10	9,018.0	-5,477.9	750.6	387,689.15	758,649.42	32° 3′ 50.025 N	103° 37' 54.55
14,700.0	90.00	179.10	9,018.0	-5,577.9	752.1	387,589.16	758,651.00	32° 3′ 49.035 N	103° 37' 54.54
14,800.0	90.00	179.10	9,018.0	-5,677.9	753.7	387,489.18	758,652.58	32° 3' 48.046 N	103° 37' 54.534
14,900.0	90.00	179.10	9,018.0	-5,777.9	755.3	387,389.20	758,654.16	32° 3' 47.056 N	103° 37' 54.523
15,000.0	90.00	179.10	9,018.0	-5,877.9	756.9	387,289.21	758,655.73	32° 3' 46.067 N	103° 37' 54.512
15,100.0	90.00	179.10	9,018.0	-5,977.9	758.4	387,189.23	758,657.31	32° 3' 45.077 N	103° 37' 54.50
15,100.0	90.00	179.10	9,018.0	-6,077.8	760.0	387,089.24	758,658.89	32° 3' 44.088 N	103° 37' 54.49
15,200.0	90.00	179.10	9,018.0	-6,177.8	761.6	386,989.26	758,660.47	32° 3' 43.098 N	103° 37' 54.480
	90.00	179.10	9,018.0	-6,277.8	763.2	386,889.28	758,662.05	32° 3' 42.109 N	103° 37' 54.469
15,400.0 15,500.0	90.00	179.10	9,018.0	-6,277.8 -6,377.8	764.8	386,789.29	758,663.62	32° 3' 41.119 N	103° 37' 54.458
		179.10	9,018.0	-6,377.8 -6,477.8	766.3	386,689.31	758,665.20	32° 3' 40.130 N	103° 37' 54.447
15,600.0	90.00				760.3 767.9		758,666.78	32° 3' 39.140 N	103° 37′ 54.437
15,700.0	90.00	179.10	9,018.0	-6,577.8 6,677.8		386,589.32	· ·		
15,800.0	90.00	179.10	9,018.0	<i>-</i> 6,677.8	769.5	386,489.34	758,668.36	32° 3' 38.151 N	103° 37' 54.426

### Planning Report - Geographic

Database:

Old

Company:

BTA Oil Producers, LLC

Project: Site:

Lea County, NM (NAD 83) Mesa Sec 1 & 12, T26S, R32E

Well: Wellbore: Mesa #42H Wellbore #1 Design #1

Local Co-ordinate Reference:

TVD Reference: MD Reference:

North Reference:

**Survey Calculation Method:** 

Well Mesa #42H

WELL @ 3336.0usft (Original Well Elev) WELL @ 3336.0usft (Original Well Elev)

. 1. M. a. . . . . Marillani Craessissaanina Charlesis Caessis Caessis

Grid

Minimum Curvature

ign:	Desig	ın #1		-		-			
nned Survey									
Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Map Northing (usft)	Map Easting (usft)	Latitude	Longitude
15,900.0	90.00	179,10	9,018.0	-6,777.8	771.1	386,389.36	758,669.94	32° 3' 37.161 N	103° 37' 54.415
16,000.0	90.00	179.10	9.018.0	-6,877.7	772.7	386,289,37	758,671.51	32° 3' 36.172 N	103° 37' 54.404
16,100.0	90.00	179.10	9,018.0	-6,977.7	774.2	386,189.39	758,673.09	32° 3' 35.182 N	103° 37' 54.394
16,200.0	90.00	179.10	9,018.0	-7,077.7	775.8	386,089.41	758,674.67	32° 3' 34.193 N	103° 37' 54.38
16,300.0	90.00	179.10	9,018.0	-7.177.7	777,4	385,989.42	758,676,25	32° 3' 33.203 N	103° 37' 54,37;
16,400.0	90.00	179.10	9,018.0	-7,277.7	779.0	385,889.44	758,677.83	32° 3' 32.214 N	103° 37' 54.36
16,500.0	90.00	179.10	9,018.0	-7,377.7	780.5	385,789.45	758,679.40	32° 3' 31.224 N	103° 37' 54.35
16,600.0	90.00	179.10	9,018.0	-7,477.7	782.1	385,689,47	758,680,98	32° 3' 30.235 N	103° 37' 54.34
16,700.0	90.00	179.10	9,018.0	-7,577.7	783,7	385,589.49	758,682.56	32° 3' 29.245 N	103° 37' 54,32
16,800.0	90.00	179.10	9,018.0	-7,677.6	785.3	385,489.50	758,684,14	32° 3' 28.256 N	103° 37' 54.31
16,900.0	90.00	179.10	9,018.0	-7,777.6	786.9	385,389.52	758,685.72	32° 3' 27.266 N	103° 37' 54.30
17,000.0	90.00	179.10	9,018.0	-7,877.6	788.4	385,289.53	758,687.29	32° 3' 26.277 N	103° 37' 54.29
17,100.0	90.00	179.10	9,018.0	-7,977.6	790.0	385,189.55	758,688.87	32° 3' 25.287 N	103° 37' 54.28
17,200.0	90.00	179.10	9,018.0	-8,077,6	791.6	385,089.57	758,690,45	32° 3' 24,298 N	103° 37' 54,27
17,300.0	90.00	179.10	9,018.0	-8,177.6	793.2	384,989.58	758,692.03	32° 3' 23.308 N	103° 37' 54.26
17,400.0	90.00	179.10	9,018.0	-8,277.6	794.7	384,889.60	758,693.61	32° 3' 22.319 N	103° 37' 54.25
17,500.0	90.00	179,10	9,018,0	-8,377.6	796.3	384,789.62	758,695,18	32° 3' 21.329 N	103° 37' 54,24
17,600.0	90.00	179.10	9,018.0	-8,477.5	797.9	384,689.63	758,696.76	32° 3' 20.340 N	103° 37' 54.23
17,700.0	90.00	179.10	9,018.0	-8,577.5	799.5	384,589.65	758,698.34	32° 3' 19.350 N	103° 37' 54.22
17,800.0	90.00	179.10	9,018.0	-8,677.5	801.1	384,489.66	758,699,92	32° 3' 18.361 N	103° 37' 54.21
17,900.0	90.00	179.10	9,018.0	-8,777.5	802.6	384,389.68	758,701.50	32° 3′ 17.371 N	103° 37' 54.19
18,000.0	90.00	179.10	9,018.0	-8,877.5	804.2	384,289.70	758,703.07	32° 3' 16.382 N	103° 37' 54.18
18,100.0	90.00	179.10	9,018.0	-8,977.5	805.8	384,189.71	758,704.65	32° 3' 15.392 N	103° 37' 54.17
18,200.0	90.00	179.10	9,018.0	-9,077.5	807.4	384,089.73	758,706.23	32° 3' 14.403 N	103° 37' 54.16
18,300.0	90.00	179.10	9,018.0	-9,177.5	808.9	383,989.74	758,707.81	32° 3' 13.413 N	103° 37' 54,15
18,400.0	90.00	179.10	9,018.0	-9,277.4	810.5	383,889.76	758,709.39	32° 3' 12.424 N	103° 37' 54.14
18,500.0	90.00	179.10	9,018.0	-9,377.4	812.1	383,789.78	758,710.96	32° 3' 11.434 N	103° 37' 54.13
18,600.0	90.00	179.10	9,018.0	-9,477.4	813.7	383,689.79	758,712.54	32° 3' 10.445 N	103° 37' 54.12
18,700.0	90.00	179.10	9,018.0	-9,577.4	815.3	383,589.81	758,714.12	32° 3' 9.455 N	103° 37' 54.11
18,800.0	90.00	179.10	9,018.0	-9,677.4	816.8	383,489.83	758,715.70	32° 3' 8.466 N	103° 37' 54.10
18,900.0	90.00	179.10	9,018.0	-9,777.4	818.4	383,389.84	758,717.28	32° 3′ 7.476 N	103° 37′ 54.09
19,000.0	90.00	179.10	9,018.0	-9,877.4	820.0	383,289.86	758,718.85	32° 3' 6.487 N	103° 37′ 54.08
19,100.0	90.00	179.10	9,018.0	-9,977.4	821.6	383,189.87	758,720.43	32° 3' 5.497 N	103° 37' 54.07
19,200.0	90.00	179.10	9,018.0	-10,077.3	823.2	383,089.89	758,722.01	32° 3' 4.508 N	103° 37' 54.05
19,300.0	90.00	179.10	9,018.0	-10,177.3	824.7	382,989.91	758,723.59	32° 3′ 3.518 N	103° 37' 54.04
19,400.0	90.00	179,10	9,018.0	-10,277.3	826.3	382,889.92	758,725.17	32° 3' 2.529 N	103° 37' 54.038
19,484.3	90.00	179.10	9,018.0	-10,361.6	827.6	382,805.60	758,726.50	32° 3' 1,694 N	103° 37' 54.029

Design Targets									
Target Name - hit/miss target - Shape	Dip Angle	Dip Dir.	TVD (usft)	+N/-S (usft)	+E/-W (usft)	Northing (usft)	Easting (usft)	Latitude	Longitude
Mesa #42H BHL - plan hits target cent - Point	0.00 er	0.00	9,018.0	-10,361.6	827.6	382,805.60	758,726.50	32° 3′ 1.694 N	103° 37' 54.029 W

### **Uncontrolled Copy**

### **Install the Casing Head**


- Examine the WFT Casing Head. Verify the following:
  - · bore is clean and free of debris
  - seal areas, threads and ring grooves are clean and undamaged
  - o-ring is properly installed, clean and undamaged
  - all peripheral equipment is intact and undamaged
- 2. Measure the pocket depth of the Casing Head and record this dimension.
- 3. Run the surface casing and cement as required.
- Determine the required elevation of the Casing Head as required by the Drilling Supervisor.
- Use the following calulation to determine the correct final cut location of the surface casing.


#### X = Pocket Depth

### Y = Overall Casing Head Height

# Y-X = Distance from correct elevation point to surface casing cutoff height.

- Lift the riser assembly high enough to rough cut the surface casing a minimum of 12" above the anticipated final cut location, if applicable.
- Remove the spent portion of surface casing and the riser assembly and set aside.
- 8. Determine the correct elevation for the wellhead assembly.
- Rough cut the surface casing a minimum of 12" above the final cut location.
- Cut the conductor pipe a comfortable level below the final cut location of the surface casing.

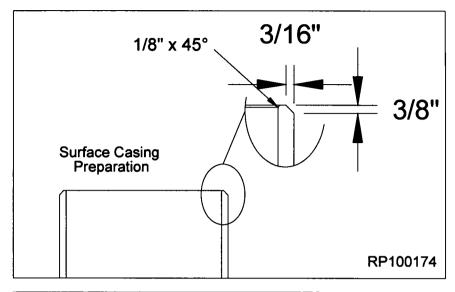

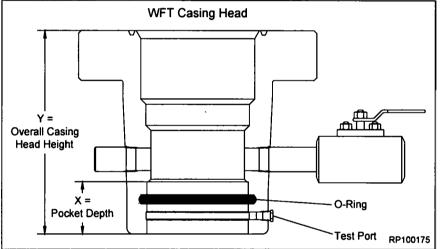

11. Final cut the surface casing at the correct elevation.

**NOTE:** Ensure the cut on the surface casing is level as this will determine the orientation of the remainder of the wellhead equipment.

- 12. Bevel the surface casing with a 3/16" x 3/8" bevel and remove any sharp edges from the OD of the casing.
- 13. Break a 1/8" x 45° bevel on the ID of the surface casing.

<b>\</b>	WFT Casing Head (Slip on Weld with O-Ring)	Approved By:	Reviewed By:	RP-001
Weatherford	Running Procedure	BO	Benco J. Ross	Rev 0
5-2-GL-GL-WES-00052		Date: Oct 21, 2010	Date: Oct 21, 2010	Page 1


### **Uncontrolled Copy**

## **Install the Casing Head**

 Wipe the ID of the o-ring of the Casing Head with a light coat of oil or grease.

**NOTE:** Excessive oil or grease will prevent a positive seal from forming.

- 15. Lower the Casing Head over the surface casing stub to a positive stop.
- 16. Remove the fitting from the test port and set aside.
- Orient the Casing Head as per the Drilling Superintendents instructions ensuring the face of the Casing Head is level and two holed to the drilling rig substructure.
- Weld and test the surface casing to the Casing Head as per the REC-OMMENDED FIELD WELDING PROCEDURE located in the back of this manual.
- Once all welding and testing is completed, replace the fitting into the open port and close the valve on the Casing Head.

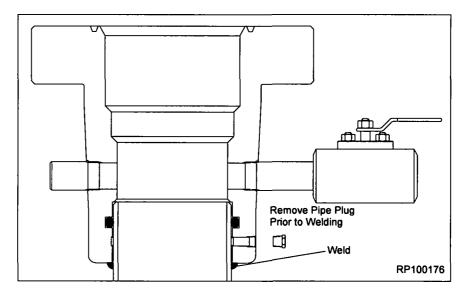

RP-001	Reviewed By:	Approved By:
Rev 0	Benco T. Ross	B
Page 2	Date: Oct 21, 2010	Date: Oct 21, 2010

WFT Casing Head (Slip on Weld with O-Ring) Running Procedure



### **Uncontrolled Copy**

# Recommended Procedure for Field Welding Pipe to Wellhead Parts for Pressure Seal

 Introduction and Scope. The following recommended procedure has been prepared with particular regard to attaining pressure-tight weld when attaching casing heads, flanges, etc., to casing. Although most of the high strength casing used (such as N-80) is not normally considered field weldable, some success may be obtained by using the following or similar procedures.

Caution: In some wellheads, the seal weld is also a structural weld and can be subjected to high tensile stresses. Consideration must therefore be given by competent authority to the mechanical properties of the weld and its heat affected zone.

- a. The steels used in wellhead parts and in casing are high strength steels that are susceptible to cracking when welded. It is imperative that the finished weld and adjacent metal be free from cracks. The heat from welding also affects the mechanical properties. This is especially serious if the weld is subjected to service tension stresses.
- b. This procedure is offered only as a recommendation. The responsibility for welding lies with the user and results are largely governed by the welder's skill. Weldability of the several makes and grades of casing varies widely, thus placing added responsibility on the welder. Transporting a qualified welder to the job, rather than using a less-skilled man who may be at hand, will, in most cases, prove economical. The responsible operating representative should ascertain the welder's qualifications and, if necessary, assure himself by instruction or demonstration, that the welder is able to perform the work satisfactorily.
- 2. Welding Conditions. Unfavorable welding conditions must be avoided or minimized in every way possible, as even the most skilled welder cannot successfully weld steels that are susceptible to cracking under adverse working conditions, or when the work is rushed. Work above the welder on the drilling floor should be avoided> The weld should be protected from dripping mud, water, and oil and from wind, rain, or other adverse weather conditions. The drilling mud, water, or other fluids must be lowered in the casing and kept at a low level until the weld has properly cooled. It is the responsibility of the user to provide supervision that will assure favorable working conditions, adequate time, and the necessary cooperation of the rig personnel.
- **3. Welding.** The welding should be done by the shielded metal-arc or other approved process.

- Filler Metals. For root pass, it's recommended to use E6010, E6011 (AC), E6019 or equivalent electrodes. The E7018 or E7018-A1 electrodes may also be used for root pass operations but has the tendency to trap slag in tight grooves. The E6010, E6011 and E6019 offer good penetration and weld deposit ductility with relatively high intrinsic hydrogen content. Since the E7018 and E7018-A1 are less susceptible to hydrogen induced cracking, it is recommended for use as the filler metal for completion of the weld groove after the root pass is completed. The E6010, E6011 (AC), E6019, E7018 and E7018-A1 are classified under one of the following codes AWS A5.1 (latest edition): Mild Steel covered electrodes or the AWS A5.5 (latest edition): Low Alloy Steel Covered Arc-Welding Electrodes. The low hydrogen electrodes, E7018 and E7018-A1, should not be exposed to the atmosphere until ready for use. It's recommended that hydrogen electrodes remain in their sealed containers. When a job arises, the container shall be opened and all unused remaining electrodes to be stored in heat electrode storage ovens. Low hydrogen electrodes exposed to the atmosphere, except water, for more than two hours should be dried 1 to 2 hours at 600°F to 700 °F (316°C to 371 °C) just before use. It's recommended for any low hydrogen electrode containing water on the surface should be scrapped.
- 5. Preparation of Base Metal. The area to be welded should be dry and free of any paint, grease/oil and dirt. All rust and heat-treat surface scale shall be ground to bright metal before welding.
- 6. Preheating. Prior to any heating, the wellhead member shall be inspected for the presence of any o-rings or other polymeric seals. If any o-rings or seals are identified then preheating requires close monitoring as noted in paragraph 6a. Before applying preheat, the fluid should be bailed out of the casing to a point several inches (>6" or 150 mm) below the weld joint/location. Preheat both the casing and wellhead member for a minimum distance of three (3) inches on each side of the weld joint using a suitable preheating torch in accordance with the temperatures shown below in a and b. The preheat temperature should be checked by the use of heat sensitive crayons. Special attention must be given to preheating the thick sections of wellhead parts to be welded, to insure uniform heating and expansion with respect to the relatively thin casing.
  - a. Wellhead members containing o-rings and other polymeric seals have tight limits on the preheat and interpass temperatures. Those temperatures must be controlled at 200°F to 325°F or 93 °C to 160°C and closely monitored to prevent damage to the o-ring or seals.
  - b. Wellhead members not containing o-rings and other polymeric seals should be maintained at a preheat and interpass temperature of 400°F to 600°F or 200°C to 300°C.

<b>\</b>	WFT Casing Head (Slip on Weld with O-Ring)	Approved By:	Reviewed By:	RP-001
Weatherford	Running Procedure	2	Benco T. Roar	Rev 0
5-2-GL-GL-WES-00052		Date: Oct 21, 2010	Date: Oct 21, 2010	Page 3

### **Uncontrolled Copy**

# Recommended Procedure for Field Welding Pipe to Wellhead Parts for Pressure Seal (continued)

- 7. Welding Technique. Use a 1/8 or 5/32-inch (3.2 or 4.0 mm) E6010 or E7018 electrode and step weld the first bead (root pass); that, weld approximately 2 to 4 inches (50 to 100 mm) and then move diametrically opposite this point and weld 2 to 4 inches (50 to 100 mm) halfway between the first two welds, move diametrically opposite this weld, and so on until the first pass is completed. This second pass should be made with a 5/32-inch (4.0 mm) low hydrogen electrode of the proper strength and may be continuous. The balance of the welding groove may then be filled with continuous passes without back stepping or lacing, using a 3/16-inch (4.8 mm) low hydrogen electrode. All beads should be stringer beads with good penetration. There should be no undercutting and weld shall be workmanlike in appearance.
  - **a.** Test ports should be open when welding is performed to prevent pressure buildup within the test cavity.
  - **b.** During welding the temperature of the base metal on either side of the weld should be maintained at 200 to 300°F (93 to 149°C).
  - c. Care should be taken to insure that the welding cable is properly grounded to the casing, but ground wire should not be welded to the casing or the wellhead. Ground wire should be firmly clamped to the casing, the wellhead, or fixed in position between pipe slips. Bad contact may cause sparking, with resultant hard spots beneath which incipient cracks may develop. The welding cable should not be grounded to the steel derrick, nor to the rotary-table base.
- 8. Cleaning. All slag or flux remaining on any welding bead should be removed before laying the next bead. This also applies to the completed weld.
- Defects. Any cracks or blow holes that appear on any bead should be removed to sound metal by chipping or grinding before depositing the next bead.
- 10. Postheating. Post-heating should be performed at the temperatures shown below and held at that temperature for no less than one hour followed by a slow cooling. The post-heating temperature should be in accordance with the following paragraphs.
  - a. Wellhead members containing o-rings and other polymeric seals have tight limits on the post-heating temperatures. Those temperatures must be controlled at 250°F to 300°F or 120 °C to 150°C and closely monitored to prevent damage to the o-ring or seals.
  - b. Wellhead members not containing o-rings and other polymeric seals should be post-heated at a temperature of 400°F to 600°F or 200°C to 300°C.

- 11. Cooling. Rapid cooling must be avoided. To assure slow cooling, welds should be protected from extreme weather conditions (cold, rain, high winds, etc.) by the use of suitable insulating material. (Specially designed insulating blankets are available at many welding supply stores.) Particular attention should be given to maintaining uniform cooling of the thick sections of the wellhead parts and the relatively thin casing, as the relatively thin casing will pull away from the head or hanger if allowed to cool more rapidly. The welds should cool in air to less than 200°F (93°C) (measured with a heat sensitive crayon) prior to permitting the mud to rise in the casing.
- 12. Test the Weld. After cooling, test the weld. The weld must be cool otherwise the test media will crack the weld. The test pressure should be no more than 80% of the casing collapse pressure.

Test Media		
Acceptable Medias	Unacceptable Medias	
Water Water Soluable Oil Inert Gas •Nitrogen •Argon Gas	Oxygen Acetylene Hydraulic Oil Motor Oil Brake Fluid	

RP-001	Reviewed By:	Approved By:
Rev 0	Benco T. Ross	PA C
Page 4	Date: Oct 21, 2010	Date: Oct 21, 2010

WFT Casing Head (Slip on Weld with O-Ring) Running Procedure






Weatherford®

# Wellhead Field Service Manual

# WFT-SB Wellhead System Running Procedure

**Publication: SM-11-1** 

Release Date: December 2014

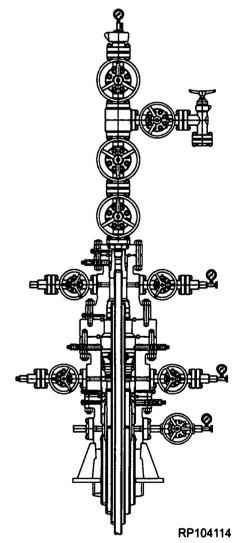

©2014 Weatherford International Ltd. All Rights Reserved

<b>*</b>		Prepared By:	Reviewed By:	Approved By:	SM-11-1
Weatherford	Field Service Manual	Marion Roberton	Bruce Ross	Manuel Zaragoza	Rev WIP
Tycaulci lui u	Maildai	Marion Robertson	Bruce Ross	Manuel Zaragoza	Da 4 6 0 4
5-3-GL-GL-WES-00XXX		Dec 2014	Dec 2014	Dec 2014	Page 1 of 24

#### **Table of Content**


WFT-Split Bowl (SB) Wellhead System	
Wellhead System Assembly Drawing	3
Running Procedure	
Casing Head/Spool Assembly Rig-Up and Installation	4
Testing the BOP	5
Running and Retrieving the Long Bowl Protector	3
Running the Bowl Protector Prior to Drilling	6
Retrieving the Bowl Protector After Drilling	7
Hanging Off the Intermediate Casing	7
Hanging Off the Intermediate Casing- Contingency Completion	9
Installation of the Pack-Off Bushing and Energizing the Seals	10
Installation	10
Energizing the Seal	12
Retesting the BOP Stack	14
Running and Retrieving the Short Bowl Protector	15
Running Short Bowl Protector	15
Retrieving the Short Bowl Protector	16
Running the Production Casing	16
Installation of the Slip-Type Casing Hanger Under the BOP Stack	16
Installation of the Slip-Type Casing Hanger Through the BOP Stack	17
Hanging Off the Production Casing	18
Installation and Testing the Tubing Spool Assembly	20
Installation	20
Testing the Secondary Seal and Flange Connection	20
Testing the BOP	21
Hanging Off the Production Tubing String	22
Installing and Testing of the Production Tree	23
Installation	23
Testing	24

<b>~</b>
Weatherford
5-3-GL-GL-WES-00XXX

Field Services
Manual

Prepared By:	epared By: Reviewed By:		Prepared By: Reviewed By: Approved By:		SM-13-1
Marion Robertson	Brad Franks	Manual Zaragoza	Rev WIP		
Marion Robertson	Brad Franks	Manual Zaragoza	Page 2 of 24		
Dec 2014	Dec 2014	Dec 2014	Faye 2 01 24		

#### WFT Split Bowl (SB) Wellhead System

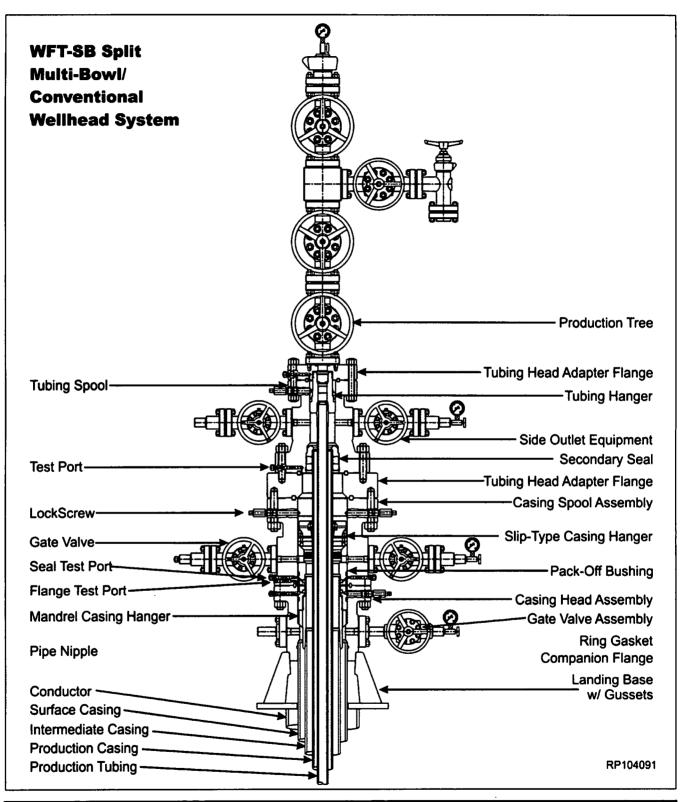

<b>*</b>	Field Comics	Prepared By:	Reviewed By:	Approved By:	SM-13-1
Monthorford	Field Service Manual	Mason Robotson	Brad Franks	Manual Zaragoza	Rev WIP
Weatherford	Manual	Marion Robertson	Brad Franks	Manual Zaragoza	Page 3 of 24
5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014	- Fage 3 01 24

#### WFT Split Bowl (SB) Multi-Bowl/Conventional Wellhead System (Continued)

### WFT-SB Casing Head/Spool Assembly Rig Up and Installation


 Determine the correct elevation for the wellhead system, and cut the conductor pipe at a comfortable elevation, below the surface casing final cut.

#### NOTE

Ensure that the cut on the conductor is level, as this will determine the orientation of all remaining wellhead equipment.

- 2. Remove any excess conductor pipe and set aside.
- Grind the conductor pipe and remove any sharp edges, ensuring that the conductor pipe cut is level.
- Run the surface casing to the required depth and cement casing in place.
   Allow the cement to set.
- Lift the blow-out preventer (BOP) or diverter and prepare to cut off the surface casing at a sufficient height above the cellar deck to facilitate the installation of the WFT-SB Casing Head/Spool Assembly with Base Plate.
- Once the surface casing is released from the rig floor, cut it approximately 12 inches (or more) above the final cut location.
- 7. Remove the excess surface casing, and the BOP or diverter, and set aside.
- Bevel the surface casing outer diameter (3/16" x 3/8") and inner diameter (1/8" x 45 degrees). Remove any sharp edges.

- 9. Examine the Casing Head with Slip-On Weld (SOW) bottom prep. Verify the following:
- O-ring seal, bore, ports and exposed ring grooves are clean and in good condition.
- Test fittings, studs and nuts, valves, flanges and bull plugs are intact and in good condition.

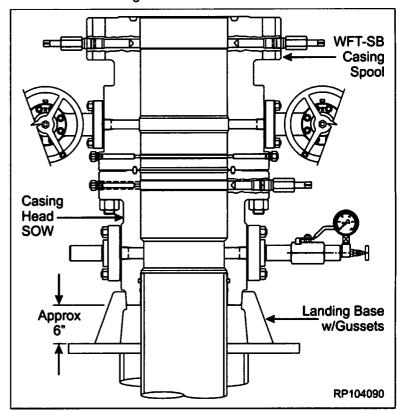

- Determine the correct elevation for the wellhead assembly.
   Measure depth of the surface casing socket in SOW with Oring bottom prep.
- 11. Lightly lubricate the casing stub with an oil or light grease.



Excessive oil or grease will prevent a positive seal from forming.

12. Align and level the WFT-SB Casing Head/Spool Assembly over the casing stub, orienting the outlets to drilling equipment, per the drilling supervisor's direction.

₩
Weatherford
5-3-GL-GL-WES-00XXX

Field Service Manual

Prepared By: Reviewed By:		Approved By:	SM-13-1
Moscon Robertson	Mater Rebets Brad Franks		Rev WIP
Marion Robertson	Brad Franks	Manual Zaragoza	Page 4 of 24
December 2014	December 2014	December 2014	7 Fage 4 01 24

- 14. Slowly and carefully lower the assembly over the casing stub until the stub bottoms in the casing socket.
- 15. Remove the test fitting from the casing head test port, and set aside.
- **16.** Ensure that the WFT-SB Casing Head/Spool Assembly is plumb and level.
- 17. Weld and test the surface casing using the recommended welding procedure located in the Appendices Section of this manual.

#### **Testing the BOP Stack**

- Examine the Test Plug/Running & Retrieval Tool. Verify the following:
- Elastomer seals, threads and plugs are intact and in good condition.
- Drill pipe threads are correct size, clean and in good condition.
- Install a new, appropriately sized ring gasket in the ring groove of the WFT-SB Spool and make up the BOP stack.

#### NOTE

Immediately after make-up of the BOP stack and periodically during drilling of hole for the casing string, the BOP stack (flanged connections and rams) must be tested.

3. Orient the test plug with elastomer down/ACME threads up, and make up a joint of drill pipe to the test plug.


#### NOTE

If pressure is to be supplied through the drill pipe, remove the pipe plug from the weep port.



Ensure that the test plug elastomer is down and Acme threads are up when testing.

- 4. Fully retract all lockscrews in the entire WFT-SB casing head/spool assembly.
- 5. Lubricate the test plug elastomer seal with a light oil or grease.
- 6. Lower the test plug through the BOP stack into the WFT-SB assembly, until it lands on the casing head load shoulder.

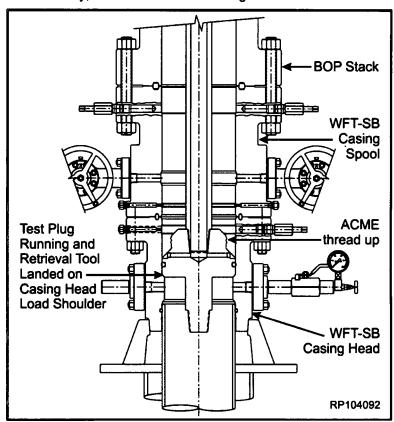

<b>~</b>	Field Comiles	Prepared By:	Reviewed By:	Approved By:	SM-13-1
Weethordord	Field Service Manual	Hosen Robertson	Brad Franks	Manual Zaragoza	Rev WIP
Weatherford	Manual	Marion Robertson	Brad Franks	Manual Zaragoza	Page 5 of 24
5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014	Fage 5 01 24

- Open lower casing head side outlet valve. Monitor any leakage past the test plug seal.
- 8. Close the BOP rams on the drill pipe, and test to **5,000 psi or as required by the drilling supervisor**.
- 9. After a satisfactory test is achieved, release pressure and open the rams.
- 10. Remove as much fluid from the BOP stack as possible.
- 11. Retrieve the test plug assembly slowly to avoid damage to the seal.
- Close all outlet valves on WFT-SB Casing Head/Spool Assembly.
- 13. Repeat Steps 1 thru 12, as required during drilling of the hole.

### Running and Retrieval of the Long Bowl Protector

#### NOTE

Always use a bowl protector while drilling to protect wellhead load shoulders from damage by drill bit or rotating drill pipe. The bowl protector must be retrieved prior to running the casing string.


### Running in the Bowl Protector prior to Drilling

- Examine the Long Bowl Protector. Verify the following:
  - Bore drift is correct size, clean, in good condition, and free of debris
  - Threads are clean and undamaged
  - O-ring seals are properly installed, clean, and undamaged.

- 2. Examine the Bowl Protector Running/Retrieval Tool. Verify the following:
  - Threads are clean, undamaged and free of debris
  - Ports are clean and unobstructed.
  - Drill Pipe threads are correct size, clean and in good condition.
- 3. Orient the Bowl Protector Running Tool with Acme threads down.



Ensure that the left hand (LH) Acme threads are down prior to engaging Bowl Protector Running Tool into Long Bowl Protector.

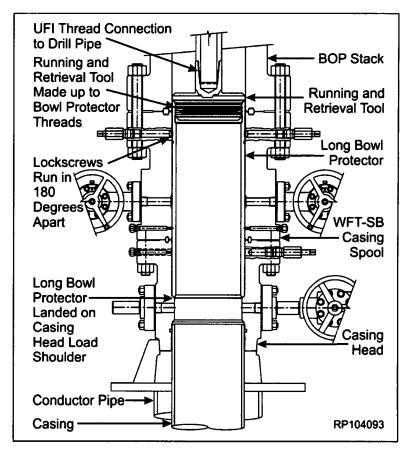

<b>~</b>
Weatherford
5-3-GL-GL-WES-00XXX

Field	Service
Manu	al

	Prepared By: Reviewed By:		Approved By:	SM-13-1
	Brad Franks		Manual Zaragoza	Rev WIP
į	Marion Robertson	Brad Franks	Manual Zaragoza	Page 6 of 24
	December 2014	December 2014	December 2014	rage 6 01 24

- 4. Make-up a drill pipe joint to the Running Tool.
- Thread Running Tool into the Long Bowl Protector, rotating two turns counterclockwise.
- Verify that all lockscrews in the WFT-SB Casing Head/Spool Assembly are fully retracted.
- Slowly lower the Running Tool/Bowl Protector Assembly through the BOP stack and into the WFT-SB Casing Head/Spool Assembly, until it lands securely on the casing head load shoulder.
- On WFT-SB Casing Spool, run in two Lockscrews ("snug" tight ONLY), 180 degrees apart, to hold Bowl Protector in place.



Do NOT over tighten the lockscrews, as this will cause damage to the Bowl Protector and the lockscrews.

- Remove the running tool from the bowl protector, by rotating the drill pipe clockwise two turns while lifting straight up.
- Drill out and prepare to run the casing string per the drilling supervisor's instruction.

### Retrieving the Bowl Protector after Drilling

- Make-up the retrieval tool to the drill pipe, with Acme threads down.
- Slowly lower the retrieval tool through the BOP Stack into the Bowl Protector.
- 3. Rotate the retrieval Tool counterclockwise, two turns, to engage with bowl protector Acme threads.

Fully retract both lockscrews on the WFT-SB casing spool, and retrieve the bowl protector.

#### NOTE

Ensure that all lockscrews in both the upper flange (casing spool) and lower flange (casing head) of the wellhead Assembly are fully retracted from well bore.

5. Remove the bowl protector and the running and retrieval tool from the drill floor.

#### Hanging off the Intermediate Casing

1. Run the intermediate casing as required and space out appropriately for the mandrel casing hanger.

#### NOTE

If the intermediate casing becomes stuck and the mandrel casing hanger cannot be landed, refer to STAGE 4B.

- 2. Examine the WFT-SBD-SN Mandrel Casing Hanger. Verify the following:
  - Bore drift is correct size, clean and free of debris
  - · All threads are clean and undamaged.
  - Flow-By flutes are clear and unobstructed.
  - Slick Neck seal area is clean and undamaged.
- 3. Examine the Mandrel Casing Hanger Running Tool. Verify the following:
  - Threads are clean and in good condition.
  - O-ring seals are clean and undamaged.
- 4. Thread the mandrel hanger onto the last joint of casing to be run. Torque the connection thread to manufacturer's optimum "make-up" torque value.
- Make up a landing joint to the top of the running tool.
   Torque the connection to thread manufacturer's maximum "make-up" torque valve.



If Steps 4 and 5 were performed prior to being shipped to location, the hanger running tool should be backed off and made back up to ensure it will back off freely.

<b>**</b>	Weatherford Field Service Manual	Prepared By:	Reviewed By:	Approved By:	SM-13-1
Moothorford		Motion Robotson	Brad Franks	Manual Zaragoza	Rev WIP
vveatnerioru	Maridai	Marion Robertson	Brad Franks	Manual Zaragoza	Page 7 of 24
5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014	Fage 7 01 24

 Liberally lubricate the outer diameter of the hanger neck and inner diameter of the running tool O-ring seals with a light oil or grease.



Do NOT use pipe dope or other metal based compounds. This will cause galling.


7. Maintaining a neutral weight, rotate the hanger running tool with chain tongs, first clockwise until a thread "jump" can be felt, then counterclockwise, approximately eight turns, to a positive stop, and then back off (clockwise) one quarter (1/4) turn.



Do NOT torque the running tool to the casing hanger connection. Do NOT back off more than one quarter (1/4) turn.

- 8. Remove the flush fitting hex head pipe plug from the outer diameter of the running tool and attach a test pump.
- Apply hydraulic test pressure to 5,000 psi and hold for 15 minutes or as required by the drilling supervisor.
- Upon completion of a successful test, bleed off test pressure through the test pump and remove the pump. Replace the pipe plug.
- Locate indicator groove machined in outer diameter of Running Tool, coat with white paint.

- 12. Verify that all lockscrews in the WFT-SB casing head/casing spool assembly are fully retracted.
- Slowly and carefully lower the mandrel hanger through the BOP stack, and land the hanger onto the casing head load shoulder.
- 14. Slack off weight on the casing.
- 15. Check that the well is stable and no pressure buildup or mud flow is occurring.

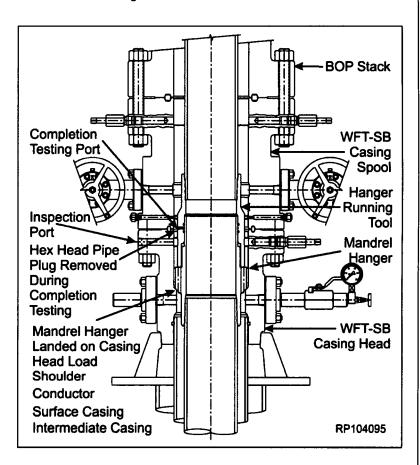

<b>~</b>	Field Comice	Prepared By:	Reviewed By:	Approved By:	SM-13-1
Weatherford Manual	Field Service	Mason Robotson	Brad Franks	Manual Zaragoza	Rev WIP
	Mailuai	Marion Robertson	Brad Franks	Manual Zaragoza	Page 8 of 24
5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014	Page 6 01 24

- 16. Drain the BOP stack through the casing head side outlet valves.
- 17. Remove the pipe plug from the casing head flange port marked "Inspection Port."
- 18. Visually verify that the running tool groove is in the center of the inspection port, and that the mandrel hanger has landed properly.
- 19. Reinstall the pipe plug and tighten securely.
- 20. Place a paint mark on the landing joint level with the rig floor, and cement casing as required.

#### NOTE

If the casing is to be reciprocated during cementing, it is advisable to pick up the mandrel hanger a minimum of eight feet above the landing point. Place a mark on the landing joint, level with the rig floor, and then reciprocate above that point. If at any time resistance is felt, land the mandrel casing hanger immediately.

21. Retrieve the hanger running tool and landing joint by rotating landing joint clockwise (to the right), fourteen full turns.

Hanging off Intermediate Casing – Contingency Completion

#### NOTE

The following procedure should ONLY be followed if the intermediate casing should become stuck in the hole. If the casing did NOT get stuck and is successfully hung off with the mandrel casing hanger, skip this stage.

- Cement the intermediate casing in accordance with the program, taking returns through the flow-by flutes of the mandrel casing hanger as required.
- 2. Drain the casing head bowl through the side outlet.
- 3. Separate the WFT-SB casing spool from the casing head.
- 4. Pull up on WFT-SB casing spool and suspend it above casing head, high enough to install a WFT-21 Slip Type Casing Hanger.
- 5. Wash out as required.
- 6. Examine the WFT-21 slip type casing hanger. Verify the following:
  - Hanger is correct size, clean and undamaged.
  - Slip segments are sharp and in proper position.
  - All screws are in place.
- 7. Remove the latch screw to open the slip type hanger.
- 8. Place two boards on the casing head flange, against the casing, to support the hanger.
- 9. Wrap the hanger around the casing and replace the latch
- 10. Prepare to lower the hanger into the casing head bowl.
- 11. Grease the WFT-21 slip type casing hanger body and remove the slip retaining cap screws.
- 12. Remove the boards and allow the hanger to slide down into the casing head.

•	Field Coming	Prepared By:	Reviewed By:	Approved By:	SM-13-1
Field Service  Monthorford Manual	Marcon Robertson	Brad Franks	Manual Zaragoza	Rev WIP	
Weatherford	Manaa	Marion Robertson	Brad Franks	Manual Zaragoza	Page 9 of 24
5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014	raye 9 01 24

13. Once the hanger has landed securely on the casing head bowl load shoulder, pull tension on the casing to the desired hanging weight, and then slack off.

#### NOTE

A sharp decrease on weight indicator will signify that the hanger has taken weight. If this does not occur, pull tension again and slack once more.

- 14. Rough cut the casing approximately eight inches, or more, above the top of the casing head flange. Remove the excess casing.
- 15. Final cut the casing at 2 1/2" +/- 1/8" above casing head flange.
- Bevel the casing outer diameter (1/4" x 30 degrees) and inner diameter (1/8" x 30 degrees).
- 17. Remove and discard the used gasket ring from the casing head.
- Clean the mating ring grooves on the WFT-SB casing spool and casing head. Lightly wipe with oil or grease.




Excessive oil or grease will prevent a positive seal from forming.

- 19. Install a new appropriately sized ring gasket into the casing head groove.
- Loosely reconnect or make up the WFT-SB casing spool to the casing head.

#### NOTE

The casing spool to casing head connection will be fully tightened after the pack-off bushing is run and proper setting is verified.

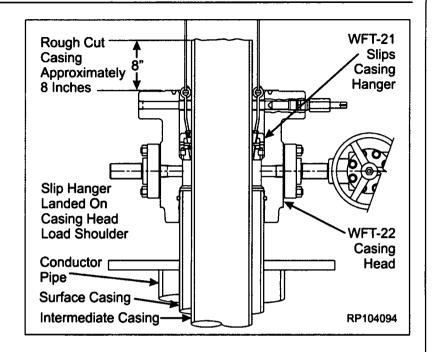

Installation of the Pack-Off Bushing and Energizing the P-Seals

WFT-SB Pack-Off Bushing Installation

#### NOTE

Installation procedure is identical for both Standard and Emergency WFT-SB Pack-Off Bushings.

- 1. Determine which pack-off bushing to use:
  - If casing has been run normally and is hung off with a mandrel casing hanger, use a standard packoff bushing.
- 2. Examine the appropriate pack-off bushing. Verify the following:
  - All elastomer seals are in place and undamaged.
  - Bore, ports and alignment lugs are clean and in good condition.
  - Coat the lockscrew relief groove with white paint.
- Liberally lubricate the inner diameter of the double P-seal grooves and outer diameter of dovetail seals with a light oil or grease.



Field Service Manual

Prepared By: Reviewed By:		Approved By:	SM-13-1
Moreon Robertson	Brad Franks	Manual Zaragoza	Rev WIP
Marion Robertson	Brad Franks	Manual Zaragoza	Page 10 of
December 2014	December 2014	December 2014	24

- 4. Examine the pack-off bushing running tool. Verify the following:
  - All elastomer seals are properly installed, clean and undamaged
  - Threads are clean, undamaged and free of debris
  - Bore and ports are clean and unobstructed.
- 5. Make-up a landing joint to the running tool and rack back assembly.
- Run two or three stands of heavy weight drill pipe or collars in the hole and set floor slips.

#### NOTE


Use heavy weight drill pipe or drill collars. Weight required to push Pack-Off Bushing into Casing Head, over Mandrel Hanger slick neck, is approximately 14,000 lbs.



When lowering the drill pipe into the well, extreme caution must be taken to not damage the top of the mandrel hanger with the end of the drill pipe. It is recommended that the drill pipe be centralized to the hanger inner diameter, as closely as possible, when entering the hanger.

- 7. Carefully lower the bushing over the drill pipe and set it on top of floor slips.
- Make up the landing joint/running tool assembly to the drill pipe suspended in floor slips.
- Carefully pick up the pack-off bushing, thread the bushing into the running tool, then rotate the bushing approximately two turns counterclockwise (to the left), coming to a positive stop.

 Lower the assembly through the BOP Stack and the WFT-SB spool assembly until the pack-off bushing lands on the casing hanger.

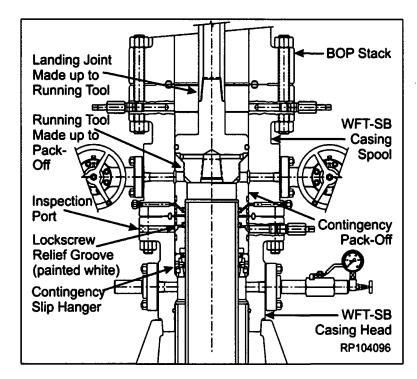

- 11. Verify, through inspection port that the pack-off bushing has landed properly after:
  - ensuring well is stable and no pressure buildup or mud flow is occurring.
  - drain BOP Stack through Casing Head side outlet valves.
  - remove Pipe Plug (1"-NPT) from Casing Head flange port marked "Inspection Port".
  - Check, to ensure, bottom of Lockscrew relief groove (painted white) on Support Bushing is at bottom of inspection port.
  - Reinstall Pipe Plug and tighten securely.
- 12. Fully run in all Casing Head Lockscrews (lower flange), in an alternating cross pattern.
- 13. Using two chain tongs, 180 apart, rotate Landing Joint/Running Tool approximately 2 turns clockwise (to the

•	<b>5</b> :-1.1.0	Prepared By:	Reviewed By:	Approved By:	SM-13-1
Mostharfard	Field Service   Manual	Marion Potestan	Brad Franks	Manual Zaragoza	Rev WIP
Weatherford	Wallual	Marion Robertson	Brad Franks	Manual Zaragoza	Page 11 of
5-3-GL-GL-WES-00XXX	]	December 2014	December 2014	December 2014	24


right), coming to a stop and carefully lift tool to Drill Floor, set aside.

#### NOTE

If the Contingency Pack-Off Bushing is being installed, it is now necessary to make up the Speed Head Casing Head/Casing Spool connection. Tighten all studs in an alternating cross pattern until the flange bolting is fully made up.

#### **Energizing the P-Seals**

- Locate the two lower injection fittings ("INJ"), located 180 degrees apart on the casing head. Remove the dust cap from one fitting and remove the second fitting entirely.
- 2. Attach a bleeder tool to the injection fitting without the dust cap, in the casing head. Open the bleeder tool.
- Attach a plastic injection tool to the open port and inject plastic packing into the port until a continuous stream flows from the bleeder tool. Close the bleeder tool.
- Remove the injection tool. Reinstall the injection fitting into the open port and remove the dust cap. Reattach the injection tool.
- Continue injecting plastic packing to 5,000 psi. or to 80% of casing collapse pressure, whichever is less.

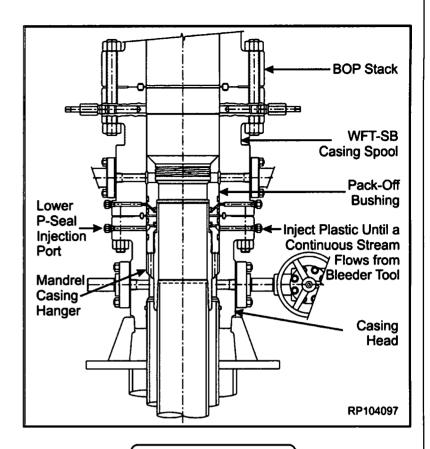

#### NOTE

The strength of a mandrel casing hanger slick neck is equivalent to P110 Grade casing with the same weight as run in the casing string.

- 6. Hold and monitor pressure for 15 minutes or as required by the drilling supervisor.
- 7. If pressure drops, the plastic packing has not filled the seal area completely. Open the bleeder tool, bleed off the pressure and repeat Steps 5 and 6, until pressure is stabilized.
- 8. Remove the plastic injection tool and bleeder tool. Reinstall the dust caps on both injection fittings.
- Repeat Steps 1 thru 8 to pack off and energize the upper P-Seal.

<b>*</b>
<b>Weatherford</b>
5-3-GL-GL-WES-00XXX

Field Service Manual

Prepared By:	Prepared By: Reviewed By:		SM-13-1
Mason Robertson	Brad Franks	Manual Zaragoza	Rev WIP
Marion Robertson	Brad Franks	Manual Zaragoza	Page 12 of
December 2014	December 2014	December 2014	24

- Locate the "SEAL TEST" fitting, slightly below and 90 degrees from the injection fittings. Remove the dust cap from this fitting.
- 11. Attach a test pump to the fitting.
- 12. Pump clean test fluid between the P-Seals until a test pressure of 5,000 psi or 80% of casing collapse pressure is attained, whichever is lower.



Do NOT exceed 80% of casing collapse pressure when a slip type casing hanger and contingency pack-off bushing are utilized.

- 13. Hold test pressure for 15 minutes or as required by the drilling supervisor.
- 14. If pressure drops, a leak has developed. Take the appropriate action per the following table:


Leak Location	Cause	Action
Into the bore of the casing head	Upper P- seal leaking	Bleed off pressure and re-inject plastic packing into leaking upper P- seal port.
Around the casing	Lower P- Seal leaking	Bleed off pressure and re-inject plastic packing into lower P-seal port.

- 15. Repeat Steps 12 thru 14 until a satisfactory test is achieved.
- 16. Once a satisfactory test is achieved, carefully bleed off pressure and remove Test Pump.
- 17. Attach the bleeder tool to the test port fitting and open the tool to vent any remaining trapped pressure.



Always direct the bleeder tool port away from people and property.

18. Remove the bleeder tool and reinstall dust cap in Test Port Fitting.

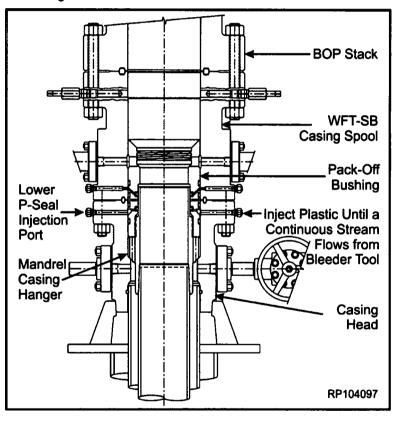

•	Field Service	Prepared By:	Reviewed By:	Approved By:	SM-13-1
Weatherford Manual	Mason Robotom	Brad Franks	Manual Zaragoza	Rev WIP	
	Mailuai	Marion Robertson	Brad Franks	Manual Zaragoza	Page 13 of
5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014	24

#### **Retesting the BOP Stack**

- Examine the Test Plug/Running Tool.
   Verify the following:
  - Elastomer seals are intact and in good condition.
  - Drill pipe threads are clean and in good condition.

#### NOTE

Immediately after testing the support bushing seals and periodically during conditioning of the hole prior to running tubing, the BOP stack (flanged connections and rams) must be tested.

Orient the test plug with elastomer down/ACME threads up. Make up a joint of drill pipe to the test plug.

#### NOTE

Remove the pipe plug from the weep port if pressure is to be supplied through the drill pipe.




Make sure the elastomer is down and ACME threads are up when testing.

Fully retract all lockscrews in the upper WFT-SB Spool Assembly.



Do NOT retract the lockscrews located in the casing head (lower flange). Doing so could allow the pack-off support bushing to rise out of position.

4. Lubricate the test plug elastomer seal with light oil or grease.

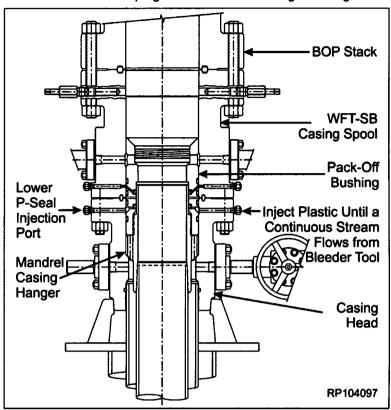

- 5. Lower the test plug through the BOP stack into the WFT-SB spool assembly until it lands on top of the pack-off bushing.
- 6. Open the upper WFT-SB casing spool side outlet valves. Monitor for any leakage past the test plug seal.
- 7. Close the BOP rams on the drill pipe and test to 10,000 psi or as required by the drilling supervisor.
- 8. After a satisfactory test is achieved, release all pressure and open the rams.
- 9. Remove as much fluid from the BOP stack as possible.
- 10. Retrieve the test plug assembly slowly to avoid damage to the seal.
- 11. Close all outlet valves on the WFT-SB casing head/spool assembly.

<b>**</b>	Field Comics	Prepared By:	Reviewed By:	Approved By:	SM-13-1
Moothorford	Field Service Manual	Mason Robertson	Brad Franks	Manual Zaragoza	Rev WIP
Weatherford	Manuar	Marion Robertson	Brad Franks	Manual Zaragoza	Page 14 of
5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014	24

Running and Retrieving the Short Bowl Protector

#### NOTE

Always use a bowl protector while drilling to protect the wellhead load shoulders from damage by the drill bit or rotating drill pipe. The bowl protector must be retrieved prior to running the casing string!

### Running the Bowl Protector Prior to Drilling

- 1. Examine the short bowl protector. Verify the following:
  - Bore drift is correct size, is clean, in good condition, and free of debris.
  - Threads are correct size and type.
  - Threads are clean and in good condition.
- 2. Orient the bowl protector running tool with ACME threads down.

#### NOTE

The running tool is the same tool used for handling the long bowl protector.



Make sure that the left hand (LH) ACME threads are down prior to engaging the bowl protector running tool into the short bowl protector.

- 3. Make-up a drill pipe joint to the running tool.
- 4. Thread the running tool into the short bowl protector, rotating two turns counterclockwise (to the left).
- Verify that all upper lockscrews in the WFT-SB spool assembly are fully retracted. Slowly lower the running

tool/bowl protector assembly through the BOP stack into the WFT-SB spool assembly until it lands on top of the pack-off bushing.




Do NOT retract the lower lockscrews located in the WFT-SB casing head, as this could allow the pack-off bushing to rise out of position.

6. On the upper WFT-SB spool assembly, run in two lockscrews ("snug" tight ONLY), 180 degrees apart, to hold the bowl protector in place.



Do NOT over tighten the lockscrews, as this will cause damage to both the bowl protector and lockscrews.

- 7. Remove the running tool from the bowl protector, by rotating the drill pipe clockwise two turns while lifting straight up.
- 8. Drill out and prepare to the production casing string per the drilling supervisor's instructions.

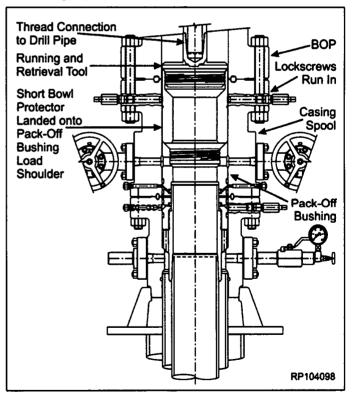

•	5:110	Prepared By:	Reviewed By:	Approved By:	SM-13-1
Mosthordove	Field Service Manual	Hater Roberton	Brad Franks	Manual Zaragoza	Rev WIP
Weatherford	Maildai	Marion Robertson	Brad Franks	Manual Zaragoza	Page 15 of
5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014	24

### Retrieval of the Short Bowl Protector After Drilling

- Make up the retrieval tool to the drill pipe with ACME threads down.
- 2. Slowly lower the retrieval tool into the bowl protector.
- Rotate the retrieval tool counterclockwise, two turns, to engage with the bowl protector ACME threads.
- Fully retract both lockscrews on the casing spool (upper flange), and retrieve the bowl protector.
- Remove the bowl protector and retrieval tool from the drill string.

#### **Running the Production Casing**

1. Run the production casing to necessary depth and cement as required.

#### NOTE

There are two methods for installing WFT-22 Slip Type Casing Hangers:

- Under the BOP stack.
- Through the BOP stack.

### Installation of the Slip-Type Casing Hanger Under the BOP Stack

- 1. Drain the casing head through the uppermost side outlet valve.
- 2. Lift and suspend the BOP stack above the WFT-SB spool assembly to a minimum of 18 inches.
- Wash out the WFT-SB casing head/spool assembly as required.
- Confirm that ONLY the lockscrews in the casing spool (upper flange) are fully retracted.

- Examine the WFT-22 slip-type casing hanger. Verify the following:
  - Slip segments are clean and undamaged.
  - All screws are in place.
  - Packing element is clean and undamaged.




The packing element should not protrude past the casing hanger outer diameter. If the packing element does extend past the outer diameter, loosen the cap screws in the bottom of the hanger.

- 6. Place two boards across the casing spool face, against the casing, to support the hanger.
- 7. Disengage the spring loaded latch, open the hanger and wrap the hanger around the casing, allowing the support boards to carry weight.
- 8. Re-engage the casing hanger spring loaded latch.
- 9. Remove the slip retaining cap screws from the outer diameter of the hanger body, allowing the slip segments to settle around the casing.
- 10. Supporting the weight of the casing hanger, remove the support boards and lower the hanger into the WFT-SB casing head/spool assembly until it lands on the pack-off bushing load shoulder.



Do NOT drop the hanger; lower it carefully.

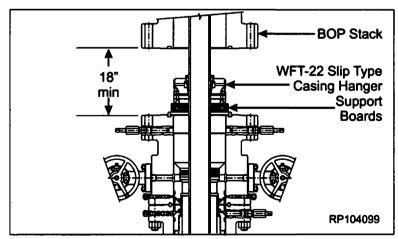

₩
Weatherford
5-3-GL-GL-WES-00XXX

Field Service Manual

Prepared By:	Reviewed By:	Approved By:	SM-13-1
Moston Robertson	Brad Franks	Manual Zaragoza	Rev WIP
Marion Robertson	Brad Franks	Manual Zaragoza	Page 16 of
December 2014	December 2014	December 2014	24

### Installation of the Slip-Type Casing Hanger through the BOP Stack

- Drain the WFT-SB casing head/spool assembly and BOP stack through the side outlet valves on the spool assembly.
- 2. Wash out the wellhead assembly until clean returns are seen.
- 3. Examine the slip type casing hanger. Verify the following:
  - slip segments are clean and undamaged
  - all screws are in place
  - Packing Element is clean and undamaged.



The packing element should not protrude past the casing hanger outer diameter. If the packing element does extend past the outer diameter, loosen the cap screws in the bottom of the hanger.


- 4. Place two boards across the rotary table, against the casing, to support the hanger.
- Disengage the spring loaded latch, open the hanger and wrap it around the casing, allowing the support boards to carry the weight.
- 6. Re-engage the casing hanger's spring loaded latch.
- Measure the distance from the top flange of the WFT-SB casing spool to the drilling rig floor (RKB).
- Measure out two lengths of soft-line cord (rope) to the same length as the

RKB measurement, and adding an additional 10 feet to each line.

- 9. Mark the soft line cord at the required length.
- 10. Install two eyebolts into the tapped holes in the top of the casing hanger slip segments, 180 degrees apart.
- 11. Securely tie the soft-line cord to the eyebolts.



Measuring the soft-line cord and installing the eyebolts into the hanger segments should be done offline.

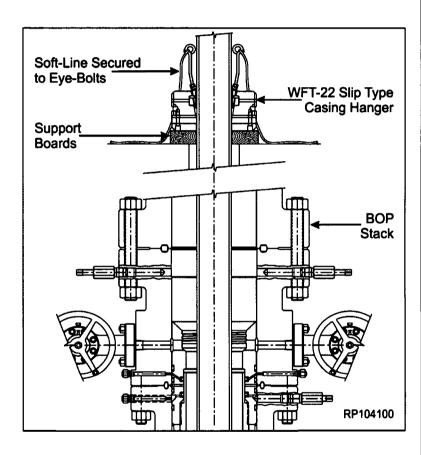

<b>~</b>	<b>5</b> . 110	Prepared By:	Reviewed By:	Approved By:	SM-13-1
1 '	Field Service Manual	Maior Robotom	Brad Franks	Manual Zaragoza	Rev WIP
Weatherford	Hailuai	Marion Robertson	Brad Franks	Manual Zaragoza	Page 17 of
5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014	24

- Remove the slip retaining cap screws from the outer diameter of the hanger body, allowing the slip segments to settle around the casing.
- 13. Supporting the weight of the casing hanger, remove the support boards and carefully lower the hanger through the BOP stack into the WFT-SB casing head/spool assembly, until it securely lands on the pack-off bushing load shoulder.



Do NOT drop hanger; lower it carefully.


#### Hanging off the Production Casing


 With the casing hanger now landed onto the pack-off bushing load shoulder, pull tension on the casing to the desired hanging weight, and then slack off.

#### NOTE

A sharp decrease on the weight indicator will signify that the hanger has taken weight. If this does not occur, pull tension again and slack off once more.

- Rough cut casing approximately 16" above top of WFT-SB Spool top flange. Remove excess casing.
- 3. Carefully remove BOP stack, set aside.
- Final cut the casing at about 12 7/8" +/1/8" above the face of the WFT-SB
  spool, which will allow room for the
  double studded adapter flange.
- Grind the casing stub level and bevel the casing outer diameter (1/4" x 1/8") and inner diameter (1/8" x 45 degrees).

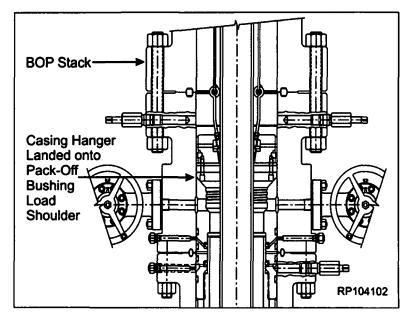

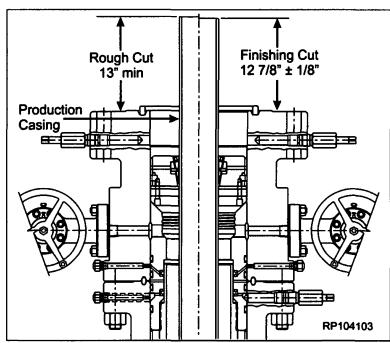

₩
Weatherford
5-3-GL-GL-WES-00XXX

Field Service Manual

Prepared By:	Reviewed By:	Approved By:	SM-13-1	
Mosson Roboton	Brad Franks	Manual Zaragoza	Rev WIP	
Marion Robertson	Brad Franks	Manual Zaragoza	Page 18 of	
December 2014	December 2014	December 2014	24	

# Installation of the Double-Studded Adapter (DSA) Flange

- Examine the double studded adapter (DSA) Flange. Verify the following:
  - Ring grooves are clean and undamaged.
  - Stud threads are clean and undamaged.
- 2. Orient the DSA flange with the 10M side down.
- Thoroughly clean the mating grooves of the DSA flange and the WFT-SB spool assembly. Wipe lightly with oil or grease.




# Excessive oil or grease will prevent a positive seal from forming.

- Install a new appropriately sized ring gasket into the WFT-SB spool assembly groove.
- Lift, while holding level, and carefully lower the DSA over the production casing stub until it lands on the ring gasket.
- Make-up the flange connection with appropriate nuts, tightening in alternate cross pattern, as required by API 6A.
- 7. Fill the void area in the DSA around the production casing with a light weight oil.
- 8. Continue filling with a light weight oil to the top of the DSA.



Do NOT allow oil to run into the ring groove. This may prevent a positive seal from forming.

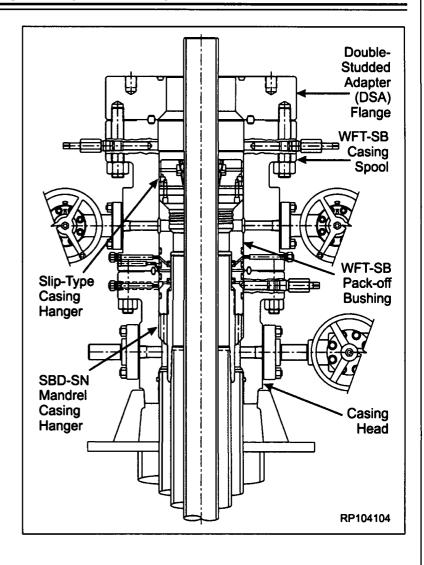

<b>~</b>	Field Comits	Prepared By:	Reviewed By:	Approved By:	SM-13-1
Moothorford	Field Service Manual	Marcon Robertson	Brad Franks	Manual Zaragoza	Rev WIP
Weatherford	Manda	Marion Robertson	Brad Franks	Manual Zaragoza	Page 19 of
5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014	24

### **Installation and Testing of the Tubing Spool Assembly**

### Installation of the TCM Tubing Spool Assembly

- Examine the tubing spool assembly.
   Verify the following:
  - bore is clean and free of debris
  - ring grooves and seals are clean and undamaged
  - PE-seal assembly is properly installed, clean and undamaged.
- 2. Thoroughly clean the mating ring grooves of the WFT-TCM Tubing Spool and WFT-SB Casing Spool.
- Lightly lubricate the inner diameter of the PE-seal and outer diameter of the casing stub with oil or grease.



# Excessive oil or grease will prevent a positive seal from forming.

- Install a new appropriately sized ring gasket into the WFT-SB casing spool assembly groove.
- Orient the tubing spool assembly as required and carefully lower it over the casing stub, until it lands on the ring gasket.
- Make up the flange connection with the appropriate studs and nuts, tightening in an alternating cross pattern, as required by API 6A.

# **Testing the Secondary Seal and Flange Connection Test**


- 1. Locate the test port fitting on the OD of the tubing spool lower flange. Remove the dust cap from the fitting.
- 2. Attach a test pump to the test port fitting.

- Pump clean test fluid into the void area between the flanges until a test pressure of 10,000 psi or 80% of casing collapse pressure is attained, whichever is lower.
- 4. Hold and monitor pressure for 15 minutes or as required by the drilling supervisor.
- 5. Once a satisfactory test is achieved, carefully bleed off pressure and remove the test pump
- 6. Attach a bleeder tool to the test port fitting and open the tool to vent any remaining trapped pressure.



# Always direct the bleeder tool port away from people and property.

- 7. Remove the bleeder tool and reinstall the dust cap on the test port fitting.
- 8. Install a new appropriately sized ring gasket into the tubing spool groove.

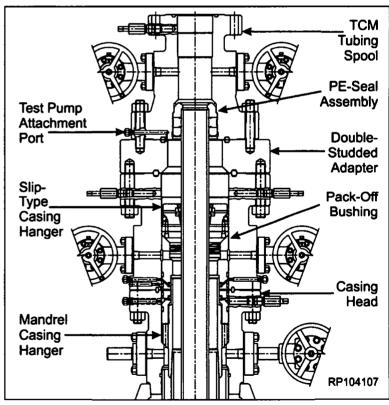

<b>~</b>	Field Comics	Prepared By:	Reviewed By:	Approved By:	SM-13-1
Weatherford Manual		Mason Robertson	Brad Franks	Manual Zaragoza	Rev WIP
	Mandai	Marion Robertson	Brad Franks	Manual Zaragoza	Page 20 of
5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014	24

#### **Testing the BOP**

#### NOTE

Immediately after the make-up of the BOP Stack and periodically during drilling of hole for the next string, the BOP stack (flanged connections and rams) must be tested.


- 1. Examine the test plug. Verify that:
  - O-ring seals and plugs are properly installed, clean and undamaged.
  - All threads are clean and undamaged.
- 2. Orient the test plug with O-ring seals up and drill pipe pin connection down.
- 3. Make up a joint of drill pipe to the top of the test plug.

#### NOTE

If pressure is to be supplied through the drill pipe, the pipe plug should be removed from the weep port.

- 4. Fully retract all lockscrews on the WFT-TCM tubing spool assembly.
- 5. Open the side outlet valves on the tubing spool.
- 6. Wipe the test plug O-ring seals with a light oil or grease.
- Lower the test plug through the BOP until it lands on the tubing spool load shoulder.
- 8. Close the BOP rams on the drill pipe and test to **10,000 psi maximum**.
- Monitor the open outlets for signs of leakage past the test plug.

- Once a satisfactory test is achieved, release pressure and open the rams.
- 11. Close the side outlet valves.
- 12. Remove as much fluid from the BOP stack as possible.
- 13. Slowly retrieve the test plug, avoiding damage to the seals.
- 14. Repeat this procedure, as required, during drilling or conditioning of the hole.

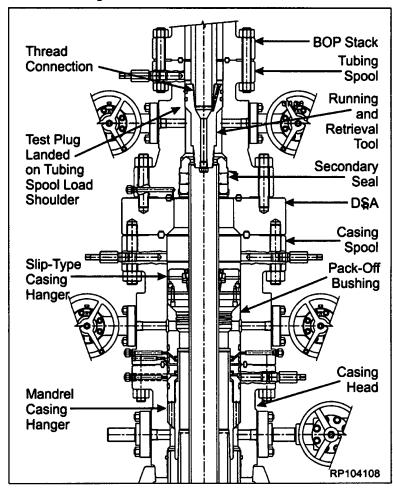

<b>~</b>	Field Service Manual	Prepared By:	Reviewed By:	Approved By:	SM-13-1
_ <u>`</u> _		Hassin Roberton	Brad Franks	Manual Zaragoza	Rev WIP
	Mailuai	Marion Robertson	Brad Franks	Manual Zaragoza	Page 21 of
5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014	24


### Hanging off the Production Tubing String

- 1. Run the production tubing and space out appropriately for the tubing hanger.
- 2. Examine the TC1AEN Tubing Hanger. Verify the following;
  - Packing element is clean and undamaged.
  - S-seals are properly installed.
  - S-seals are clean and undamaged.
  - All threads are clean and undamaged.
- 3. Make-up a short handling joint to the top of the tubing hanger.
- 4. Pick up the tubing hanger and make it up to the tubing string, tightening the connection to the thread manufacturer's recommended optimum torque value.
- Remove the short handling joint from the top of the hanger. Make up the landing joint to the top of the tubing hanger, tightening the connection to the thread manufacturer's recommended minimum torque values.
- Ensure that all tubing spool lockscrews are fully retracted from the bore and open side outlet valves. Drain the BOP stack.

#### NOTE

The side outlet valves should remain open while landing the tubing hanger.

- 7. Calculate the distance from the tubing spool load shoulder to the rig floor. Measure from the face of the tubing spool.
- 8. Carefully lower the tubing hanger into the well, tallying the tubing every five feet, until the tubing hanger lands securely on the tubing spool load shoulder.
- 9. Run in all tubing spool lockscrews, in an alternating cross pattern, to 300 ft-lbs, in 75 ft-lb increments.
- 10. Remove the landing joint from the tubing hanger, and set it aside.

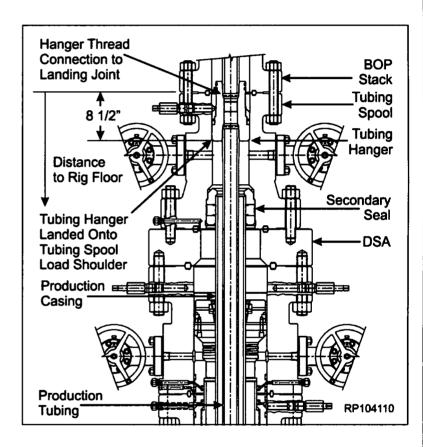

SM-13-1

Page 22 of 24

ી∙	₩	Field Coming	Prepared By:	Reviewed By:	Approved By:
	Moothorford	Field Service Manual	Hoton Robotson	Brad Franks	Manual Zaragoza
	Weatherford	Mariuai	Marion Robertson	Brad Franks	Manual Zaragoza
	5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014

- 11. Install the Type H Back Pressure Valve, carefully lowering the BPV through the BOP stack into the tubing hanger. Rotate the BPV counterclockwise (to the left) until it bottoms out in the tubing hanger BPV prep. Continue rotating counterclockwise, approximately 7 turns, to retrieve the running tool.
- 12. With the well safe and under control, the BOP stack may be removed.

### Installation and Testing of the Production Tree

#### Installation

- Examine the production tree assembly. Verify the following;
  - Bore is clean and free of debris.
  - All valves are in the fully open position.
  - All threads and seal areas are clean and undamaged.
  - All fittings, nuts and handwheels are intact and undamaged.
- Thoroughly clean all exposed portions of the tubing hanger, tubing head adapter flange and bottom prep of the tubing head adapter.
- 3. Thoroughly clean mating ring grooves of the tubing head adapter flange and WFT-TCM tubing spool.
- Lightly lubricate the tubing hanger neck outer diameter and tubing head adapter flange bottom prep with oil or grease.





Excessive oil or grease will prevent a positive seal from forming.

Install a new appropriately sized ring gasket into the WFT-TCM tubing spool groove. 6. Fill the void area around the hanger with hydraulic fluid, to the top of the tubing spool assembly.



Do NOT overfill the void area, allowing oil to run into the ring groove. This may prevent a positive seal from forming.

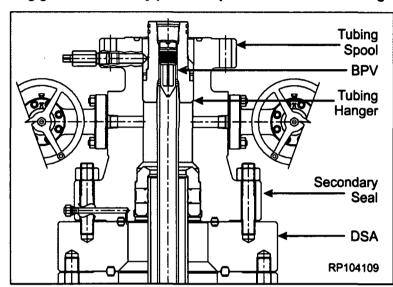

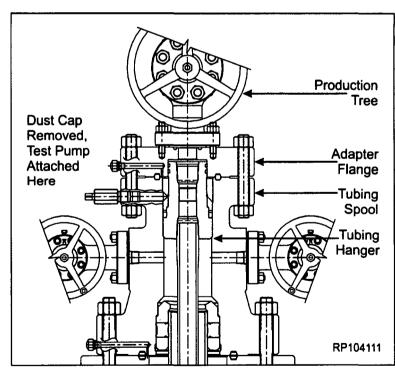

<b>~</b>	Field Service Manual	Prepared By:	Reviewed By:	Approved By:	SM-13-1
l		Marcon Roberton	Brad Franks	Manual Zaragoza	Rev WIP
	Wallual	Marion Robertson	Brad Franks	Manual Zaragoza	Page 23 of
	1	December 2014	December 2014	December 2014	24

 Align and level the production tree above the tubing hanger and carefully lower it over the tubing hanger neck, landing it on the ring gasket.



Do NOT damage the hanger neck seals, as this will impair their sealing ability.


- Make up the connection using the appropriate studs and nuts, and tightening in an alternating cross pattern, as required by API 6A.
- **Testing the Production Tree Connection**
- Locate the test port fitting on the outer diameter of the tubing head adapter flange. Remove the dust cap from the fitting.
- 2. Attach a test pump to test port fitting, and open the pump.
- Pump clean test fluid into void area between flanges, test to 10,000 psi maximum.
- 4. Hold and monitor pressure for 15 minutes or as required by the production supervisor.
- 5. Once a satisfactory test is achieved, carefully bleed off test pressure and remove the test pump.
- Attach a bleeder tool to the test port fitting, and open the tool to vent any remaining trapped pressure.



Always direct the bleeder tool away from people and property.

7. Remove the bleeder tool and reinstall the dust cap on the test port fitting.

- 8. Remove the type 'H' back pressure valve (BPV) through the production tree.
- 9. Ensure that the well is safe and secure by closing all gate valves.

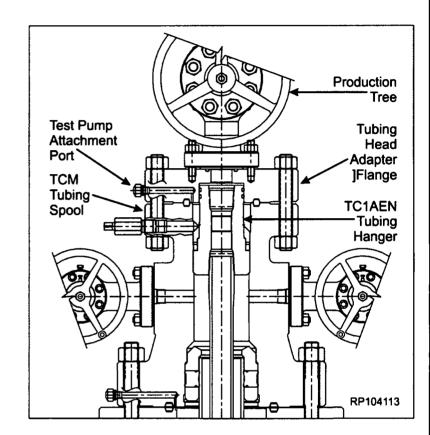

<b>~</b>	Field O	Prepared By:	Reviewed By:	Approved By:	SM-13-1
Field Service	Field Service   Manual	Marion Robotson	Brad Franks	Manual Zaragoza	Rev WIP
Weatherford	Maria	Marion Robertson	Brad Franks	Manual Zaragoza	Page 24 of
5-3-GL-GL-WES-00XXX		December 2014	December 2014	December 2014	24



### **Multi-Bowl System** 13-3/8" X 9-5/8" X 5-1/2"



w/(2) 1-13/16"- 5M Gate Valves

#### 7-1/16-5M



**Casing Spool- MBS** 

13-5/8"-5M X 13-5/8"-5M w/(2) 1-13/16" 5M SSO

7" Dbl P Seal

13-5/8" X 7" C-22 **Casing Hanger** 

### **Casing Head- MBS**

13-5/8"-5M X 13-3/8" SOW w/36" Base Plate

13-5/8"-5M

13-5/8"-5M

13-5/8" X 9-5/8" MBS **Packoff Assembly** 

13-5/8" X 9-5/8" Mandrel **Casing Hanger** 

13-3/8" SOW

### **BOP Break Testing Request**

BTA requests permission to allow BOP Break Testing under the following conditions:

- After a full BOP test is conducted on the first well on the pad.
- When skidding to drill a hole section that does not penetrate into the Wolfcamp.
- Full BOP test will be required prior to drilling any production hole.

#### U.S. Department of the Interior **BUREAU OF LAND MANAGEMENT**



APD ID: 10400049114

Submission Date: 10/10/2019

**Operator Name: BTA OIL PRODUCERS LLC** 

Well Name: MESA 8105 1-12 FED

Well Type: OIL WELL

Well Number: 42H

Well Work Type: Drill



**Show Final Text** 

#### **Section 1 - Existing Roads**

Will existing roads be used? YES

**Existing Road Map:** 

0917 Topographical Access Rd 20191010135901.pdf

Existing Road Purpose: ACCESS, FLUID TRANSPORT

Row(s) Exist? NO

ROW ID(s)

ID:

Do the existing roads need to be improved? NO

**Existing Road Improvement Description:** 

**Existing Road Improvement Attachment:** 

#### Section 2 - New or Reconstructed Access Roads

Will new roads be needed? YES

**New Road Map:** 

0917\_Topographical\_\_\_Access\_Rd\_20191010140055.pdf

**New road type: RESOURCE** 

**Length:** 590.3

Feet

Width (ft.): 25

Max slope (%): 2

Max grade (%): 2

Army Corp of Engineers (ACOE) permit required? N

**ACOE Permit Number(s):** 

New road travel width: 15

New road access erosion control: Road construction requirements and regular maintenance would alleviate potential

impacts to the access road from water erosion damage

New road access plan or profile prepared? N

New road access plan attachment:

Access road engineering design? N

Access road engineering design attachment:

Well Name: MESA 8105 1-12 FED

Well Number: 42H

**Turnout? N** 

Access surfacing type: OTHER

Access topsoil source: BOTH

Access surfacing type description: Native Caliche

Access onsite topsoil source depth: 6

Offsite topsoil source description: material will be obtained from the closest existing caliche pit as designated by the BLM

Onsite topsoil removal process: The top 6 inches is pushed off and stockpiled along the side of the location. An approximate 160' X 160' area is used within the proposed well site to remove caliche. Subsoil is removed and stockpiled within the pad site to buld the location and road. Then subsoil is pushed back in the hole and caliche is spread accordingly across the proposed access road.

Access other construction information:

Access miscellaneous information:

Number of access turnouts:

Access turnout map:

#### **Drainage Control**

New road drainage crossing: OTHER

**Drainage Control comments:** See Above

Road Drainage Control Structures (DCS) description: Any ditches will be at 3:1 slope and 3 feet wide

Road Drainage Control Structures (DCS) attachment:

**Access Additional Attachments** 

#### **Section 3 - Location of Existing Wells**

**Existing Wells Map?** YES

Attach Well map:

0917\_1\_mile\_radius\_20191010141736.pdf

#### Section 4 - Location of Existing and/or Proposed Production Facilities

Submit or defer a Proposed Production Facilities plan? SUBMIT

**Production Facilities description:** If well is productive, we will use the existing well pad for the tank battery and all necessary production facilities.

**Production Facilities map:** 

Production\_Facility\_Layout\_20190930141417.pdf

#### **Section 5 - Location and Types of Water Supply**

#### **Water Source Table**

Well Name: MESA 8105 1-12 FED

Well Number: 42H

Water source type: OTHER

Describe type: PIT

Water source use type:

**SURFACE CASING** 

**STIMULATION** 

**DUST CONTROL** 

INTERMEDIATE/PRODUCTION

CASING

Source latitude:

Source longitude:

Source datum:

Water source permit type:

PRIVATE CONTRACT

Water source transport method:

**TRUCKING** 

Source land ownership: FEDERAL

Source transportation land ownership: PRIVATE

Water source volume (barrels): 100000

Source volume (acre-feet): 12.88930963

Source volume (gal): 4200000

#### Water source and transportation map:

Mesa\_8105\_42H\_and\_43H\_Water\_Transportation\_Map\_20191010141807.pdf

Water source comments: Water Pit is in SESE Quarter Quarter of Sec 1, T26S, R32E in Lea Co, NM

New water well? N

#### **New Water Well Info**

Well latitude:

Well Longitude:

Well datum:

Well target aquifer:

Est. depth to top of aquifer(ft):

Est thickness of aquifer:

**Aquifer comments:** 

Aquifer documentation:

Well depth (ft):

Well casing type:

Well casing outside diameter (in.):

Well casing inside diameter (in.):

New water well casing?

Used casing source:

**Drilling method:** 

**Drill material:** 

**Grout material:** 

Grout depth:

Well Name: MESA 8105 1-12 FED Well Number: 42H

Casing length (ft.):

Casing top depth (ft.):

**Well Production type:** 

**Completion Method:** 

Water well additional information:

State appropriation permit:

Additional information attachment:

#### **Section 6 - Construction Materials**

Using any construction materials: YES

Construction Materials description: Caliche used for construction of the drilling pad and access road will be obtained from the closest existing caliche pit as approved by the BLM or from prevailing deposits found under the location. If there is not sufficient material available, caliche will be purchased from the nearest caliche pit located in Section 4 T26S R32E Lea County, NM.

**Construction Materials source location attachment:** 

#### Section 7 - Methods for Handling Waste

Waste type: DRILLING

Waste content description: Drilling fluids and cuttings.

Amount of waste: 4164

barrels

Waste disposal frequency: One Time Only

Safe containment description: All drilling fluids will be stored safely and disposed of properly.

Safe containment attachment:

Waste disposal type: HAUL TO COMMERCIAL

Disposal location ownership: COMMERCIAL

**FACILITY** 

Disposal type description:

**Disposal location description:** Trucked to a state approved disposal facility.

Waste type: SEWAGE

Waste content description: Human waste and grey water.

Amount of waste: 1000

gallons

Waste disposal frequency: One Time Only

Safe containment description: Waste material will be stored safely and disposed of properly.

Safe containment attachment:

Waste disposal type: HAUL TO COMMERCIAL

Disposal location ownership: COMMERCIAL

**FACILITY** 

Disposal type description:

**Disposal location description:** Trucked to a state approved disposal facility.

Well Name: MESA 8105 1-12 FED

Well Number: 42H

Waste type: GARBAGE

Waste content description: Trash

Amount of waste: 500

pounds

Waste disposal frequency: One Time Only

Safe containment description: Trash produced during drilling and completion operations will be collected in a trash

container and disposed of properly.

Safe containment attachment:

Waste disposal type: HAUL TO COMMERCIAL

**Disposal location ownership: COMMERCIAL** 

**FACILITY** 

Disposal type description:

Disposal location description: Trucked to a state approved disposal facility.

#### **Reserve Pit**

Reserve Pit being used? N

Temporary disposal of produced water into reserve pit? NO

Reserve pit length (ft.)

Reserve pit width (ft.)

Reserve pit depth (ft.)

Reserve pit volume (cu. yd.)

Is at least 50% of the reserve pit in cut?

Reserve pit liner

Reserve pit liner specifications and installation description

#### **Cuttings Area**

Cuttings Area being used? NO

Are you storing cuttings on location? N

**Description of cuttings location** 

**Cuttings area length (ft.)** 

Cuttings area width (ft.)

Cuttings area depth (ft.)

Cuttings area volume (cu. yd.)

Is at least 50% of the cuttings area in cut?

WCuttings area liner

Cuttings area liner specifications and installation description

Well Name: MESA 8105 1-12 FED Well Number: 42H

#### **Section 8 - Ancillary Facilities**

Are you requesting any Ancillary Facilities?: N

**Ancillary Facilities attachment:** 

Comments:

**Section 9 - Well Site Layout** 

#### Well Site Layout Diagram:

Rig\_Layout\_20191009140414.pdf 0917\_Well\_Site\_Plan\_20191010142002.pdf 0917\_ACCESS\_ROAD\_20191010142002.pdf

Comments:

#### **Section 10 - Plans for Surface Reclamation**

Type of disturbance: New Surface Disturbance Multiple Well Pad Name: MESA 8105

Multiple Well Pad Number: 42H and 43H

#### **Recontouring attachment:**

**Drainage/Erosion control construction:** During construction proper erosion control methods will be used to control erosion, runoff, and siltation of the surrounding area.

**Drainage/Erosion control reclamation:** Proper erosion control methods will be used on the area to control erosion, runoff, and siltation of the surrounding area.

Well pad proposed disturbance

(acres): 3.6

Road proposed disturbance (acres):

0.01

Powerline proposed disturbance

(acres): 0

Pipeline proposed disturbance

(acres):

Other proposed disturbance (acres): 0

Total proposed disturbance: 3.61

Well pad interim reclamation (acres):

0.2

Road interim reclamation (acres): 0

Powerline interim reclamation (acres):

0

Pipeline interim reclamation (acres): 0

Other interim reclamation (acres): 0

Total interim reclamation: 0.2

Well pad long term disturbance

(acres): 3.4

Road long term disturbance (acres):

0.0

Powerline long term disturbance

(acres): 0

Pipeline long term disturbance

(acres): 0

Other long term disturbance (acres): 0

Total long term disturbance:

3.409999999999997

#### **Disturbance Comments:**

**Reconstruction method:** The areas planned for interim reclamation will then be recontoured to the original contour if feasible, or if not feasible, to an interim contour that blends with the surrounding topography as much as possible. Where applicable, the fill material of the well pad will be backfilled into the cut to bring the area back to the original contour. The interim cut and fill slopes prior to re-seeding will not be steeper than a 3:1 ratio, unless the adjacent native topography is steeper. Note: Constructed slopes may be much steeper during drilling, but will be recontoured to the above ratios during interim reclamation.

Topsoil redistribution: Topsoil will be evenly respread and aggressively revegetated over the entire disturbed area not

Well Name: MESA 8105 1-12 FED Well Number: 42H

needed for all-weather operations.

**Soil treatment:** To seed the area, the proper BLM seed mixture, free of noxious weeds, will be used. Final seedbed preparation will consist of contour cultivating to a depth of 4 to 6 inches within 24 hours prior to seeding, dozer tracking, or other imprinting in order to break the soil crust and create seed germination micro-sites.

**Existing Vegetation at the well pad:** The historic climax plant community is a grassland dominated by black grama, dropseeds, and blue stems with sand sage and shinnery oak distributed evenly throughout. Current landscape displays mesquite, shinnery oak, yucca, desert sage, fourwing saltbush, snakeweed, and bunch grasses.

Existing Vegetation at the well pad attachment:

Existing Vegetation Community at the road: Refer to "Existing Vegetation at the well pad"

**Existing Vegetation Community at the road attachment:** 

Existing Vegetation Community at the pipeline: Refer to "Existing Vegetation at the well pad"

**Existing Vegetation Community at the pipeline attachment:** 

Existing Vegetation Community at other disturbances: Refer to "Existing Vegetation at the well pad"

**Existing Vegetation Community at other disturbances attachment:** 

Non native seed used? N

Non native seed description:

Seedling transplant description:

Will seedlings be transplanted for this project? N

Seedling transplant description attachment:

Will seed be harvested for use in site reclamation? N

Seed harvest description:

Seed harvest description attachment:

Seed Management

**Seed Table** 

Seed Summary	
Seed Type	Pounds/Acre

Total pounds/Acre:

Seed reclamation attachment:

Operator Contact/Responsible Official Contact Info

Well Name: MESA 8105 1-12 FED	Well Number: 42H
WEII NAME. WESA 0103 1-12 FED	Well Nulliber. 420
First Name:	Last Name:
Phone: (432)682-3753	Email: csmith@btaoil.com
Seedbed prep:	
Seed BMP:	
Seed method:	
Existing invasive species? N	
Existing invasive species treatment description:	
Existing invasive species treatment attachment:	
Weed treatment plan description: No invasive specilocation and road.  Weed treatment plan attachment:	ies present. Standard regular maintenance to maintain a clear
weeds from construction equipment during construction	ng weeds prior to construction; prevent the introduction and spread of on; and contain weed seeds and propagules by preventing as. No invasive species present. Standard regular maintenance to
Success standards: To maintain all disturbed areas	as per Gold Book standards.
Pit closure description: N/A	
Pit closure attachment:	
Section 11 - Surface Ownership	
Disturbance type: WELL PAD	
Describe:	
Surface Owner: BUREAU OF LAND MANAGEMENT	г
Other surface owner description:	
BIA Local Office:	
BOR Local Office:	
COE Local Office:	
DOD Local Office:	
NPS Local Office:	
State Local Office:	
Military Local Office:	
USFWS Local Office:	
Other Local Office:	
USFS Region:	

**Operator Name: BTA OIL PRODUCERS LLC** 

Well Name: MESA 8105 1-12 FED

Well Number: 42H

**USFS Forest/Grassland:** 

**USFS Ranger District:** 

**Section 12 - Other Information** 

Right of Way needed? N

**Use APD as ROW?** 

ROW Type(s):


**ROW Applications** 


**SUPO Additional Information:** 

Use a previously conducted onsite? Y

Previous Onsite information: Onsite conducted on 10/10/19 by McKenna Ryder BLM

Other SUPO Attachment

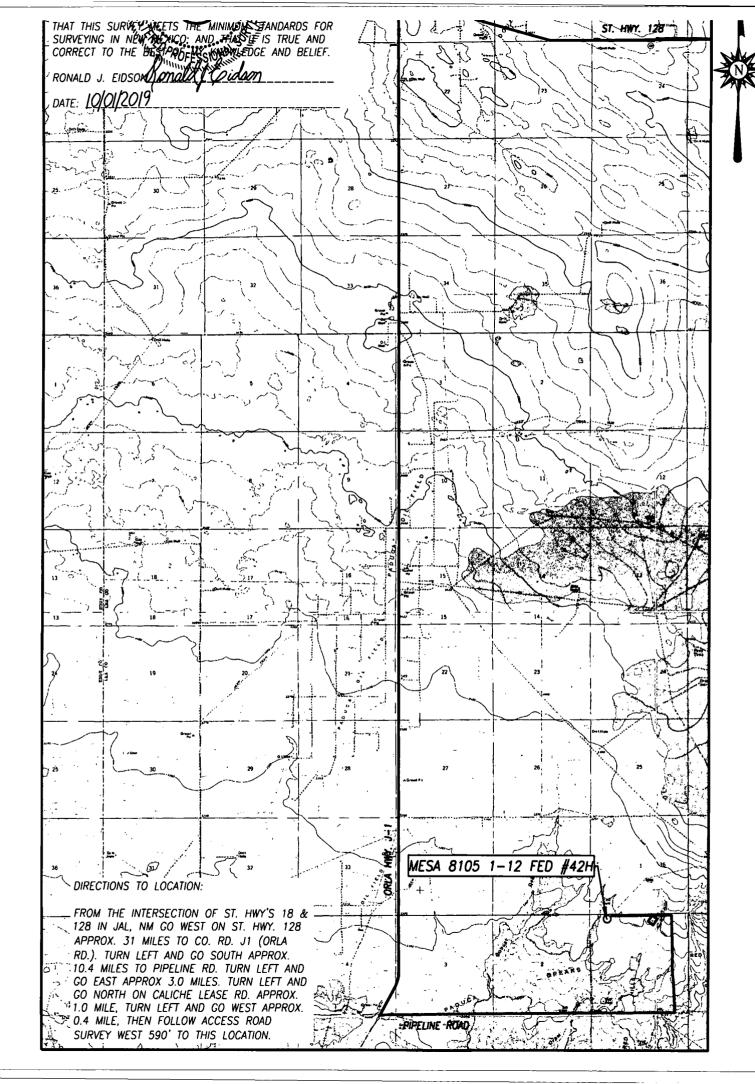

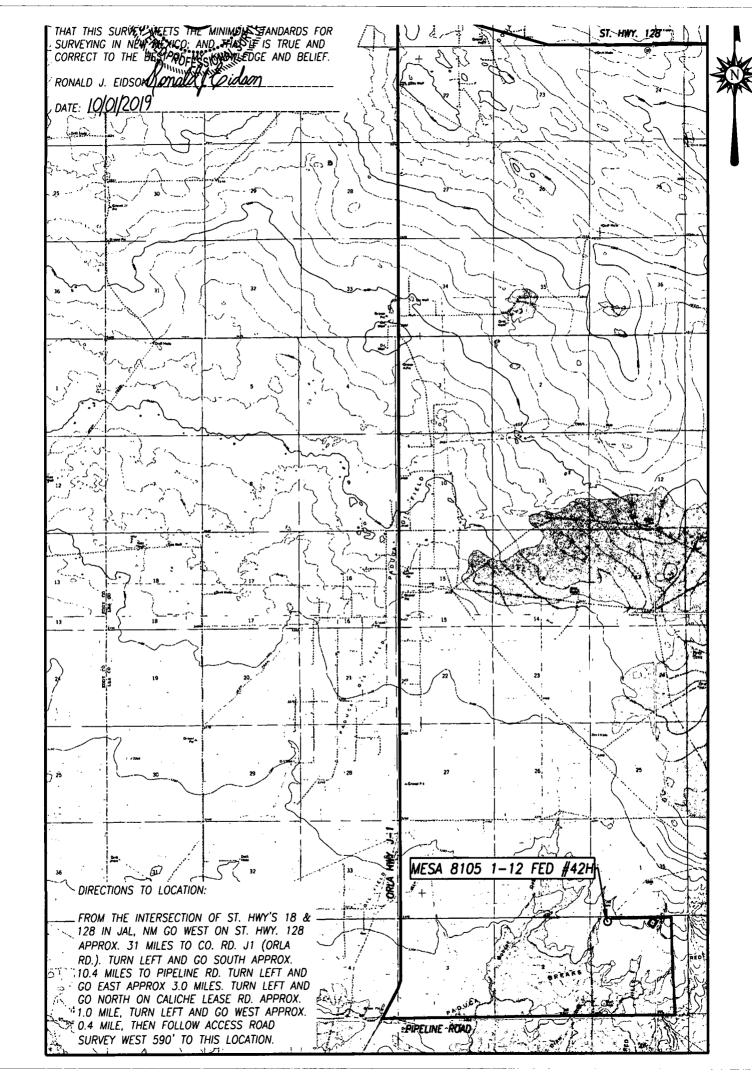

DISTRICT I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720
DISTRICT II
BILLS First St. Artesia NM 88210

811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720 DISTRICT III 1000 Rio Brazos Road, Aztec, NM 87410 Phone: (505) 334-6178 Fax: (505) 334-6170

DISTRICT IV 1220 S. St. Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3460 Fax: (505) 476-3462 State of New Mexico
Energy, Minerals & Natural Resources Department
OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, New Mexico 87505

Form C-102 Revised August 1, 2011 Submit one copy to appropriate District Office

□AMENDED REPORT

#### WELL LOCATION AND ACREAGE DEDICATION PLAT

API Number	Pool Code	JENNINGS ; UPPER BONE SRPING SH.		
Property Code	•	orty Name D5 1-12 FED	Well Number 42H	
OGRID No. 260297		ator Name DDUCERS, LLC	Elevation 3356'	


#### Surface Location


UL or lot No.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
D	1	26-S	32-E		280	NORTH	990	WEST	LEA


#### Bottom Hole Location If Different From Surface

UL or lot No.	Section 12	Township 26-S	Range 32-E	Lot Idn	Feet from the 50	North/South line SOUTH	Feet from the 1650	East/West line WEST	County LEA
Dedicated Acres 320	Joint or	Infill C	onsolidation C	ode Ord	er No.				

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

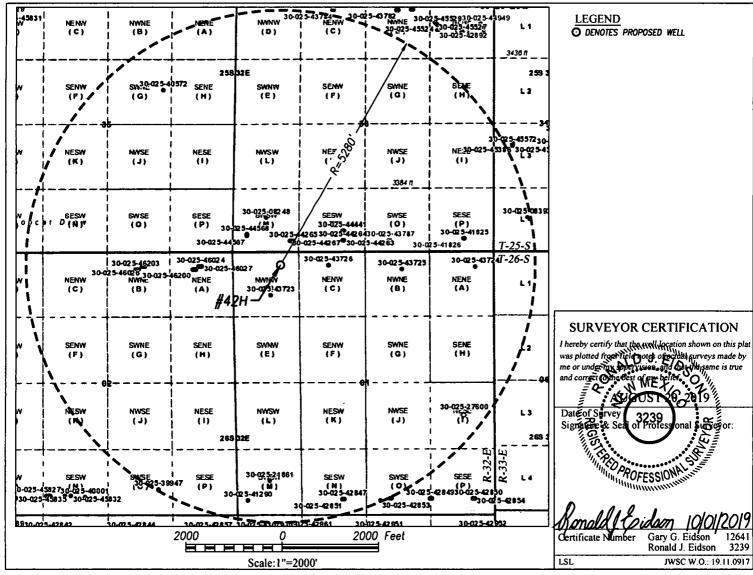


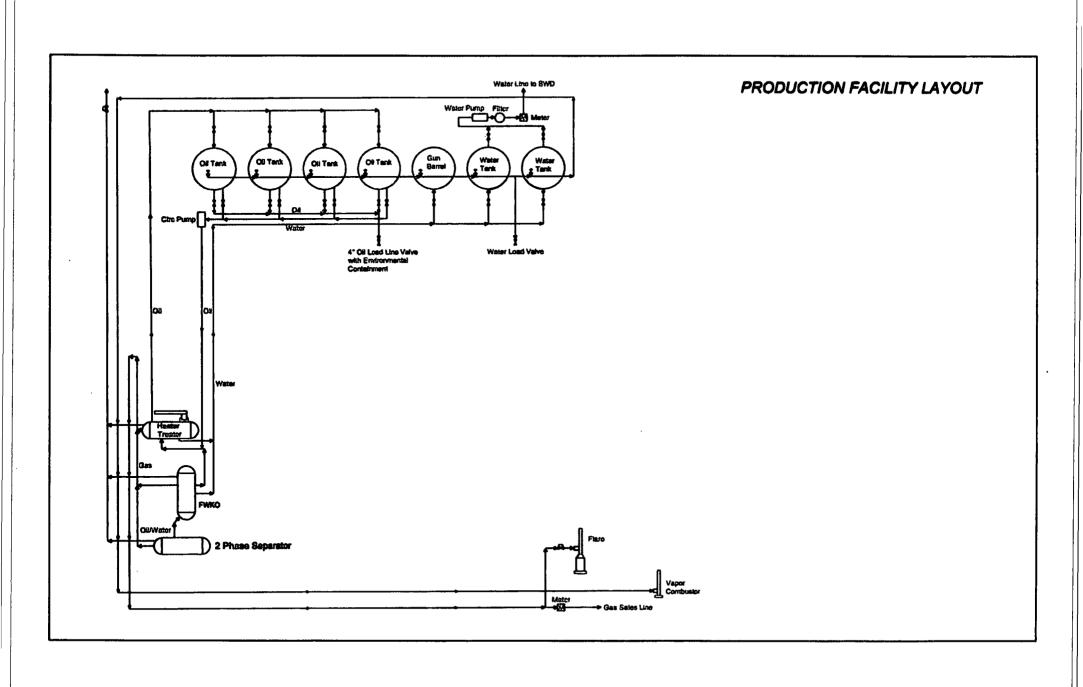

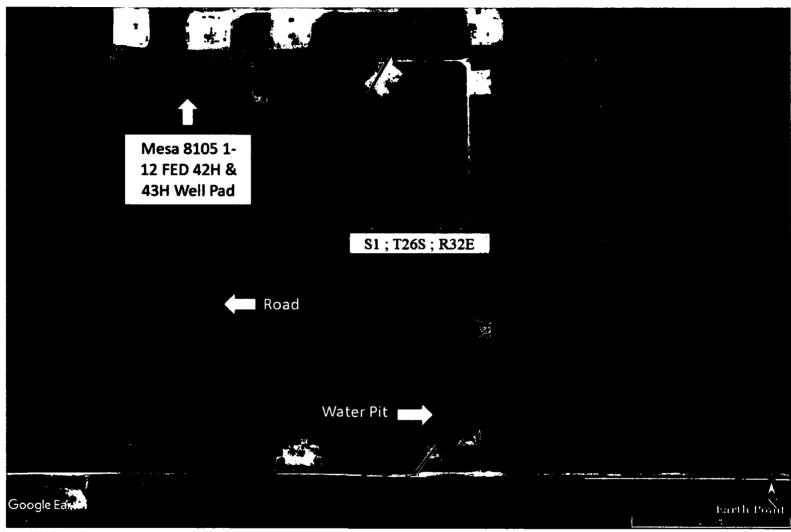



BTA OIL PRODUCERS, LLC
WATER TRANSPORTATION MAP
MESA 8105 1-12 FED 42H & 43H WELL PAD TO WATER PIT
SEC 1; T26S; R32E
LEA COUNTY, NM



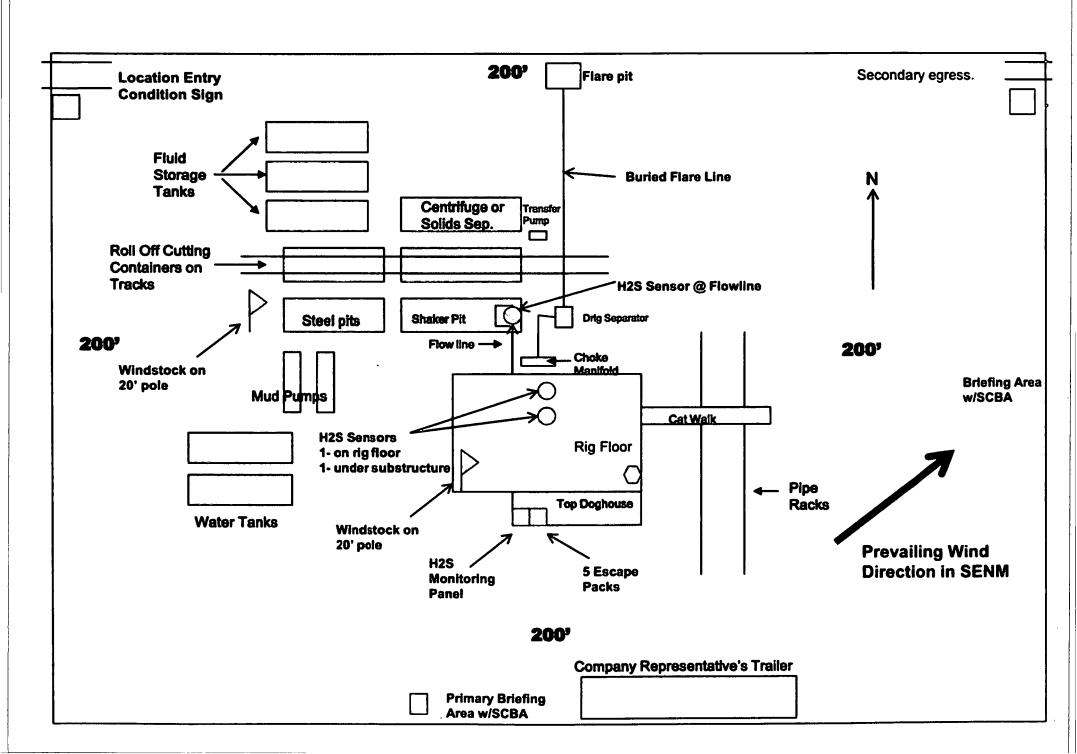

# WELL SITE PLAN

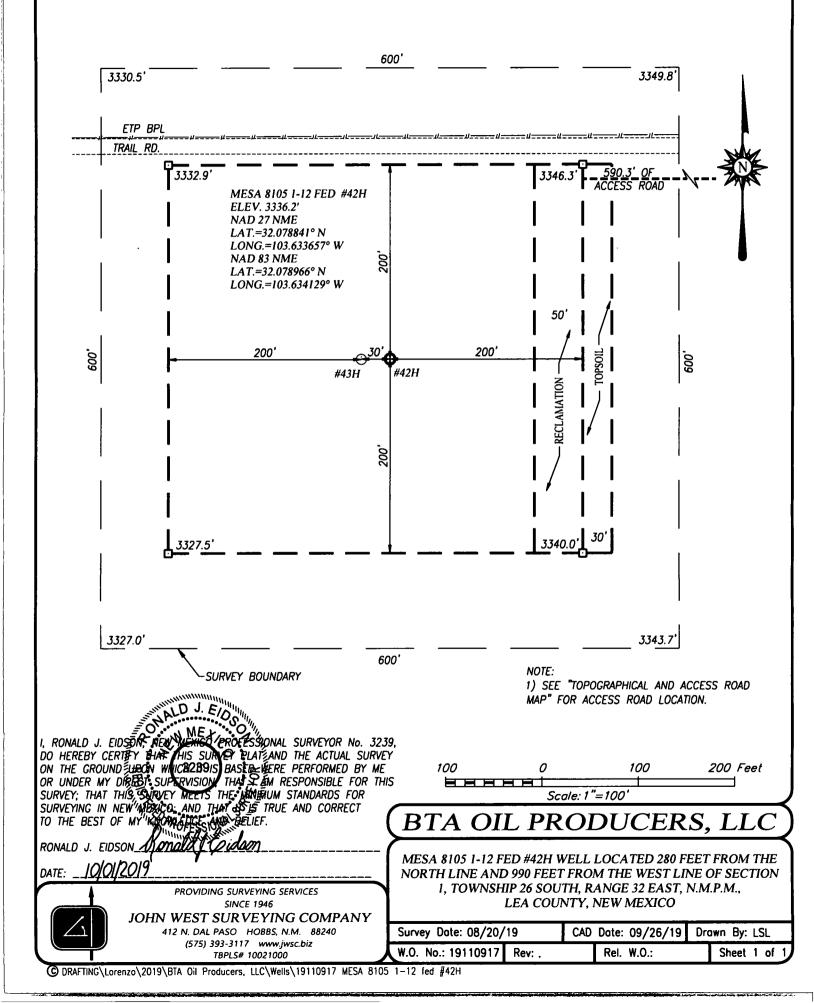

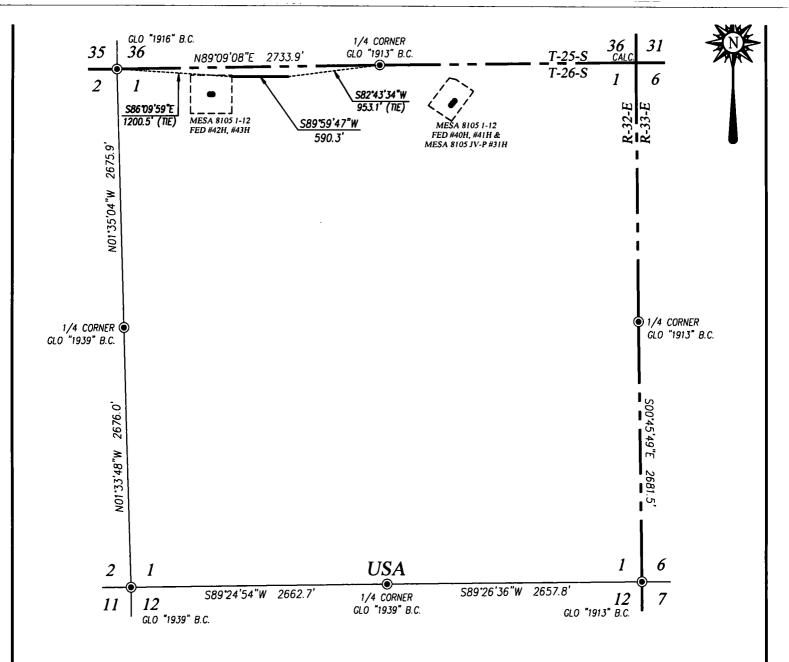

#### **DESCRIPTION**

SURVEY FOR A STRIP OF LAND 30.0 FEET WIDE AND 590.3 FEET OR 0.112 MILES IN LENGTH CROSSING USA LAND IN SECTION 1, TOWNSHIP 26 SOUTH, RANGE 32 EAST, N.M.P.M., LEA COUNTY, NEW MEXICO, AND BEING 15.0 FEET LEFT AND 15.0 FEET RIGHT OF THE ABOVE PLATTED CENTERLINE SURVEY.

# NOTE BEARINGS SHOWN HEREON ARE MERCATOR GRID AND CONFORM TO THE NEW MEXICO COORDINATE SYSTEM NEW MEXICO EAST ZONE" NORTH AMERICAN DATUM 1832 DISTANCE SINGLE SURFACE VALUES. I, RONALD J. EIDSONE NEW MEXICO EXPONENTIAND THE ACTUAL SURVEY ON THE GROUND UPON WHICH G209B SED WERE PERFORMED BY ME OR UNDER MY DIRECT SUPERVISION; THAT I AN RESPONSIBLE FOR THIS SURVEY; THAT THIS SURVEY MEETS THE MINIMUM STANDARDS FOR SURVEYING IN NEW MEXICO EAST ZONE" BEARINGS SHOWN HEREON ARE MERCATOR GRID AND CORRECT TO THE BEST OF MY KNOWLEGG AND THAT THIS STRUE AND CORRECT TO THE BEST OF MY KNOWLEGG AND THAT THIS STRUE AND CORRECT TO

SURVEY FOR AN ACCESS ROAD TO THE MESA

Konald & Didgon

RONALD J FIDSON

# U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

02/18/2020

**APD ID:** 10400049114

Submission Date: 10/10/2019

**Operator Name: BTA OIL PRODUCERS LLC** 

Well Name: MESA 8105 1-12 FED

Well Number: 42H

Well Type: OIL WELL

Well Work Type: Drill

#### Section 1 - General

Would you like to address long-term produced water disposal? NO

#### **Section 2 - Lined Pits**

Would you like to utilize Lined Pit PWD options? N

**Produced Water Disposal (PWD) Location:** 

PWD surface owner:

PWD disturbance (acres):

Lined pit PWD on or off channel:

Lined pit PWD discharge volume (bbl/day):

Lined pit specifications:

Pit liner description:

Pit liner manufacturers information:

Precipitated solids disposal:

Decribe precipitated solids disposal:

Precipitated solids disposal permit:

Lined pit precipitated solids disposal schedule:

Lined pit precipitated solids disposal schedule attachment:

Lined pit reclamation description:

Lined pit reclamation attachment:

Leak detection system description:

Leak detection system attachment:

Operator Italiie. DIA OIL FRODUCENS LLO Well Name: MESA 8105 1-12 FED Well Number: 42H **Lined pit Monitor description: Lined pit Monitor attachment:** Lined pit: do you have a reclamation bond for the pit? is the reclamation bond a rider under the BLM bond? Lined pit bond number: Lined pit bond amount: Additional bond information attachment: Section 3 - Unlined Pits Would you like to utilize Unlined Pit PWD options? N **Produced Water Disposal (PWD) Location:** PWD disturbance (acres): PWD surface owner: Unlined pit PWD on or off channel: Unlined pit PWD discharge volume (bbl/day): Unlined pit specifications: Precipitated solids disposal: Decribe precipitated solids disposal: Precipitated solids disposal permit: Unlined pit precipitated solids disposal schedule: Unlined pit precipitated solids disposal schedule attachment: Unlined pit reclamation description: Unlined pit reclamation attachment: **Unlined pit Monitor description: Unlined pit Monitor attachment:** Do you propose to put the produced water to beneficial use? Beneficial use user confirmation: Estimated depth of the shallowest aquifer (feet): Does the produced water have an annual average Total Dissolved Solids (TDS) concentration equal to or less than that of the existing water to be protected? TDS lab results: Geologic and hydrologic evidence: State authorization:

**Unlined Produced Water Pit Estimated percolation:** 

Unlined pit: do you have a reclamation bond for the pit?

Operator Maine. DIA OIL FRODUCENS LLC	
Well Name: MESA 8105 1-12 FED	Well Number: 42H
Is the reclamation bond a rider under the BLM bond?	
Unlined pit bond number:	
Unlined pit bond amount:	
Additional bond information attachment:	
Section 4 - Injection	
Would you like to utilize Injection PWD options? N	
Produced Water Disposal (PWD) Location:	
PWD surface owner:	PWD disturbance (acres):
Injection PWD discharge volume (bbl/day):	
Injection well mineral owner:	
Injection well type:	
Injection well number:	Injection well name:
Assigned injection well API number?	Injection well API number:
Injection well new surface disturbance (acres):	
Minerals protection information:	
Mineral protection attachment:	
Underground Injection Control (UIC) Permit?	
UIC Permit attachment:	
Section 5 - Surface Discharge	
Would you like to utilize Surface Discharge PWD options	? N
Produced Water Disposal (PWD) Location:	
PWD surface owner:	PWD disturbance (acres):
Surface discharge PWD discharge volume (bbl/day):	
Surface Discharge NPDES Permit?	
Surface Discharge NPDES Permit attachment:	
Surface Discharge site facilities information:	
Surface discharge site facilities map:	
Section 6 - Other	
Would you like to utilize Other PWD options? N	
Produced Water Disposal (PWD) Location:	
PWD surface owner:	PWD disturbance (acres):
Other PWD discharge volume (bbl/day):	

Operator maille. DIA OIL FRODUCERS LLO

Well Name: MESA 8105 1-12 FED

Well Number: 42H

Other PWD type description:

Other PWD type attachment:

Have other regulatory requirements been met?

Other regulatory requirements attachment:

#### U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

02/18/2020 The state of the s

**APD ID: 10400049114** 

Submission Date: 10/10/2019

**Operator Name: BTA OIL PRODUCERS LLC** 

Well Name: MESA 8105 1-12 FED

Well Number: 42H

**Show Final Text** 

Well Type: OIL WELL

Well Work Type: Drill

#### **Bond Information**

Federal/Indian APD: FED

**BLM Bond number: NMB001711** 

**BIA Bond number:** 

Do you have a reclamation bond? NO

Is the reclamation bond a rider under the BLM bond?

Is the reclamation bond BLM or Forest Service?

**BLM** reclamation bond number:

Forest Service reclamation bond number:

Forest Service reclamation bond attachment:

Reclamation bond number:

Reclamation bond amount:

Reclamation bond rider amount:

Additional reclamation bond information attachment:

# Success, you've submitted your claim!

We'll send a confirmation email to Lylashea217@gmail.com.

For reference your claim ID is 451464090.




## An Asurion Expert will visit you at

3611 Oakridge Dr, Midland, TX 79707-2833

Today, between 7pm and 9pm

Here's how to get ready and what to expect for your appointment:



O It will take the Asurion Expert approximately 45 minutes to get your device setup.

You'll need your Verizon PIN number to activate your device.

If you have pets, please ensure they are secure when your expert arrives.

### Tell us what you think

Your delivery will include:

Did our website exceed your expectations? Please click here to tell us about it. We hope you will recommend us to your friends and family.

#### **Delivery Address**

LylaShea Valdez 3611 Oakridge Dr, Midland, TX 79707-2833

## **Billing Summary**

Insurance Deductible \$199

Shipping Fee FREE

Taxes \$0.00

You Pay \$199

# **Payment Details**

Visa card ending in 2772



Samsung Galaxy S10 128GB Black

- 4G LTE SIM Card
- Home charger



# Weatherford®

# WFT Casing Head (Slip on Weld with O-Ring) Running Procedure

Publication RP-001 October 21, 2010

© 2010 Weatherford International Inc. All rights reserved



WFT Casing Head (Slip on Weld with O-Ring) Running Procedure

Approved By:	Reviewed By:	RP-001
R.	Bene J. Rose	Rev 0
Date: Oct 21, 2010	Date: Oct 21, 2010	