Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

NMOCD Hobbs

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

	Expires: Jul	ŀ
5.	Lease Serial No.	
	NMNM128927	

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.				6. If Indian, Allottee or Tribe Name		
SUBMIT IN TRI	PLICATE - Other instruc	ctions on reverse side.		7. If Unit or CA/Agre	eement, Name and/or No.	
	NMNM125386A					
Type of Well Gas Well □ Otl Gas Well □ Otl	8. Well Name and No. RED HILLS WEST UNIT 009H					
Name of Operator MEWBOURNE OIL COMPAN	Contact:	JACKIE LATHAN ewbourne.com		9. API Well No. 30-025-42705-0	00-X1 /	
3a. Address		3b. Phone No. (include are	acolds OCD	10. Field and Pool, or Exploratory		
HOBBS, NM 88241		Ph: 575-393-5905		JENNINGS		
4. Location of Well (Footage, Sec., 7	., R., M., or Survey Description)	OV 30 2013	11. County or Parish,	and State	
Sec 8 T26S R32E SWSW 330	FSL 380FWL	,		LEA COUNTY,	NM	
	/		RECEIVED			
12. CHECK APPI	ROPRIATE BOX(ES) TO) INDICATE NATURE		EPORT, OR OTHE	R DATA	
TYPE OF SUBMISSION		TY	PE OF ACTION			
	☐ Acidize	☐ Deepen	□ Produc	tion (Start/Resume)	☐ Water Shut-Off	
☐ Notice of Intent	☐ Alter Casing	☐ Fracture Treat	□ Reclan		☐ Well Integrity	
Subsequent Report	☐ Casing Repair	☐ New Constructi	on Recom	plete	Other	
☐ Final Abandonment Notice	☐ Change Plans	☐ Plug and Aband	on	rarily Abandon	Drilling Operations	
	☐ Convert to Injection	□ Plug Back	☐ Water	Disposal		
8/13/2015 TD 12 1/4" hole at 4 sks Lite Class C (35:65:4) w/ a R3. Mixed @ 14.8w/ 1.33 yd. Tested BOPE to 3000# & Ann OK. Drilled out w/ 8 3/4" bit.	additives. Mixed @ 12.5#/ Plug down @ 5:15 p.m. 8	g w/2.09 yd. Tail w/ 200 /13/2015. Circ 165 sks c	sks Class C w/ (of cmt to the pit. V	0.1% VOC. /		
Charts and schematic attache	d.					
Bond on file: NM1693 nationw	ide & NMB000919					
1-				*		
14. I hereby certify that the foregoing is	Electronic Submission #3 For MEWBOU	IRNE OIL COMPANY, sei	nt to the Hobbs			
Name (Printed/Typed) JACKIE L	nitted to AFMSS for proces		JTHORIZED REF			
					11	
Signature (Electronic S	Submission)	Date 09	/01/2015		120	
	THIS SPACE FO	R FEDERAL OR ST	ATE OFFICE U	SE	1	
ACCEPTED FOR I	RECORD					
Approved DAVID	R. GLASS_	Title			Date	
Conditions of approval if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to condu	itable title to those rights in the	not warrant or subject lease Office		,		
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious on fraudulent	O.S.C. Section 1212, make it a statements or representations as	crime for any person knowing to any matter within its jurisd	ly and willfully to m	ake to any department or	agency of the United	

** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **

MAN WELDING SERVICES, INC.

Comp	mpany Menderuns Date	e 8-15-15			
Lease	se Red Hills West U. + HOUTH Cou	inty Lea NA	1		
Drilli	Illing Contractor Policison 36 Plug	g & Drill Pipe Size	11"	C-22	4.5XH
Accur	umulator Pressure: 3000 Manifold Press	sure: 1500	. Annul	ar Pressure:	1300
	Accumulator Functio				
To Ch	Check - USABLE FLUID IN THE NITROGEN BO	OTTLES (III.A.	2.c.i. or	ii or iii)	
•	 Make sure all rams and annular are open and if age Ensure accumulator is pumped up to working pre Open HCR Valve. (If applicable) Close annular. Close all pipe rams. Open one set of the pipe rams to simulate close For 3 ram stacks, open the annular to achieve to Record remaining pressure /BOO psi. Te a. {950 psi for a 1500 psi system} If annular is closed, open it at this time and closed. 	ing the blind ram. the 50+ % safety factor for a 2000 psi for a 2000	actor. (5)	M and greate er than requ	

To Check - PRECHARGE ON BOTTLES OR SPHERICAL (III.A.2.d.)

- Start with manifold pressure at, or above, maximum acceptable pre-charge pressure:
 a. {800 psi for a 1500 psi system}
 b. {\$100 psi for 2000 and 3000 psi system}
 - 1. Open bleed line to the tank, slowly. (gauge needle will drop at the lowest bottle pressure)
 - 2. Close bleed line. Barely bump electric pump and see what pressure the needle jumps up to.
 - 3. Record pressure drop 950 psi. Test fails if pressure drops below minimum.
- Minimum: a. [700 psi for a 1500 psi system] b. [900 psi for a 2000 & 3000 psi system]

To Check - THE CAPACITY OF THE ACCUMULATOR PUMPS (III.A.2.f.)

- Isolate the accumulator bottles or spherical from the pumps & manifold.
- Open the bleed off valve to the tank, {manifold psi should go to 0 psi} close bleed valve.
 - 1. Open the HCR valve, {if applicable}
 - 2. Close annular
 - 3. With pumps only, time how long it takes to regain the required manifold pressure.
 - 4. Record elapsed time 3.24. Test fails if it takes over 2 minutes.
- a. {950 psi for a 1500 psi system} b. {1200 psi for a 2000 & 3000 psi system}




WELDING • BOP TESTING • NIPPLE UP SERVICE • BOP LIFTS • TANDEM MUD AND GAS SEPARATORS

Lovington, NM • 575-396-4540

Pg.	of
FQ.	OI

44 (4	1 12 E	
company: Mewbonine	Date: 8 13-15	frivoice #
Lease: Red Hills West Unit #609 H	Drilling Contractor: Tat	k150n Rig#36
Plug Size &Type:	Drill Pipe Size 4.5.+H	Tester: ROSS Charis #127
Required BOP:	Installed BOP:	
*Appropriate Casing Valve Must Be Open During BOP Test *		* Check Valve Must Be Open/Disabled To Test Kill Line Valve:
Pipe Rams #13 #11 #20 #9 Pipe Rams #14 Pipe Rams #14	#25 Super Choke	Just P Charac Value

TEST #	ITEMS TESTED	TEST LENGTH	LOW PSI	HIGH PSI	REMARKS
1	13,7	10-10	250	3000	Test Pass
2	19,8,12	10-10	250	3000	Test Poss
3	12,10,3,4,5	10-10	750	3000	Test Pass
4	12,11,1,2,6	10-10	750	3000	Test Pass
5	12,9,25,26,5	BurpTEST		3000	Tes+ fess
6	15,9,7	10-10	250	1500	Tes+ Pass
7	20,21,77,23	10-10	250	3000	Test Pass
8	24	10-10	250	3000	Tes! Rss
9	17	10-10	250	3000	Test-Poss
10	18	10.10	250	3000	TOST PASS
11	18	10-10	250	3000	Tot Pass
12	19	10-10	250	3000	TEST Pass
	743				
	2213				
					The second secon

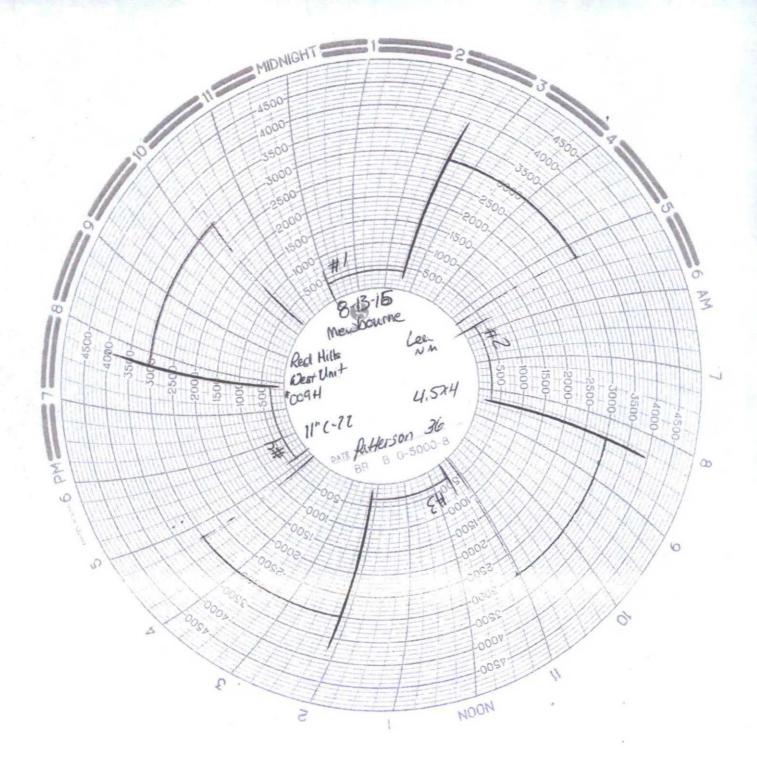

· · ·

