
Form 3160-5		OCD Hobb	5		
	UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT NOTICES AND REPORTS ON WELLS			FORM APPROVED OM B No 1004-0135 Expires January 31, 2004	
				5 Lease Serial No NM-NM56263	
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160 - 3 (APD) for such proposals.			6 If Indian, Allottee or Tribe Name n/a		
	IPLICATE- Other inst	ructions on revers	side. D	7 If Unit or CA/Agreement, Name and/or No n/a	
1 Type of Well	✓ Oil Well Gas Well Other		3 2016	8 Well Name and No. SUN PERAL FEDERAL #1	
2 Name of Operator CHEVRON	DEOFILIER		9. API Well No.		
3a Address 15 SMITH RD. MIDLAND TX 790705		3b. Phone No. (include area code) 432-687-7279		30-025-30409 10 Field and Pool, or Exploratory Area	
4. Location of Well (Footage, Sec., T. R. M., or Survey Description) SEC 28 T19S R34E NWSE 1650FSL 1650FEL				PEARL 11 County or Parish, State LEA, NEW MEXICO	
TYPE OF SUBMISSION		TYPE	OF ACTION		
Notice of Intent	Acidize	Deepen Fracture Treat	Production (S	tart/Resume) Water Shut-Off Well Integrity	
Subsequent Report	Casing Repair	New Construction	Recomplete	Other	
Final Abandonment Notice	Change Plans	Plug and Abandon Plug Back			
4781'-4799 ⁷ , 4525'-4505' P&A PROCEDURE: NO SET 4-1/2'' CIBP @ 4500	341', TOC @ SURFACE, 4-1/2 TIFY BLM 48HRS BEFORE Sof CIBP So - /00 ' WITH 25SXS OF CMT ON ' RESSURE CSG TO 500PSI	MOVING ON LOCATI	ON (575) 234-590	URFACE, PERFS 5070'-5080',4839'-4847', P RECLAMATION PROCEDURE ATTACHED	
4781'-4799', 4525'-4505' P&A PROCEDURE: NO SET 4-1/2" CIBP @ 4500 WOC TAG TOC AND PI TEST CSG FOR 15 MIN	TIFY, BLM 48HRS BEFORE 50 F CLBO SO - 100 WITH 25SXS OF CMT ON 7 RESSURE CSG TO 500PSI S. RECORD.	MOVING ON LOCATI 96000 00 Pop Pe TOP.	ON (575) 234-590	RECLAMATION PROCEDURE	
4781'-4799', 4525'-4505' P&A PROCEDURE: NO SET 4-1/2" CIBP @ 4500 WOC TAG TOC AND PI TEST CSG FOR 15 MIN	TIFY, BLM 48HRS BEFORE 50 F CLBO SO - 100 WITH 25SXS OF CMT ON 7 RESSURE CSG TO 500PSI S. RECORD.	MOVING ON LOCATI 96000 00 Pop Pe TOP.	ON (575) 234-590	RECLAMATION PROCEDURE ATTACHED	
4781'-4799', 4525'-4505' P&A PROCEDURE: NO SET 4-1/2" CIBP @ 4500 WOC TAG TOC AND PI TEST CSG FOR 15 MIN	TIFY, BLM 48HRS BEFORE 50 F CLBO SO - 100 WITH 25SXS OF CMT ON 7 RESSURE CSG TO 500PSI S. RECORD.	MOVING ON LOCATI 96000 00 Pop Pe TOP.	ON (575) 234-590	PLUG FROM 4200' - SURFACE	
4781'-4799', 4525'-4505' P&A PROCEDURE: NO SET 4-1/2" CIBP @ 4500 WOC TAG TOC AND PI TEST CSG FOR 15 MIN MIX AND PUMP A MUI	TIFY BLM 48HRS BEFORE Sof CIBO SO - 100 WITH 25SXS OF CMT ON RESSURE CSG TO 500PSI S. RECORD. LTI-STAGED 4200' 320 SXS,	MOVING ON LOCATI 96000 00 Pop Pe TOP.	ON (575) 234-590	PLUG FROM 4200' - SURFACE	
4781'-4799', 4525'-4505' P&A PROCEDURE: NO SET 4-1/2" CIBP @ 4500 WOC TAG TOC AND PI TEST CSG FOR 15 MIN MIX AND PUMP A MUI	TIFY BLM 48HRS BEFORE Sof CIBO SO - 100 WITH 25SXS OF CMT ON RESSURE CSG TO 500PSI S. RECORD. LTI-STAGED 4200' 320 SXS, 1 Rem. COAS A4 Proving is true and correct	MOVING ON LOCATH 40000 Por Por TOP. 15.6PPG, 1.18 YEILD, C	ON (575) 234-590	PLUG FROM 4200' - SURFACE ATTACHED PLUG FROM 4200' - SURFACE ATTACHED FOR NDITIONS OF APPROVAL	
4781'-4799', 4525'-4505' P&A PROCEDURE: NO SET 4-1/2" CIBP @ 4500 WOC TAG TOC AND PI TEST CSG FOR 15 MIN MIX AND PUMP A MUI	TIFY BLM 48HRS BEFORE Sof CIBO SO - 100 WITH 25SXS OF CMT ON RESSURE CSG TO 500PSI S. RECORD. LTI-STAGED 4200' 320 SXS, 1 Rem. COAS A4 Proving is true and correct	MOVING ON LOCATH 40000 Por Por TOP. 15.6PPG, 1.18 YEILD, C	ON (575) 234-590 LASS "C" CMT SEE CON	PLUG FROM 4200' - SURFACE ATTACHED PLUG FROM 4200' - SURFACE ATTACHED FOR NDITIONS OF APPROVAL	
4781'-4799', 4525'-4505' P&A PROCEDURE: NO SET 4-1/2" CIBP @ 4500 WOC TAG TOC AND PI TEST CSG FOR 15 MIN MIX AND PUMP A MUI Printed Chick Name (Printed Typed) Tony C. Raphae	TIFY BLM 48HRS BEFORE Sof CIBP SO - 100 WITH 25SXS OF CMT ON RESSURE CSG TO 500PSI S. RECORD. TI-STAGED 4200' 320 SXS, COAS A egoing is true and correct	MOVING ON LOCATH Gove For Per TOP. 15.6PPG, 1.18 YEILD, C Title We Date	ON (575) 234-590 LASS "C" CMT SEE CON	PLUG FROM 4200' - SURFACE ATTACHED FOR ATTACHED FOR ATTACHED FOR NDITIONS OF APPROVAL Engineer 06/21/2016	
4781'-4799', 4525'-4505' P&A PROCEDURE: NO SET 4-1/2" CIBP @ 4500 WOC TAG TOC AND PI TEST CSG FOR 15 MIN MIX AND PUMP A MUI AND PUMP A MUI IN AND PUMP A MUI IN AND PUMP A MUI Signature The Comparison of the com	TIFY BLM 48HRS BEFORE Sof CIBP SO - 100 WITH 25SXS OF CMT ON T RESSURE CSG TO 500PSI S. RECORD. TI-STAGED 4200' 320 SXS, COAS A egoing is true and correct THIS SPACE FOR THIS SPACE FOR MULLS attached Approval of this notice I or equitable title to those rights i	MOVING ON LOCATH Gove Ferrar Control 15.6PPG, 1.18 YEILD, C Title We Date FEDERAL OR ST does not warrant or	ATE OFFICE	PLUG FROM 4200' - SURFACE ATTACHED FOR ATTACHED FOR ATTACHED FOR NDITIONS OF APPROVAL Engineer 06/21/2016	
4781'-4799', 4525'-4505' P&A PROCEDURE: NO SET 4-1/2" CIBP @ 4500 WOC TAG TOC AND PI TEST CSG FOR 15 MIN MIX AND PUMP A MUI AND PUMP A MUI Printed Typed) Tony C. Raphae Signature The Composition of approval. If any, are certify that the applicant holds lega which would entitle the applicant to	TIFY BLM 48HRS BEFORE Sof CIBP So - 700 WITH 25SXS OF CMT ON T RESSURE CSG TO 500PSI S. RECORD. TI-STAGED 4200' 320 SXS, TI-STAGED 4200' 320 SXS, COAS A egoing is true and correct THIS SPACE FOR THIS SPACE FOR USA attached Approval of this notice of orequitable title to those rights to conduct operations thereon e 43 US C. Section 1212, make it a	MOVING ON LOCATH 4 Dove Ferror 15.6PPG, 1.18 YEILD, C Title We Date FEDERAL OR ST does not warrant or n the subject lease Off a crime for any person know	ATE OFFICE e Eng ice GO	PLUG FROM 4200' - SURFACE ATTACHED FOR ATTACHED FOR DITIONS OF APPROVAL Engineer 06/21/2016	

Current Wellbore Schematic

WELL (PN): SUN PEARL FED 1(CVX) (890790) FIELD OFFICE: HOBBS FIELD: PEARL QUEEN STATE / COUNTY: NEW MEXICO / LEA LOCATION: SEC 28-19S-34E, 1650 FSL & 1650 FEL ROUTE: HOB-NM-ROUTE 04- CONTRACT ELEVATION: GL: 3,702.0 KB: 3,714.0 KB Height: 12.0 DEPTHS: TD: 6,500.0

API #: 3002530409 Serial #: SPUD DATE: 6/2/1989 IG RELEASE: 6/12/1989

RIG RELEASE: 6/12/1989 1ST SALES GAS: 1ST SALES OIL: 6/1/1989 Current Status: PRODUCING

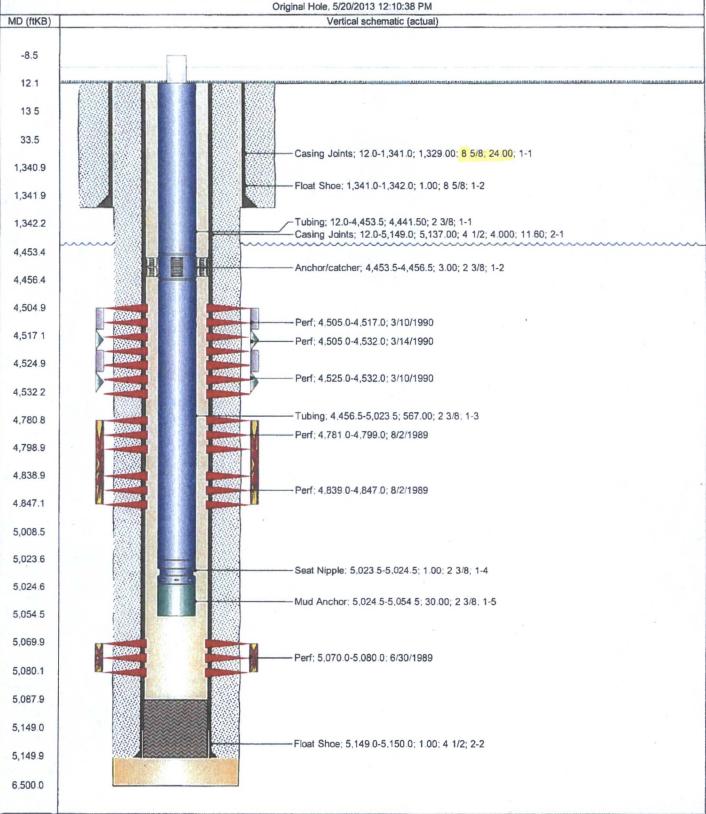

		-			
	Surface, 8 56 m; 0 000 m, 12-1,342 ftKB Centent, Production Casing Centert, 12-5,150 ftKB		Cement, Production Casing Cement (plug), 5,088-5,150 ftKB	Production, 4 1/2 m, 4 000 m, 12-5,150 flKB	
MIX AND PUMP A MULTI-STAGED 4200', 3205XS, 15.6PPG, 1.18 YEILD, CLASS "C" CMT PLUG FROM 4200' – SURFACE.	8 56° 24# J-55 Surf Csg. 1,342 Cmt w/ 700 sr Circ w/ 280 sr, 1,342	Set CLBA So-100'4bur Set CLBA So-100'4bur topperf TOP. WOC & TOC. PRESSURE TEST PLUG AND CSG TO SOOPSI		4 1/2" 11 6# J-55 Prod Csg. 5,150 Cmt w/1600 sr. Ctrc, 5,150	

•

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.** Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¹/₄ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken: From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Appropriate time for submittal would be when filing the Vell Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.

- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.
- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Linda Denniston Environmental Protection Specialist 575-234-5974

Henryetta Price Environmental Protection Specialist 575-234-5951

Dara Glass Environmental Protection Specialist 575-234-5924

Shelly Tucker Environmental Protection Specialist 575-234-5979