
AUG 1 5 B	UNITED STATES EPARTMENT OF THE IN	Hobbs		FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010	
CUNDDY			5. Lease Serial No.		
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.				NMLC060821A           6. If Indian, Allottee or Tribe Name	
SUBMIT IN TRI	ions on reverse side.	erse side.       7. If Unit or CA/Agreement, Name and/or No         8910084860       8. Well Name and No.         WEST CAP QUEEN SAND UNIT 25			
. Type of Well Gas Well Ott					
2. Name of Operator Contact: LAURA LEGACY RESERVES OPERATING E-Mail: Ipina@legacylp.com				9. API Well No. 30-005-01118-00-S1	
a. Address PO BOX 10848 MIDLAND, TX 79702-7848		3b. Phone No. (include area code Ph: 432-689-5200	. Phone No. (include area code) 10. Field a CAPR		
Location of Well (Footage, Sec., 7	T., R., M., or Survey Description)	and the second	11. County	or Parish, and State	
Sec 21 T14S R31E SWSE Tract 11 660FSL 1980FEL		(	CHAVES COUNTY, NM		
12. CHECK APP	ROPRIATE BOX(ES) TO	INDICATE NATURE OF	NOTICE, REPORT, OI	R OTHER DATA	
TYPE OF SUBMISSION		TYPE OF ACTION			
Notice of Intent	□ Acidize	Deepen	□ Production (Start/]	INT TO PA	
	□ Alter Casing	Fracture Treat	Reclamation	P&A NR	
□ Subsequent Report	Casing Repair	New Construction	Recomplete	P&A R	
Final Abandonment Notice	Change Plans	Plug and Abandon	Temporarily Aban		
	Convert to Injection	Plug Back	Water Disposal		
NOTE: All plugs to be minimu				ECUIS	
Proposed P&A Procedure: 1. MIRU. Lay down tubing stri 2. RIH and tag cement top @ 3. Circulate minimum 9.5 ppg 4. Pressure test and isolate le 5. TOOH. Perforate @ 2015'. 6. RIH with PKR to 1750'. Pur w/opened ended tubing and ta 7. TOOH. Perforate @ 1350'.	ing. Pick up work string. 2881'. Spot 25 sx of cemer P&A mud to surface. eak if any. mp into perf @ 2015' w/min ag TOC at/above 1915'.	imum 35 sx cement. WOC,	POOH w/packer, RIH	REC Blis 120	
Proposed P&A Procedure: 1. MIRU. Lay down tubing stri 2. RIH and tag cement top @ 3. Circulate minimum 9.5 ppg 4. Pressure test and isolate le 5. TOOH. Perforate @ 2015'. 6. RIH with PKR to 1750'. Pur w/opened ended tubing and ta 7. TOOH. Perforate @ 1350'. 4. I hereby certify that the foregoing is	ing. Pick up work string. 2881'. Spot 25 sx of cemer P&A mud to surface. eak if any. mp into perf @ 2015' w/min ag TOC at/above 1915'. s true and correct. Electronic Submission #34 For LEGACY RES	imum 35 sx cement. WOC, 47182 verified by the BLM We SERVES OPERATING, sent to	POOH w/packer, RIH	E)	
Proposed P&A Procedure: 1. MIRU. Lay down tubing stri 2. RIH and tag cement top @ 3. Circulate minimum 9.5 ppg 4. Pressure test and isolate le 5. TOOH. Perforate @ 2015'. 6. RIH with PKR to 1750'. Pur w/opened ended tubing and ta 7. TOOH. Perforate @ 1350'. 4. Thereby certify that the foregoing is	ing. Pick up work string. 2881'. Spot 25 sx of cemer P&A mud to surface. eak if any. mp into perf @ 2015' w/min ag TOC at/above 1915'. s true and correct. Electronic Submission #34 For LEGACY RES committed to AFMSS for proce	imum 35 sx cement. WOC, 47182 verified by the BLM We SERVES OPERATING, sent to essing by DAVID GLASS on 0	POOH w/packer, RIH	=)	
Proposed P&A Procedure: 1. MIRU. Lay down tubing stri 2. RIH and tag cement top @ 3. Circulate minimum 9.5 ppg 4. Pressure test and isolate le 5. TOOH. Perforate @ 2015'. 6. RIH with PKR to 1750'. Pur w/opened ended tubing and ta 7. TOOH. Perforate @ 1350'. 4. I hereby certify that the foregoing is Name (Printed/Typed) LAURA P	ing. Pick up work string. 2881'. Spot 25 sx of cemer P&A mud to surface. eak if any. mp into perf @ 2015' w/min ag TOC at/above 1915'. s true and correct. Electronic Submission #34 For LEGACY RES committed to AFMSS for proce	imum 35 sx cement. WOC, 47182 verified by the BLM We SERVES OPERATING, sent to essing by DAVID GLASS on 0	POOH w/packer, RIH ell Information System o the Roswell 08/09/2016 (16DRG0330SE LIANCE COORDINATC	=)	
Proposed P&A Procedure: 1. MIRU. Lay down tubing stri 2. RIH and tag cement top @ 3. Circulate minimum 9.5 ppg 4. Pressure test and isolate le 5. TOOH. Perforate @ 2015'. 6. RIH with PKR to 1750'. Pur w/opened ended tubing and ta 7. TOOH. Perforate @ 1350'. 4. I hereby certify that the foregoing is Co Name (Printed/Typed) LAURA P	ing. Pick up work string. 2881'. Spot 25 sx of cemer P&A mud to surface. eak if any. mp into perf @ 2015' w/min ag TOC at/above 1915'. s true and correct. Electronic Submission #34 For LEGACY RES committed to AFMSS for proce PINA	imum 35 sx cement. WOC, 47182 verified by the BLM We SERVES OPERATING, sent to essing by DAVID GLASS on O Title COMP	POOH w/packer, RIH ell Information System of the Roswell 08/09/2016 (16DRG0330SI LIANCE COORDINATO 2016	=)	
Proposed P&A Procedure: 1. MIRU. Lay down tubing stri 2. RIH and tag cement top @ 3. Circulate minimum 9.5 ppg 4. Pressure test and isolate le 5. TOOH. Perforate @ 2015'. 6. RIH with PKR to 1750'. Pur w/opened ended tubing and ta 7. TOOH. Perforate @ 1350'.  4. I hereby certify that the foregoing is Coo Name (Printed/Typed) LAURA P Signature (Electronic S Approved By_/SLDAV	ing. Pick up work string. 2881'. Spot 25 sx of cemer P&A mud to surface. eak if any. mp into perf @ 2015' w/min ag TOC at/above 1915'. s true and correct. Electronic Submission #34 For LEGACY RES committed to AFMSS for proce PINA Submission) THIS SPACE FOR ID R_GLAS	A7182 verified by the BLM We BERVES OPERATING, sent to essing by DAVID GLASS on O Title COMP Date 08/09/2 R FEDERAL OR STATE	POOH w/packer, RIH ell Information System of the Roswell 08/09/2016 (16DRG0330SI LIANCE COORDINATO 2016	E) DR	
Proposed P&A Procedure: 1. MIRU. Lay down tubing stri 2. RIH and tag cement top @ 3. Circulate minimum 9.5 ppg 4. Pressure test and isolate le 5. TOOH. Perforate @ 2015'. 6. RIH with PKR to 1750'. Pur w/opened ended tubing and ta 7. TOOH. Perforate @ 1350'.  14. I hereby certify that the foregoing is Co Name (Printed/Typed) LAURA P Signature (Electronic S Approved By /S/DAV	ing. Pick up work string. 2881'. Spot 25 sx of cemer P&A mud to surface. eak if any. mp into perf @ 2015' w/min ag TOC at/above 1915'. s true and correct. Electronic Submission #34 For LEGACY RES ommitted to AFMSS for proce INA Submission) THIS SPACE FOR ID R_GLASS ed. Approval of this notice does n uitable title to those rights in the s	imum 35 sx cement. WOC, 47182 verified by the BLM We SERVES OPERATING, sent to ERVES OPERATING, sent to ERVES OPERATING, sent to Date 08/09/2 R FEDERAL OR STATE S	POOH w/packer, RIH ell Information System o the Roswell 08/09/2016 (16DRG0330SI LIANCE COORDINATO 2016 OFFICE USE	E) DR	
Proposed P&A Procedure: 1. MIRU. Lay down tubing stri 2. RIH and tag cement top @ 3. Circulate minimum 9.5 ppg 4. Pressure test and isolate le 5. TOOH. Perforate @ 2015'. 6. RIH with PKR to 1750'. Pur w/opened ended tubing and ta 7. TOOH. Perforate @ 1350'.  14. I hereby certify that the foregoing is Co Name (Printed/Typed) LAURA P Signature (Electronic S	ing. Pick up work string. 2881'. Spot 25 sx of cemer P&A mud to surface. eak if any. mp into perf @ 2015' w/min ag TOC at/above 1915'. s true and correct. Electronic Submission #34 For LEGACY RES ommitted to AFMSS for proce PINA Submission) THIS SPACE FOR ID R_GLASS ed. Approval of this notice does n uitable title to those rights in the s uct operations thereon.	imum 35 sx cement. WOC, 47182 verified by the BLM We SERVES OPERATING, sent to ERVES OPERATING, sent to ERVES OPERATING, sent to Date 08/09/2 R FEDERAL OR STATE S Title O8/09/2 R FEDERAL OR STATE S Office Time for any person knowingly and	POOH w/packer, RIH	E) DR AMG 0 9 201	
Proposed P&A Procedure: 1. MIRU. Lay down tubing stri 2. RIH and tag cement top @ 3. Circulate minimum 9.5 ppg 4. Pressure test and isolate le 5. TOOH. Perforate @ 2015'. 6. RIH with PKR to 1750'. Pur w/opened ended tubing and ta 7. TOOH. Perforate @ 1350'. 14. I hereby certify that the foregoing is Co Name (Printed/Typed) LAURA P Signature (Electronic S Approved By_/SL DAV miditions of approval, if any, are attached the 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	ing. Pick up work string. 2881'. Spot 25 sx of cemer P&A mud to surface. eak if any. mp into perf @ 2015' w/min ag TOC at/above 1915'. s true and correct. Electronic Submission #34 For LEGACY RES for LEGACY for LEGACY RES for LEGACY for LEGAC	imum 35 sx cement. WOC, 47182 verified by the BLM We SERVES OPERATING, sent to ERVES OPERATING, sent to ERVES OPERATING, sent to Date 08/09/2 R FEDERAL OR STATE S Title O8/09/2 R FEDERAL OR STATE Office Time for any person knowingly and	POOH w/packer, RIH	E) DR AUG 0 9 201 eartment or agency of the United	


## Additional data for EC transaction #347182 that would not fit on the form

## 32. Additional remarks, continued

8. RIH with PKR to 1050'. Pump into perf @ 1350' w/minimum 35 sx cement. WOC, POOH w/packer, RIH w/opened ended tubing and tag TOC at/above 1250'.
9. TOOH. Perforate @ 212'.
10. Circulate cement from 212' to surface.
11. POOH, top off casing, remove WH, set P&A marker, clean and reclaim location.

Current & proposed wellbore diagrams attached.

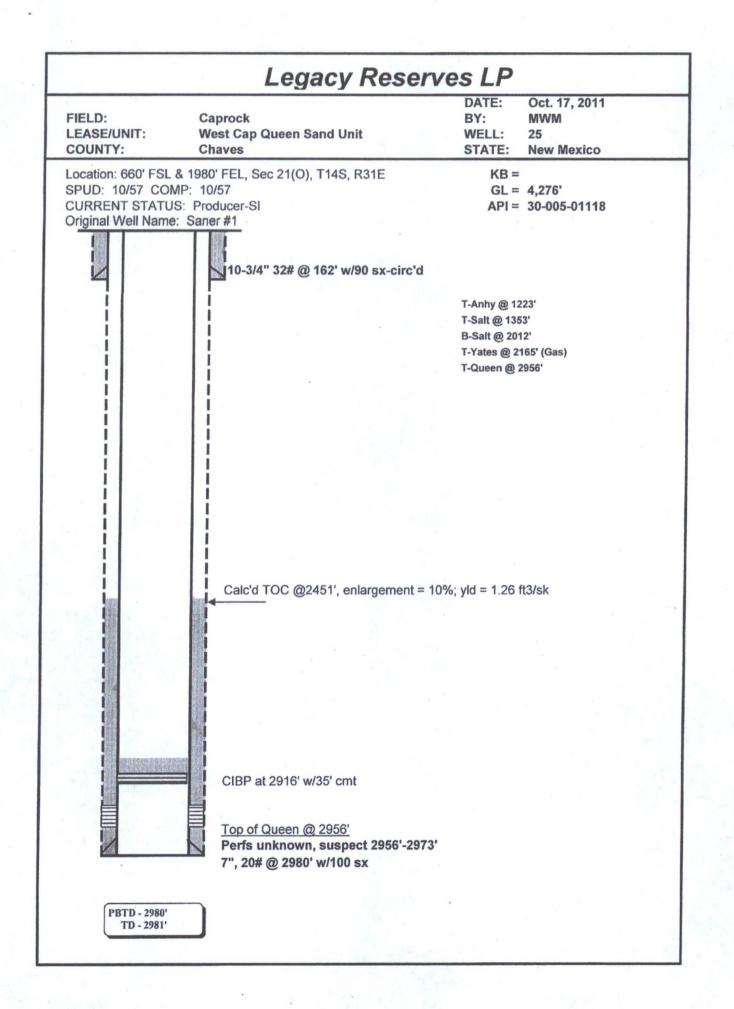

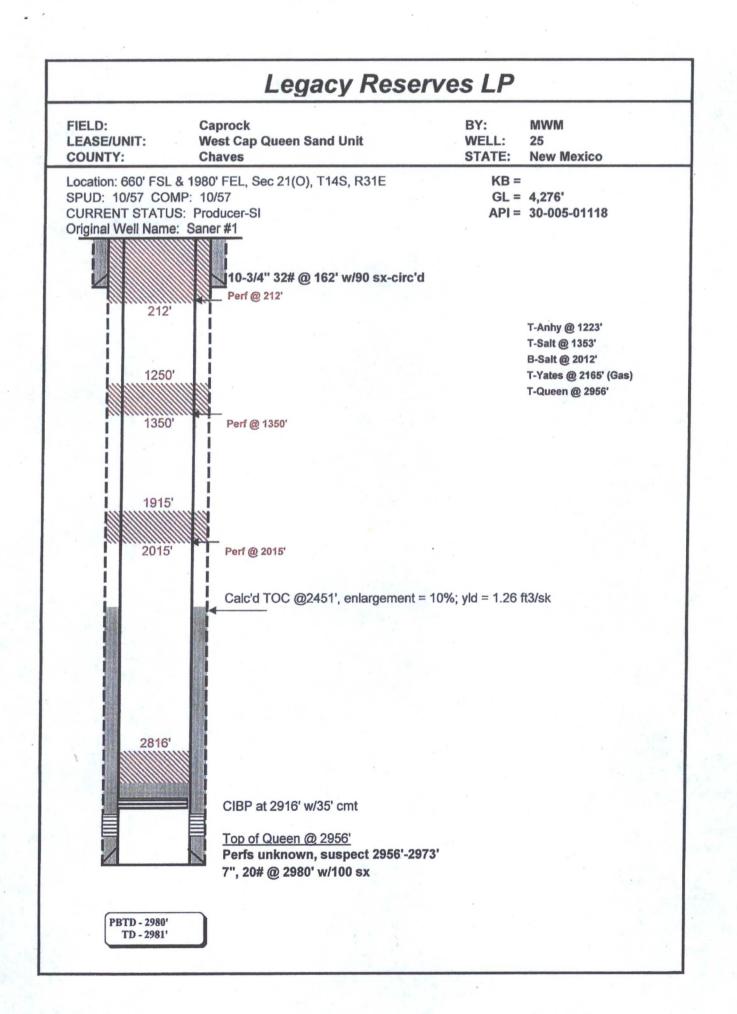

## BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 (575) 627-0272

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **ninety** (90) days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90<sup>th</sup> day provide the BLM Roswell Field Office (RFO), prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action. Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.

2. <u>Notification:</u> Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10 feet in length, 4 feet above the ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.