

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OCD Hobbs

FORM APPROVED
OMB NO. 1004-0137
Expires: January 31, 2018**SUNDRY NOTICES AND REPORTS ON WELLS**
*Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.*5. Lease Serial No.
NMNM86154

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.
TRISTE DRAW 25 FED COM 10H9. API Well No.
30-025-42082-00-X110. Field and Pool or Exploratory Area
TRISTE DRAW-DELAWARE11. County or Parish, State
LEA COUNTY, NM**SUBMIT IN TRIPLICATE - Other instructions on page 2**

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

CIMAREX ENERGY COMPANY OF CO

Contact: ARICKA EASTERLING

E-Mail: aeasterling@cimarex.com

3a. Address

202 S CHEYENNE AVE. SUITE 1000
TULSA, OK 74103

3b. Phone No. (include area code)

Ph: 918.560.7060

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Sec 25 T23S R32E SWSW 330FSL 1270FWL
32.269353 N Lat, 103.632767 W Lon

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

TYPE OF ACTION

☒ Notice of Intent☐ Subsequent Report☐ Final Abandonment Notice☐ Acidize☐ Alter Casing☐ Casing Repair☐ Change Plans☐ Convert to Injection☐ Deepen☐ Hydraulic Fracturing☐ New Construction☐ Plug and Abandon☐ Plug Back☐ Production (Start/Resume)☐ Reclamation☐ Recomplete☐ Temporarily Abandon☐ Water Disposal☐ Water Shut-Off☐ Well Integrity☒ Other
Change to Original A
PD

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

Cimarex respectfully request approval for a multibowl well head, please see attached diagram and procedure.

**SEE ATTACHED FOR
CONDITIONS OF APPROVAL**

14. I hereby certify that the foregoing is true and correct.

Electronic Submission #390532 verified by the BLM Well Information System

For CIMAREX ENERGY COMPANY OF CO, sent to the Hobbs

Committed to AFMSS for processing by ZOTA STEVENS on 10/18/2017 (18ZS0010SE)

Name (Printed/Typed) ARICKA EASTERLING

Title REGULATORY ANALYST

Signature (Electronic Submission)

Date 10/03/2017

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By ZOTA STEVENS

Title PETROLEUM ENGINEER

Date 10/23/2017


Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office Hobbs

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

**** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED *****KZ*

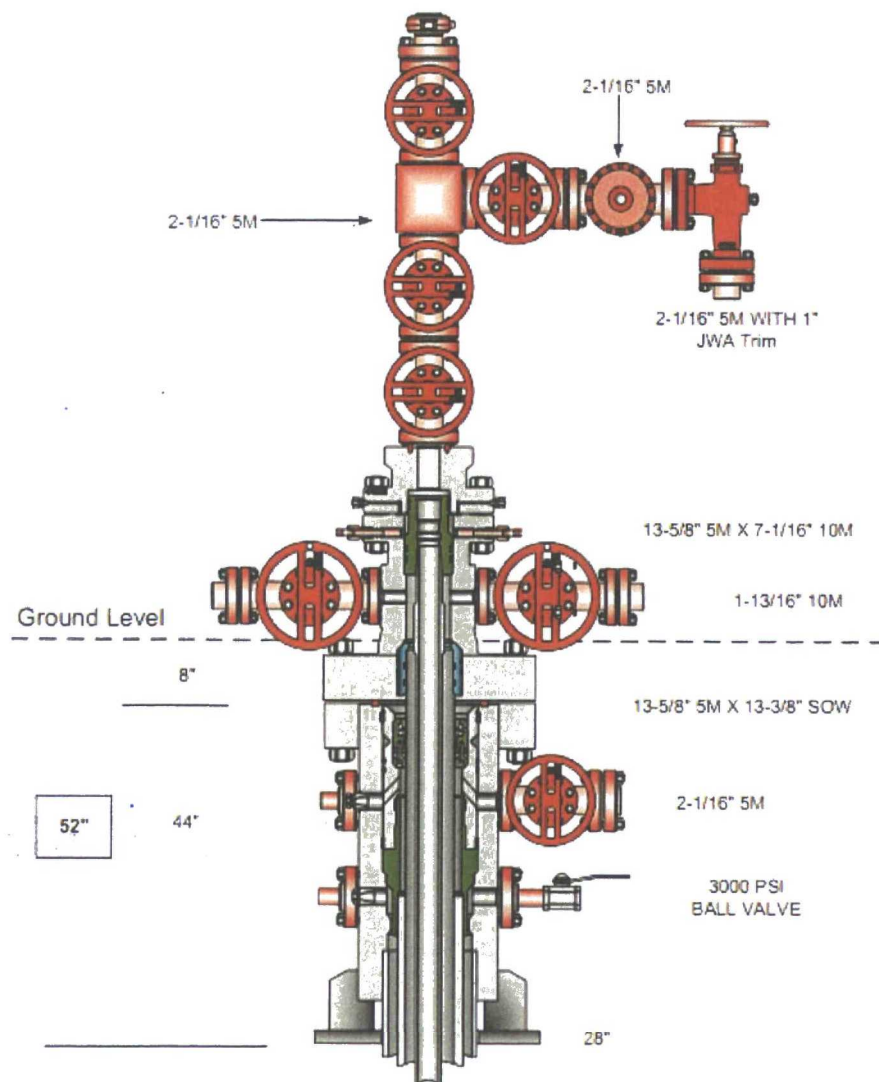

Cactus Multi-Bowl Wellhead Steps:

1. Drill 17.5" Hole to Surface TD.
2. Trip out of hole.
3. Run and cement 13-3/8" casing.
4. Weld on Cactus Multi-Bowl Wellhead per Manufacturer's procedure.
5. Test weld to 70% of 13-3/8" surface casing.
6. Manufacturer representative will install test plug
7. Test BOPE equipment to 3,000 psi per permitted test pressure for drilling below 9-5/8" intermediate shoe.
8. Install Wear Bushing
9. Drill to 9-5/8" casing shoe
10. Trip out of hole.
11. Remove Wear Bushing.
12. Run 9-5/8" casing and land 9-5/8" casing hanger.
13. Cement casing.
14. Washout stack. Run wash tool to clean hanger.
15. Run and Install Packoff.
16. Test Packoff Seals.
17. Run Wear Bushing.
18. TIH to float collar.
19. Test Casing per COA WOC times. (500 psi compressive strength and 8 hours, whichever is greater)
20. Drill to production hole TD.
21. Trip out of hole.
22. Run 5.5" Production Casing.
23. Cement 5.5" Casing.
24. Set 5.5" Casing Slips.

Note: We will not Test BOP's after welding on the Surface head unless we exceed the 30 day limit per Onshore Order #2.

PECOS DISTRICT CONDITIONS OF APPROVAL

OPERATOR'S NAME:	Cimarex Energy Co
LEASE NO.:	NM86154
WELL NAME & NO.:	10H Triste Draw 25 Fed Com
SURFACE HOLE FOOTAGE:	330' FSL & 1270 FWL
BOTTOM HOLE FOOTAGE:	330' FNL & 440 FWL,
LOCATION:	Section 25, T 23 S, R 32 E., NMPM
COUNTY:	Lea County, New Mexico

All COAs still apply expect the following TABLE OF CONTENTS

I. DRILLING

A. PRESSURE CONTROL

1. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **2000 (2M) psi**
 - a. **For surface casing only:** If the BOP/BOPE is to be tested against casing, the wait on cement (WOC) time for that casing is to be met (see WOC statement at start of casing section). Independent Service Company required.
2. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the **9-5/8** intermediate casing shoe shall be **3000 (3M) psi**.

Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the intermediate casing shoe shall be **3000 (3M) psi**.

- a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
- b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- c. Manufacturer representative shall install the test plug for the initial BOP test.
- d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.

ZS 102317