

UNITED STATES DEPARTMENT OF THE INTERIOR GEOLOGICAL SURVEY

SUBMIT IN TRIPLE (Other Instructions reverse side)

Form approved. Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 0346362 (b)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL [X] GAS WELL [] OTHER []

RECEIVED

7. UNIT AGREEMENT NAME

2. NAME OF OPERATOR Atlantic Richfield Company

FEB 4 1975

8. FARM OR LEASE NAME

Woodman Federal

3. ADDRESS OF OPERATOR P. O. Box 1710, Hobbs, New Mexico 88240

O.C.C. ARTESIA, OFFICE

9. WELL NO.

1

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface

10. FIELD AND POOL, OR WILDCAT

Cato - San Andres

1980' FNL & 660' FEL (Unit H)

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

28-T8S-R30E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

4148' GR

12. COUNTY OR PARISH

Chaves

13. STATE

N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF [] FRACTURE TREAT [] SHOOT OR ACIDIZE [] REPAIR WELL [] (Other) []

PULL OR ALTER CASING [] MULTIPLE COMPLETE [] ABANDON* [] CHANGE PLANS []

Plug & Abandon [X]

SUBSEQUENT REPORT OF:

WATER SHUT-OFF [] FRACTURE TREATMENT [] SHOOTING OR ACIDIZING [] (Other) []

REPAIRING WELL [] ALTERING CASING [] ABANDONMENT* []

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

TD 3600', PBD 3578'. San Andres perfs @ 3447-3531'. 8-5/8" OD 20# SP40 csg @ 272' & cmtd w/200 sx to surface. 4-1/2" OD 9.5# J-55 csg @ 3600' & cmtd w/300 sx. TOC @ 2530'.

RECEIVED

FEB - 3 1975

Propose to plug and abandon in the following manner:

- 1. Rig up csg pullers. Install BOP. Run bit & csg scraper to 3400' Run 4 1/2" cmt retr & set @ 3400' & cmt w/100 sx.
2. Load hole w/9# mud.
3. Cut off & rec 4 1/2" csg from free pt.
4. Spot 30 sk cmt plug half in & half out of 4 1/2" csg stub.
5. Spot 40 sk cmt plug across top of salt @ 1000'.
6. Spot 40 sk cmt plug across 8-5/8" shoe @ 272'.
7. Spot 10 sk cmt plug @ surface. Erect dry hole marker. Clean & level location.

U.S. GEOLOGICAL SURVEY ARTESIA, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Dist. Drlg. Supv.

DATE

1/31/75

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY


APPROVED SUBJECT TO POSSIBLE ADDITIONAL REQUIREMENT THAT PAD AND/OR ROAD BE REPAIRED AND SIGNED

FEB 3 1975

L. L. BEERMAN

*See Instructions on Reverse Side

CONTACT THIS OFFICE REGARDING ABOVE BEFORE MAKING FINAL CLEANUP.

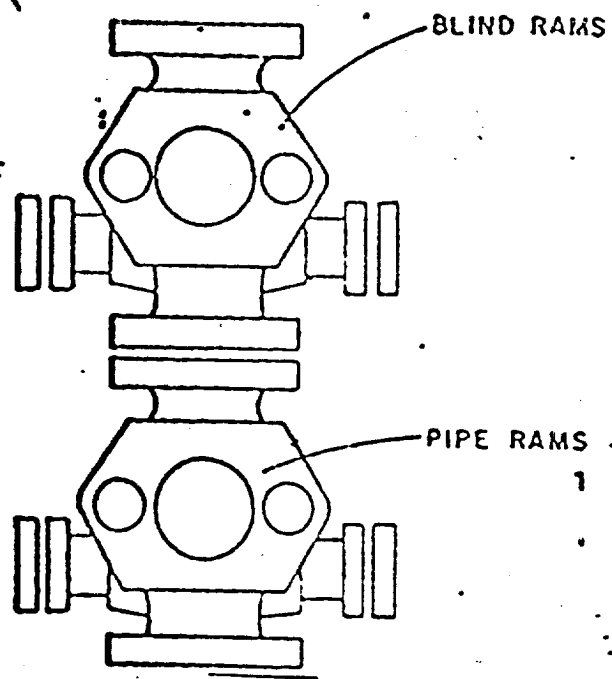

RECEIVED
 FEB - 3 1975
 U. S. GEOLOGICAL SURVEY
 ARTESIA, NEW MEXICO

ATLANTIC RICHFIELD COMPANY
 Blow Out Preventer Program

Lease Name Woodman Federal

Well No. 1

Location 1980' FNL & 660' FEL
Sec 28, T8S, R30E, Chaves Co.

BOP to be tested before installed on well and will be maintained in good working condition during workover. All wellhead fittings to be of sufficient pressure to operate in a safe manner.