

Submit 3 Copies To Appropriate District Received by OCD: 5/14/2021 3:25:26 PM District I 1625 N. French Dr., Hobbs, NM 88240 State of New Mexico Energy, Minerals and Natural Resources	Formage 10 of 7 May 27, 2004 WELL API NO.
District II 1301 W. Grand Ave., Artesia, NM 88210 OIL CONSERVATION DIVISION	30-025-23252
District III 1220 South St. Francis Dr.	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410 District IV Santa Fe, NM 87505	STATE FEE
1220 S. St. Francis Dr., Santa Fe, NM 87505	6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	7. Lease Name or Unit Agreement Name State I-29 8. Well Number
1. Type of Well: Oil Well Gas Well Other	#6
2. Name of Operator	9. OGRID Number
Texland Petroleum-Hobbs, LLC	113315
3. Address of Operator	10. Pool name or Wildcat
777 Main Street, Suite 3200, Fort Worth, Texas 76020	Hobbs, Upper Blinebry
4. Well Location	seeses, opper Binicory
Unit LetterP:_330feet from theSouth_ line and660	feet from the East line
Section 29 Township 18S Range 38	E NMPM Lea County
11. Elevation (Show whether DR, RKB, RT, GR, etc.) County
Pit or Polov grade Took Application Took Application Took	
Pit or Below-grade Tank Application or Closure	
Pit typeDepth to GroundwaterDistance from nearest fresh water wellDis	tance from nearest surface water
	onstruction Material
12. Check Appropriate Box to Indicate Nature of Notice,	Report or Other Data
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON XX TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRI PULL OR ALTER CASING MULTIPLE COMPL CASING/CEMEN	LLING OPNS. PAND A
OTHER: OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and of starting any proposed work). SEE RULE 1103. For Multiple Completions: At or recompletion.	d give pertinent dates, including estimated date tach wellbore diagram of proposed completion
Texland Petroleum-Hobbs proposes to plug and abandon the above c	antioned well as follows:
Prill out existing CIBP & cement @ 5830 and 6100 set CIBP 6440 Spot 25 sx Class C cement WOC	& tag Set CIBP 6112 Spot 25 sx Class C WOC & tag
1) Existing CIBP set @ 5830' w/5 sks cmt Set CIBP 5800 Spot 28	Sx Class C cement WOC & tag Pressure test casing Circ
2) Circ 9.5# salt gel mud between plugs	
	diameter 4' tall Above Ground Marker
4) Spot 75sk plug @ 3490-3850', WOC & Tag	SEE ATTACHED CONDITIONS
5) Spot 50 sk plug @ 2500-2600', WOC & Tag	OF APPROVAL
6) Spot 50 sk plug @ 1500-1600', WOC & Tag	0.7
7) Perf @ 430', Spot 300 sk plug @ 430- surface; install dry hole m	arker
See attached Well Bore Schematic	
I hereby certify that the information above is true and complete to the best of my knowledge grade tank has been/will be constructed or closed according to NMOCD guidelines \square , a general permit \square of	and belief. I further certify that any pit or below- r an (attached) alternative OCD-approved plan □.
SIGNATURE Vickie SmithTITLE_Regulatory Analys	tDATE5/14/2021
Type or print name Vickie Smith E-mail address: vsmith@texpetro.	com Telephone No. 575-433-8395
APPROVED BY: TITLE Compliance Officer A	DATE 5/19/21

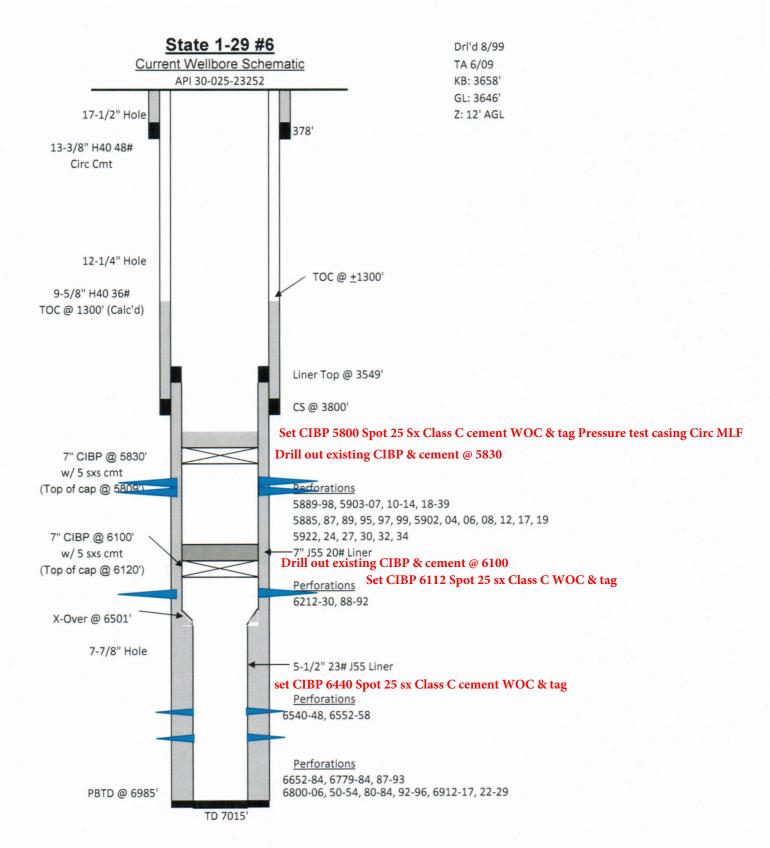

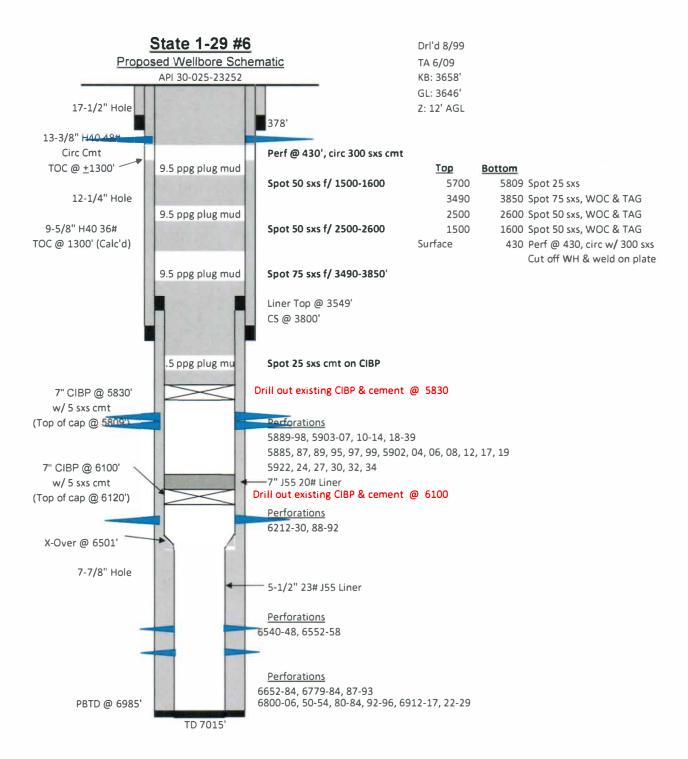

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be SO' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, woe and tagged. These plugs will be set SO' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III
1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 28329

COMMENTS

Operator:			OGRID:	Action Number:	Action Type:
TEXLAND PETROLEUM-HOBBS, LLC	777 Main Street	Fort Worth, TX76102	113315	28329	C-103F

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM	05/19/2021

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 28329

CONDITIONS OF APPROVAL

Operator:			OGRID:	Action Number:	Action Type:
TEXLAND PETROLEUM-HOBBS, LLC	777 Main Street	Fort Worth, TX76102	113315	28329	C-103F

OCD Reviewer	Condition
kfortner	See Attached conditions of approval Note changes to procedure