eceineditor Copy Po Appropriate Desired: 55 PM	State of New Mexico	Form C-103
Office <u>District I</u> – (575) 393-6161 Er	nergy, Minerals and Natural Resources	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240		WELL API NO. 30-015-24687
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	IL CONSERVATION DIVISION	5. Indicate Type of Lease
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr.	STATE X FEE
<u>District IV</u> – (505) 476-3460	Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505		
	ND REPORTS ON WELLS DRILL OR TO DEEPEN OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		Avalon (Delaware) Unit
PROPOSALS.) 1. Type of Well: Oil Well X Gas Well Other		8. Well Number #916
2. Name of Operator XTO Energy, Inc. ZTO Energy, Inc.		9. OGRID Number
		005380
3. Address of Operator		10. Pool name or Wildcat
6401 Holiday Hill Rd bldg #5, Midland T	1 X /9/0/	Avalon Delaware 3715
4. Well Location		
Unit Letter A : 660		660 feet from the East line NMPM County Eddy
Section 6	Township 21S Range 27E evation (Show whether DR, RKB, RT, GR, etc.	5 Eddy
11. E	3236' GR	(3.)
	3230 311	
12. Check Approp	riate Box to Indicate Nature of Notice	. Report or Other Data
		, 1
NOTICE OF INTENT		BSEQUENT REPORT OF:
	AND ABANDON ☑ REMEDIAL WO	RK ☐ ALTERING CASING ☐ ☐ RILLING OPNS.☐ P AND A ☐
	IGE PLANS	_
DOWNHOLE COMMINGLE		
	l l	Notify OCD 24 hrs. prior to any work
CLOSED-LOOP SYSTEM		1
OTHER:	☐ OTHER:	lone
OTHER: 13. Describe proposed or completed operations of the complete operation of the complete operation of the complete operation.	erations. (Clearly state all pertinent details, a	nd give pertinent dates, including estimated date
OTHER: 13. Describe proposed or completed operating any proposed work). SE	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple C	nd give pertinent dates, including estimated date
OTHER: 13. Describe proposed or completed operation of starting any proposed work). SE proposed completion or recompletion	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con.	nd give pertinent dates, including estimated date
OTHER: 13. Describe proposed or completed operating any proposed work). SE	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con.	nd give pertinent dates, including estimated date
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion or recompletion and the starting and proposed completion or recompletion and the starting and proposed completion or recompletion and the starting and starting	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con. the above well al BOP. Function test BOP.	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion. XTO Energy, Inc Respectfully submits NOI to PA for the proposed completion. The proposed completion or recompletion. The proposed completion or recompletion. The proposed completion of the proposed	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con. the above well al BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM.
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion. XTO Energy, Inc Respectfully submits NOI to PA for the starting and proposed completion. The proposed completion or recompletion. XTO Energy, Inc Respectfully submits NOI to PA for the proposed completion. The proposed completion of the proposed completion of the proposed completion of the proposed completion. The proposed completion of the proposed comple	erations. (Clearly state all pertinent details, at E RULE 19.15.7.14 NMAC. For Multiple Con. the above well al BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi.	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug.
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion or recompletion of starting any proposed work). SE proposed completion or recompletion or recompletion or recompletion of the start o	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con. the above well all BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates)
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion. XTO Energy, Inc Respectfully submits NOI to PA for the starting and the proposed completion or recompletion. XTO Energy, Inc Respectfully submits NOI to PA for the proposed completion or recompletion. POOH w/ rods. ND WH and NU 3K manually. Release 2-7/8" x 5.5" TAC and POOH w/ 23. MIRU WL, RIH WL w/ 5-1/2" CIBP to 2,4. WOC and tag. Circulate 9.5# salt gel mud. POOH w/ tbg. RIH WL. Perf 5-1/2" csg at 5. POOH w/ tbg. RU WL, and RIH WL. Perf 5. ND BOP and cut off wellhead 5' below sur	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con. the above well al BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates)
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion or recompletion of starting any proposed work). SE proposed completion or recompletion or recompletion or recompletion of the start o	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con. the above well all BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates)
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion. XTO Energy, Inc Respectfully submits NOI to PA for the starting and the proposed completion or recompletion. XTO Energy, Inc Respectfully submits NOI to PA for the proposed completion or recompletion. POOH w/ rods. ND WH and NU 3K manually. Release 2-7/8" x 5.5" TAC and POOH w/ 23. MIRU WL, RIH WL w/ 5-1/2" CIBP to 2,4. WOC and tag. Circulate 9.5# salt gel mud. POOH w/ tbg. RIH WL. Perf 5-1/2" csg at 5. POOH w/ tbg. RU WL, and RIH WL. Perf 5. ND BOP and cut off wellhead 5' below sur	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con. the above well all BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates)
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion. XTO Energy, Inc Respectfully submits NOI to PA for the starting and the proposed completion or recompletion. XTO Energy, Inc Respectfully submits NOI to PA for the proposed completion or recompletion. POOH w/ rods. ND WH and NU 3K manually. Release 2-7/8" x 5.5" TAC and POOH w/ 23. MIRU WL, RIH WL w/ 5-1/2" CIBP to 2,4. WOC and tag. Circulate 9.5# salt gel mud. POOH w/ tbg. RIH WL. Perf 5-1/2" csg at 5. POOH w/ tbg. RU WL, and RIH WL. Perf 5. ND BOP and cut off wellhead 5' below sur	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con. the above well all BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates)
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion. XTO Energy, Inc Respectfully submits NOI to PA for the starting and the proposed completion or recompletion. XTO Energy, Inc Respectfully submits NOI to PA for the proposed completion or recompletion. POOH w/ rods. ND WH and NU 3K manually. Release 2-7/8" x 5.5" TAC and POOH w/ 23. MIRU WL, RIH WL w/ 5-1/2" CIBP to 2,4. WOC and tag. Circulate 9.5# salt gel mud. POOH w/ tbg. RIH WL. Perf 5-1/2" csg at 5. POOH w/ tbg. RU WL, and RIH WL. Perf 5. ND BOP and cut off wellhead 5' below sur	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con. the above well all BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates)
OTHER: 13. Describe proposed or completed operation of starting any proposed work). SE proposed completion or recompletion or recompletion of the proposed completion or recompletion or recompletion or recompletion of the proposed completion or recompletion of the proposed completion of the	erations. (Clearly state all pertinent details, at E RULE 19.15.7.14 NMAC. For Multiple Con. the above well al BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of britest casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC face. RDMO PU, transport trucks, and pump truck.	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates)
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion. XTO Energy, Inc Respectfully submits NOI to PA for the starting and the proposed completion or recompletion. XTO Energy, Inc Respectfully submits NOI to PA for the proposed completion or recompletion. POOH w/ rods. ND WH and NU 3K manually. Release 2-7/8" x 5.5" TAC and POOH w/ 23. MIRU WL, RIH WL w/ 5-1/2" CIBP to 2,4. WOC and tag. Circulate 9.5# salt gel mud. POOH w/ tbg. RIH WL. Perf 5-1/2" csg at 5. POOH w/ tbg. RU WL, and RIH WL. Perf 5. ND BOP and cut off wellhead 5' below sur	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con. the above well all BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates)
OTHER: 13. Describe proposed or completed ope of starting any proposed work). SE proposed completion or recompletic XTO Energy, Inc Respectfully submits NOI to PA for 1) POOH w/ rods. ND WH and NU 3K manu. 2) Release 2-7/8" x 5.5" TAC and POOH w/ 23 3) MIRU WL, RIH WL w/ 5-1/2" CIBP to 2,6 WOC and tag. Circulate 9.5# salt gel mud. 4) POOH w/ tbg. RIH WL. Perf 5-1/2" csg at 5) POOH w/tbg. RU WL, and RIH WL. Perf 3. 5) POOH w/tbg. RU WL, and RIH WL. Perf 3. 6) ND BOP and cut off wellhead 5' below sur 7) Set P&A marker. Spud Date: 02/18/1984	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con. the above well al BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC face. RDMO PU, transport trucks, and pump truck. Rig Release Date: 03/11/1984	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates) & confirm TOC at Surface.
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion of starting any proposed work). SE proposed completion or recompletion of recompletion of recompletion with the proposed completion of recompletion with the proposed completion of recompletion of starting and the proposed completion of the proposed completion of the proposed completion of starting and	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con. the above well al BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC face. RDMO PU, transport trucks, and pump truck. Rig Release Date: 03/11/1984	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates) & confirm TOC at Surface.
OTHER: 13. Describe proposed or completed ope of starting any proposed work). SE proposed completion or recompletic XTO Energy, Inc Respectfully submits NOI to PA for 1) POOH w/ rods. ND WH and NU 3K manu. 2) Release 2-7/8" x 5.5" TAC and POOH w/ 23 3) MIRU WL, RIH WL w/ 5-1/2" CIBP to 2,6 WOC and tag. Circulate 9.5# salt gel mud. 4) POOH w/ tbg. RIH WL. Perf 5-1/2" csg at 5) POOH w/tbg. RU WL, and RIH WL. Perf 3. 5) POOH w/tbg. RU WL, and RIH WL. Perf 3. 6) ND BOP and cut off wellhead 5' below sur 7) Set P&A marker. Spud Date: 02/18/1984	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con. the above well al BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC face. RDMO PU, transport trucks, and pump truck. Rig Release Date: 03/11/1984	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates) & confirm TOC at Surface.
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion of starting any proposed work). SE proposed completion or recompletion of recompletion of the proposed completion of t	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Com. the above well al BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of britest casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC fface. RDMO PU, transport trucks, and pump truck. Rig Release Date: 03/11/1984 Must be plug true and complete to the best of my knowled.	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates) & confirm TOC at Surface.
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion of starting any proposed work). SE proposed completion or recompletion of recompletion of recompletion with the proposed completion of recompletion with the proposed completion of recompletion of starting and the proposed completion of the proposed completion of the proposed completion of starting and	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Con. the above well al BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC face. RDMO PU, transport trucks, and pump truck. Rig Release Date: 03/11/1984	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates) & confirm TOC at Surface.
OTHER: 13. Describe proposed or completed ope of starting any proposed work). SE proposed completion or recompletic XTO Energy, Inc Respectfully submits NOI to PA for 1) POOH w/ rods. ND WH and NU 3K manu 2) Release 2-7/8" x 5.5" TAC and POOH w/ 23 MIRU WL, RIH WL w/ 5-1/2" CIBP to 2,4 WOC and tag. Circulate 9.5# salt gel mud. 4) POOH w/ tbg. RIH WL. Perf 5-1/2" csg at 5) POOH w/tbg. RU WL, and RIH WL. Perf 5.6 ND BOP and cut off wellhead 5' below sur 5.00 Set P&A marker. Spud Date: 02/18/1984 ****SEE ATTACHED COA's***** I hereby certify that the information above is SIGNATURE	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Com. the above well al BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC face. RDMO PU, transport trucks, and pump truck. Rig Release Date: O3/11/1984 TITLE Regulatory Analyst	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates) & confirm TOC at Surface. gged by 8/27/2022 lge and belief. DATE 08/23/2021
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion of starting any proposed work). SE proposed completion or recompletion of recompletion of recompletion of the proposed completion of the proposed compl	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Com. the above well al BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of britest casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC fface. RDMO PU, transport trucks, and pump truck. Rig Release Date: 03/11/1984 Must be plug true and complete to the best of my knowled.	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of DH 2-3/8" tbg and notify BLM. dge plug. , Yates) & confirm TOC at Surface. gged by 8/27/2022 Ige and belief. DATE 08/23/2021
OTHER: 13. Describe proposed or completed ope of starting any proposed work). SE proposed completion or recompletic XTO Energy, Inc Respectfully submits NOI to PA for 1) POOH w/ rods. ND WH and NU 3K manu 2) Release 2-7/8" x 5.5" TAC and POOH w/ 23 MIRU WL, RIH WL w/ 5-1/2" CIBP to 2,4 WOC and tag. Circulate 9.5# salt gel mud. 4) POOH w/ tbg. RIH WL. Perf 5-1/2" csg at 5) POOH w/tbg. RU WL, and RIH WL. Perf 5.6 ND BOP and cut off wellhead 5' below sur 5.00 Set P&A marker. Spud Date: 02/18/1984 ****SEE ATTACHED COA's***** I hereby certify that the information above is SIGNATURE	erations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Com. the above well al BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC face. RDMO PU, transport trucks, and pump truck. Rig Release Date: O3/11/1984 TITLE Regulatory Analyst	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates) & confirm TOC at Surface. gged by 8/27/2022 lge and belief. DATE 08/23/2021 xonmobil.com PHONE: 432.218.3671
OTHER: 13. Describe proposed or completed oper of starting any proposed work). SE proposed completion or recompletion of starting any proposed work). SE proposed completion or recompletion of starting and subject to POOH w/ rods. ND WH and NU 3K manual 2) Release 2-7/8" x 5.5" TAC and POOH w/. 30 MIRU WL, RIH WL w/ 5-1/2" CIBP to 2,4 WOC and tag. Circulate 9.5# salt gel mud. 4) POOH w/ tbg. RIH WL. Perf 5-1/2" csg at 5) POOH w/tbg. RU WL, and RIH WL. Perf 5.0 ND BOP and cut off wellhead 5" below sur 7) Set P&A marker. Spud Date: 02/18/1984 ****SEE ATTACHED COA's***** I hereby certify that the information above is SIGNATURE Cassie Evans Cassie Evans	Perations. (Clearly state all pertinent details, a E RULE 19.15.7.14 NMAC. For Multiple Coon. The above well all BOP. Function test BOP. 2-7/8" tbg. RIH 2-3/8" tbg and tag PBTD at 5,500'. POC 500'. Set CIBP and spot 25 sxs Class C cmt on top of bri Test casing to 500psi. 510' and squeeze 95 sxs Class C cmt. (13-3/8" csg shoe 5-1/2" csg at 60' and squeeze 25 sxs Class C cmt. WOC face. RDMO PU, transport trucks, and pump truck. Rig Release Date: 03/11/1984 Must be plug true and complete to the best of my knowled TITLE Regulatory Analyst E-mail address: cassie.evans@ex	nd give pertinent dates, including estimated date ompletions: Attach wellbore diagram of OH 2-3/8" tbg and notify BLM. dge plug. , Yates) & confirm TOC at Surface. gged by 8/27/2022 Ige and belief. DATE 08/23/2021 xonmobil.com PHONE: 432.218.3671

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E)Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K)Potash---(In the R-111-P Area (Page 3 & 4), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

R-111-P Area

T 18S - R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

T 19S - R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A-F. Sec 27 Unit A,B,C,F,G,H.

T 19S - R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

T 19S - R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

T 20S - R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G.

T 20S - R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 20 – 29. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

T 20S - R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36.

T 21S - R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

T 21S - R 30E

Sec 1 – Sec 36

T 21S - R 31E

Sec 1 – Sec 36

T 22S - R 28E

Sec 36 Unit A,H,I,P.

T 22S - R 29E

Sec 1. Sec2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

T 22S - R 30E

Sec 1 – Sec 36

T 22S - R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

T 23S - R 28E

Sec 1 Unit A

T 23S - R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

T 23S - R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

T 23S - R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E.

T 24S – R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

T 24S - R 30E

Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.


T 24S – R 31E

Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.

T 25S - R 31E

Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

AVALON UT 916 WSW- Current and Proposed WBD's

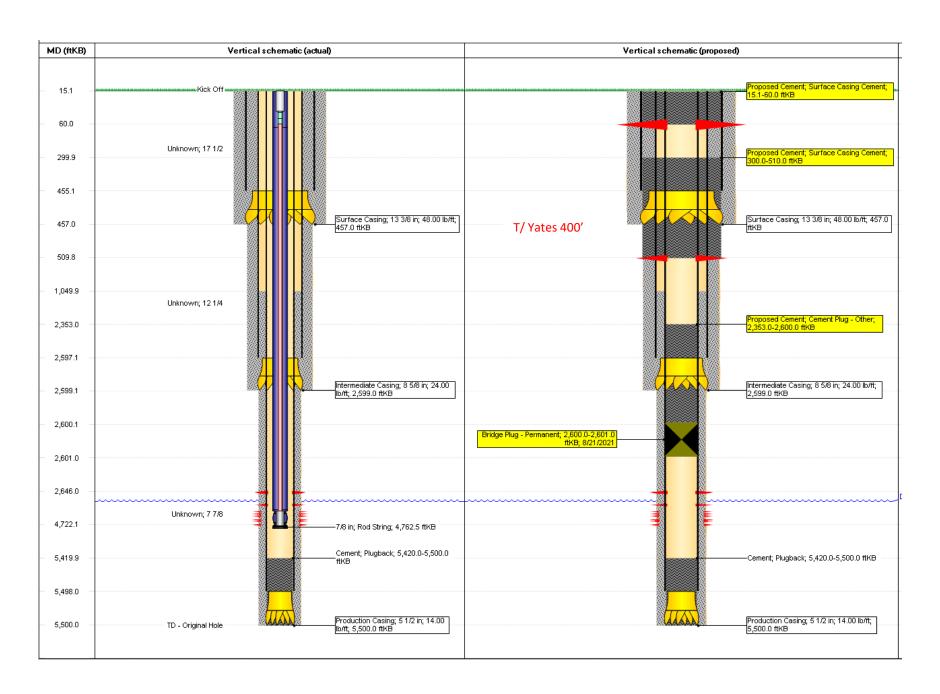

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 44439

CONDITIONS

Operator:	OGRID:
XTO ENERGY, INC	5380
6401 Holiday Hill Road	Action Number:
Midland, TX 79707	44439
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	8/27/2021