
Ceived by OCP; Office	8/13/2021-11:35:2	5 AM Sta	ate of New Mex	tico			Form	Page 1 o
<u>District I</u> – (575) 3		Energy, Mi	nerals and Natura	al Resources	WELL API N		Revised July	18, 2013
<u>District II</u> – (575)	r., Hobbs, NM 88240 748-1283	OII CON	SERVATION 1	DIVICION	WELL AIT	30-025-07	7977	
811 S. First St., Ar District III – (505)			South St. France		5. Indicate T			
1000 Rio Brazos R	Rd., Aztec, NM 87410		inta Fe, NM 875		6. State Oil 8		FEE X	
	s Dr., Santa Fe, NM	54	inta 1 0 , 1 (1) 1 0 / 1	702	0. State Off o	x Gas Leas	e No.	
87505	SUNDRY NOTI	CES AND REPOR	STS ON WELLS		7. Lease Nar	ne or Unit	Δ greement 1	Vame
DIFFERENT RES	HIS FORM FOR PROPOS SERVOIR. USE "APPLIC	SALS TO DRILL OR	TO DEEPEN OR PLU		S.B. Fletch		Agreement	vanic
PROPOSALS.) 1. Type of We	ell: Oil Well 🛚 🗓	Gas Well Ot	her		8. Well Num	iber 2		
2. Name of Op	aaratar	erating Company,	LLC		9. OGRID N	umber 262	214	
3. Address of 0		glas Ave., Suite 12	201, Dallas Tx 752	25	10. Pool nan House (Sev			
4. Well Locati		1000	N				W	
Unit I	Letter <u>F</u> :					t from the		line
Sectio	on 5			ge 39E	NMPM	Cou	nty Lea	
		11. Elevation (Si 3596 GI	how whether DR, I	KKB, KI, GK, etc.	/			
TEMPORARILY PULL OR ALTE DOWNHOLE C CLOSED-LOOI OTHER: 13. Describ	ER CASING COMMINGLE	CHANGE PLAN MULTIPLE CON	IPL	COMMENCE DR CASING/CEMEN OTHER: Casin extinent details, an	T JOB [mpletion	l.	ated date
of starti	ing any proposed wo	ork). SEE RULE 1						
We propose to p	plug and abandon th	is well as follow:			es to procedure r 4' tall Above Gr	ound Marke	r	
MIRU pulling u	ınit and POH w/ rod	s and tubing.		SEE ATTA	CHED CONDITION	ONS		
	and set CIBP + 35' cl							
Load hole w/ plu	ugging mud. ass C @ 1790'. 1437-1	Spot 25 sx Class C 3810		•	s C 2880 T. Yates B.	Salt		
	ass C @ 1790 . 1437- ass C @ 380'. Surface							
C		1	C					
After plugging a	a dry hole marker wil	ll be installed and	the location cleanu	e up to NMOCD	standards.			
Spud Date:	January 5, 1951		Rig Release Date	e: February 10), 1951			
hereby certify t	that the information a	above is true and c	complete to the bes	t of my knowledg	ge and belief.			
SIGNATURE_			TITLECon	nsultant		_DATE	8/11/21	
Гуре or print na For State Use C		e	_ E-mail address:	pwiv@zianet.c	com	PHONE:	575 626 7	660
APPROVED BY		Fortner	TITLEComplian	nce Officer A		DATE 9	/17/21	

Fletcher A #2 Section 5, T20S, R39E 1980' FNL and 1650' FWL

WELL BORE DIAGRAM

Well Spud 1/25/1951

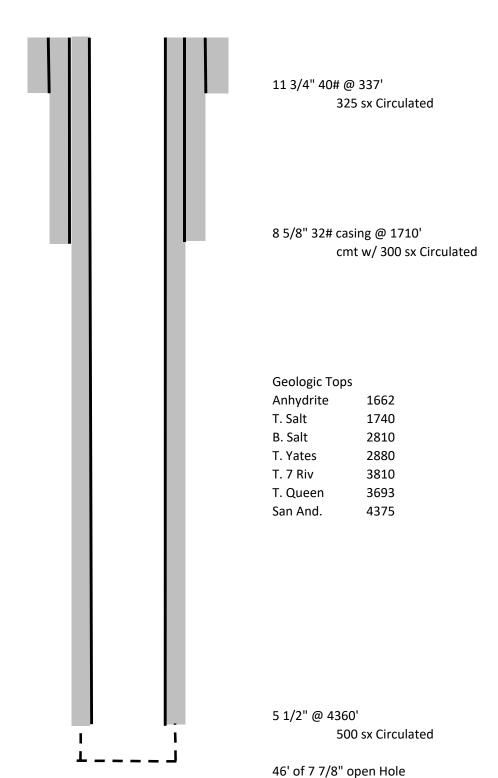


TD 4,402', deepend approx 4' in 1996'

Released to Imaging: 9/17/2021 9:35:06 AM

Fletcher A #2 Section 5, T20S, R39E 1980' FNL and 1650' FWL

PROPOSED PLUGS

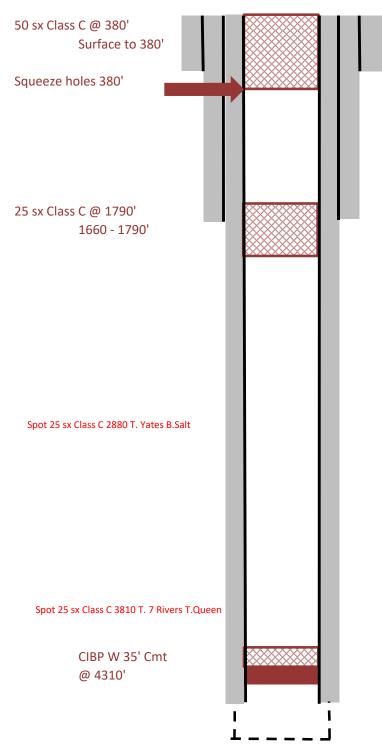

WELL BORE DIAGRAM

Well Spud 1/25/1951

11 3/4" 40# @ 337' 325 sx Circulated

8 5/8" 32# casing @ 1710' cmt w/ 300 sx Circulated

Geologic Tops

Anhydrite	1662
T. Salt	1740
B. Salt	2810
T. Yates	2880
T. 7 Riv	3810
T. Queen	3693
San And.	4375

5 1/2" @ 4360'

500 sx Circulated

46' of 7 7/8" open Hole TD 4,402', deepend approx 4' in 1996'

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS


In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

Office	State of New Me	xico	Form C-103 of
District I – (575) 393-6161	Energy, Minerals and Natur	ral Resources	Revised July 18, 2013 TELL API NO.
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	OIL CONCEDUATION		30-025-07977
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178	OIL CONSERVATION 1220 South St. Fran	5	Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410			STATE FEE X
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe, NM 87	505	State Oil & Gas Lease No.
SUNDRY NOT (DO NOT USE THIS FORM FOR PROPO	ICES AND REPORTS ON WELLS OSALS TO DRILL OR TO DEEPEN OR PLU ICATION FOR PERMIT" (FORM C-101) FO	JG BACK TO A	Lease Name or Unit Agreement Name S.B. Fletcher "A"
PROPOSALS.) 1. Type of Well: Oil Well X	Gas Well Other		Well Number 2
2 Name of Operator	perating Company, LLC	9.	OGRID Number 262214
3. Address of Operator		10). Pool name or Wildcat
	iglas Ave., Suite 1201, Dallas Tx 752		House (Seven Rivers/Yates)
4. Well Location Unit Letter F:	1980 feet from the N	line and 1650	feet from the W line
Section 5	reet from the		MPM County Lea
Section 3	11. Elevation (Show whether DR,	0	County 255
	3596 GL		
12 Check	Appropriate Box to Indicate Na	ature of Notice Re	port or Other Data
	NTENTION TO:		QUENT REPORT OF:
PERFORM REMEDIAL WORK TEMPORARILY ABANDON	PLUG AND ABANDON ☐ CHANGE PLANS ☐	REMEDIAL WORK COMMENCE DRILLII	☐ ALTERING CASING ☐ NG OPNS.☐ P AND A ☐
PULL OR ALTER CASING	MULTIPLE COMPL	CASING/CEMENT JO	_
DOWNHOLE COMMINGLE	927 22 99 2		
CLOSED-LOOP SYSTEM □		Casimata	et and Completion —
OTHER:	alated amountions. (Clearly state all m		st and Completion ve pertinent dates, including estimated date
	ork). SEE RULE 19.15.7.14 NMAC		
We propose to plug and abandon th	nis well as follow:		
MIRU pulling unit and POH w/ roo	ds and tubing.		
	, and the second		
MIRU wireline and set CIBP + 35' c	ds and tubing. class C cement @ 4310' and peforate 3	380'.	
MIRU wireline and set CIBP + 35' c Load hole w/ plugging mud.	class C cement @ 4310' and peforate 3		
MIRU wireline and set CIBP + 35' c Load hole w/ plugging mud. Plug 1: 25 sx class C @ 1790'. 1437-	, and the second	noe	
MIRU wireline and set CIBP + 35' c Load hole w/ plugging mud. Plug 1: 25 sx class C @ 1790'. 1437-	class C cement @ 4310' and peforate 3 -1790' to cover Top salt and 8 5/8" sh	noe	
MIRU wireline and set CIBP + 35' c Load hole w/ plugging mud. Plug 1: 25 sx class C @ 1790'. 1437- Plug 2: 50 sx class C @ 380'. Surfac	class C cement @ 4310' and peforate 3 -1790' to cover Top salt and 8 5/8" sh	toe 4" shoe	dards.
MIRU wireline and set CIBP + 35' c Load hole w/ plugging mud. Plug 1: 25 sx class C @ 1790'. 1437- Plug 2: 50 sx class C @ 380'. Surfac After plugging a dry hole marker w	class C cement @ 4310' and peforate 3 -1790' to cover Top salt and 8 5/8" sh ce to 380' Surface plug to cover 11 3/4 ill be installed and the location clean	ue up to NMOCD stan	
MIRU wireline and set CIBP + 35' c Load hole w/ plugging mud. Plug 1: 25 sx class C @ 1790'. 1437- Plug 2: 50 sx class C @ 380'. Surfac After plugging a dry hole marker w	class C cement @ 4310' and peforate 3 -1790' to cover Top salt and 8 5/8" sh ce to 380' Surface plug to cover 11 3/4	ue up to NMOCD stan	
MIRU wireline and set CIBP + 35' c Load hole w/ plugging mud. Plug 1: 25 sx class C @ 1790'. 1437- Plug 2: 50 sx class C @ 380'. Surfac After plugging a dry hole marker w	class C cement @ 4310' and peforate 3 -1790' to cover Top salt and 8 5/8" sh ce to 380' Surface plug to cover 11 3/4 ill be installed and the location clean Rig Release Dat	toe 4" shoe ue up to NMOCD stan te: February 10, 19	51
MIRU wireline and set CIBP + 35' c Load hole w/ plugging mud. Plug 1: 25 sx class C @ 1790'. 1437- Plug 2: 50 sx class C @ 380'. Surfac After plugging a dry hole marker w	class C cement @ 4310' and peforate 3 -1790' to cover Top salt and 8 5/8" sh ce to 380' Surface plug to cover 11 3/4 ill be installed and the location clean	toe 4" shoe ue up to NMOCD stan te: February 10, 19	51
MIRU wireline and set CIBP + 35' control to Load hole w/ plugging mud. Plug 1: 25 sx class C @ 1790'. 1437-Plug 2: 50 sx class C @ 380'. Surface After plugging a dry hole marker with the surface of the second se	class C cement @ 4310' and peforate 3 -1790' to cover Top salt and 8 5/8" sh ce to 380' Surface plug to cover 11 3/4 ill be installed and the location clean Rig Release Date above is true and complete to the be	toe 4" shoe ue up to NMOCD stan te: February 10, 19	51
MIRU wireline and set CIBP + 35' control Load hole w/ plugging mud. Plug 1: 25 sx class C @ 1790'. 1437-Plug 2: 50 sx class C @ 380'. Surface After plugging a dry hole marker with the information Spud Date: January 5, 1951 Thereby certify that the information SIGNATURE Phelps White	class C cement @ 4310' and peforate 3 -1790' to cover Top salt and 8 5/8" sh ce to 380' Surface plug to cover 11 3/4 ill be installed and the location clean Rig Release Date above is true and complete to the be	te: February 10, 19	51 d belief.
MIRU wireline and set CIBP + 35' control to Load hole w/ plugging mud. Plug 1: 25 sx class C @ 1790'. 1437-Plug 2: 50 sx class C @ 380'. Surface After plugging a dry hole marker with the surface of the second plugging and the second plugging and the second plugging a dry hole marker with the second plugging and the second plugging a dry hole marker with the second plugging and the second plugging and the second plugging a dry hole marker with the second plugging a dry hole marker with the second plugging and the second plugging a dry hole marker with the second plugging and the second plugging and the second plugging a dry hole marker with the second plugging a	class C cement @ 4310' and peforate 3 -1790' to cover Top salt and 8 5/8" sh ce to 380' Surface plug to cover 11 3/4 ill be installed and the location clean Rig Release Date above is true and complete to the be	te: February 10, 19	51 d beliefDATE8/11/21

Fletcher A #2 Section 5, T20S, R39E 1980' FNL and 1650' FWL

PROPOSED PLUGS

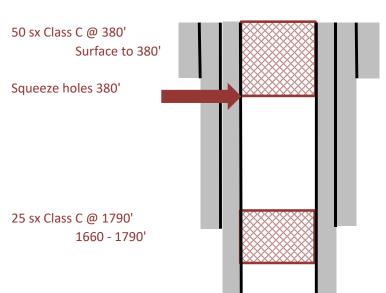

WELL BORE DIAGRAM

Well Spud 1/25/1951

11 3/4" 40# @ 337' 325 sx Circulated

8 5/8" 32# casing @ 1710' cmt w/ 300 sx Circulated

Geologic Tops

Anhydrite	1662
T. Salt	1740
B. Salt	2810
T. Yates	2880
T. 7 Riv	3810
T. Queen	3693
San And.	4375

CIBP W 35' Cmt @ 4310'

5 1/2" @ 4360'


500 sx Circulated

46' of 7 7/8" open Hole TD 4,402', deepend approx 4' in 1996'

Fletcher A #2 Section 5, T20S, R39E 1980' FNL and 1650' FWL

WELL BORE DIAGRAM


Well Spud 1/25/1951

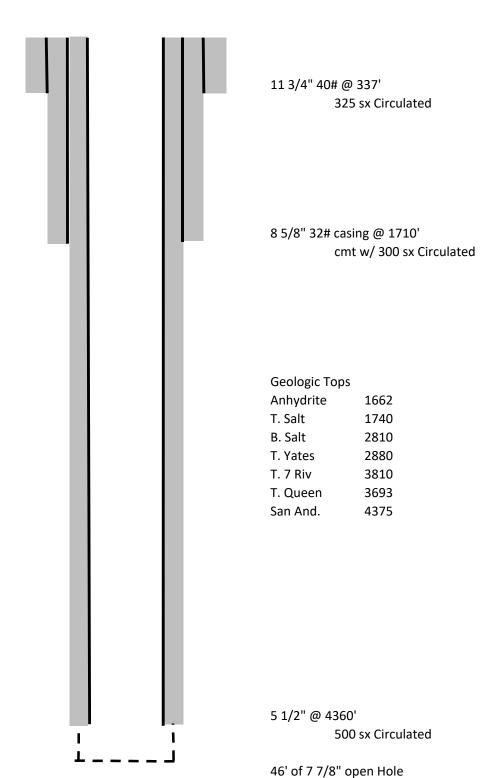

TD 4,402', deepend approx 4' in 1996'

Fletcher A #2 Section 5, T20S, R39E 1980' FNL and 1650' FWL

PROPOSED PLUGS

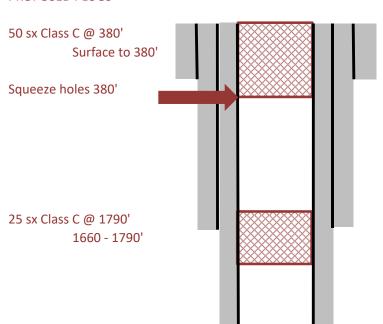

WELL BORE DIAGRAM

Well Spud 1/25/1951

11 3/4" 40# @ 337' 325 sx Circulated

8 5/8" 32# casing @ 1710' cmt w/ 300 sx Circulated

Geologic Tops

Anhydrite	1662
T. Salt	1740
B. Salt	2810
T. Yates	2880
T. 7 Riv	3810
T. Queen	3693
San And.	4375

CIBP W 35' Cmt @ 4310'

5 1/2" @ 4360'

500 sx Circulated

46' of 7 7/8" open Hole TD 4,402', deepend approx 4' in 1996'

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 41911

CONDITIONS

Operator:	OGRID:
FBS OPERATING COMPANY, LLC	262214
8235 Douglas Avenue	Action Number:
Dallas, TX 75225	41911
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
kfortner	See attached conditions of approval Note changes to procedure	9/17/2021