
Office	Yo Appropriate District 22 P	State 0.	f New Mexic	O			Form C-103	,
Office District I = (575	() 393-6161	Energy, Mineral	s and Natural l			vised July 18, 2013	3	
<u>District I</u> – (575) 393-6161 Energy, Wilner 1625 N. French Dr., Hobbs, NM 88240					WELL API	NO.		
	District II – (575) 748-1283 811 S. First St. Artesia, NM 88210 OIL CONSERVATION DIVISION				30-015-31335			
011 5. 1 list 5t., 7 litesia, 14W 00210					5. Indicate 7	Type of Lease		
District III – (50			th St. Francis		STAT		FEE 🗌	
	000 Rio Brazos Rd., Aztec, NM 87410 <u>vistrict IV</u> – (505) 476-3460 Santa Fe, NM 87505					& Gas Lease 1		7
	icis Dr., Santa Fe, NM							
87505								
		ES AND REPORTS (7. Lease Na	me or Unit Ag	greement Name	
	THIS FORM FOR PROPOSA				Remuda Ba	sin State		
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)								
1. Type of V	8. Well Number ₅							
2. Name of Operator						9. OGRID Number		
XTO Energy, Inc						005380		
3. Address of Operator 4601 Holiday Hill Rd bldg 5					10. Pool name or Wildcat			
Midland Tx 79707					Nash Draw Delaware			
4. Well Loca		79707						-
	_	330 feet from the	Nouth	line and 990	fac	et from the	West line	
	·		_					
Sect	tion 19	Township			NMPM	County	y Eddy	
		11. Elevation (Show v		B, RT, GR, etc.,)			
		3025	i'					
	12. Check Ap	opropriate Box to I	ndicate Natur	e of Notice,	Report or O	ther Data		
		.1 1		,	1			
	NOTICE OF INT	ENTION TO:		SUB	SEQUENT	REPORT	OF:	
PERFORM F	REMEDIAL WORK 🗌	PLUG AND ABANDO	N 🛭 RE	MEDIAL WOR	RK	☐ ALTERI	ING CASING 🔲	
TEMPORAR	ILY ABANDON	CHANGE PLANS		MMENCE DR	ILLING OPNS.	☐ P AND A	Α 🗆	
PULL OR AL	TER CASING	MULTIPLE COMPL		SING/CEMEN	IT JOB			
DOWNHOLE						_		
	OP SYSTEM				Notify OCD 24	hrs. prior to a	any work	
					al a sa a			
OTHER:				HER:	done			
	ribe proposed or comple	ted operations. (Clear		11L1X.		t dates, includ	ling estimated da	_ te
13. Desc			ly state all pertin	nent details, an	id give pertinen			- te
13. Description of sta	ribe proposed or comple arting any proposed work osed completion or recor	k). SEE RULE 19.15.	ly state all perting. 14 NMAC. For	nent details, an or Multiple Co	id give pertinen			- te
13. Desc. of sta	arting any proposed work osed completion or recor	k). SEE RULE 19.15. mpletion. Mus	ly state all perting 7.14 NMAC. For the structure of the	nent details, an or Multiple Co	id give pertinen	ach wellbore	diagram of	- te
13. Description of star proportion of the propor	arting any proposed work osed completion or recon ergy, Inc Respectfully submits	k). SEE RULE 19.15. mpletion. Must the NOI to PA the well about	ly state all perting 7.14 NMAC. For the structure closed we	nent details, an or Multiple Co	id give pertinen		diagram of	te
13. Description of star proportion of the propor	arting any proposed work osed completion or recon ergy, Inc Respectfully submits POOH laying down 2-7/8" t	k). SEE RULE 19.15. mpletion. Must the NOI to PA the well about and 2-7/8" x 5-1/2" TAC	ly state all perting 7.14 NMAC. For the closed we	nent details, an or Multiple Co loop system	id give pertinen	ach wellbore	diagram of	_ te
13. Description of star proportion of the propor	ergy, Inc Respectfully submits POOH laying down 2-7/8" t TIH 2-3/8" tbg and tag PBT	k). SEE RULE 19.15. mpletion. Must the NOI to PA the well about at 7,210'. POOH 2-3/8" tf	ly state all perting 7.14 NMAC. For the closed we be and notify BLM.	nent details, an or Multiple Co.	d give pertinen mpletions: Att	ach wellbore	diagram of	_ te
13. Description of star proportion of the propor	arting any proposed work osed completion or recon ergy, Inc Respectfully submits POOH laying down 2-7/8" t	k). SEE RULE 19.15. mpletion. Must the NOI to PA the well abord and 2-7/8" x 5-1/2" TACD at 7,210'. POOH 2-3/8" ti/2" CIBP to 6,900'. Set CIB	ly state all perting 7.14 NMAC. For the closed we be and notify BLM.	nent details, an or Multiple Co.	d give pertinen mpletions: Att	ach wellbore	diagram of	te
13. Description of star proportion of the propor	arting any proposed world posed completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" tbg and tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tbg. RIH WL. Per	the NOI to PA the well above bg and 2-7/8" x 5-1/2" TACD at 7,210'. POOH 2-3/8" tf /2" CIBP to 6,900'. Set CIBP to 2,000'. Set CIBP to 3,409' and so	Ity state all perting 7.14 NMAC. For the structure of the	nent details, an or Multiple Coop system	d give pertinen mpletions: Att	ach wellbore	diagram of	te
13. Desc. of sta propo XTO Ene 1) 2) 3) 4)	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" to gand tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tog. RIH WL. Per 714'. (8-5/8" csg shoe, B' Sa	the NOI to PA the well abord bg and 2-7/8" x 5-1/2" TACD at 7,210'. POOH 2-3/8" ti. "CIBP to 6,900'. Set CIB "CIBP to 3,409' and scalt - T' Salt Solid Cement Plane.	rly state all perting 7.14 NMAC. For the closed we be and notify BLM. Pand spot 25 sxs Claueeze 300 sxs Clasug, T' Delaware)	nent details, an or Multiple Coloop system	d give pertinen mpletions: Att	ach wellbore	diagram of	te
13. Description of star proportion (1) (2) (3)	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" to gand tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tog. RIH WL. Per 714'. (8-5/8" csg shoe, B' Se POOH w/tog. RU WL, and I	the NOI to PA the well abord bg and 2-7/8" x 5-1/2" TACD at 7,210'. POOH 2-3/8" ti. "CIBP to 6,900'. Set CIB "CIBP to 3,409' and scalt - T' Salt Solid Cement Plane.	rly state all perting 7.14 NMAC. For the closed we be and notify BLM. Pand spot 25 sxs Claueeze 300 sxs Clasug, T' Delaware)	nent details, an or Multiple Coloop system	d give pertinen mpletions: Att	ach wellbore	diagram of	te
13. Description of star proposes the propose	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" to the 2-3/8" complete the 2-3/8" c	the NOI to PA the well abord bg and 2-7/8" x 5-1/2" TACD at 7,210". POOH 2-3/8" t/2" CIBP to 6,900". Set CIB if 5-1/2" csg at 3,409 and so alt - T' Salt Solid Cement PRIH WL. Perf 5-1/2" csg at ad 5' below surface. RDMO	ly state all perting 7.14 NMAC. For the closed of the clos	nent details, an or Multiple Coloop system lass C cmt on top of s C cmt. WOC & The state of the	nd give pertinen impletions: Att of bridge plug. Tag at least OC at Surface.	ach wellbore	diagram of	te
13. Description of star proper XTO Ene 1) 2) 3) 4) 5)	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" to the grand tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tog. RIH WL. Per 714'. (8-5/8" csg shoe, B' St POOH w/tog. RU WL, and I (Surface Plug)	the NOI to PA the well abord bg and 2-7/8" x 5-1/2" TACD at 7,210". POOH 2-3/8" t/2" CIBP to 6,900". Set CIB if 5-1/2" csg at 3,409 and so alt - T' Salt Solid Cement PRIH WL. Perf 5-1/2" csg at ad 5' below surface. RDMO	ly state all perting 7.14 NMAC. For the closed of the clos	nent details, an or Multiple Coloop system lass C cmt on top of s C cmt. WOC & The state of the	nd give pertinen impletions: Att of bridge plug. Tag at least OC at Surface.	ach wellbore	diagram of	te
13. Description of star proposes the propose	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" to gand tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tog. RIH WL. Per 714'. (8-5/8" csg shoe, B' Se POOH w/tbg. RU WL, and I (Surface Plug) ND BOP and cut off wellher Set P&A marker, Well PA'd	k). SEE RULE 19.15. mpletion. Musthe NOI to PA the well aborded by and 2-7/8" x 5-1/2" TACD at 7,210'. POOH 2-3/8" tight in the Noise of the Noise	ly state all perting 7.14 NMAC. For the closed we be and notify BLM. Pand spot 25 sxs Claueeze 300 sxs Clasulug, T' Delaware) 420' and squeeze C	nent details, an or Multiple Coloop system lass C cmt on top of S C cmt. WOC & The state of the color of the	nd give pertinen impletions: Att of bridge plug. Tag at least OC at Surface.	R-111-P	diagram of Area	te
13. Description of star proposes the propose	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" to gand tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tog. RIH WL. Per 714'. (8-5/8" csg shoe, B' Se POOH w/tbg. RU WL, and I (Surface Plug) ND BOP and cut off wellher Set P&A marker, Well PA'd	the NOI to PA the well abord bg and 2-7/8" x 5-1/2" TACD at 7,210". POOH 2-3/8" t/2" CIBP to 6,900". Set CIB if 5-1/2" csg at 3,409 and so alt - T' Salt Solid Cement PRIH WL. Perf 5-1/2" csg at ad 5' below surface. RDMO	ly state all perting 7.14 NMAC. For the closed we be and notify BLM. Pand spot 25 sxs Claueeze 300 sxs Clasulug, T' Delaware) 420' and squeeze C	nent details, an or Multiple Coloop system lass C cmt on top of S C cmt. WOC & The state of the color of the	nd give pertinen impletions: Att of bridge plug. Tag at least OC at Surface.	R-111-P	diagram of Area	te
13. Description of star proposes the propose	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" to gand tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tog. RIH WL. Per 714'. (8-5/8" csg shoe, B' Se POOH w/tbg. RU WL, and I (Surface Plug) ND BOP and cut off wellher Set P&A marker, Well PA'd	k). SEE RULE 19.15. mpletion. Musthe NOI to PA the well aborded by and 2-7/8" x 5-1/2" TACD at 7,210'. POOH 2-3/8" tight in the Noise of the Noise	ly state all perting 7.14 NMAC. For the closed we be and notify BLM. Pand spot 25 sxs Claueeze 300 sxs Clasulug, T' Delaware) 420' and squeeze C	nent details, an or Multiple Coloop system lass C cmt on top of S C cmt. WOC & The state of the color of the	nd give pertinen impletions: Att of bridge plug. Tag at least OC at Surface.	R-111-P	diagram of Area	te
13. Desc. of sta propo	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" tbg and tag PBT MIRU WL, RIH WL w. 5-1. WOC and Tag at least 6,653 POOH w/ tbg. RIH WL. Per 714'. (8-5/8" csg shoe, B' St POOH w/bg. RU WL, and I (Surface Plug) ND BOP and cut off wellher Set P&A marker, Well PA'd ****SEE ATTAC	k). SEE RULE 19.15. mpletion. Musthe NOI to PA the well above begand 2-7/8" x 5-1/2" TACD at 7,210". POOH 2-3/8" to 7,210". POOH 2-3/8" to 7,210". Set CIB to 6,900". Set CIB to 6,900". Set CIB to 7. If 5-1/2" csg at 3,409" and so alt - T' Salt Solid Cement Plant WL. Perf 5-1/2" csg at ad 5' below surface. RDMO in the CHED COA's****	rly state all perting 7.14 NMAC. For the closed we compared by and notify BLM. By and spot 25 sxs Compared and spot 25 sxs Compared and squeeze 300 sxs Classlug, T' Delaware) 420' and squeeze Compared and squeeze Compar	nent details, an or Multiple Coop system lass C cmt on top of s C cmt. WOC & The lass C cmt until To s, and pump truck. Mus	d give pertinen impletions: Att of bridge plug. Tag at least of at Surface. Tag at be plugge	R-111-P	diagram of Area	te
13. Description of star proposes the propose	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" to gand tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tog. RIH WL. Per 714'. (8-5/8" csg shoe, B' Se POOH w/tbg. RU WL, and I (Surface Plug) ND BOP and cut off wellher Set P&A marker, Well PA'd	k). SEE RULE 19.15. mpletion. Musthe NOI to PA the well above begand 2-7/8" x 5-1/2" TACD at 7,210". POOH 2-3/8" to 7,210". POOH 2-3/8" to 7,210". Set CIB to 6,900". Set CIB to 6,900". Set CIB to 7. If 5-1/2" csg at 3,409" and so alt - T' Salt Solid Cement Plant WL. Perf 5-1/2" csg at ad 5' below surface. RDMO in the CHED COA's****	ly state all perting 7.14 NMAC. For the closed we be and notify BLM. Pand spot 25 sxs Claueeze 300 sxs Clasulug, T' Delaware) 420' and squeeze C	nent details, an or Multiple Coloop system lass C cmt on top of S C cmt. WOC & The state of the color of the	d give pertinen impletions: Att of bridge plug. Tag at least of at Surface. Tag at be plugge	R-111-P	diagram of Area	te
13. Desc. of sta propo	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" tbg and tag PBT MIRU WL, RIH WL w. 5-1. WOC and Tag at least 6,653 POOH w/ tbg. RIH WL. Per 714'. (8-5/8" csg shoe, B' St POOH w/bg. RU WL, and I (Surface Plug) ND BOP and cut off wellher Set P&A marker, Well PA'd ****SEE ATTAC	k). SEE RULE 19.15. mpletion. Musthe NOI to PA the well above begand 2-7/8" x 5-1/2" TACD at 7,210". POOH 2-3/8" to 7,210". POOH 2-3/8" to 7,210". Set CIB to 6,900". Set CIB to 6,900". Set CIB to 7. If 5-1/2" csg at 3,409" and so alt - T' Salt Solid Cement Plant WL. Perf 5-1/2" csg at ad 5' below surface. RDMO in the CHED COA's****	rly state all perting 7.14 NMAC. For the closed we compared by and notify BLM. By and spot 25 sxs Compared and spot 25 sxs Compared and squeeze 300 sxs Classlug, T' Delaware) 420' and squeeze Compared and squeeze Compar	nent details, an or Multiple Coop system lass C cmt on top of s C cmt. WOC & The lass C cmt until To s, and pump truck. Mus	d give pertinen impletions: Att of bridge plug. Tag at least of at Surface. Tag at be plugge	R-111-P	diagram of Area	te
13. Desc. of sta propo	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" tbg and tag PBT MIRU WL, RIH WL w. 5-1. WOC and Tag at least 6,653 POOH w/ tbg. RIH WL. Per 714'. (8-5/8" csg shoe, B' St POOH w/bg. RU WL, and I (Surface Plug) ND BOP and cut off wellher Set P&A marker, Well PA'd ****SEE ATTAC	k). SEE RULE 19.15. mpletion. Musthe NOI to PA the well above begand 2-7/8" x 5-1/2" TACD at 7,210". POOH 2-3/8" to 7,210". POOH 2-3/8" to 7,210". Set CIB to 6,900". Set CIB to 6,900". Set CIB to 7. If 5-1/2" csg at 3,409" and so alt - T' Salt Solid Cement Plant WL. Perf 5-1/2" csg at ad 5' below surface. RDMO in the CHED COA's****	rly state all perting 7.14 NMAC. For the closed we compared by and notify BLM. By and spot 25 sxs Compared and spot 25 sxs Compared and squeeze 300 sxs Classlug, T' Delaware) 420' and squeeze Compared and squeeze Compar	nent details, an or Multiple Coop system lass C cmt on top of s C cmt. WOC & The lass C cmt until To s, and pump truck. Mus	d give pertinen impletions: Att of bridge plug. Tag at least of at Surface. Tag at be plugge	R-111-P	diagram of Area	te
13. Desc. of sta propose XTO Ene 1) 2) 3) 4) 5) 6) 7) Spud Date:	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" tbg and tag PBT MIRU WL, RIH WL w. 5-1. WOC and Tag at least 6,653 POOH w/ tbg. RIH WL. Per 714'. (8-5/8" csg shoe, B' St POOH w/bg. RU WL, and I (Surface Plug) ND BOP and cut off wellher Set P&A marker, Well PA'd ****SEE ATTAC	k). SEE RULE 19.15. mpletion. Musthe NOI to PA the well aborder the NOI to PA the well aborder to PA the NOI to PA the	ly state all perting 7.14 NMAC. For the closed we be and notify BLM. By and spot 25 sxs Clauceze 300 sxs Clasug, T' Delaware) 420' and squeeze C PU, transport truck Release Date:	nent details, an or Multiple Coloop system lass C cmt on top of S C cmt. WOC & The State of S C cmt until To S, and pump truck. Mus 01/12/2001	nd give pertinen impletions: Att of bridge plug. Tag at least of at Surface. St be plugge	R-111-P	diagram of Area	te
13. Desc. of sta propose XTO Ene 1) 2) 3) 4) 5) 6) 7) Spud Date:	arting any proposed work osed completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" to gand tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tbg. RIH WL. Per 714'. (8-5/8" csg shoe, B' Se POOH w/tbg. RU WL, and I (Surface Plug) ND BOP and cut off wellheaset P&A marker, Well PA'd ****SEE ATTAC**	k). SEE RULE 19.15. mpletion. Musthe NOI to PA the well aborder the NOI to PA the well aborder to PA the NOI to PA the	ly state all perting 7.14 NMAC. For the closed we be and notify BLM. By and spot 25 sxs Clauceze 300 sxs Clasug, T' Delaware) 420' and squeeze C PU, transport truck Release Date:	nent details, an or Multiple Coloop system lass C cmt on top of S C cmt. WOC & The State of S C cmt until To S, and pump truck. Mus 01/12/2001	nd give pertinen impletions: Att of bridge plug. Tag at least of at Surface. St be plugge	R-111-P	diagram of Area	te
13. Description of star proposes of star proposes the star proposes of star proposes and star proposes the star proposes of star proposes and star proposes the star proposes and star proposes and star proposes the star proposes and star proposes	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" tbg and tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tbg. RIH WL. Per 714'. (8-5/8" csg shoe, B' Se POOH w/tbg. RU WL, and I (Surface Plug) ND BOP and cut off wellhed Set P&A marker, Well PA'd ****SEE ATTAC** 12/27/2000	k). SEE RULE 19.15. mpletion. Musthe NOI to PA the well aborder the NOI to PA the NOI t	ete to the best o	nent details, an or Multiple Coop system lass C cmt on top of second coop system lass C cmt woc & The second coop system Mus 01/12/2001	nd give pertinen impletions: Att of bridge plug. Tag at least of at Surface. St be plugge	ed by 9/30	diagram of Area /2022	te
13. Desc. of sta propose XTO Ene 1) 2) 3) 4) 5) 6) 7) Spud Date:	arting any proposed world based completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" tbg and tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tbg. RIH WL. Per 714'. (8-5/8" csg shoe, B' Se POOH w/tbg. RU WL, and I (Surface Plug) ND BOP and cut off wellhed Set P&A marker, Well PA'd ****SEE ATTAC** 12/27/2000	k). SEE RULE 19.15. mpletion. Musthe NOI to PA the well aborder the NOI to PA the NOI t	ete to the best o	nent details, an or Multiple Coloop system lass C cmt on top of S C cmt. WOC & The State of S C cmt until To S, and pump truck. Mus 01/12/2001	nd give pertinen impletions: Att of bridge plug. Tag at least of at Surface. St be plugge	ed by 9/30	diagram of Area	te
13. Description of star proposed star propos	arting any proposed work osed completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" to gand tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tog. RIH WL. Per 714'. (8-5/8" csg shoe, B' Se POOH w/tog. RU WL, and I (Surface Plug) ND BOP and cut off wellher Set P&A marker, Well PA'd ***SEE ATTAC** 12/27/2000	the NOI to PA the well aborted by and 2-7/8" x 5-1/2" TACD at 7,210'. POOH 2-3/8" ti /2" CIBP to 6,900'. Set CIB /2" CIBP to 5,900'. Set CIBRIH WL. Perf 5-1/2" csg at ad 5' below surface. RDMO and 5' below surface.	Ity state all perting 7.14 NMAC. For the closed over the close	ment details, an or Multiple Coloop system lass C cmt on top of s C cmt. WOC & Talass C cmt until To s, and pump truck. Mus 01/12/2001 f my knowledgery Analyst	of bridge plug. Tag at least OC at Surface. St be plugge	ed by 9/30	/2022 09/28/2021	te
13. Description of star proposed star propos	arting any proposed work osed completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" tbg and tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tbg. RIH WL. Per 714'. (8-5/8" csg shoe, B' Se POOH w/tbg. RU WL, and I (Surface Plug) ND BOP and cut off wellher Set P&A marker, Well PA'd ****SEE ATTAC** 12/27/2000 Ty that the information about the information and the consequence of	the NOI to PA the well aborted by and 2-7/8" x 5-1/2" TACD at 7,210'. POOH 2-3/8" ti /2" CIBP to 6,900'. Set CIB /2" CIBP to 5,900'. Set CIBRIH WL. Perf 5-1/2" csg at ad 5' below surface. RDMO and 5' below surface.	ete to the best o	nent details, an or Multiple Coop system lass C cmt on top of second coop system lass C cmt woc & The second coop system Mus 01/12/2001	of bridge plug. Tag at least OC at Surface. St be plugge	ed by 9/30	diagram of Area /2022	te —
13. Description of star proposed star propos	arting any proposed work osed completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" tbg and tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tbg. RIH WL. Per 714'. (8-5/8" csg shoe, B' Se POOH w/tbg. RU WL, and I (Surface Plug) ND BOP and cut off wellher Set P&A marker, Well PA'd ****SEE ATTAC** 12/27/2000 Ty that the information about the information and the consequence of	the NOI to PA the well aborted by and 2-7/8" x 5-1/2" TACD at 7,210'. POOH 2-3/8" ti /2" CIBP to 6,900'. Set CIB /2" CIBP to 5,900'. Set CIBRIH WL. Perf 5-1/2" csg at ad 5' below surface. RDMO and 5' below surface.	Ity state all perting 7.14 NMAC. For the closed over the close	ment details, an or Multiple Coloop system lass C cmt on top of s C cmt. WOC & Talass C cmt until To s, and pump truck. Mus 01/12/2001 f my knowledgery Analyst	of bridge plug. Tag at least OC at Surface. St be plugge	ed by 9/30	/2022 09/28/2021	te —
13. Description of star proposes of star proposes to star	arting any proposed work osed completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" tbg and tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tbg. RIH WL. Per 714'. (8-5/8" csg shoe, B' Se POOH w/tbg. RU WL, and I (Surface Plug) ND BOP and cut off wellheaset P&A marker, Well PA'd ****SEE ATTAC** 12/27/2000 Ty that the information about the i	k). SEE RULE 19.15. mpletion. Musthe NOI to PA the well aborbing and 2-7/8" x 5-1/2" TACD at 7,210'. POOH 2-3/8" tf /2" CIBP to 6,900'. Set CIBP to 5,900'. Set CIBP to 7'. Salt Solid Cement PRIH WL. Perf 5-1/2" csg at ad 5' below surface. RDMO 1 CHED COA's**** Rig Dove is true and complete true and complete true and complete true and complete true.	ely state all perting 7.14 NMAC. For the closed of the clo	nent details, an or Multiple Coloop system lass C cmt on top of s C cmt. WOC & Talass C cmt until To s, and pump truck. Mus 01/12/2001 f my knowledgery Analyst cassie.evans@exx	of bridge plug. Tag at least OC at Surface. St be plugge	ed by 9/30/	diagram of Area /2022 09/28/2021 432.218.3671	te —
13. Description of star proposed star propos	arting any proposed work osed completion or reconsergy, Inc Respectfully submits POOH laying down 2-7/8" to TIH 2-3/8" tbg and tag PBT MIRU WL, RIH WL w/5-1. WOC and Tag at least 6,653 POOH w/ tbg. RIH WL. Per 714'. (8-5/8" csg shoe, B' Se POOH w/tbg. RU WL, and I (Surface Plug) ND BOP and cut off wellher Set P&A marker, Well PA'd ****SEE ATTAC** 12/27/2000 Ty that the information about the information and the consequence of	k). SEE RULE 19.15. mpletion. Musthe NOI to PA the well aborbing and 2-7/8" x 5-1/2" TACD at 7,210'. POOH 2-3/8" tf /2" CIBP to 6,900'. Set CIBP to 5,900'. Set CIBP to 7'. Salt Solid Cement PRIH WL. Perf 5-1/2" csg at ad 5' below surface. RDMO 1 CHED COA's**** Rig Dove is true and complete true and complete true and complete true and complete true.	ely state all perting 7.14 NMAC. For the closed of the clo	ment details, an or Multiple Coloop system lass C cmt on top of s C cmt. WOC & Talass C cmt until To s, and pump truck. Mus 01/12/2001 f my knowledgery Analyst	of bridge plug. Tag at least OC at Surface. St be plugge	ed by 9/30/ DATEPHONE:	/2022 09/28/2021	

Remuda Basin State 5Q - Current and Proposed WBD's

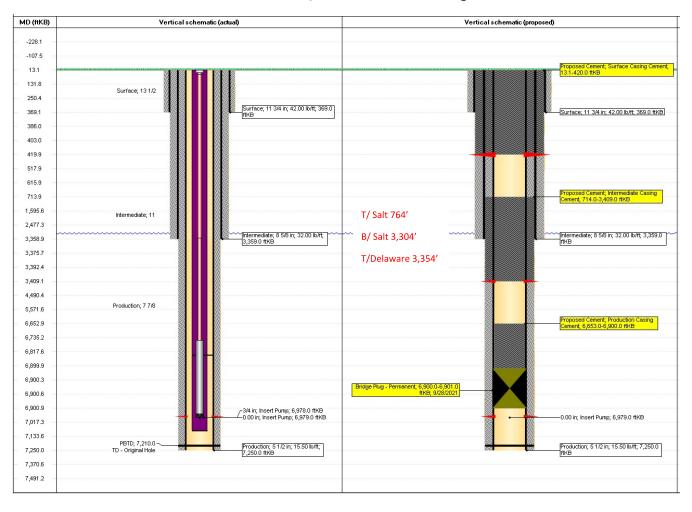

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- A notice of intent to plug and abandon a wellbore is required to be approved before plugging
 operations are conducted. A cement evaluation tool is required in order to ensure isolation of
 producing formations, protection of water and correlative rights. A cement bond log or other
 accepted cement evaluation tool is to be provided to the division for evaluation if one has not
 been previously run or if the well did not have cement circulated to surface during the original
 casing cementing job or subsequent cementing jobs. Insure all bradenheads have been
 exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E)Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K)Potash---(In the R-111-P Area (Page 3 & 4), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

R-111-P Area

T 18S - R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

T 19S - R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A-F. Sec 27 Unit A,B,C,F,G,H.

T 19S - R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

T 19S - R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

T 20S - R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G.

T 20S - R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 20 – 29. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

T 20S - R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36.

T 21S - R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

T 21S - R 30E

Sec 1 – Sec 36

T 21S - R 31E

Sec 1 – Sec 36

T 22S - R 28E

Sec 36 Unit A,H,I,P.

T 22S - R 29E

Sec 1. Sec2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

T 22S - R 30E

Sec 1 – Sec 36

T 22S - R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

T 23S - R 28E

Sec 1 Unit A

T 23S - R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

T 23S - R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

T 23S - R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E.

T 24S – R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

T 24S - R 30E

Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.

T 24S - R 31E

Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.

T 25S - R 31E

Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 52536

CONDITIONS

Operator:	OGRID:
XTO ENERGY, INC	5380
6401 Holiday Hill Road	Action Number:
Midland, TX 79707	52536
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	9/30/2021