U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Report

Well Name: GOLDEN D FED

Well Location: T21S / R29E / SEC 17 /

County or Parish/State: EDDY /

NM

Well Number: 1

RECOVERY

NENW /

Lease Number: NMNM0509

Unit or CA Name:

Unit or CA Number:

US Well Number: 3001527294

Well Status: Water Disposal Well

Operator: XTO PERMIAN

OPERATING LLC

Accepted for record – NMOCD gc 6/13/2022

Notice of Intent

Sundry ID: 2675241

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Time Sundry Submitted: 05:59

Date proposed operation will begin: 07/07/2022

Date Sundry Submitted: 06/07/2022

Procedure Description: 1) POOH laying down 2-3/8" tbg and 2-3/8" x 5-1/2" TAC. 2) TIH 2-3/8" tbg to PBTD at 4,253'. POOH 2-3/8" tbg and notify BLM. 3) MIRU WL, RIH WL w/ 5-1/2" CIBP to 4,200'. Set CIBP and spot 25 sks Class C cmt on top of bridge plug. WOC and Tag at least 3,953'. (T/Perfs) 4) PUH to 3,562' and spot 25 sxs class C cmt. (T/Del) 5) POOH w/tbg. RU WL, and RIH WL. Perf 5-1/2" csg at 715' and squeeze Class C cmt until returns at surface. (9-5/8" csg shoe, surface plug) 6) ND BOP and cut off wellhead 5' below surface. RDMO PU, transport trucks, and pump truck. 7) Set P&A marker.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

GOLDEN_D_FEDERAL_001_SWD___Proposed_WBD_20220607055842.pdf

Received by OCD: WINRARD: 3380ER AMED

Well Location: T21S / R29E / SEC 17 / NENW /

County or Parish/State: EDDY /

Page 2 of 16

NM

Well Number: 1

Type of Well: INJECTION - ENHANCED Allottee or Tribe Name:

RECOVERY

Lease Number: NMNM0509

Unit or CA Name:

Unit or CA Number:

US Well Number: 3001527294

Well Status: Water Disposal Well

Operator: XTO PERMIAN OPERATING LLC

Conditions of Approval

Specialist Review

 $Golden_D_Fed_1_Sundry_ID_2675241_P_A_20220610065450.pdf$

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: CASSIE EVANS Signed on: JUN 07, 2022 05:59 AM

Name: XTO PERMIAN OPERATING LLC

Title: Regulatory Analyst

Street Address: 6401 Holiday Hill Road, Bldg 5
City: Midland State: TX

Phone: (432) 218-3671

Email address: CASSIE.EVANS@EXXONMOBIL.COM

Field

Representative Name:

Street Address:

City: State: Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: LONG VO BLM POC Title: Petroleum Engineer


BLM POC Phone: 5752345972 BLM POC Email Address: LVO@BLM.GOV

Disposition: Approved **Disposition Date:** 06/10/2022

Signature: Long Vo

Page 2 of 2

GOLDEN D FEDERAL 001 SWD - Current and Proposed WBD's

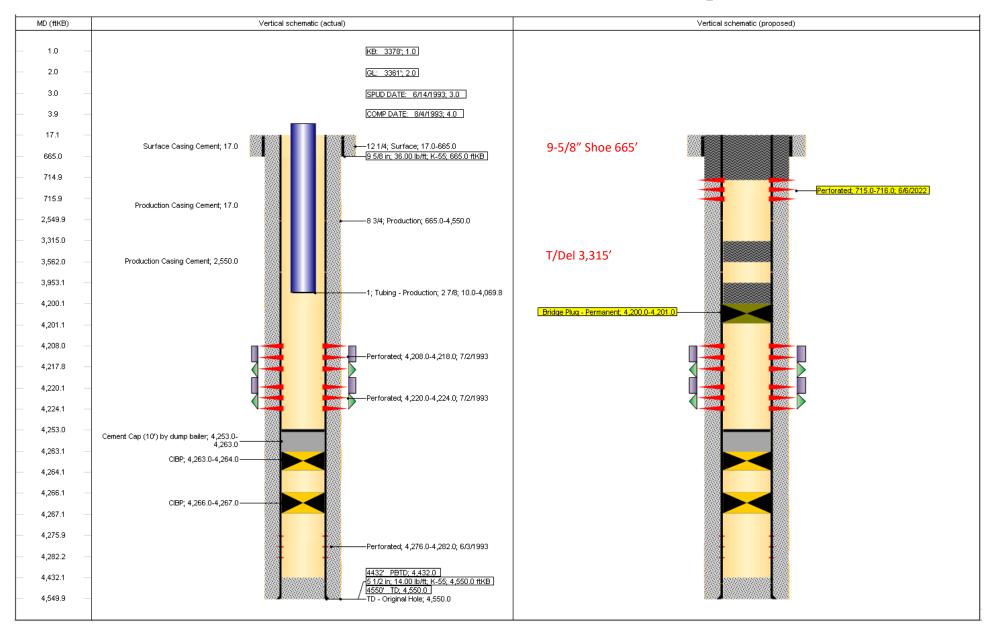



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Report

Well Name: GOLDEN D FED Well Location: T21S / R29E / SEC 17 / Co

NENW /

County or Parish/State: EDDY /

NM

Well Number: 1 Type of Well: INJECTION - ENHANCED Allottee or Tribe Name:

RECOVERY

Lease Number: NMNM0509 Unit or CA Name:

Unit or CA Number:

US Well Number: 3001527294 Well Status: Water Disposal Well Operator: XTO PERMIAN

OPERATING LLC

Notice of Intent

LONG VO Digitally signed by LONG VO Date: 2022.06.09 09:48:06 -05'00'

Sundry ID: 2675241

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 06/07/2022

Time Sundry Submitted: 05:59

Date proposed operation will begin: 07/07/2022

Procedure Description: 1) POOH laying down 2-3/8" tbg and 2-3/8" x 5-1/2" TAC. 2) TIH 2-3/8" tbg to PBTD at 4,253'. POOH 2-3/8" tbg and notify BLM. 3) MIRU WL, RIH WL w/ 5-1/2" CIBP to 4,200'. Set CIBP and spot 25 sks Class C cmt on top of bridge plug. WOC and Tag at least 3,953'. (T/Perfs) 4) PUH to 3,562' and spot 25 sxs class C cmt. (T/Del) 5) POOH w/tbg. RU WL, and RIH WL. Perf 5-1/2" csg at 715' and squeeze Class C cmt until returns at surface. (9-5/8" csg shoe, surface plug) 6) ND BOP and cut off wellhead 5' below surface. RDMO PU, transport trucks, and pump truck. 7) Set P&A marker.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

GOLDEN_D_FEDERAL_001_SWD___Proposed_WBD_20220607055842.pdf

Received by OCD: WINNERS. 3380EN DIED

Well Location: T21S / R29E / SEC 17 / NENW /

County or Parish/State: EDDY / NM

NM

Well Number: 1

RECOVERY

Lease Number: NMNM0509

Unit or CA Name:

Unit or CA Number:

US Well Number: 3001527294

Well Status: Water Disposal Well

 $\textbf{Operator:} \ \mathsf{XTO} \ \mathsf{PERMIAN}$

Page 5 of 16

OPERATING LLC

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: CASSIE EVANS Signed on: JUN 07, 2022 05:59 AM

Name: XTO PERMIAN OPERATING LLC

Title: Regulatory Analyst

Street Address: 6401 Holiday Hill Road, Bldg 5
City: Midland State: TX

Phone: (432) 218-3671

Email address: CASSIE.EVANS@EXXONMOBIL.COM

Field

Representative Name:

Street Address:

City: State: Zip:

Phone:

Email address:

PLUG AND ABANDONMENT **CONDITIONS OF APPROVAL**

OPERATOR'S NAME:	XTO Permian Operating LLC
LEASE NO.:	NMNM0509
WELL NAME & NO.:	Golden D Fed 1
US Well Number:	3001527294
LOCATION:	Section 17, T.21 S., R.29 E., NMPM
COUNTY:	Eddy County, New Mexico
Sundry ID:	2675241
Karst:	□Low ⊠Medium □High □Critical
Potash:	□Secretary □R111P
Special Area:	□Prairie Chicken □Canitan Reef

- 1) POOH laying down 2-3/8" tbg and 2-3/8" x 5-1/2" TAC.
- 2) TIH 2-3/8" tbg to PBTD at 4,253'. POOH 2-3/8" tbg and notify BLM.

Tag CIBP at 4253'. Spot 25 sx from 4253' to 4012'. WOC and Tag.

3) MIRU WL, RIH WL w/5-1/2" CIBP to 4,200'4158'. Set CIBP and spot 25 sks Class C cmt on top of bridge plug. WOC and Tag at least 3,953'. (T/Perfs)

□ Prairie Chicken □ Capitan Reef

4) PUH to 3,562'3111' and spot 25 sxs class C cmt. (T/Del & DV Tool) (3111' to 2781') WOC and Tag.


Spot from 1796' to 1678'. WOC and Tag.

- 5) POOH w/tbg. RU WL, and RIH WL. Perf 5-1/2" csg at 715'-836' and squeeze Class C cmt until returns at surface. (9-5/8" csg shoe, surface plug)-(87 sx)
- 6) ND BOP and cut off wellhead 5' below surface. RDMO PU, transport trucks, and pump truck.
- 7) Set P&A marker.

Approval Subject to General Requirements and Special Stipulations Attached

- No more than 3000 feet between cement plugs in cased hole.
- Wait on Cement and Tag Top of Cement Requirement:
 - 1. Shoe, Top of Salt, Base of Salt, DV tool, Perforate and Squeeze, Open Perforation.
 - 2. Formation plug is optional if a solid base is established and confirmed.

GOLDEN D FEDERAL 001 SWD - Current and Proposed WBD's

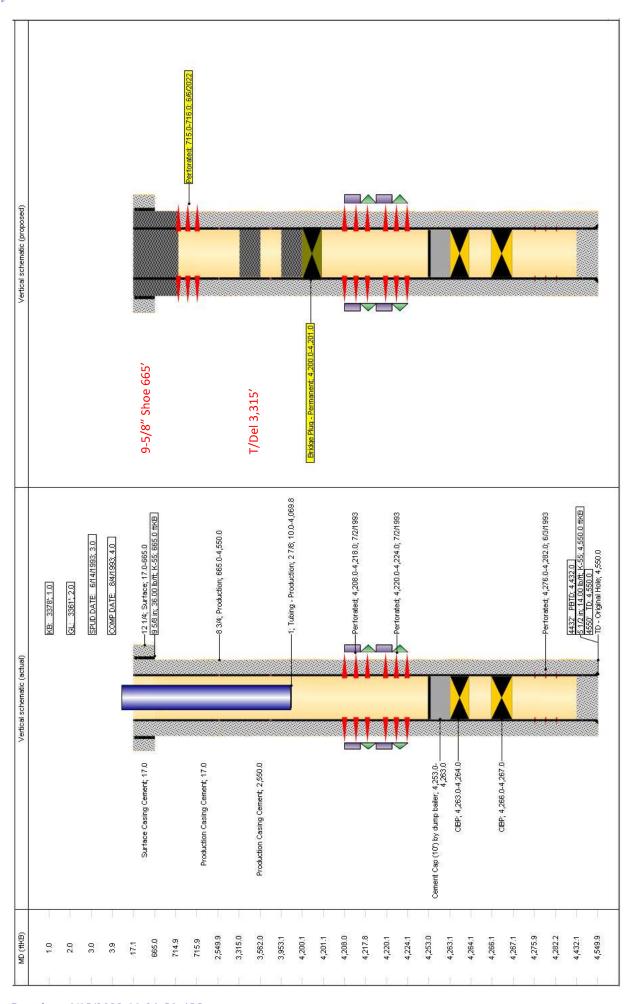

Sundry ID 2675241

Plug Type							1	
Surface Plug								
Surface Plug		Notes	Sacks	Tag	Length	Bottom	Тор	Plug Type
Shoe Plug 608.35 715.00 106.65 Tag/Verify Fresh Water @ 725 667.75 775.00 107.25 If solid Top of Salt @ 836 777.64 886.00 108.36 Tag/Verify 87.00 Surface. Base of Salt @ 1746 1678.54 1796.00 117.46 Tag/Verify Spot from 1796' tag/Verify DV tool plug 2781.40 2910.00 128.60 Tag/Verify If solid base no need to Tag (CIBP)						886.00		
Fresh Water @ 725 667.75 775.00 107.25 If solid Spot from 836' to surface. Verify at 87.00 Surface. Verify at 87.00 Spot from 1796' to 1678'. WOC and 108.36 Tag/Verify Spot from 1796' to 1678'. WOC and 117.46 Tag/Verify 25.00 Tag. DV tool plug 2781.40 2910.00 128.60 Tag/Verify If solid base no need to Tag (CIBP) Tag (CIBP) Tag/Verify Tag								
Top of Salt @ 836 777.64 886.00 108.36 Tag/Verify 87.00 Surface. Verify at 87.00 Surface. Spot from 1796' to 1678'. WOC and 117.46 Tag/Verify 25.00 Tag. DV tool plug 2781.40 2910.00 128.60 Tag/Verify If solid base no need to Tag (CIBP)								
Top of Salt @ 836 777.64 886.00 108.36 Tag/Verify 87.00 Surface. Verify at Surface. Spot from 1796' to 1678'. WOC and 25.00 Tag. DV tool plug 2781.40 2910.00 128.60 Tag/Verify If Solid base no need to Tag (CIBP)	i' to	Spot from 836' to						
Top of Salt @ 836 777.64 886.00 108.36 Tag/Verify 87.00 Surface. Base of Salt @ 1746 1678.54 1796.00 117.46 Tag/Verify 25.00 Tag. DV tool plug 2781.40 2910.00 128.60 Tag/Verify If solid base no need to Tag (CIBP)								
Base of Salt @ 1746 1678.54 1796.00 117.46 Tag/Verify 25.00 Tag. DV tool plug 2781.40 2910.00 If solid base no need to Tag (CIBP)	,		87 00	Tag/Verify	108.36	886 00	777 64	Top of Salt @ 836
Base of Salt @ 1746 1678.54 1796.00 117.46 Tag/Verify 25.00 Tag. DV tool plug If solid base no need to Tag (CIBP)	36' to		07.00	rag, vorny	100.00	000.00	777.01	1 00 01 0411 @ 000
Base of Salt @ 1746 1678.54 1796.00 117.46 Tag/Verify 25.00 Tag. DV tool plug 2781.40 2910.00 128.60 Tag/Verify If solid base no need to Tag (CIBP)								
DV tool plug 2781.40 2910.00 128.60 Tag/Verify If solid base no need to Tag (CIBP)	II IG		25.00	Tag/Verify	117.46	1796 00	1678 54	Base of Salt @ 1746
If solid base no need to Tag (CIBP		rug.	20.00	rag, verny	117.40	1730.00	1070.04	Base of Gait @ 1740
If solid base no need to Tag (CIBP				Tag//erify	128 60	2010.00	2781 40	DV tool plug
base no need to Tag (CIBP				rag/verily	120,00	2910,00	2701,40	DV tool plug
base no need to Tag (CIBP								
base no need to Tag (CIBP								
need to Tag (CIBP								
Tag (CIBP								
(CIBP								
Inresent				(CIBP				
I Iprocont				present				
and/or				and/or				
Mechanic Mechanic				Mechanic				
al Integrity								
Test), If								
Perf &								
Sqz then								
Tag, Leak								
Test all								
CIBP if no								
	11140	Coat from 2111						
Open Spot from 3111't								
Perforatio 2781'. WOC and	ina		05.00		400.04	0444.00		
Delaware @ 3061 2980.39 3111.00 130.61 ns 35.00 Tag.		Tag.	35.00	ns	130.61	3111.00	2980.39	Delaware @ 3061
If solid								
base no								
need to								
Tag								
(CIBP				(CIBP				
present								
and/or								
Mechanic Mechanic								
al Integrity								
Test), If								
Perf &								
Sqz then								
Tag, Leak								
Test all								
	450	O-4 CIDD -4 445						
CIBP if no Set CIBP at 4158								
Open Spot from 4158' t								
Perforatio 3917'. Leak Test	est							
CIBP Plug 4123.00 4158.00 35.00 ns 25.00 CIBP.		CIRP	25.00	Ins	35.00	4158.00	4123.00	CIBP Plug

Perforations Plug (If No CIBP)	4131.76	4274.00	142.24	Tag/Verify		
<u> </u>						
				If solid		
				base no		
				need to		
				Tag		
				(CIBP present		
				and/or		
				Mechanic		
				al Integrity		
				Test), If		
				Perf &		
				Sqz then		
				Tag, Leak		
				Test all		T OIDD - 1 40501
				CIBP if no		Tag CIBP at 4253'.
				Open Perforatio		Spot 25 sx from 4253' to 4012'.
CIBP Plug	4228.00	4263.00	35.00		25.00	WOC and Tag.
Shoe Plug	4454.50	4600.00	145.50	Tag/Verify		Not Necessary

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.

Class H >7500'

Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water.

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement	Medium Top of S	alt to surface	
Shoe @	665.00		
Shoe @	4550.00		
5.100 @			
Perforatons Top @	4208.00	Perforations	4224.00
DV Tool @	2860.00	CIBP @	4263.00
		CIBP @	4158.00

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 115725

CONDITIONS

Operator:	OGRID:
XTO PERMIAN OPERATING LLC.	373075
6401 HOLIDAY HILL ROAD	Action Number:
MIDLAND, TX 79707	115725
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	6/13/2022