Ceined by Opy Po Appropriate District: 51 F Office	State of New Mic			Form C-103	
<u>District I</u> – (575) 393-6161	ict I – (575) 393-6161 Energy, Minerals and Natural Resources		Revised July 18, 2013 WELL API NO.		
1625 N. French Dr., Hobbs, NM 88240 <u>District II - (575) 748-1283</u> 811 S. First St., Artesia, NM 88210 <u>District III - (505) 334-6178</u> 1000 Rio Prograp Rd. Artes NM 87410  1220 South St. Francis Dr.		30-015-29713			
		5. Indicate Type of			
		STATE   FEE			
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460  Santa Fe, NM 87505			6. State Oil & Gas I		
1220 S. St. Francis Dr., Santa Fe, NM					
87505 SUNDRY NOTIC (DO NOT USE THIS FORM FOR PROPOSA	7. Lease Name or Unit Agreement Name				
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)  1. Type of Well: Oil Well  Gas Well  Other  2. Name of Operator  SILVERBACK OPERATING II, LLC  3. Address of Operator 19707 West IH 10, Suite 201  San Antonio, TX 78257			Marshall	APH	
			8. Well Number 4		
			9 OGRID Number	9. OGRID Number	
			330968  10. Pool name or Wildcat		
					PENASCO DRAW; SA-YESO
			4. Well Location		
	om the North line and 660 feet fro	om the West line			
			// Cameter E	ddy	
Section 9 Towns	ship 19S Range 25E			uuy	
	11. Elevation (Show whether DR 3541' GR	i, KKB, KI, GK, etc	;.)		
	3311 GR				
12. Check A <sub>I</sub>	ppropriate Box to Indicate N ENTION TO:	•	, Report or Other D		
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WO	<del></del>	LTERING CASING	
TEMPORARILY ABANDON	CHANGE PLANS			AND A	
PULL OR ALTER CASING	MULTIPLE COMPL	CASING/CEMEN	NT JOB		
DOWNHOLE COMMINGLE		N	otify OCD 24 hrs. prid	or to any work	
CLOSED-LOOP SYSTEM		٦	one	·	
OTHER:		OTHER:			
<ol> <li>Describe proposed or comple of starting any proposed work proposed completion or record</li> </ol>	k). SEE RULE 19.15.7.14 NMAG				
Silverback Operating II, I	LC plans to plug and abandon thi	is well as follows:			
1. MIRU workover rig.	Load tbg and csg with water as no	eeded. POOH with	rods and pump.		
			1 1		
2. ND pumping tee. NU B	OF. FOOR WILL 2 1/6 TUG				
	and set at 2,002'. Spot 25 sk ceme	ent plug on CIBP.			
	and set at 2,002'. Spot 25 sk ceme		sqz cmt 638' - 488' - T SA	- WOC & tag	
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' V	Perf &	sqz cmt 638' - 488' - T SA	- WOC & tag	
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' vplug from 0-149'	Perf & NOC & tag	sqz cmt 638' - 488' - T SA	- WOC & tag	
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' V	Perf & NOC & tag	sqz cmt 638' - 488' - T SA	- WOC & tag	
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' vplug from 0-149' stall dry hole marker. Clean locat	Perf & NOC & tag	sqz cmt 638' - 488' - T SA	- WOC & tag	
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' vplug from 0-149' stall dry hole marker. Clean locat	Perf & NOC & tag	sqz cmt 638' - 488' - T SA	- WOC & tag	
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' vplug from 0-149' stall dry hole marker. Clean locat	Perf & NOC & tag	sqz cmt 638' - 488' - T SA	- WOC & tag	
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' vplug from 0-149' stall dry hole marker. Clean locat	Perf & NOC & tag	sqz cmt 638' - 488' - T SA	- WOC & tag	
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in Wellbore schematics attac	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug st sk cmt plug from 1,068'-1,217' vplug from 0-149' astall dry hole marker. Clean locat ched.	Perf & WOC & tag tion as regulated.	sqz cmt 638' - 488' - T SA	- WOC & tag	
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' vplug from 0-149' stall dry hole marker. Clean locat	Perf & WOC & tag tion as regulated.	sqz cmt 638' - 488' - T SA	- WOC & tag	
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in Wellbore schematics attac	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' vplug from 0-149' estall dry hole marker. Clean locat ched.	Perf & WOC & tag tion as regulated.	sqz cmt 638' - 488' - T SA		
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in Wellbore schematics attace	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' plug from 0-149' istall dry hole marker. Clean location.  Rig Release Da COA's***	Perf & WOC & tag tion as regulated.  ate:  MUST BE PLU	JGGED BY 9/15/24		
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in Wellbore schematics attace	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' plug from 0-149' istall dry hole marker. Clean location.  Rig Release Da COA's***	Perf & WOC & tag tion as regulated.  ate:  MUST BE PLU	JGGED BY 9/15/24		
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in Wellbore schematics attace	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' plug from 0-149' istall dry hole marker. Clean location.  Rig Release Da COA's***	Perf & WOC & tag tion as regulated.  ate:  MUST BE PLU	JGGED BY 9/15/24		
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in Wellbore schematics attack  Spud Date:  ***SEE ATTACHED	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' plug from 0-149' estall dry hole marker. Clean locat ched.  Rig Release Da COA's***	Perf & WOC & tag tion as regulated.  ate:  MUST BE PLU  est of my knowled	JGGED BY 9/15/24		
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in Wellbore schematics attack  Spud Date:  ***SEE ATTACHED  Thereby certify that the information all SIGNATURE ***SEATHER**  SIGNATURE ****SEATHER**  SIGNATURE ****SEATHER**  SIGNATURE ****SEATHER**  SIGNATURE *****  ****SEE ATTACHER**  SIGNATURE *****  ****SEE ATTACHER**  SIGNATURE *****  *****  *****  *****  ****  ****  ****	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' plug from 0-149' istall dry hole marker. Clean locate ched.  Rig Release Date of COA's***  bove is true and complete to the bear of the first structure of the proof of the proof of the proof of the first structure of the proof o	Perf & WOC & tag tion as regulated.  ate:  MUST BE PLU best of my knowled erations Analyst	JGGED BY 9/15/24 ge and belief.  DATE 08/31/2023		
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in Wellbore schematics attack  Spud Date:  ***SEE ATTACHED Thereby certify that the information all SIGNATURE ***Ceather**  Fype or print name Heather Treffer	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' plug from 0-149' istall dry hole marker. Clean locate ched.  Rig Release Date of COA's***  bove is true and complete to the bear of the first structure of the proof of the proof of the proof of the first structure of the proof o	Perf & WOC & tag tion as regulated.  ate:  MUST BE PLU best of my knowled erations Analyst	JGGED BY 9/15/24 ge and belief.  DATE 08/31/2023		
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in Wellbore schematics attack  Spud Date:  ***SEE ATTACHED  Thereby certify that the information all SIGNATURE ***SEATHER**  SIGNATURE ****SEATHER**  SIGNATURE ****SEATHER**  SIGNATURE ****SEATHER**  SIGNATURE *****  ****SEE ATTACHER**  SIGNATURE *****  ****SEE ATTACHER**  SIGNATURE *****  *****  *****  *****  ****  ****  ****	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' plug from 0-149' istall dry hole marker. Clean locate ched.  Rig Release Date of COA's***  bove is true and complete to the bear of the first structure of the proof of the proof of the proof of the first structure of the proof o	Perf & WOC & tag tion as regulated.  ate:  MUST BE PLU best of my knowled erations Analyst	JGGED BY 9/15/24 ge and belief.  DATE 08/31/2023		
3. GIH with CIBP on tbg 4. WOC. Test casing 500p 5. Perf at 1,192' & Sqz 25 6. PU and spot 25 sk cmt 7. Cut off wellhead and in Wellbore schematics attack  Spud Date:  ***SEE ATTACHED Thereby certify that the information all SIGNATURE ***Ceather**  Fype or print name Heather Treffer	and set at 2,002'. Spot 25 sk ceme psi/30 min. Tag cmt plug sk cmt plug from 1,068'-1,217' plug from 0-149' install dry hole marker. Clean locate ched.  Rig Release Date of the bound of the complete to the compl	Perf & WOC & tag tion as regulated.  ate:  MUST BE PLU best of my knowled erations Analyst	JGGED BY 9/15/24 ge and belief.  DATE 08/31/2023	689-5332	

# CONDITIONS FOR PLUGGING AND ABANDONMENT

#### OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD at 575-626-0830 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- A notice of intent to plug and abandon a wellbore is required to be approved before plugging
  operations are conducted. A cement evaluation tool is required in order to ensure isolation of
  producing formations, protection of water and correlative rights. A cement bond log or other
  accepted cement evaluation tool is to be provided to the division for evaluation if one has not
  been previously run or if the well did not have cement circulated to surface during the original
  casing cementing job or subsequent cementing jobs. Insure all bradenheads have been
  exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
  - A) Fusselman
  - B) Devonian
  - C) Morrow
  - D) Wolfcamp
  - E) Bone Springs
  - F) Delaware
  - G) Any salt sections
  - H) Abo
  - 1) Glorieta
  - J) Yates.
  - K) Cherry Canyon Eddy County
  - L) Potash---(In the R-111-P Area (Page 3 & 4), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

## **DRY HOLE MARKER REQUIRMENTS**

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

# R-111-P Area

#### T 18S - R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

## T 19S - R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A-F. Sec 27 Unit A,B,C,F,G,H.

#### T 19S - R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

## T 19S - R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

#### T 20S - R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G.

## T 20S - R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

## T 20S - R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36.

## T 21S - R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

## T 21S - R 30E

Sec 1 – Sec 36

# T 21S - R 31E

Sec 1 – Sec 36

# T 22S - R 28E

Sec 36 Unit A,H,I,P.

#### T 22S - R 29E

Sec 1. Sec 2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

## T 22S - R 30E

Sec 1 – Sec 36

## T 22S - R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

## T 23S - R 28E

Sec 1 Unit A

## T 23S - R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

## T 23S - R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

## T 23S - R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E.

## T 24S – R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

### T 24S - R 30E


Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.


#### T 24S - R 31E

Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.

## T 25S - R 31E

Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

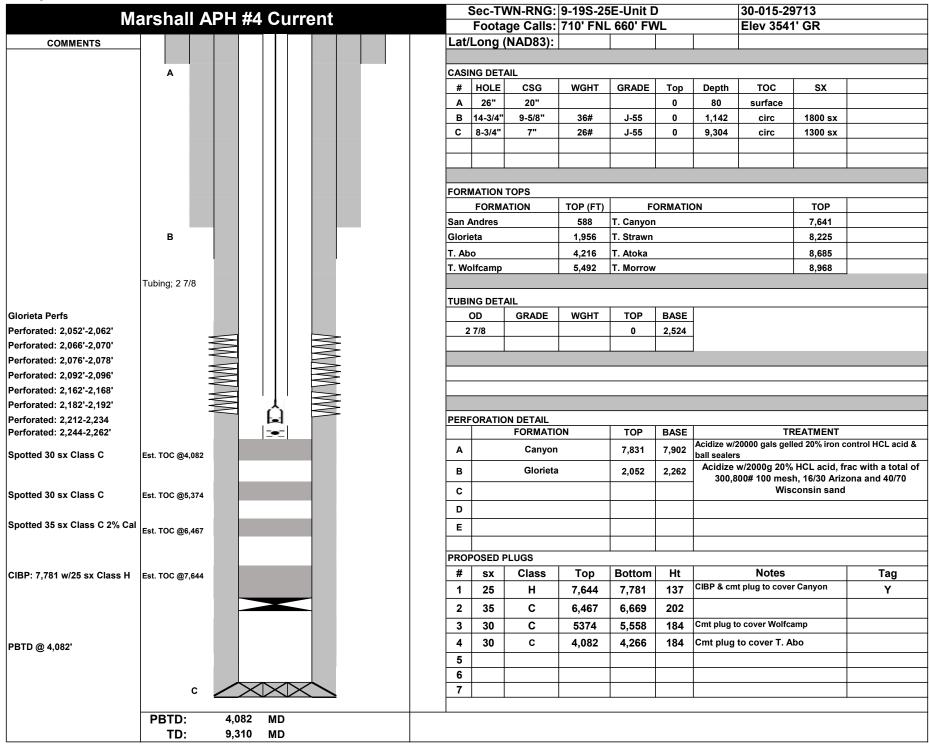

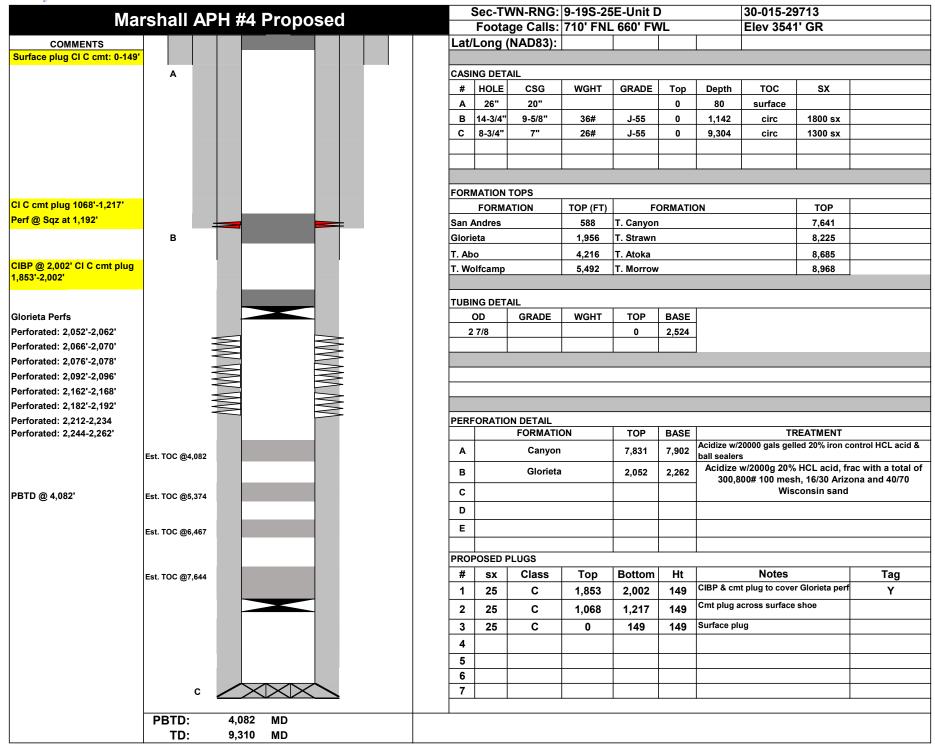

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 261050

# **CONDITIONS**

Operator:	OGRID:
Silverback Operating II, LLC	330968
19707 IH10 West, Suite 201	Action Number:
San Antonio, TX 78256	261050
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Creat	ted By	Condition	Condition Date
gco	rdero	None	9/15/2023