Received by WCD-Sy18/2024 8:55:19 AM U.S. Department of the Interior		Sundry Print Report 01/18/2024
BUREAU OF LAND MANAGEMENT		200-01-202
Well Name: RIDGE NOSE FEDERAL COM	Well Location: T26S / R29E / SEC 31 / SWNE / 32.000509 / -104.022282	County or Parish/State: EDDY / NM
Well Number: 1H	Type of Well: OIL WELL	Allottee or Tribe Name:
Lease Number: NMNM121474	Unit or CA Name: RIDGE NOSE FED COM 1H	Unit or CA Number: NMNM134623
US Well Number: 3001542391	Well Status: Producing Oil Well	Operator: COG PRODUCTION

Record Only SUBJECT TO LIKE NMOCD 1/30/24 X 7

Notice of Intent

Sundry ID: 2765587

Type of Submission: Notice of Intent

Date Sundry Submitted: 12/12/2023

Date proposed operation will begin: 01/17/2024

Type of Action: Plug and Abandonment

Time Sundry Submitted: 08:22

Procedure Description: 1. Set 5.5" CIBP @ 5596' cap w/ 20 sxs cmt on top WOC & Tag. 2. Spot 20 sxs @ 4813'-4713'. 3. Perf/Sqz 40 sxs @ 3579'-3479'. 4. Perf/Sqz 110 sxs @ 2727'-2391' WOC & Tag. 5. Perf/Sqz 40 sxs @ 995'-895' WOC & Tag. 6. Perf/Sqz 40 sxs @ 818'-718' 7. Perf/Circ 150 sxs from 455'-surface. 8. Cut off well head, verify cmt @ surface weld on Dry Hole Marker.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Ridge_Nose_Fed_Com_1H_Proposed_WBD_20231212082141.pdf

Ridge_Nose_Fed_Com_1H_Current_WBD_20231212082124.pdf

Ceived by OCD: 1/18/2024 8:55:19 AM Well Name: RIDGE NOSE FEDERAL COM	Well Location: T26S / R29E / SEC 31 / SWNE / 32.000509 / -104.022282	County or Parish/State: EDBY 7 0
Well Number: 1H	Type of Well: OIL WELL	Allottee or Tribe Name:
Lease Number: NMNM121474	Unit or CA Name: RIDGE NOSE FED COM 1H	Unit or CA Number: NMNM134623
US Well Number: 3001542391	Well Status: Producing Oil Well	Operator: COG PRODUCTION LLC

Conditions of Approval

Specialist Review

Ridge_Nose_Fed_Com_1H___2765587_Procedure_and_COAs_20240112094604.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: RUTH SHOCKENCY

Name: COG PRODUCTION LLC

Title: Regulatory Analyst

Street Address: 600 W. ILLINOIS AVE.

City: MIDLAND

State: TX

State:

Phone: (575) 703-8321

Email address: RUTH.SHOCKENCY@CONOCOPHILLIPS.COM

Field

Representative Name: Street Address:

City:

Phone: Email address:

BLM Point of Contact

BLM POC Name: JULIO A SANCHEZ BLM POC Phone: 5752342240 Disposition: Approved Signature: Julio Sanchez

BLM POC Title: ENGINEER

Zip:

BLM POC Email Address: JULIOSANCHEZ@BLM.GOV

Signed on: DEC 12, 2023 08:21 AM

Disposition Date: 01/12/2024

R

Form 3160-5 (June 2019) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FORM APPROVED SUBME NO. 1004-1017 Express: October 31, 2021 5. Lease Serial No MURAL OF LAND MANAGEMENT 5. Lease Serial No MURAL 2014 NUMM121474 6. If Indian, Allottee or Tribe Name 6. If Indian, Allottee or Tribe Name 7. If Unit of CA/Agreement, Name and/or No. RIDGE NOSE FED COM 11-MUNANM134623 8. Well Name and No RIDGE NOSE FED COM 11-MUNANM134623 8. Well Onlewel 8. Well Name and No RIDGE NOSE FED COM 11-MUNANM134623 9. Of Well Gas Well Other 3a. Address 2208 West Main Street, Artesia, NM 88210 3b. Phone No. (include area code) (575) 748-6840 10. Field and Pool or Exploratory Area BRUSHY DRAW-DELAWARE/BRUSHY DRAW 4. Location of Well (Pootage, Sec., T.RM., or Survey Description) 11. Country or Parish, State EDDY/NM 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Water Shut-Off Alter Casing Hoydraulic Fracturing Recomplet Other Subsequent Report Cleange Plans Plug and Abandon Temporarily Abandon I bodi under which the work will be performed or provide the Boad No. The Water Shut-Off Other Subsequent Report Cleange Plans P	eceived by OCD: 1/18/2024 8:	55:19 AM				Page 3 of 1	
NUMBRIZ NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals. 6. If Indian, Allottee or Tribe Name SUBMIT IN TRIPLICATE - Other instructions on page 2 1. Type of Well Gas Well Other 2. Name of Operator COG PRODUCTION LLC 9. API Well No 3a. Address 2208 West Main Street, Artesia, NM 88210 3b. Phone No. (include area code) 10. Field and Pool or Exploratory Area BRUSHY DRAW-DELAWARE/BRUSHY DRAW 10. Centers, T.R., M, or Survey Description) EDDYNM EDDYNM SEC 31T/265/R29E/NUM Notice of Intent Atter Casing Hydraulic Fracturing Recomplete Other 3b. Subsequent Report Casing Repair Production (Start/Resume) Water Shat-Off Subsequent Report Change Plans Plug and Abandon Temporating Abandon Subsequent Report Change Plans Plug and Abandon Temporating Abandon measured and true eventual, a form 3160-4 markers and 200 days follow 13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration the the proposal is to deepen directionally or recomplete horizonatily, give substaritice locations and measured and true eventual	(Inv. 2010)		OMB No. 1004-0137 Expires: October 31, 2021				
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals. Interview of the second s	BURI	EAU OF LAND MAN	5. Lease Serial No. NMNM121474				
Jump of Well RDGE NOSE FED COM 1H/NMM134623 I. Type of Well Gas Well Other I. Type of Well Gas Well Other Submit in Wind Construction 8. Well Name and No. RIDGE NOSE FED COM 1H/NMM134623 Status 8. Well Name and No. RIDGE NOSE FED COM 1H/NMM134623 Submit in Wind Construction 9. API Well No. 3a. Address 208 West Main Street, Artesia, NM 88210 3b. Phone No. (include area code) 10. Field and Pool or Exploratory Area BRUSHY DRAW-DELAWARE/BRUSHY DRAW 11. Country or Parish, State EEC 31/T26S/R29E/MMP 11. Country or Parish, State EDDY/NM 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Water Shut-Off Alter Casing Bubsequent Report Acidize Change Plans Plug and Abandon Temporarily Abandon Temporarily Abandon Final Abandonment Notice Convert to Injection Subsequent Report Change Plans Change Plans Plug Back Water Disposal 13. Describe Proposed or Completed Operation:: Clearly state all pertinent de	Do not use this f	form for proposals	to drill or to re-enter a		6. If Indian, Allottee or Tribe	Name	
1. Type of Well RIOGE NOSE FED COM 1H/NMNM134623 2. Name of Operator GGG PRODUCTION LLC 3a. Address 2208 West Main Street, Artesia, NM 88210 3b. Phone No. (include area code) (G75) 748-6940 10. Field and Pool or Exploratory Area BRUSHY DRAW-DELAWARE/BRUSHY DRAW 1. Country or Parish, State EDDY/NM 11. Country or Parish, State EDDY/NM 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Well Abandonment Notice Casing Repair Subsequent Report Casing Repair Caser: Convert to Injection Plug and Abandon Final Abandonment Notice Convert to Injection 13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration the proposal is to deceme directionally or recompletion or recompletion or recompleted in the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed once testing completed once stating estimated stating date of any proposed work and approximate duration the the proposal is to deceme directionally or recompletion or recompletion in a new interval, a Form 3160-4 must be filed once testing completion of the involved operation: Learly state all pertinent details, including reclamation, have been completed and the operator has detennined that is ready for final habandomment No	SUBMIT IN	TRIPLICATE - Other inst	ructions on page 2		7. If Unit of CA/Agreement,	Name and/or No.	
Image: Sec. 1 Other 8. Well Name and No. RIDGE NOSE FEDERAL CO 2. Name of Operator COG PRODUCTION LLC 9. API Well No. 3001542391 3a. Address 2208 West Main Street, Artesia, NM 88210 3b. Phone No. (include area code) 10. Field and Pool or Exploratory Area BRUSHY DRAW-DELAWARE/BRUSHY DRAW BUSHY DRAW-DELAWARE/BRUSHY DRAW 11. Country or Parish, State SEC 31/T26S/R29E/NMP 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Image: Notice of Intent Acidize Deepen Image: Operator Or Completed Operator: Clarry state all pertinent details, including estimated starting date of any proposed work and approximate duration the the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent details, including estimated latarting date of any proposed work and approximate duration the the proposed or Completed Operation: Clarry state all pertinent details, including estimated latarting date of any proposed work and approximate duration the the proposed or Completed Operation: Substantial, give subsurface locations and measured and true vertical depths of all pertinent markers and zone the Bond under which the work will be performed or provide the Bond No. on file with BLM/BLA. Required subsequent reports must be filed only after all requirements, including estimated starting date of any proposed work and approximate duration the the proposed to Completed Operation. Suft an a multiple completi							
2. Name of Operator Oce PRODUCTION LLC 9. API Well No. 3001542391 3a. Address 2208 West Main Street, Artesia, NM 88210 3b. Phone No. (include area code) 10. Field and Pool or Exploratory Area BRUSHY DRAW-DELAWARE/BRUSHY DRAW 4. Location of Well (Footage, Sec., T, R, M, or Survey Description) 11. Country or Parish, State SEC 31/T26S/R29E/NMP 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Image: Notice of Intent Acidize Alter Casing Hydraulic Fracturing Reclamation Well Integrity Subsequent Report Casing Repair Final Abandonment Notice Convert to Injection I3. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration the the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zone the Bond under which the work will be perfonned or provide the Bond No. on file with BLA/BLA. Required subsequent reports must be filed within 30 days follow completion of the involved operations. If the operation results in a multiple completion or recompleted and the operator has detennined that is ready for final inspection.) 13. Describe Proposed or Completed Operation. If the operation results in a multiple completion or recompleted and the operator has de	✓ Oil Well Gas W				8. Well Name and No. RIDG	E NOSE FEDERAL COM/1H	
(575) 748-6940 BRUSHY DRAW-DELAWARE/BRUSHY DRAW 4. Location of Well (<i>Footage, Sec., T.R.,M., or Survey Description</i>) 11. Country or Parish, State SEC 31/T26S/R29E/NMP 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Image: Activity of Production (Start/Resume) Water Shut-Off Actidize Deepen Production (Start/Resume) Water Shut-Off Atter Casing Hydraulic Fracturing Subsequent Report Casing Repair Change Plans Plug and Abandon Temporarily Abandon Temporarily Abandon I3. Describe Proposed or Complete Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration the the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zom the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed once testing completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has detennined that is ready for final inspection.) 1. Set 5.5 CIBP @ 5596 cap w/ 20 sxs cm on top WOC & Tag. Spot 20 sxs @ 4813-4713. 3. Perf/Sqz 40 sxs @ 3579-3479. Perf/Sqz 40 sxs @ 3579-3479. <tr< td=""><td>2. Name of Operator COG PRODUC</td><td>TION LLC</td><td></td><td></td><td>9. API Well No. 300154239</td><td>1</td></tr<>	2. Name of Operator COG PRODUC	TION LLC			9. API Well No. 300154239	1	
(575) 748-6940 BRUSHY DRAW-DELAWARE/BRUSHY DRAW 4. Location of Well (Footage, Sec., T.R., M., or Survey Description) 11. Country or Parish, State SEC 31/T26S/R29E/NMP I1. Country or Parish, State EDDY/NM I2. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Image: Acidize Deepen Production (Start/Resume) Water Shut-Off Alter Casing Hydraulic Fracturing Reclamation Well Integrity Subsequent Report Casing Repair Plug and Abandon Temporarily Abandon Final Abandonment Notice Convert to Injection Plug Back Water Disposal 13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration the the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zone the Bond under which the work will be perfoned or provide the Bond No. on file with BL/MBLA. Required subsequent reports must be filed once testing completion or tecompletion in a new interval, a Form 3160-4 must be filed once testing completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has detennined that is ready for final inspection.) <	3a. Address 2208 West Main Street,	, Artesia, NM 88210	3b. Phone No. (include area c	ode)	10. Field and Pool or Explora	atory Area	
SEC 31/T26S/R29E/NMP EDDY/NM 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Image: Complete of Intent Acidize Deepen Production (Start/Resume) Water Shut-Off Subsequent Report Casing Repair New Construction Recomplete Other Final Abandonment Notice Convert to Injection Plug and Abandon Temporarily Abandon 13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration the the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zone the Bond under which the work will be performed or provide the Bond No. on file with BLM/BLA. Required subsequent reports must be filed only after all requirements, including reclamation, have been completed and the operator has detennined that is ready for final inspection.) 1. Set 5.5 CIBP @ 5596 cap w/ 20 sxs cmt on top WOC & Tag. Spot 20 sxs @ 4813-4713. 3. Pert/Sqz 40 sxs @ 3579-3479. Pert/Sqz 40 sxs @ 3579-3479. 4. Pert/Sqz 40 sxs @ 995-895 WOC & Tag. Fert/Sqz 40 sxs @ 3579-34718.			(575) 748-6940		BRUSHY DRAW-DELAW	VARE/BRUSHY DRAW-DELAV	
TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent Acidize Deepen Hydraulic Fracturing Reclamation Well Integrity Subsequent Report Casing Repair New Construction Recomplete Other Subsequent Report Change Plans Plug and Abandon Temporarily Abandon Temporarily Abandon Temporarily Abandon Poscribe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration the the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zond the Bond Null on Con file with BL/BLA Required subsequent reports must be filed within 30 days follow completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has detennined that is ready for final inspection.) Set 5.5 CIBP @ 5596 cap w/ 20 sxs cmt on top WOC & Tag. Spot 20 sxs @ 4813-4713. Perf/Sqz 40 sxs @ 3579-3479. Perf/Sqz 40 sxs @ 3579-3479. Perf/Sqz 40 sxs @ 995-895 WOC & Tag. Perf/Sqz 40 sxs @ 995-895 WOC & Tag. Perf/Sqz 40 sxs @ 818-718		R.,M., or Survey Description	n)				
 Notice of Intent Acidize Deepen Hydraulic Fracturing Reclamation Well Integrity Casing Repair New Construction Recomplete Other Other Change Plans Plug and Abandon Temporarily Abandon Convert to Injection Plug Back Water Disposal Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zond the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed once testing completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has detennined that is ready for final inspection.) 1. Set 5.5 CIBP @ 5596 cap w/ 20 sxs cmt on top WOC & Tag. 2. Spot 20 sxs @ 4813-4713. 3. Perf/Sqz 40 sxs @ 3579-3479. 4. Perf/Sqz 110 sxs @ 2727-2391 WOC & Tag. 5. Perf/Sqz 40 sxs @ 995-895 WOC & Tag. 6. Perf/Sqz 40 sxs @ 818-718 	12. CHE4	CK THE APPROPRIATE E	ICE, REPORT OR OTHER DA	ATA			
 Notice of intent Alter Casing Hydraulic Fracturing Reclamation Well Integrity Casing Repair New Construction Recomplete Other Change Plans Plug and Abandon Temporarily Abandon Temporarily Abandon Convert to Injection Plug Back Water Disposal 13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration the the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zone the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days follow completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has detennined that is ready for final inspection.) Set 5.5 CIBP @ 5596 cap w/ 20 sxs cmt on top WOC & Tag. Spot 20 sxs @ 4813-4713. Pert/Sqz 40 sxs @ 3579-3479. Pert/Sqz 40 sxs @ 2727-2391 WOC & Tag. Pert/Sqz 40 sxs @ 995-895 WOC & Tag. Pert/Sqz 40 sxs @ 995-895 WOC & Tag. Pert/Sqz 40 sxs @ 818-718 	TYPE OF SUBMISSION		1	TYPE OF AC	TION		
 Final Abandonment Notice Convert to Injection Plug Back Water Disposal Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zone the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days follow completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has detennined that is ready for final inspection.) 1. Set 5.5 CIBP @ 5596 cap w/ 20 sxs cmt on top WOC & Tag. 2. Spot 20 sxs @ 4813-4713. 3. Perf/Sqz 40 sxs @ 3579-3479. 4. Perf/Sqz 110 sxs @ 2727-2391 WOC & Tag. 5. Perf/Sqz 40 sxs @ 995-895 WOC & Tag. 6. Perf/Sqz 40 sxs @ 818-718 	Notice of Intent Alter Casing Hydraulic Fracturing Rec Casing Remain				amation	Well Integrity	
 13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zone the Bond under which the work will be perfonned or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days follow completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed only after all requirements, including reclamation, have been completed and the operator has detennined that is ready for final inspection.) 1. Set 5.5 CIBP @ 5596 cap w/ 20 sxs cmt on top WOC & Tag. 2. Spot 20 sxs @ 4813-4713. 3. Perf/Sqz 40 sxs @ 3579-3479. 4. Perf/Sqz 110 sxs @ 2727-2391 WOC & Tag. 5. Perf/Sqz 40 sxs @ 995-895 WOC & Tag. 6. Perf/Sqz 40 sxs @ 188-718 	Final Abandonment Notice						
8. Cut off well head, verify cmt @ surface weld on Dry Hole Marker.	 the proposal is to deepen directiona the Bond under which the work wil completion of the involved operation completed. Final Abandonment Not is ready for final inspection.) 1. Set 5.5 CIBP @ 5596 cap w 2. Spot 20 sxs @ 4813-4713. 3. Perf/Sqz 40 sxs @ 3579-34 4. Perf/Sqz 110 sxs @ 2727-2 5. Perf/Sqz 40 sxs @ 995-895 6. Perf/Sqz 40 sxs @ 818-718 7. Perf/Circ 150 sxs from 455-3 	ally or recomplete horizonta Il be perfonned or provide th ons. If the operation results tices must be filed only afte v/ 20 sxs cmt on top WOC 79. 391 WOC & Tag. 5 WOC & Tag. 5 surface.	lly, give subsurface locations an ne Bond No. on file with BLM/E in a multiple completion or reco r all requirements, including rec C & Tag.	d measured a DA. Required mpletion in a	nd true vertical depths of all pe l subsequent reports must be fil new interval, a Form 3160-4 r	ertinent markers and zones. Attach led within 30 days following nust be filed once testing has been	

14. I hereby certify that the foregoing is true and correct. Name (<i>Printed/Typed</i>) RUTH SHOCKENCY / Ph: (575) 703-8321	Regulatory Analyst Title							
(Electronic Submission)	Date	12/12/2023						

THE SPACE FOR FEDERAL OR STATE OFICE USE

Approved by		
JULIO A SANCHEZ / Ph: (575) 234-2240 / Approved	ENGINEER Title	01/12/2024 Date
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.	Office CARLSBAD	

Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

GENERAL INSTRUCTIONS

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

SPECIFIC INSTRUCTIONS

Item 4 - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

NOTICES

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c)and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.


The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT: Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240


Additional Information

Location of Well


0. SHL: SWNE / 200 FSL / 2310 FEL / TWSP: 26S / RANGE: 29E / SECTION: 31 / LAT: 32.000509 / LONG: -104.022282 (TVD: 0 feet, MD: 0 feet) BHL: NWNE / 374 FNL / 2300 FEL / TWSP: 26S / RANGE: 29E / SECTION: 30 / LAT: 0.0 / LONG: 0.0 (TVD: 0 feet, MD: 0 feet)



Description	0.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	13.325	J55	54.5	405	17 1/2	1,000	surf
Inter Csg	9.625	J55	40	2,605	12 1/4	1,300	surf
Prod Csg	5.5	P110	17	13,030	7 7/8	2,750	4,020' by CBL

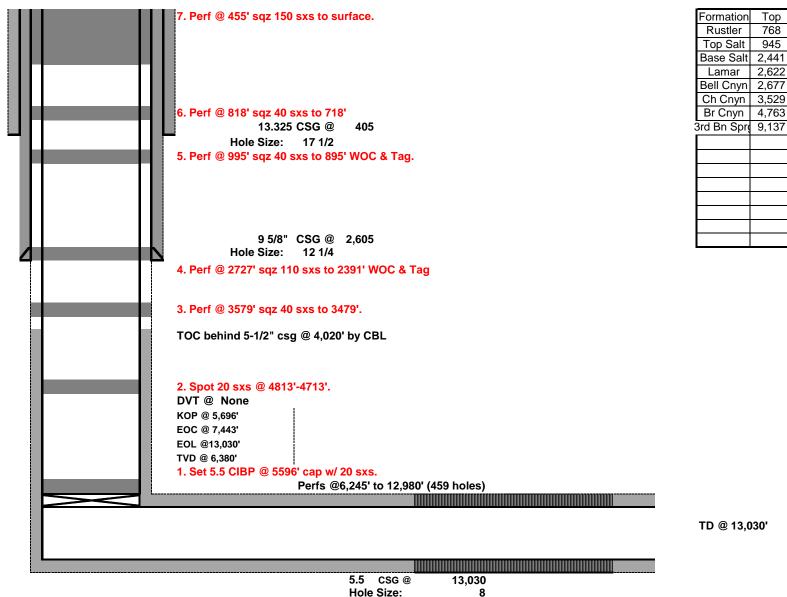

Received by OCD: 1/18/2024 8:55:19 AM

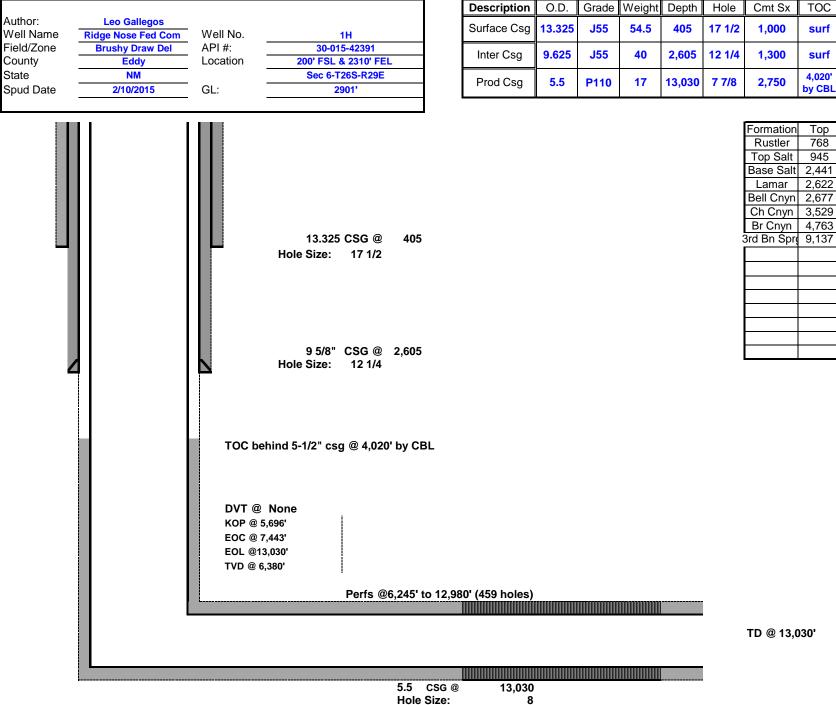

Hole Size:

					Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Author: Well Name	Leo Gallegos	Well No.	411		Surface Csg	13.325	J55	54.5	405	17 1/2	1,000	surf
Field/Zone	Ridge Nose Fed Com Brushy Draw Del	API #:	1H 30-015-42391	_								
County	Eddy	Location	200' FSL & 2310' FEL		Inter Csg	9.625	J55	40	2,605	12 1/4	1,300	surf
State	NM		Sec 6-T26S-R29E		Prod Csg	5.5	P110	17	13,030	7 7/8	2,750	4,020'
Spud Date	2/10/2015	GL:	2901'	_		••••			10,000		_,	by CBL
		DVТ (КОР @ ЕОС @	Hole Size: 17 1/2 9 5/8" CSG @ 2,6 Hole Size: 12 1/4 Dehind 5-1/2" csg @ 4,020' by 0 None 0 5,696' 0 7,443' 113,030' 16,380'	CBL	0' (459 holes)						Formation Rustler Top Salt Base Salt Lamar Bell Cnyn Br Cnyn 3rd Bn Sprg	768 945 2,441 2,622 2,677 3,529 4,763 9,137
											TD @ 13,0	030'

5.5 CSG @

Hole Size:

13,030

8

.

Page 8

Nuthor: Leo Gallegos Well No. 1H Ridge Nose Fed Com Well No. 1H Brushy Draw Del API #: 30-015-42391 County Eddy Location 200' FSL & 2310' FEL State NM Sec 6-T26S-R29E Prod Csr 55 P140 17 13 030 7 7/8 2 750 4,020'					1 6	Description	O.D.	Grade	Weiaht	Depth	Hole	Cmt Sx	TOC	erv
13.25 C SG @ _ 405 Hole Size: 17.12 5. Perf @ 995' sqz 296 sxs to 0' Verify circulated to surface 9.586' C SG @ _ 2.605 Hole Size: 12.11 9. Perf @ 975' sqz 40 sxs to 346' WOC & Tag 9. Perf @ 975' sqz 40 sxs to 3479'. WOC & TAG TC De brind 5-1/2'' csg @ 4,020' by CBL 9. Spot 25 sxs @ 4813'-4713'. DVT @ None Kp _ 5,656' Gold _ 7,433' TVD @ 6,330'' TVD @ 6,330'' TVD @ 6,330'' St s.S C EDP 5585' cap w/ 25 sxs. 500psi leak test 30mins Perfs @ 6,245' to 12,980' (459 holes) TD @ 13,030'' To @ 13,030'' Hole Size: 8 '' To @ 13,030'' To @ 13,030'' To @ 13,030'' To @ 13,030'' To @ 13,030''' To @ 13,030''	Author:									1				edl
13.25 C SG @ _ 405 Hole Size: 17.12 5. Port @ 995' sqz 296 sxs to 0' Verify circulated to surface 9.562' C SG @ _ 2,605 Hole Size: 12.14 4. Port @ 2727' sqz 110 sxs to 2366' WOC & Tag 9. Port @ 3579' sqz 40 sxs to 3479', WOC & TAG TOC behlind 5-1/2'' csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. DVT @ None Kod 7.443' 5.00 7.433' Food @ 3559' cap wl 25 sxs. 500pis loak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' To @ 13,03' To @ 13,0					l ⊨				04.0				3011	y C
13.325 CSG @ 405 Hole Size: 17.12 5. Perf @ 995' sqz 296 sxs to 0' Verify circulated to surface 9.564" CSG @ 2,605 Hole Size: 12.14 4. Perf @ 2727' sqz 110 sxs to 2366' WOC & Tag 3. Perf @ 3579' sqz 40 sxs to 3479'. WOC & TAG TOC behlnd 5-1/2" csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. DVT @ None Stop 7.443' Sologi Loak test 30mins Perfs @6,245' to 12,380' (459 holes) TD @ 13,03' To @ 13,03' Store Stops: Sologi Loak test 30mins Perfs @6,245' to 12,380' (459 holes) TD @ 13,03' To @ 13,03'	County				1	Inter Csg	9.625	J55	40	2,605	12 1/4	1,300	surf	
13.25 C SG @ _ 405 Hole Size: 17.12 5. Port @ 995' sqz 296 sxs to 0' Verify circulated to surface 9.562' C SG @ _ 2,605 Hole Size: 12.14 4. Port @ 2727' sqz 110 sxs to 2366' WOC & Tag 9. Port @ 3579' sqz 40 sxs to 3479', WOC & TAG TOC behlind 5-1/2'' csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. DVT @ None Kod 7.443' 5.00 7.433' Food @ 3559' cap wl 25 sxs. 500pis loak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' To @ 13,03' To @ 13,0	State				1	Prod Csg	55	D110	17	13 030	7 7/8	2 750		
13.25 C SG @ _ 405 Hole Size: 17.12 5. Perf @ 995' sqz 296 sxs to 0' Verify circulated to surface 9.586' C SG @ _ 2.605 Hole Size: 12.11 9. Perf @ 975' sqz 40 sxs to 346' WOC & Tag 9. Perf @ 975' sqz 40 sxs to 3479'. WOC & TAG TC De brind 5-1/2'' csg @ 4,020' by CBL 9. Spot 25 sxs @ 4813'-4713'. DVT @ None Kp _ 5,656' Gold _ 7,433' TVD @ 6,330'' TVD @ 6,330'' TVD @ 6,330'' St s.S C EDP 5585' cap w/ 25 sxs. 500psi leak test 30mins Perfs @ 6,245' to 12,980' (459 holes) TD @ 13,030'' To @ 13,030'' Hole Size: 8 '' To @ 13,030'' To @ 13,030'' To @ 13,030'' To @ 13,030'' To @ 13,030''' To @ 13,030''	Spud Date	2/10/2015	GL:	2901'] L	Flod Csy	5.5	PIIV	17	13,030	1 110	2,750	by CBL	
13.25 CSG @ 405 Hols Siz: 17 12 5. Pof @ 995' sqz 236 sxs to 0' Verify circulated to surface 9.58°. CSG @ 2,605 Hols Siz: 12 11 9. Porf @ 995' sqz 40 sxs to 3479', WOC & Tag 9. Porf @ 935' sqz 40 sxs to 3479', WOC & Tag 9. Porf @ 935' sqz 40 sxs to 3479', WOC & Tag 9. Porf @ 3579' sqz 40 sxs to 3479', WOC & Tag 9. Spot 25 sxs @ 4813'-4713'. D'U' @ None KD 7.4330' You Set Soc CBP 5585' cap w/ 25 sxs. Sopois leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13.03'' To @ 13.03'					1									/20
13.25 C SG @ _ 405 Hole Size: 17.12 5. Perf @ 995' sqz 296 sxs to 0' Verify circulated to surface 9.5 Ki* C SG @ _ 2,605 Hole Size: 12.14 4. Perf @ 7272' sqz 110 sxs to 2366' WOC & Tag 9. Perf @ 3579' sqz 40 sxs to 3479'. WOC & TAG TOC behind 5-1/2" csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. DVT @ None KD So 5. CG CD @ _ 7,433' TV @ 6,330' TV @ 6,330' TV @ 6,330' TV @ 6,55' So 5. CG CD @ _ 7,433' Yo B & S. 5. CG CDP (5595' cap W/ 25 sx.) Solpai leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' To @ 13,030' Hole Size: 8 Bord Back Start 100' With the set 100' With the set 100' With the set 100' With the set 100' Wit														124
13.325 CSG @ 405 Hole Size: 17.12 5. Perf @ 995' sqz 296 sxs to 0' Verify circulated to surface 9.564" CSG @ 2,605 Hole Size: 12.14 4. Perf @ 2727' sqz 110 sxs to 2366' WOC & Tag 3. Perf @ 3579' sqz 40 sxs to 3479'. WOC & TAG TOC behlnd 5-1/2" csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. DVT @ None Stop 7.443' Sologi Loak test 30mins Perfs @6,245' to 12,380' (459 holes) TD @ 13,03' To @ 13,03' Store Stops: Sologi Loak test 30mins Perfs @6,245' to 12,380' (459 holes) TD @ 13,03' To @ 13,03'														C:5
13.325 CSG @ 405 Hole Size: 17.12 5. Porf @ 995' sqz 236 sxs to 0' Verify circulated to surface 9.562'' CSG @ 2,605 Hole Size: 12.14 4. Porf @ 2727' sqz 110 sxs to 2366' WOC & Tag 9. Porf @ 935' sqz 40 sxs to 3479'. WOC & TAG TOC behlnd 5-1/2'' csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813-4713'. DVT @ None Stop You @ s.300' Tybe @ stop: and test 30mins Porfs @6,245' to 12,380' (459 holes) TD @ 13,03'' To @ 13,03'' Stop is bak test 30mins Porfs @6,245' to 12,380' (459 holes) TD @ 13,03'' To @ 13,03'' T												Base Salt		0:1
13.325 CSG @ 405 Hole Size: 17.12 5. Porf @ 995' sqz 236 sxs to 0' Verify circulated to surface 9.562'' CSG @ 2,605 Hole Size: 12.14 4. Porf @ 2727' sqz 110 sxs to 2366' WOC & Tag 9. Porf @ 935' sqz 40 sxs to 3479'. WOC & TAG TOC behlnd 5-1/2'' csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813-4713'. DVT @ None Stop You @ s.300' Tybe @ stop: and test 30mins Porfs @6,245' to 12,380' (459 holes) TD @ 13,03'' To @ 13,03'' Stop is bak test 30mins Porfs @6,245' to 12,380' (459 holes) TD @ 13,03'' To @ 13,03'' T												Lamar	2,622	9 A
13.325 CSG @ 405 Br Cnyn 4,763 Hole Size: 17 1/2 5. Perf @ 995' sqz 296 sxs to 0' Verify circulated to surface 9 5/8" CSG @ 2,605 Hole Size: 12 1/4 4. Perf @ 2727' sqz 110 sxs to 2366' WOC & Tag 3. Perf @ 3579' sqz 40 sxs to 3479'. WOC & TAG TOC behind 5-12" cog @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. Dr W None KCP 7,834" EOC 7,334" TW @ 6,380" 13,030" TW @ 6,380" 10,030 Mole Size: 8														N
13.325 CS6 @ 405 3rd En Spt 9,137 Hole Size: 17 1/2 5. Perf @ 995' sqz 236 sxs to 0' Verify circulated to surface 9 5/8" CS6 @ 2,605 Hole Size: 12 1/4 4. Perf @ 2727' sqz 110 sxs to 2366' WOC & Tag 3. Perf @ 3579' sqz 40 sxs to 3479'. WOC & TAG TOC behind 5-1/2" csg @ 4,020' by CBL 9 5/8" CS6 @ 2,605 1. Perf @ 3579' sqz 40 sxs to 3479'. WOC & TAG TOC behind 5-1/2" csg @ 4,020' by CBL 9 5/8" CS6 @ 13,030' TV0 @ 6,380' Stot 55 CIBP @ 5595' cap w/ 25 sxs. 500psi loak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' TD @ 13,030' TD @ 13,030'														
5. Perf @ 995' sqz 296 sxs to 0' Verify circulated to surface 9 5/8" CSG @ 2,605 Hole Size: 121/4 4. Perf @ 2572' sqz 110 sxs to 2366' WOC & Tag 3. Perf @ 3579' sqz 40 sxs to 3479', WOC & TAG TOC behind 5-1/2" csg @ 4,020' by CBL 9 5/8" CSG @ 7,443' 60 9 5/8" Sys @ 4813'-4713'. DVT @ None KOP § 13,030' TO @ 5,39" 1. Sut 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' TD @ 13,030' TD @ 13,030' TD @ 13,030'				13.325 CSG @ 405							:			
9 56% CSC @ 2,605 ble Size: 12 14 4. Perf@ 2727' sqz 110 sxs to 2366' WOC & Tag 3. Perf@ 3579' sqz 40 sxs to 3479', WOC & TAG TC behind 5-1/2' csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. DVT @ None KDG @ 5,686' ECC @ 7,443' EOL @ 413,030' TD @ 6,300' 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' Td @ 13,														
Hole Size: 12 1/4 4. Perf @ 2727' sqz 110 sxs to 2366' WOC & Tag 3. Perf @ 3579' sqz 40 sxs to 3479'. WOC & TAG TOC behind 5-112" csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. DVT @ None KOP 6,686' EOC 7,443' EOL @ 13,030' TVD @ 6,380' 13.030' TVD @ 6,380' . 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' Store Colspan="2">Classes (13,030) Hole Size: 8 Classes/classes			5. Perf	@ 995' sqz 296 sxs to 0' Verify	circulate	d to surface								
Hole Size: 12 1/4 4. Perf @ 2727' sqz 110 sxs to 2366' WOC & Tag 3. Perf @ 3579' sqz 40 sxs to 3479'. WOC & TAG TOC behind 5-112" csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. DVT @ None KOP 6,686' EOC 7,443' EOL @ 13,030' TVD @ 6,380' 13.030' TVD @ 6,380' . 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' Store Colspan="2">Classes (13,030) Hole Size: 8 Classes/classes														
Hole Size: 12 1/4 4. Perf @ 2727' sqz 110 sxs to 2366' WOC & Tag 3. Perf @ 3579' sqz 40 sxs to 3479'. WOC & TAG TOC behind 5-112" csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. DVT @ None KOP 6,686' EO 7,443' EOL @ 13,030' TVD @ 6,380' 13.030' TVD @ 6,380' . 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. . SOOpsi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030'														
Hole Size: 12 1/4 4. Perf @ 2727' sqz 110 sxs to 2366' WOC & Tag 3. Perf @ 3579' sqz 40 sxs to 3479'. WOC & TAG TOC behind 5-112" csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. DVT @ None KOP 6,686' EO 7,443' EOL @ 13,030' TVD @ 6,380' 13.030' TVD @ 6,380' . 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. . SOOpsi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030'														
Hole Size: 12 1/4 4. Perf @ 2727' sqz 110 sxs to 2366' WOC & Tag 3. Perf @ 3579' sqz 40 sxs to 3479'. WOC & TAG TOC behind 5-12" csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. DVT @ None KOP 6,566' EO 7,443' EOL @ 13,030' TVD @ 6,380' 13.030' TVD @ 6,380' . 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030'				9 5/8" CSG @ 2,605										
1. Perf @ 3579' sqz 40 sxs to 3479'. WOC & TAG TOC behind 5-1/2" csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713', DVT @ None KOP \$ 5,696' EOC 7,443' EOL @ 13,030' TVD @ 5,880' 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' TD @ 13,030' Kop @ 13,030' Not @ 13,030' Classe @ 13,030'			N	Hole Size: 12 1/4										
TOC behind 5-1/2" csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. DVT @ None KOP 5,696' EOL 7,443' EOL 013,030' TVD @ 6,380' 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' ClustersChristOpper,Romero/Destop Christ/Concor/Ridge Mose Fed Com #1478/dge Mose			4. Perf	@ 2727' sqz 110 sxs to 2366' W	VOC & Tag	g								
TOC behind 5-1/2" csg @ 4,020' by CBL 2. Spot 25 sxs @ 4813'-4713'. DVT @ None KOP 5,696' EOL 7,443' EOL 013,030' TVD @ 6,380' 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' ClustersChristOpper,Romero/Destop Christ/Concor/Ridge Mose Fed Com #1478/dge Mose														
2. Spot 25 sxs @ 4813'4713'. DVT @ None KOP 6.596' EOC 7.443' EOL @13,030' TVD @ 6,380' 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' 5.5 CSG @ 13,030 Hole Size: 8 Cuberaconservicesetaptic/finis/ConcodRidge Mose Fed Com #1HRidge Nose Fed Co			3. Perf	@ 3579' sqz 40 sxs to 3479'. W	OC & TA	G								
DVT @ None KOP 5,696' KOP @ 13,030' EOL @ 13,030' 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins So0psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' S.5 CSG @ 13,030 Hole Size: 8 Cluters/Christopher.Romero/Desktop/Christ/ConcolRidge Nose Fed Com #IHRidge Nose Fed Co			TOC be	ehind 5-1/2" csg @ 4,020' by CB	BL									
DVT @ None KOP 5,696' KOP @ 15,696' EOL @ 13,030' TVD @ 6,380' 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' S.5 CSG @ 13,030 Hole Size: 8 Cluers/ChristOpher.RomerolDesktop/ChristOphocolRidge Nose Fed Com #1HRidge Nose Fed Com #1 HRidge														
DVT @ None KOP 5,696' KOP @ 15,696' EOL @ 13,030' TVD @ 6,380' 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' S.5 CSG @ 13,030 Hole Size: 8 Cluers/ChristOpher.RomerolDesktop/ChristOphocolRidge Nose Fed Com #1HRidge Nose Fed Com #1 HRidge														
KOP @ 5,696' EOC @ 7,443' @13,030' TVD @ 6,380' @13,030' 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' 5.5 CSG @ 13,030 Hole Size: 8 CLUBERS/Christ/Christ/Concol/Ridge Nese Fed Cam #IH/Ridge Nese Fed Cam #														
EOC @ 7,443' EOL TVD @ 6,380' 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' TD @ 13,030' S.5 CSG @ 13,030 Hole Size: 8 CUBers/Christopher.RomerolDesktop/ChristConcoolRidge Nose Fed Com #1HRidge Nose Fed Com #1H			-		5 696'									
EOL @13,030' TVD @ 6,380' 1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' 5.5 CSG @ 13,030 Hole Size: 8 CLUBERICHISTOPHER.Romerol Desktopl/Christ/ConocolRidge Nose Fed Com #1HRidge Nose Fed Com #1 HRidge Nose F				@										
1. Set 5.5 CIBP @ 5596' cap w/ 25 sxs. 500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' 5.5 CSG @ 13,030 Hole Size: 8 C:Users/Christopher.Romero/Desktop/Chris/Concco/Ridge Nose Fed Com 1H 3 STRING HORIZONTALWED				@										
500psi leak test 30mins Perfs @6,245' to 12,980' (459 holes) TD @ 13,030' 5.5 CSG @ 13,030 Hole Size: 8 C:Users/Christopher.Romero/Desktop/Chris/Conoco/Ridge Nose Fed Com #1H/Ridge Nose Fed Com 1H 3 STRING HORIZONTALWED			-											
TD @ 13,030' 5.5 CSG @ 13,030 Hole Size: 8 C:Users\Christopher.Romero\Desktop\Chris\Conoco\Ridge Nose Fed Com 1H 3 STRING HORIZONTALW						Parts @6 24	15' to 12	980' (45	59 holes	.)				
5.5 CSG @ 13,030 Hole Size: 8 C:\Users\Christopher.Romero\Desktop\Chris\Conoco\Ridge Nose Fed Com #1H\Ridge Nose Fed Com 1H 3 STRING HORIZONTALW			Soobal							'' 	1			
5.5 CSG @ 13,030 Hole Size: 8 C:\Users\Christopher.Romero\Desktop\Chris\Conoco\Ridge Nose Fed Com #1H\Ridge Nose F														
C:\Users\Christopher.Romero\Desktop\Chris\Conoco\Ridge Nose Fed Com #1H\Ridge Nose Fed Com 1H 3 STRING HORIZONTALW												TD @ 13,0	030'	
C:\Users\Christopher.Romero\Desktop\Chris\Conoco\Ridge Nose Fed Com #1H\Ridge Nose Fed Com 1H 3 STRING HORIZONTALW														
C:\Users\Christopher.Romero\Desktop\Chris\Conoco\Ridge Nose Fed Com #1H\Ridge Nose Fed Com 1H 3 STRING HORIZONTALW														-
C:\Users\Christopher.Romero\Desktop\Chris\Conoco\Ridge Nose Fed Com #1H\Ridge Nose Fed Com 1H 3 STRING HORIZONTAL				5.5	CSG @									Spe
C:\Users\Christopher.Romero\Desktop\Chris\Conoco\Ridge Nose Fed Com #1H\Ridge Nose Fed Com 1H 3 STRING HORIZONTAL				Hole	3126:									e y
18						C:\Users\C	hristopher.R	omero\Deskt	op\Chris\Cor	noco\Ridge No	ose Fed Com	n #1H\Ridge Nose	e Fed Com 1H	3 STRING HORIZONTALWED
														18

.

Received by OCD: 1/18/2024 8:55:19 AM

- 1. Set 5.5" CIBP @ 5596' cap w/ 25 sxs cmt on top WOC & Tag.
- 2. Spot 25 sxs @ 4813'-4713'.
- 3. Perf/Sqz 40 sxs @ 3579'-3479'. WOC & Tag.
- 4. Perf/Sqz 110 sxs @ 2727'-2366' WOC & Tag.
- 5. 5. Perf @ 995' sqz 296 sxs to 0' Verify circulated to surface
- 6. Cut off well head, verify cmt @ surface weld on Dry Hole Marker.

JULIO SANCHEZ Date: 2023.12.18 09:35:43 -07'00'

Sundry ID	2765587					
Plug Type	Тор	Bottom	Length	Tag	Sack	Notes
Surface Plug	0.00	995.00	995.00	Verify circulated	296	Perf and Squeeze
Shoe Plug	0.00	995.00	995.00	to surface	SXS	Fell and Squeeze
Top of Salt @ 945	0.00	995.00	995.00	WOC and		
Base of Salt @ 2441	2366.00	2727.00	361.00			
Shoe Plug	2366.00	2727.00	361.00	WOC and Tag	100 sxs	Perf and Squeeze
Delaware @ 2677	2366.00					
		TOC @ 4				
CIBP Plug	5561.00	5596.00		WOC and Tag	25 sxs	500psi leak test 30 min

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs
in cased hole.
Class H >7500'
Class C<7500'
Fluid used to mix the cement in R111P shall be saturated with the salts common to the section
penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will
be considered the desired mixture whenever possible.
Critical, High Cave Karst: Cave Karst depth to surface
R111P: Solid plug in all annuli - 50' from bottom of salt to surface.
Class C: 1.32 ft^3/sx

Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement	Medium	KARST DEPTH/TOS to s	urface ##	###
Shoe @ Shoe @ Shoe @	405.00 2605.00 13030.00		4020.00	
Perforatons Top @	6245.00	Perforations Bottom @	12980.00	

CIBP @ 5596.00

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours. Tagging the plug means running in the hole with a string of tubing or drill pipe and placing sufficient weight on the plug to ensure its integrity. Other methods of tagging the plug may be approved by the BLM authorized officer or BLM field representative.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Doris Lauger Martinez Environmental Protection Specialist 575-234-5926

Jaden Johnston Environmental Protection Asst. (Intern) 575-234-6252

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

COMMENTS

Operator: (OGRID:
COG PRODUCTION, LLC	217955
600 W. Illinois Ave	Action Number:
Midland, TX 79701	304872
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Created By		Comment Date
plmartinez	DATA ENTRY PM.	1/31/2024

Page 17 of 18

.

Action 304872

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

217955
Number:
304872
Туре:
[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
kfortner	Like approval from BLM	1/30/2024

.

CONDITIONS

Action 304872