Form 3160-5 (June 2015)

# **UNITED STATES** DEPARTMENT OF THE INTERIOR

Operator FORM APPROVED OMB No. 1004-0137 Expires: January 31, 2018

DEI	THE THE IT OF THE HATERON			Aprico. Juliadi y 51, 2010	
BUR	EAU OF LAND MANAGEMEN	T	5. Lease Serial No.	LC-029415-B	Andrews (1) (1) (1) (1) (1) (1) (1) (1) (1) (1)
Do not use this i	NOTICES AND REPORTS ON form for proposals to drill or Use Form 3160-3 (APD) for s	to re-enter an	6. If Indian, Allottee		and the second s
	TRIPLICATE - Other instructions on pa	7. If Unit of CA/Agreement, Name and/or No.			
1. Type of Well  ☐ Gas V		8. Well Name and N	No. PUCKETT B 001		
2. Name of Operator HUDSON OIL C	COMPANY OF TEXAS		9. API Well No. 35-	-015-05373	
3a. Address 616 TEXAS STREET FORT WORTH, TX 761	3b. Phone N	o. (include area code) 7109	10. Field and Pool o		
4. Location of Well <i>(Footage, Sec., T.,F</i> S24; T17S; R31E 660 FT. FRC	R.,M., or Survey Description) OM THE SOUTH AND 660 FT. FROM	THE WEST	11. Country or Paris EDDY, NEW ME		
12. CHE	CK THE APPROPRIATE BOX(ES) TO I	NDICATE NATURE OF NO	OTICE, REPORT OR OT	THER DATA	
TYPE OF SUBMISSION		TYPE OF A	CTION		
✓ Notice of Intent  Subsequent Report	Alter Casing Hy  Casing Repair Ne	draulic Fracturing Re	oduction (Start/Resume eclamation ecomplete	Water Shut-Off Well Integrity Other	
Final Abandonment Notice		- Incomment	emporarily Abandon ater Disposal		
the Bond under which the work will completion of the involved operation completed. Final Abandonment Not is ready for final inspection.)  1. MIRU well service rig and plus and plus and plus and WOC. Final POOH with tubing and WOC. Final POOH with tubing and WOC. Final POOH with the shoot sques are also and perforate 7" casing final perforate 7" and 8-6. Cut off well head and verify final perforate 7" and renework and perforate 7". Cut off anchors, Rip and renework and perforate 7".	Ily or recomplete horizontally, give subsur I be perfonned or provide the Bond No. or ons. If the operation results in a multiple of tices must be filed only after all requirement ugging equipment. Unload work string the tubing and tag CIBP. Test casing the RIH with tbg and tag cement @ 3,000' seeze holes @ 2,040'. Squeeze cement @ 800'. Squeeze cement across 10-1/4" casing @ 60'. Squeeze 50 sx cer cement to surface around both casing move caliche, contour to surrounding to Rip and remove caliche, contour to surrounding to Rip and R	n file with BLM/BIA. Requirement of the mines of the mines, including reclamation, he g. RIH with 7" Swage to possible of the mines of	ed subsequent reports manew interval, a Formave been completed and ossible collapsed cas with 9.5 ppg mud. Spational cement to bring WOC. RIH and tag SEE and dry hole market cation.	nust be filed within 30 day, 3160-4 must be filed once of the operator has detenning @ 329'. Swage out pot 65 sx cement on top top to 3,000'.  If cement, POOH, cement, POOH with turk ATTACHEL NDITIONS O	es following the testing has been the that the site the casing. The of CIBP.
4. I hereby certify that the foregoing is KAREN ZORNES	true and correct. Name (Printed/Typed)	REGULATORY C	ONSULTANT		
Signature anem Ja	mer	Date	10/15/	2019	
	THE SPACE FOR FEI	DERAL OR STATE C	FICE USE		
Conditions of approval, if any, are attachertify that the applicant holds legal or exhibit would entitle the applicant to conditions.	ned. Approval of this notice does not warraquitable title to those rights in the subject duct operations thereon.	Title SAL	ET	Date 11-3	-19

Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

# <u>Hudson Oil of Texas – P&A Procedure – 10/14/2019</u>

# Puckett "B" #1

API#: 35-015-05373

AFE#:

Field: Maljamar

Surf Location: Sec 24, T17S - R31E

660' FSL & 660' FWL

Latitude: 00.0000<sup>o</sup> N / Longitude: -00.0000<sup>o</sup> W

Eddy County, NM Spud Date: 1-21-41

#### **Directions to Location**

From Maljamar: West on Hwy 82 for 4 miles. Turn south into location.

Description	Size	Wght	Grade	ID	Drift	Burst	Collapse	Btm MD	TOC
Surface	10-3/4"	40		10.05"	9.89"			695'	
Production	7"	20		4.95"	4.825"			3,302'	2,845' Est
Tubing									

**KB:** 3,874' **GL:** 3,872' **PBTD:** 3,942' **TD:** 3,951'

Current Perfs: 3,302' - 3,942' Open Hole

Objective: P&A Well Bore in compliance with the rules and regulations for the state of New Mexico.

Proposed Perfs: None

#### Procedure

- 1. MIRU well service rig and plugging equipment. Unload work string. RIH with 7'' Swage to possible collapsed casing @ 329'. Swage out casing.
- 2. Set CIBP @ 3,250'. RIH with tubing and tag CIBP. Test casing to 500 psi. Displace well with 9.5 ppg mud. Spot 65 sx cement on top of CIBP. POOH with tubing and WOC. RIH with tbg and tag cement @ 3,000'. If necessary, pump additional cement to bring top to 3,000'.
- 3. POOH with tbg. Shoot squeeze holes @ 2,040'. Squeeze cement plug from 2,040' 1,650'. WOC. RIH and tag cement. POOH.

840 840 645

- 4. RIH and perforate 7" casing @ 800". Squeeze cement across 10-3/4" shoe from 800' 595'. WOC. RIH and tag cement. POOH with tubing.
- 5. RIH and perforate 7" and 8-1/4" casing @ 60'. Squeeze 50 sx cement to surface.
- 6. Cut off well head and verify cement to surface around both casing strings. Install below ground dry hole marker.
- 7. Cut off anchors, Rip and remove caliche, contour to surrounding topography. and reseed location.

THIS PROCEDURE HAS BEEN PROPOSED IN CONSIDERATION OF AND WITH RESPECT GIVEN TO THE MANY VARIABLES AND POTENTIAL PROBLEMS THAT MAY BE ENCOUNTERED IN THIS WELL IN THIS GEOGRAPHICAL AREA. THEREFORE, THIS PROCEDURE IS TO SERVE AS A GENERAL GUIDELINE AND WILL BE REVIEWED AND MODIFIED WHEN REQUIRED AS DETERMINED BY ACTUAL WELLBORE CONDITIONS ENCOUNTERED IN THE OPERATIONS. SAFETY AND PRUDENT PRACTICES WILL TAKE PRIORITY AT ALL TIMES.

Notify Blm Prior to any Changes to Approval

Prior to rig up of any operations and prior to the actual operations, always hold safety meeting to discuss any potential hazards, accurately record names of all personnel on location, pick meeting place, discuss evacuation plans, designate hospital of choice and have coordinates and phone numbers for care flight operations if necessary. Completely discuss the operation and/or rig-up so that all personnel understand the plan, responsibilities and any potential changes that may take place during the rig up or operation

Prepared By:

Greg Milner

Date: 10-14-19

Petroleum Engineer

Anhy @ 660' Top of Salt @ 860' Base of Salt @ 1,762" Yates @ 1,990' Queen @ 2,850' Grayburg @ 3,240' San Andres @ 3,640'

Operator:

Hudson Oil Company of Texas

Well Name:

Puckett "B" #1

Field: County/State:

Maljamar-GB-SA

API Number

Eddy County, New Mexico 30-015-05373

Location:

Lease Number LC-029415-B

Sec 24 - T17S - R31E 660' FSL & 660' FWL

DRILLING DETAILS									
Spud Date:	1-21-41	KB [ft]:	3,874'						
TD:	3,951	GL [ft]:	3,872'						
PBTD	3,942	KB-GL:	2						
WELLHEAD AND TREE DETAILS									
		The second secon	THE RESERVE OF THE PERSON NAMED IN COLUMN TWO IS NOT THE OWNER, THE PERSON NAMED IN COLUMN TWO IS NOT THE OWNER.						

Size & Rating A Section:

B Section: Tree:

		CMTING	DETAILS				
Hole	Size	Wght	Grde	TOL	Depth	Vol	TOC [ft],
	10-3/4"	40			695	75 sx 🖊	
10"	7"	20 🖊			3,302' -	150 sx /	2,845' Est

9-16-91 - Hit possible collapsed casing @ 329'. No tubing in hole.

10-3/4" @ 695'

Downhole Item 3/28/1979	Length	Depth
KB Correction	2.00	2.00
Lay down tubing		2.00
		2.00
		2.00
		2.00

ASSISTANT	Downhole Item	3/28/1979	Length	Depth Set
	Lay down rods			0.00
				0.00
				0.00
				0.00

TOC @ 2,845' Est


PERFORATION DETAILS										
Zone Gross Interval Net Pay Shots IP Date P&A'd										
Grayburg /San Andress	Grayburg /San Andress 3,302' - 3,942' 640' Open hole									

TREATMENT DETAILS									
Interval	Interval [bbls] Type Sd [lbs] ISIP ATR ATP								
3,302' - 3,803'	238	Oil	9,000		16 Bpm	3,400#			

7" @ 3,302'

PBTD @ 3,942' TD@3,951'

Date:	5/21/2019
Ву:	Greg Milner

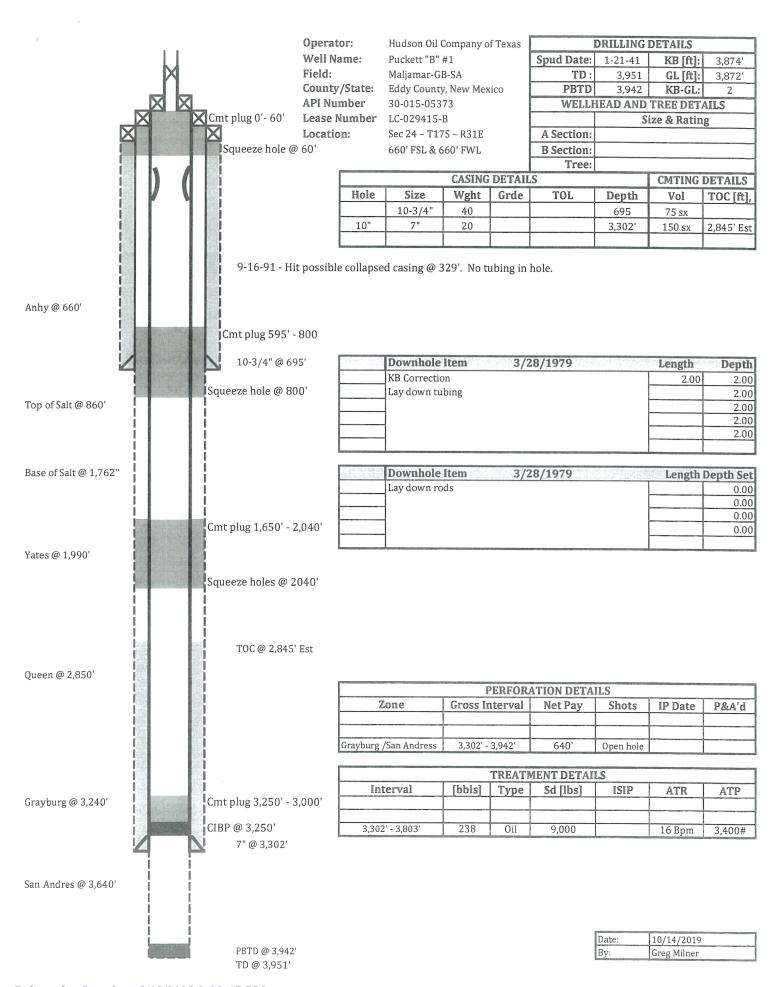

#### BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

### Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/Condition of Approval for Lesser Prairie-Chicken: From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted

## <u>Hudson Oil of Texas – P&A Procedure – 10/14/2019</u>

# Puckett "B" #1

API #: 35-015-05373

AFE#:

Field: Maljamar

Surf Location: Sec 24, T17S – R31E

660' FSL & 660' FWL

Latitude: 00.0000<sup>0</sup> N / Longitude: -00.0000<sup>0</sup> W

Eddy County, NM Spud Date: 1-21-41

#### **Directions to Location**

From Maljamar: West on Hwy 82 for 4 miles. Turn south into location.

Description	Size	Wght	Grade	ID	Drift	Burst	Collapse	Btm MD	TOC
Surface	10-3/4"	40		10.05"	9.89"			695'	
Production	7"	20		4.95"	4.825"			3,302'	2,845' Est
Tubing									

**KB:** 3,874' **GL:** 3,872' **PBTD:** 3,942' **TD:** 3,951'

**Current Perfs:** 3,302' – 3,942' Open Hole

**Objective:** P&A Well Bore in compliance with the rules and regulations for the state of New Mexico.

Proposed Perfs: None

#### **Procedure**

- 1. MIRU well service rig and plugging equipment. Unload work string. RIH with 7" Swage to possible collapsed casing @ 329'. Swage out casing.
- 2. Set CIBP @ 3,250'. RIH with tubing and tag CIBP. Test casing to 500 psi. Displace well with 9.5 ppg mud. Spot 65 sx cement on top of CIBP. POOH with tubing and WOC. RIH with tbg and tag cement @ 3,000'. If necessary, pump additional cement to bring top to 3,000'.
- 3. POOH with tbg. Shoot squeeze holes @ 2,040'. Squeeze cement plug from 2,040' 1,650'. WOC. RIH and tag cement. POOH.

Page 1 of 2


- 4. RIH and perforate 7" casing @ 800'. Squeeze cement across 10-3/4" shoe from 800' 595'. WOC. RIH and tag cement. POOH with tubing.
- 5. RIH and perforate 7" and 8-1/4" casing @ 60'. Squeeze 50 sx cement to surface.
- 6. Cut off well head and verify cement to surface around both casing strings. Install below ground dry hole marker.
- 7. Cut off anchors, Rip and remove caliche, contour to surrounding topography, and reseed location.

THIS PROCEDURE HAS BEEN PROPOSED IN CONSIDERATION OF AND WITH RESPECT GIVEN TO THE MANY VARIABLES AND POTENTIAL PROBLEMS THAT MAY BE ENCOUNTERED IN THIS WELL IN THIS GEOGRAPHICAL AREA. THEREFORE, THIS PROCEDURE IS TO SERVE AS A GENERAL GUIDELINE AND WILL BE REVIEWED AND MODIFIED WHEN REQUIRED AS DETERMINED BY ACTUAL WELLBORE CONDITIONS ENCOUNTERED IN THE OPERATIONS. SAFETY AND PRUDENT PRACTICES WILL TAKE PRIORITY AT ALL TIMES.

Prior to rig up of any operations and prior to the actual operations, always hold safety meeting to discuss any potential hazards, accurately record names of all personnel on location, pick meeting place, discuss evacuation plans, designate hospital of choice and have coordinates and phone numbers for care flight operations if necessary. Completely discuss the operation and/or rig-up so that all personnel understand the plan, responsibilities and any potential changes that may take place during the rig up or operation

Prepared By: Greg Milner Date: 10-14-19

Petroleum Engineer

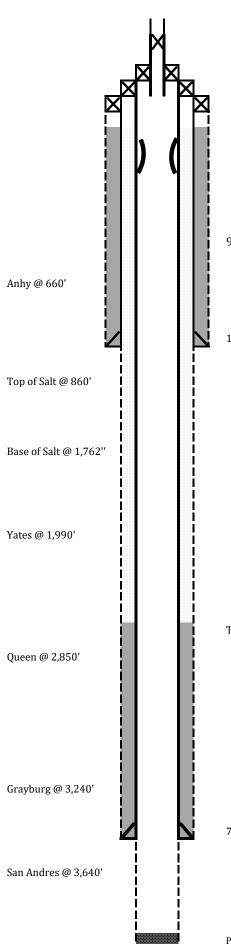

**Operator: Hudson Oil Company of Texas** 

30-015-05373

Well Name: Puckett "B" #1 Field: Maljamar-GB-SA County/State: Eddy County, New Mexico

**API Number** 

**Lease Number** LC-029415-B **Location:** 

Sec 24 - T17S - R31E 660' FSL & 660' FWL

DRILLING DETAILS									
<b>Spud Date:</b> 1-21-41 <b>KB [ft]:</b> 3,874'									
TD:	3,951	GL [ft]:	3,872'						
PBTD	3,942	KB-GL:	2						
WELLH	IEAD AND	TREE DETA	AILS						
	S	ize & Ratin	g						
A Section:									
R Section:									

				Tree:			
		CASING	DETAIL	.S		CMTING	DETAILS
Hole	Size	Wght	Grde	TOL	Depth	Vol	TOC [ft],
	10-3/4"	40			695	75 sx	
10"	7"	20			3,302'	150 sx	2,845' Est

9-16-91 - Hit possible collapsed casing @ 329'. No tubing in hole.

10-3/4" @ 695'

Downhole Item	3/28/1979	Length	Depth
KB Correction		2.00	2.00
Lay down tubing			2.00
			2.00
			2.00
			2.00

Downhole Item	3/28/1979	Length Depth S	et
Lay down rods		0.0	00
		0.0	00
		0.0	00
		0.0	00

TOC @ 2,845' Est


PERFORATION DETAILS						
Zone	<b>Gross Interval</b>	Net Pay	Shots	IP Date	P&A'd	
Grayburg /San Andress	3,302' - 3,942'	640'	Open hole			

TREATMENT DETAILS						
Interval [bbls] Type Sd [lbs] ISIP ATR ATI						ATP
3,302' - 3,803'	238	Oil	9,000		16 Bpm	3,400#

7"@3,302'

PBTD @ 3,942' TD @ 3,951'

Date:	5/21/2019
By:	Greg Milner

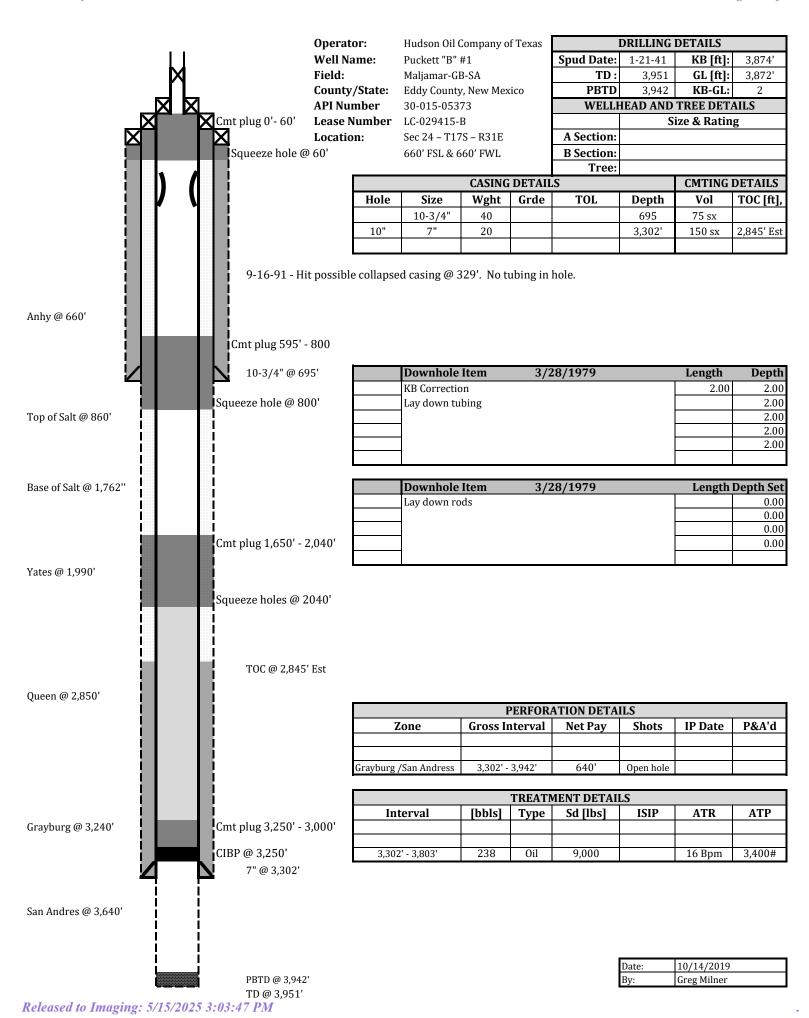

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory <a href="https://www.emnrd.nm.gov/ocd/contact-us">https://www.emnrd.nm.gov/ocd/contact-us</a>

# State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 420140

#### **CONDITIONS**

Operator:	OGRID:
HUDSON OIL COMPANY OF TEXAS	25111
616 Texas Street	Action Number:
Fort Worth, TX 76102	420140
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

(	Created By	Condition	Condition Date
	gcordero	• This well was plugged without prior approval or notification to OCD.	5/15/2025