st-1999)

UNITED STATES.M. OIL CONS. DIV-DISt. 2 DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT W. Grand Avenue

FORM APPROVED OMB NO. 1004-0136 Expires: November 30, 2000

APPLICATION FOR PERMIT TO DRII	Artesia NM 8821	10 3	Lease Serial No. LC-056302-B	
la. Type of Work X DRILL REEN	TER	6.	. If Indian, Allotee o	Tribe Name
1b. Type of Well Oil Well Gas Well Other	X Single Zone Multiple Zon	ne 7.	. Unit or CA Agreen	nent Name and No.
2. Name of Operator OXY USA WTP Limited Partnership 3a. Address P.O. Box 50250 Midland, TX 79710-0250	192463 349 3b. Phone No. (include area of 432-685-5717	48	OXY Bounder i API Well No. 30-015-	
4. Location of Well (Report location clearly and in accordance with any SAt surface 880 FSL 1980 FEL SWSE(0) At proposed prod. zone	State equirements)* RECEIVED JUL 2.8. 2001	11.	Field and Pool, or E Undsg. Fren M	xploratory
14. Distance in miles and direction from nearest town or post office*	OCD-ASTEO	"	Sec 33 T16S County or Parish	R31E 13.State
6 miles northeast from L	oco Hills. NM	<u> </u> Ed	dy	<u>l nm</u>
15. Distance from proposed* location to nearest property or lease line, ft. (Also to nearest drg. unit line, if any)	16. No. of Acres in lease	17.Spacin	ng Unit dedicated to	this well
18. Distance from proposed location* to nearest well, drilling, completed, applied for, on this lease ft	19. Proposed Depth	20. BLM/	BIA Bond No. on fi	ile
N/A	12400'	<u> </u>	619469	0
21. Elevations (Show whether DF, KDB, RT, GL, etc. 3962	22. Approximate date work will star 9/1/05	rt*	23. Estimated dura	tion days
	24. Attachments Keswell (Controll	od Water Reek	
 Well plat certified by a registered surveyor. A Drilling Plan A Surface Use Plan (if the location is on National Forest System Lands, SUPO shall be filed with the appropriate Forest Service Office). 	Oil and Gas Order No. 1, shall be attache 4. Bond to cover the operation ltem 20 above)	d to this for	rm: covered by an existing	ng bond on file (see
25. Signuature	Name (Printed/Typed)		Date	
Vi ST	David Stewart		6/14/05	
Sr. Regulatory Analyst				
Approved by (Signautre) /s/ Joe G. Lara	Name (Printed/Typed) /s/ Joe G. L	ara	Date	JUL 2 6 2005
FIELD MANAGER	Office CARLSBAD	FIEL		
Application approval does not warrant or certify that the applicant holds leg	gal or equitable title to those rights in the	e subject l	case which would e	ntitle the applicant to
conduct operations thereon. Conditions of approval, if any, are attached.	APPROVA			_
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a United States any false, fictitious or fraudulent statements or representations	crime for any person knowlingly and was to any matter within its jurisdiction.	rilifully to	make to any departs	nent or agency of the

*(Instructions on Reverse)

WITNESS: 13 3/8" COMENT JOB

APPROVAL SUBJECT TO GENERAL REQUIREMENTS AND SPECIAL STIPULATIONS ATTACHED

OXY Bounder Federal #1 880 FSL 1980 FEL SWSE(O) SEC 33 T16S R31E Eddy County, NM Federal Lease No. LC-056302B

PROPOSED TD:

12400' TVD

BOP PROGRAM:

0-625

None

625-45001

13-3/8" 3M annular preventer, to be used as

divertor only.

4500-12400%

11" 5M. blind pipe rams with 5M

preventer and rotating head below 8500'.

CASING:

Surface:

..13-3/8" OD 48# H40 ST&C new casing set at 625'

17-1/2" hole

Intermediate: 9-5/8" OD 36# K55/HCK55 ST&C new casing from 0-4500'

12-1/4" hole

Production:

5-1/2" OD 17# N80-HP110 LT&C new casing from 0-12400'

8-3/4" hole 8750'-N80 3650'-HP110

CEMENT:

Surface - Circulate cement with 350sx HES light PP $\rm w/$ 2% $\rm CaCl_2$ + .25#/sx Flocele followed by 250sx PP w/ 2% CaCl₂ + .25#/sx Flocele.

Intermediate - Circulate cement with 1100sx IFC w/ .25#/sx Flocele followed by 200sx PP w/ 2% CaCl2.

Production - Cement with 600sx Interfill H w/ .1% HR-7 followed by 400sx Super H w/ .5% HR-344 + .4% CFR-3 + 5#/sx Gilsonite + 1#/sx salt + .2% HR-7. Estimated top of cement is 7500'.

Note: Cement volumes may need to be adjusted to hole caliper.

MUD:

DM 4 5 IUL

0-625'

Fresh water/native mud. Lime for pH control

(9-10). Paper for seepage. Wt 8.7-9.2 ppg, Vis 32-34 sec

625-45001

Fresh/*Brine water. Lime for pH control (10.0-

10.5). Paper for seepage.

Wt 8.3-9.0/10.0-10.1ppg, Vis 28-29 sec

*Fresh water will be used unless, chlorides in

the mud system increases to 20000PPM.

4500-8700'

Fresh water. Lime for pH control(9-9.5). Paper

for seepage.

Wt 8.3-8.5 ppg, Vis 28-29 sec

8700~10000

Cut brine. Lime for pH control (10-10.5).

Wt 9.6-10.0 ppg, Vis 28-29sec

10000-12400

Mud up with an Duo Vis/Flo Trol mud system.

Wt 9.6-10.0ppg, Vis 32-36sec, WL<10cc

* - - - - - - PARTO TI MACON DUNDA GENERO PONDE

64:6 HA 91 NOT 9002

BECEIVED

n Dr., Hobbs, NM 88240

State of New Mexico Energy Minerals and Natural Resources

Form C-144 March 12, 2004

and Avenue, Artesia, NM 88210
Brazos Road, Aztec, NM 87410
V
St. Francis Dr., Santa Fe, NM 87505

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505 For drilling and production facilities, submit to appropriate NMOCD District Office.
For downstream facilities, submit to Santa Fe office

Pit	or	Below	-Grade	Tank	Registra	ation or	· Closure
_							

Is pit or below-grade tan Type of action: Registration of a pit of	ak covered by a "general plan"? Yes I I or below-grade tank Closure of a pit or below-	No ⊠ grade tank □
Operator: _Oxy U.S.A. W.T.P. Limited PartnershipTelephone: _432. Address: _P.O. Box 50250 Midland, TX 79710		
Facility or well name: Oxy Bounder Fed #1API #:	U/L or Qtr/Qtr SWSE Sec 33 T	16S R 31E
County:EddyLatitude_32°52'23.34"N Longitude_103°5		_
Pit	Below-grade tank	
Type: Drilling ☑ Production ☐ Disposal ☐	Volume:bbl Type of fluid:	
Workover Emergency	Construction material:	
Lined Unlined	Double-walled, with leak detection? Yes [If	not, explain why not.
Liner type: Synthetic ☑ Thickness _12mil Clay ☐ Volume		
_11,000bbi		
Depth to ground water (vertical distance from bottom of pit to seasonal high	Less than 50 feet	(20 points)
water elevation of ground water.)	50 feet or more, but less than 100 feet	(10 points)
	100 feet or more	(0 points) 0
Wellhead protection area: (Less than 200 feet from a private domestic	Yes	(20 points)
water source, or less than 1000 feet from all other water sources.)	No	0 points) 0
Distance 6.	Less than 200 feet	(20 points)
Distance to surface water: (horizontal distance to all wetlands, playas,	200 feet or more, but less than 1000 feet	(10 points)
irrigation canals, ditches, and perennial and ephemeral watercourses.)	1000 feet or more	(0 points) 0
	Ranking Score (Total Points)	0
If this is a pit closure: (1) attach a diagram of the facility showing the pit's	relationship to other equipment and tanks. (2) Ind	licate disposal location:
onsite offsite from If offsite, name of facility		
date. (4) Groundwater encountered: No Tyes If yes, show depth belo		
diagram of sample locations and excavations.		ipie results. (3) Attach son sample results and a
1 hereby certify that the information above is true and complete to the best of a been/will be constructed or closed according to NMOCD guidelines , a Date:June 14, 2005	general permit , or an (attached) alternative	OCD-approved plan .
Printed Name/Title _Fred Ray / Drilling Specialist	Signature Signature	nedkay
Your certification and NMOCD approval of this application/closure does not a otherwise endanger public health or the environment. Nor does it relieve the oregulations.	relieve the operator of liability should the contents	of the nit or tank contaminate around unter or
Approval: JUL 28 2005 d Supervisor		
Printed Name/Title	Signature	

CONDITIONS OF APPROVAL - DRILLING

Operator's Name:

OXY USA WTP LIMITED PARTNERSHIP

Well Name & No.

1 – OXY BOUNDER FEDERAL

Location: Lease:

800' FSL & 1980' FEL - SEC 33 - T16S - R31E - EDDY COUNTY

LC-056302B

I. DRILLING OPERATIONS REQUIREMENTS:

1. The Bureau of Land Management (BLM) is to be notified at the Roswell Field Office, 2909 West Second St., Roswell NM 88201, (505) 627-0272 for wells in Chaves and Roosevelt Counties; the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (505) 234-5909 or (505) 361-2822 (After hours) - for wells in Eddy County; and the Hobbs Field Station, 414 West Taylor, Hobbs NM 88240, (505) 393-3612 for wells in Lea County, in sufficient time for a representative to witness:

A. Spudding

B. Cementing casing: 13-3/8 inch _9-5/8 inch _5-1/2 inch

C. BOP tests

- 2. A Hydrogen Sulfide (H2S) Drilling Plan will be in effect although no H2S has been reported in Sec 33, T16S, R31E. Hydrogen Sulfide (H2S) has however been reported in Sec 25, T16S, R33E from the Grayburg Jackson Pool at approximately 2000 feet. A copy of the plan will be posted at the drilling site.
- 3 Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
- 4. Submit a Sundry Notice (Form 3160-5, one original and five copies) for each casing string, describing the casing and cementing operations. Include pertinent information such as; spud date, hole size, casing (size, weight, grade and thread type), cement (type, quantity and top), water zones and problems or hazards encountered. The Sundry shall be submitted within 15 days of completion of each casing string. The reports may be combined into the same Sundry if they fall within the same 15 day time frame.
- 5. The API No. assigned to the well by NMOCD shall be included on the subsequent report of setting the first casing string.

II. CASING:

- 1. The 13-3/8 inch surface casing shall be set at 625 feet, below usable water and cement circulated to the surface. If cement does not circulate to the surface the appropriate BLM office shall be notified and a temperature survey or cement bond log shall be run to verify the top of the cement. Remedial cementing shall be completed prior to drilling out that string.
- 2. The minimum required fill of cement behind the 9-5/8 inch salt protection casing is circulate cement to the surface.
- 3. The minimum required fill of cement behind the 5-1/2 inch production casing is cement shall extend upward a minimum of 500 feet above the uppermost hydrocarbon bearing interval.

III. PRESSURE CONTROL:

- 1. All BOP systems and related equipment shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2. The BOP and related equipment shall be installed and operational before drilling below the 13-3/8 inch casing shoe and shall be tested as described in Onshore Order No. 2. Any equipment failing to test satisfactorily shall be repaired or replaced.
- 2. Minimum working pressure of the blowout preventer and related equipment (BOPE) required for drilling the surface and intermediate casing shall be <u>2000</u> psi. Minimum working pressure of the blowout preventer and related equipment (BOPE) required for drilling below the <u>9-5/8</u> inch casing shall be <u>5000</u> psi.
- 3. The appropriate BLM office shall be notified in sufficient time for a representative to witness the tests.

- The tests shall be done by an independent service company.

- The results of the test shall be reported to the appropriate BLM office.

- Testing fluid must be water or an appropriate clear liquid suitable for sub-freezing temperatures. Use of drilling mud for testing is not permitted since it can mask small leaks.

- Testing must be done in a safe workman-like manner. Hard line connections shall be required.

- BOPE must be tested prior to drilling into the <u>Wolfcamp</u> Formation by an independent service company.

IV. DRILLING MUD:

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the <u>Wolfcamp</u> Formation, and shall be used until production casing is run and cemented. Monitoring equipment shall consist of the following:

1. Recording pit level indicator to indicate volume gains and losses.

2. Mud measuring device for accurately determining the mud volumes necessary to fill the hole during trips.

3. Flow-sensor on the flow line to warn of abnormal mud returns from the well.

TRICT I SES N. FERNCE DR., BOSHS, NK 86240

State of New Mexico

Energy, Minerals and Natural Resources Department

DISTRICT II

OIL CONSERVATION DIVISION 1220 SOUTH ST. FRANCIS DR. Santa Fe, New Mexico 87505

Form C-10 Revised JUNE 10, 200 Submit to Appropriate District Office State Lease - 4 Copie Pee Lease - 3 Copie

3962

DISTRICT III

192463

1000 Rio Brazos Rd., Axtec. NM 87410

DISTRICT IV WELL LOCATION AND ACREAGE DEDICATION PLAT 1220 S. ST. FRANCIS DR., SANTA FE, KM 87505 AMENDED REPORT API Number Pool Code Pool Name 30-015-96663 Undesignated Fren Morrow Property Code Property Name Well Number **OXY BOUNDER FEDERAL** 1 OGRID No. Operator Name Elevation

OXY U.S.A. W.T.P., LP Surface Location

UL or lot No.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
0	33	16-S	31 ~ E		880	SOUTH	1980	EAST	EDDY


Bottom Hole Location If Different From Surface


						Hene From Sur	IACE		
UL ar lot Na.	Section	Township	Range	iot idn	Feet from the	North/South line	Feet from the	East/West line	County
Dedicated Acres	Joint o	r Infill Co	nsolidation	Code Or	der No.	<u> </u>		<u> </u>	
320	N			ĺ					
210 1770									

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDAD

ON A NON-STANDARD UNIT HAS BEEN APPROVED BY T	HE DIVISION
WAR DIAMPARED UNIT HAS BEEN APPROVED BY T	OPERATOR CERTIFICATION I hereby certify the the information contained herein is true and complete to the best of my knowledge and belief. Signature David Stewart Printed Name Sr. Regulatory Analyst Title (((())) Date
GEODETIC COORDINATES NAD 27 NME Y=681672.6 N X=641616.3 E LAT.=32*52*23. 4" N LONG.=103*52*19. 48" W 3959.1' 3968.9' 600' 3958.9*V 3968.2' • (2) 600 (1)	SURVEYOR CERTIFICATION I hereby certify that the well location shown on this plat was plotted from field notes of actual surveys made by me or under my supervison and that the same is true and correct to the best of my belief. MAY 31, 2005 Date Surveysed LA Signature & Seat all 5 Professional Surveyor ME Q5_17.0790 Certificate-No. GARY-EMSOR 12841

- (1) 30-015-04974 CBS Operating Corp. North Square Lake Unit #168 Square Lake GBSA 330 FSL 2310 FEL TD-3597'
- (2) 30-015-05027 Pre-Ongard Johnson B #14 Dry Hole -510 FSL 2130 FEL - TD-3798'

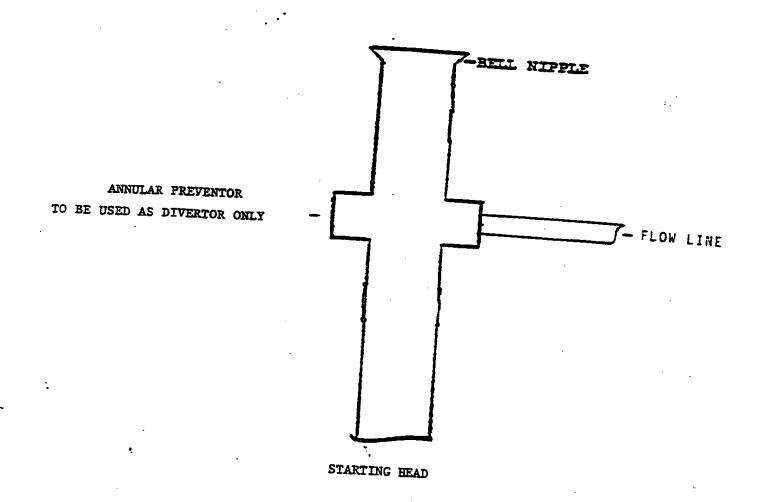

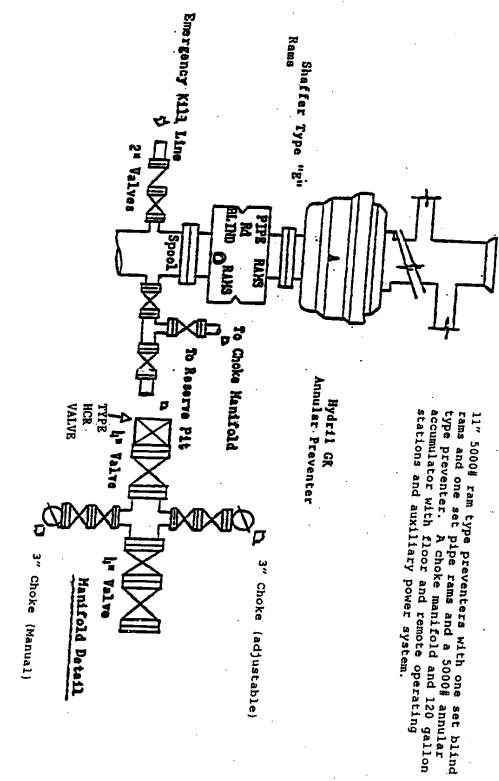

Choke Manifold

MULTI-POINT SURFACE USE AND OPERATIONS PLAN

OXY USA WTP Limited Partnership OXY Bounder Federal #1 Eddy County, New Mexico Lease No. LC-056302-B

This plan is submitted with the Application for Permit to Drill the above described well. The purpose of the plan is to identify the location of the proposed well, the proposed construction activities and operations plan, the magnitude of necessary surface disturbance involved and the procedures to be followed in rehabilitating the surface after completion of the operation so that a complete appraisal may be made of the environmental effects associated with the operation.

The well, and work area have been staked by a registered New Mexico land surveyor. Boone Archaeological Services, LLC has been engaged to make an archaeological reconnaissance of the work area. Their findings concerning cultural resources will be reported to the Bureau of Land Management.

1. Existing Roads

A copy of a USGS "Maljamar NE, New Mexico" quadrangle map is attached showing the proposed location. The well location is spotted on this map, which also shows the existing road system. Exhibit B.

Directions to location:

From the intersection of CR 220 amd CR 252, go east on CR 252 approximately 3.1 miles. Turn right and go south-southeast approx. 0.7 miles. Turn left at capped well and intersection and continue east-southeast approx. 0.2 miles. Location is approximately 270, to the east.

2. Planned Access Road

- A. A new access road will be built. The access road will run approximately 66' northeast from an existing road to the location. Exhibit B.
- B. Surfacing material: Six inches of caliche and water, compacted and graded.
- C. Maximum Grade: Less than 3%
- D. Turnouts: None needed
- E. Drainage Design: N/A
- F. Culverts: None needed
- G. Cuts and Fills: Leveling the location will require minimal cuts or fills.
- H. Gates or Cattleguards: None required
- Existing wells within a one mile radius of the proposed development well are shown on Exhibit C.

Multi-Point Surface Use and Operations Plan OXY Bounder Federal #1 Page 4

- H. The well site, if a producer, will be maintained and kept clean of all trash and litter which detracts from the surrounding environment. Equipment will be maintained in accordance with good operating practice.
- I. After the wellsite is cleaned and pits and sumps backfilled, any obstruction to the natural drainage will be corrected by ditching or terracing. All disturbed areas, including any access road no longer needed, will be ripped. Those areas will be reseeded with grass if, in the opinion of the land owner, it is required.

13. Operator's Representatives and Certification

The field representative responsible for assuring compliance with the approved surface use and operations plan are as follows:

John Erickson Production Coordinator P.O. Box 69 Hobbs, New Mexico 88240 Office Phone: 505-393-2174 Cellular: 505-390-6426

Calvin C. (Dusty) Weaver Operation Specialist P.O. Box 2000 Levelland, TX 79336 Office Phone: 806-229-9467 Cellular: 806-893-3067 Joe Fleming Drilling Coordinator P.O. Box 50250 Midland, TX 79710-0250 Office Phone: 915-685-5858

Terry Asel
Operation Specialist
1017 W. Stanolind Rd.
Hobbs, NM 88240
Office Phone: 505-397-8217
Cellular: 505-631-0393


I hereby certify that I, or persons under my direct supervision, have inspected the proposed drill site and access route; that I am familiar with the conditions which presently exist; that the statements made in this plan are, to the best of my knowledge, true and correct; and, that the work associated with the operations proposed herein will be performed by OXY USA WTP Limited Partnership and its contractors and sub-contractors in conformity with this plan and the terms and conditions under which it is approved.

Scott Gengler Engineering Advisor

432-685-5825

South Permian Asset Team

OXY USA WTP Limited Partnership

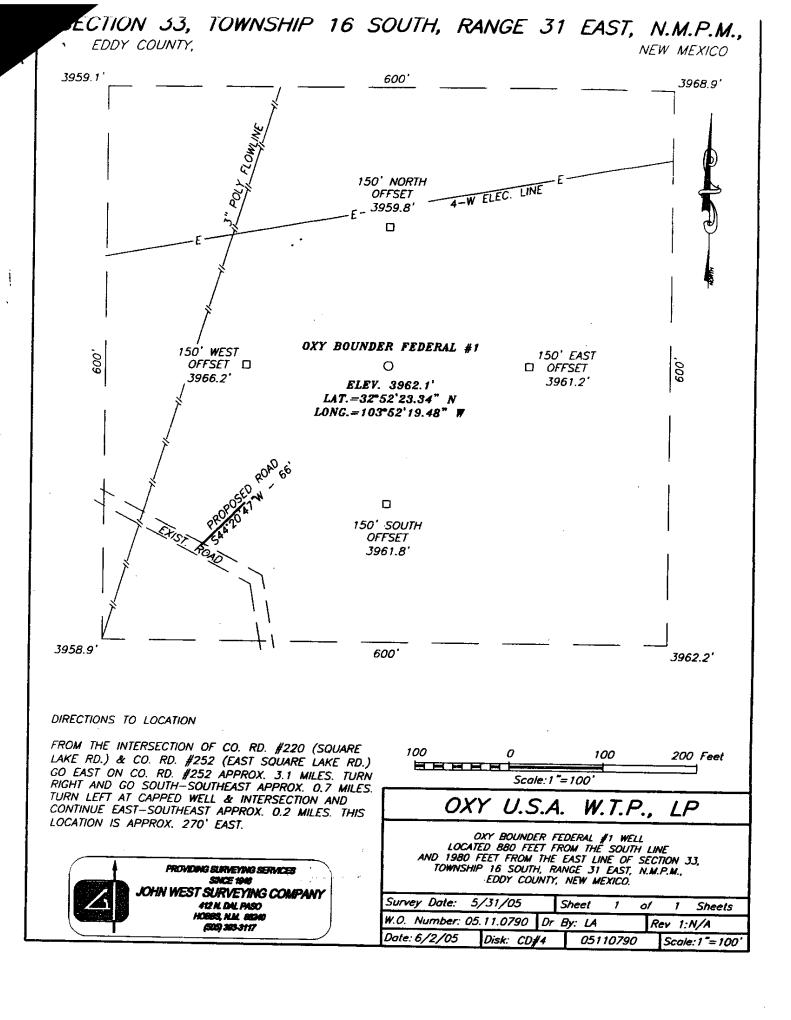

OXY USA WTP Limited Partnership PO Box 50250 Midland, TX 79710

Hydrogen Sulfide (H₂S) Contingency Plan

For

Oxy Bounder Fed. No. 1 880 ft FSL, 1980 ft FEL Sec 33, T16S, R31E Eddy County, NM

And

Patterson / UTI Rig No. 503

TABLE OF CONTENTS

<u>ITEM</u>	P.A	\GE
PREFACE		
LOCATION MAP	-	-
RIG SKETCH	_	
EMERGENCY RESPONSE ACTIVATION AND GENERAL RESPONSIBILITIES	. 6	
SPECIFIC EMERGENCY GUIDANCE - H2S Release Well Control	_	
PUBLIC RELATIONS		
PHONE CONTACTS OP DOWNHOLE SERVICES GROUP		
EMERGENCY PERSONELL NOTIFICATION NUMBERS		
PHONE CONTACTS - OP PRODUCTION AND PLANT PERSONNEL		
PHONE CONTACTS - OP HES PERSONNEL	16	

PREFACE

An effective and viable Contingency Plan is intended to provide prior planning and guidance in responding to emergency incidents. The primary considerations in its development are protection of personnel, the public, company and public property, and the environment.

Although the plan addresses varied emergency situations which may occur, it recognizes that flexibility and the use of the organization's knowledge and experience is critical to safe resolution of emergency incidents. Response actions outlined in the plan provide a framework, which may be placed into operation without confusion. These actions should promote quick and decisive actions during the critical initial period and immediately following an emergency. As the response progresses, additional guidelines and procedures may need to be implemented as the situation dictates. In addition, all emergency incidents must be properly reported per the Oxy Incident Reporting and Notification Policy, state and federal requirements, etc.


This Contingency Plan is intended for use on Oxy Downhole Services Group projects and the operations within their area of responsibility, such as drilling, critical well work, etc.

A copy of the Plan shall be maintained in the Top Dog House, Rig Managers trailer, and Company Representative's trailer if applicable.


Oxy Bounder Fed No. 1 Y = 681672.6 N X = 641616.3 E Lat. 32°52'23.34N Long. 103°52'19.48" W



NORTH

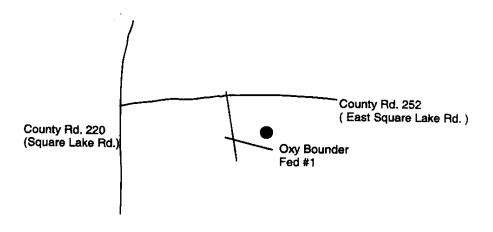

From the intersection of County Rd. 220 (Square Lake Rd.) and County Rd. 252 (East Square Lake Rd.) go east on County Rd. 252 for approximately 3.1 miles. Turn right (South / Southeast) approx 0.7 miles. Turn left at capped well and intersection and continue east / southeast approx 0.2 miles . The location is 270' east.

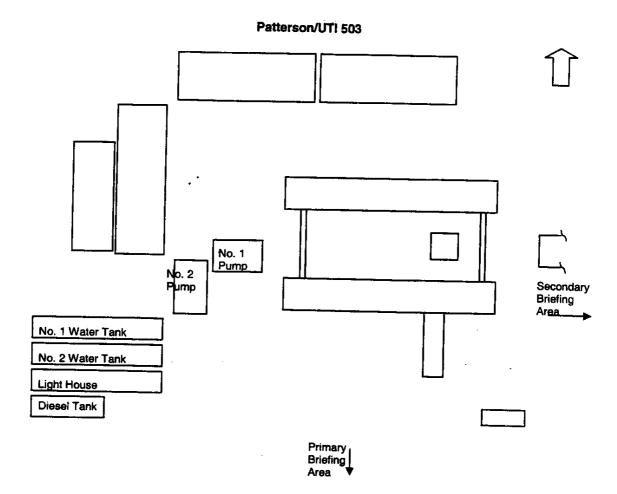

EMERGENCY RESPONSE ACTIVATION AND GENERAL RESPONSIBILITIES

Activation of the Emergency Action Plan

- A. In the event of any emergency situation, all personnel on location should first ensure that the following items are initiated. After that, they should refer to the appropriate Specific Emergency Guidance sections on pages ten (10) through twelve (12) in this document for further responsibilities:
 - 1. Notify the senior ranking contract representative on site.

2. Notify Oxy representative in charge.

- 3. Notify civil authorities if the Oxy Representative can not be contacted and the situation dictates.
- 4. Perform rescue and first aid as required (without jeopardizing additional personnel).

General Responsibilities

Oxy Permian Personnel:

- A. Operations Specialist: The Oxy Drilling/Critical Well Servicing Operations Specialist or contract personnel serving in that capacity will serve as Operations Chief Officer for all emergency incidents. The Operations Chief Officer is responsible for:
 - Notification to the Downhole Services Team Leader of the incident occurrence.
 - 2. Notification to the local RMT/PMT leader of the incident occurrence, and the need for the designated local RMT/PMT Incident Commander to act in that capacity for the response effort.
 - Sole control of all tactical activities directed toward reducing the immediate hazard, establishing situational control and restoring the operations to a non-emergency state.
- B. Local RMT/PMT Designated Incident Commander: The Oxy local RMT/PMT Designated Incident Commander will serve as the overall Incident Commander for the drilling or critical well servicing emergency incident. The Incident Commander is responsible for:
 - Coordinating with the Downhole Services Team Leader for notification to the Oxy Crisis Management team of the incident occurrence.
 - Establishing and managing the overall incident command structure and response from inception through restoration of normal activities in the area.
- C. Downhole Services HES Tech: The Downhole Services HES Tech (or his designate) is responsible for reporting to the incident as soon as reasonably possible, to provide support to the response effort as required by the Operations Chief Officer or the Incident Commander.

Contract Drilling Personnel will immediately report to their assigned stations and perform their duties as outlined in the appropriate Specific Emergency Guidance sections on pages ten (10) through twelve (12) in this document.

Other Contractor Personnel will report to the safe briefing area to assist Oxy personnel and civil authorities as requested when it is safe to do so and if they have been adequately trained in their assigned duties.

Civil Authorities (Law Enforcement, Fire, and EMS) will be responsible for:

- 1. Establishing-membership in the Unified Incident Command.
- 2. As directed by the Incident Commander and the Unified Command, control site access, re-route traffic, and provide escort services for response personnel.
- 3. Perform all fire control activities in coordination with the Unified Command.
- 4. Initiate public evacuation plans as instructed by the Incident Commander.
- 5. Perform rescue or recovery activities with coordination from the Unified Command.
- 6. Provide medical assistance as dictated by the situation at hand.

H2S RELEASE

The following procedures and responsibilities will be implemented on activation of the H2S siren and lights.

All Personnel:

1. On alarm, don escape unit (if available) and report to upwind briefing area.

Rig Manager/Tool Pusher:

- 1. Check that all personnel are accounted for and their condition.
- 2. Administer or arrange for first aid treatment, and /or call EMTs as needed.
- 3. Identify two people best suited to secure well and perform rescue, and instruct them to don SCBA.
- 4. Notify Contractor management and Oxy Representative.
- 5. Remain at the briefing area, assess and monitor personnel and overall situation for hazards or conditions that might warrant a change in the action plan.

Two People Responsible For Shut-in and Rescue:

- Don SCBA and acquire tools to secure well and perform rescue, i.e., wrenches, retrieval ropes, etc.
- 2. Utilize the buddy system to secure well and perform rescue(s).
- 3. Return to the briefing area and stand by for further instructions.

All Other Personnel:

 Isolate the area and prevent entry by other persons into the 100 ppm ROE. Additionally the first responder(s) must evacuate any public places encompassed by the 100 ppm ROE. First responder(s) must take care not to injure themselves during this operation. Company and/or local officials must be contacted to aid in this operation. Evacuation of the public should be beyond the 100 ppm ROE.

Oxy Representative:

- 1. Remain at the briefing area, assess and monitor personnel and overall situation for hazards or conditions that might warrant a change in the action plan.
- Notify Operation Specialists or Team Leader and RMT Leader or Local Incident Commander, and Police, Fire Department, or other local emergency services as required.

<u>Training</u>

There will be an initial training session prior to encountering a known or probable H2S zone (within 3 days or 500 feet) and weekly H2S and well control drills for all personnel in each crew. The initial training session shall include a review of the site specific H2S Drilling Operations Plan and the Public Protection Plan (Contingency Plan). This plan shall be available at the well site. All personnel will be required to carry documentation that they have received the proper training.

Ignition of Gas Source

Should control of the well be considered lost and ignition considered, take care to protect against exposure to Sulfur Dioxide (SO2). Intentional ignition must be coordinated with the NMOCD and local officials. Additionally the NM State Police shall be the Incident Command of any major release. Ignition of the well will be with the concurrence of the drilling team leader and the Oxy Crisis Management Team as time allows.

Characteristics of H2S and SO2

Common Name	Chemical Formula	Specific Gravity	Threshold Limit	Hazardous Limit	Lethal Concentration
Hydrogen Sulfide	H ₂ S	1.189 Air = 1	10 ppm	100 ppm	600 ppm
Sulfur Dioxide	SO ₂	2.21 Air = 1	2 ppm		1000 ppm

Contacting Authorities

Oxy Permian personnel must liaison with local and state agencies to ensure a proper response to a major release. Additionally, the OCD must be notified of the release as soon as possible but no later than 4 hours. Agencies will ask for information such as; type and volume of release, wind direction, location of release, etc. Be prepared with all information available. The following call list of essential and potential responders has been prepared for use during a release. This response plan must be in coordination with the State of New Mexico's 'Hazardous Materials Emergency Response Plan' (HMER).

WELL CONTROL

The following procedures will be implemented when a loss of primary control is indicated. Indicators of loss of primary control are flow from the well, an increase in pit volume, or when the drilling fluid used to fill the hole on trips is less than the calculated pipe displacement volume. The emergency signal for well control procedures will be a single long blast of the rig air horn.

Kick While Drilling - Procedures And Responsibilities

Driller:

- 1. Stop the rotary and hoist the kelly above the rotary table.
- 2. Stop the mud pump(s).
- 3. Check for flow.
- 4. If flowing, sound the alarm immediately.
- 5. Ensure that all crew members fill their responsibilities to secure the well.
- 6. Record drill pipe and casing shut-in pressures and pit volume increase and begin kill sheet.

Derrickman:

- 1. Go to BOP/choke manifold area.
- 2. Open choke line valve on BOP.
- 3. Signal to Floorman #1 that the choke line is open.
- 4. Close chokes after annular or pipe rams are closed.
- 5. Record shut-in casing pressure and pit volume increase.
- 6. Report readings and observations to Driller.
- 7. Verify actual mud weight in suction pit and report to Driller.
- 8. Be readily available as required for additional tasks.

Floorman # 1:

- 1. Go to accumulator control station and await signal from Derrickman.
- 2. Close annular preventer and HCR on signal (if available, if not then close pipe rams).
- 3. Record accumulator pressures and check for leaks in the BOP or accumulator system.
- 4. Report to Driller, and be readily available as required for additional tasks.

Floorman # 2:

- 1. Start water on motor exhausts.
- 2. Notify Contractor Tool Pusher or Rig Manager of well control situation.
- 3. Check location for ignition sources and extinguish or turn off, and stop any welding in progress.
- 4. Report to Driller, and be readily available as required for additional tasks.

Floorman # 3:

1. Stand-by with Driller, and be readily available as required for additional tasks.

Tool Pusher/Rig Manager:

- 1. Notify Oxy Representative and report to rig floor.
- 2. Review and verify all pertinent information.
- 3. Communicate information to Oxy Representative, and confer on an action plan.
- 4. Finalize well control worksheets, calculations and preparatory work for action plan.
- 5. Initiate and ensure the action plan is carried out.
- 6. Communicate any changes in well or site conditions, or any indications that the action plan needs to be revised to the Oxy representative.

Oxy Representative:

 Notify Operation Specialists or Team Leader and RMT Leader or Local Incident Commander, and Police, Fire Department, or other local emergency services as required.

Kick While Tripping - Procedures and Responsibilities

Driller:

- 1. Sound the alarm immediately when pipe displacement volume is less than 75% of calculated.
- 2. Position the upper tool joint just above rotary table and set slips.
- 3. Check for flow.
- 4. Ensure that all crew members fill their responsibilities to secure the well.
- Record drill pipe and casing shut-in pressures and pit volume increase, and begin kill sheets.

<u>Derrickman:</u> (same as while drilling)

Floor Man # 1:

- 1. Install full opening valve (with help from Floorman #2) in top drill string connection.
- 2. Tighten valve with make up tongs.
- 3. Go to accumulator control station and await signal from Derrickman.
- Close annular preventer and HCR valve on signal (if available, if not then close pipe rams).
- 5. Record accumulator pressures and check for leaks in the BOP and accumulator system.
- 6. Report to Driller, and be readily available as required for additional tasks.

Floor Man # 2:

- 1. Assist installing full opening valve in drill string.
- 2. Position back-up tongs for valve make-up.
- 3. Start water on motor exhausts.
- 4. Notify Contractor Tool Pusher or Rig Manager of well control situation.
- 5. Check location for ignition sources and extinguish or turn off, and stop any welding in progress.
- 6. Report to Driller, and be readily available as required for additional tasks.

Floorman # 3, Rig Manager/Tool Pusher, and Oxy Representative: (same as while drilling)

PUBLIC RELATIONS

Oxy recognizes that the news media have a legitimate interest in incidents at Oxy facilities that could affect the public. It is to the company's benefit to cooperate with the news media when incidents occur because these media are our best liaison with the public.

Our objective is to see that all reports of any emergency are factual and represent the company's position fairly and accurately. Cooperation with news media representatives is the most reliable guarantee that this objective will be met.

All contract and Oxy employees are instructed NOT to make any statement to the media concerning the emergency incident. If a media representative contacts any employee, they should refer them to the designated Emergency Command Center where they should contact the Incident Commander or his designated relief for any information concerning the incident.

OXY PERMIAN DOWNHOLE SERVICES GROUP

	LOCATION	OFFICE	HOME	CELL	
Manager Operations S				NOTELL NOTE AND ADDRESS OF THE PROPERTY OF THE	PAGER
Hardesty, Steve	Midland	432-685-5880	432/694-6441	713-560-8095	
Team Leader					
Pennington, Randy	Midland	432-685-5684	432/689-7642	432-556-0207	
			Toledo Bend =	318-590-2349	
Operations Specialists					
Fleming, Joe	Midland	432-685-5858	432/699-0875	432-425-6075	432-498-328
Ray, Fred	Midland	432-685-5683	432/362-2857	432-661-3893	432-499-343
HES Tech					
Thompson, Don	Midland	432-685-5719	432/684-3900	432-556-1505	

Emergency Notification Numbers

Public Authorities					
New Mexico State Police	Artesia	505/746-2704			
New Mexico State Police	Carlsbad	505/885-3137			
New Mexico State Police	Hobbs	505/392-5588			
Eddy County Sheriff's Office	Artesia	505/746-2704			
Eddy County Sheriff's Office	Carlsbad	505/887-7551			
Lea County Sheriff's Office	Hobbs	505/393-2515			
Local Emergency Planning Center	Eddy County	505/887-9511			
Local Emergency Planning Center	Lea County	505/397-9231			
New Mexico Oil & Gas Commission	Artesia	505/748-1283			
New Mexico Oil & Gas Commission	Hobbs	505/393-6161			
NM Emergency Response Center	Hobbs	505/827-9222			

Emer	gency Services	
Fire Fighting, Rescue, Ambulance, Police	Artesia	911
Fire Fighting, Rescue, Ambulance, Police	Carlsbad	911
Fire Fighting, Rescue, Ambulance, Police	Hobbs	911
Flight For Life	Lubbock	806/743-9911
Aerocare	Lubbock	806/7478923
Med Flight Air Ambulance	Albuquerque	505/842-4433

Other Ei	mergency Services	
BOOTS and Coots		1/800-256-9688
Cudd Pressure Control	Midland	432/699-0139
B.J. Services	Artesia	505/746-3569
Halliburton	Artesia	505/746-2757

OXY Permian Production and Plant Personnel OXY Permian Crisis Team Hotline Notification (713) 935-7210

PERSON	LOCATION	OFFICE	FAX	CELL	PAGE
Asset Management-Operations Areas	and the second of the second o		Fr. G. G.		
OXY Permian General Manager: Tom Menges	Houston	(281) 552-1147	(281) 552-1484	(713) 560-8038	γ
South Permian Asset: Matt Hyde	Midland	(432) 685-5802	(432) 685-5930	(432) 556-5016	
DAT/DAT London On the					
TMI/PMI Leaders: South Permian Ass	et est all the same of the constant	t with the same to be a con-			
Frontier RMT:	Midland	(432) 685-5600	(432)	(432)	(432)
Frontier RMT:			(432)	(432)	(432)
RMT/PMT Leaders: South Permian Ass Frontier RMT: John Nicholas PERSON	Midland	(432) 685-5600			
Frontier RMT: John Nicholas	Midland	(432)	(432)	(432)	(432)

PERSON	LOCATION	OFFICE	FAX	OFILE A	
HES Coordinators & Area of Responsibili				CELL	PAGER
Frontier: Ricky Tyler	Midland	(432) 685-5707	(432) 685-5742	(432) 556-5790	(432)
HES Techs & Area of Responsibility	er a francis de la propia del propia de la propia dela propia de la propia dela propia de la propia dela propia dela propia de la propia de la propia dela propia d		TO MAKE	J. 26 1972 年 - 中国	200 Annual Sections
Hobbs RMT: Steve Bishop	Hobbs	(505) 397-8251	(505) 397-8204	(505)	(877) 339-1954-
Frontier-New Mexico: Rick Kerby	Hobbs	(505) 393-2174	(505) 393-2671	(505) 390-8639	1118# (505) 370-6527


OXY USA WTP Limited Partnership

P.O. Box 50250, Midland, TX 79710-0250

June 14, 2005

United States Department of the Interior Bureau of Land Management Roswell District Office 2909 West Second Street Roswell, New Mexico 88201

Application for Permit to Drill OXY USA WTP Limited Partnership OXY Bounder Federal #1 Eddy County, New Mexico Lease No. LC-056302-B

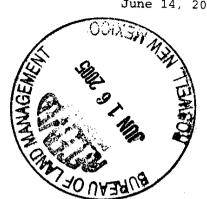

Gentlemen:

OXY USA WTP Limited Partnership respectfully requests permission to drill our OXY Bounder Federal #1 located 880 FSL and 1980 FEL of Section 33, T16S, R31E, Eddy County, New Mexico, Federal Lease No. LC-056302-B. The proposed well will be drilled to a TD of approximately 12400' (TVD). The location and work area has been staked. It is approximately 6 miles northeast of Loco Hills, New Mexico.

In accordance with requirements stipulated in Federal Onshore Oil and Gas Order No. 1 under 43 CFR 3162.1, our Application for Permission to Drill and supporting evidence is hereby submitted.

- I. Application for Permit to Drill:
 - Form 3160.3, Application for Permit to Drill. 1.
 - Form C-102 Location and Acreage Dedication Plat certified by Gary 2. G. Eidson, Registered Land Surveyor No. 12641 in the State of New Mexico, dated June 6, 2005.
 - The elevation of the unprepared ground is 3962 feet above sea level.
 - The geologic name of the surface formation is Permian Rustler.
 - 5. Rotary drilling equipment will be utilized to drill the well to TD 12400' (TVD), and run casing. This equipment will then be rigged down and the well will be completed with a pulling unit.
 - 6. Proposed total depth is 12400' TVD.
 - Estimated tops of important geologic markers. 7.

Wolfcamp 8525' TVD Strawn 11125' TVD Atoka 11325' TVD Morrow 11750' TVD

Estimated depths at which anticipated water, oil, gas or other 8. mineral bearing formations are expected to be encountered:

Primary Objective: Morrow 11750' TVD

Secondary Objective: Atoka 11325' TVD

APD - OXY Bounder Federal #1 Page 2

9. The proposed casing program is as follows:

Surface: 13-3/8" 48# H40 ST&C new casing set at 625'

Intermediate: 9-5/8" 36# K55/HCK55 ST&C new casing from 0-4500'

Production: 5-1/2" 17# N80/HP110 LT&C new casing from 0-12400'

10. Casing setting depth and cementing program:

A. 13-3/8" surface casing set at 625' in 17-1/2" hole. Circulate cement with 350sx HES light PP w/ 2% $CaCl_2 + .25\#/sx$ Flocele followed by 250sx PP w/ 2% $CaCl_2 + .25\#/sx$ Flocele.

If cement does not circulate, a temperature survey will be run to find the TOC and then finish cementing to surface through 1" using Class C with 2% CaCl₂.

B. 9-5/8" intermediate casing set at 4500' in 12-1/4" hole. Circulate cement with 1100sx IFC w/ .25#/sx Flocele followed by 200sx PP w/ 2% CaCl₂.

If hole conditions dictate, a DV tool may be run to ensure that the intermediate string is cemented to surface.

If cement does not circulate, a temperature survey will be run to find the TOC and then finish cementing to surface through 1" using Class C with 2% CaCl₂.

Note: Cement volumes may be adjusted according to fluid caliper.

C. 5-1/2" production casing set at 12400' in 8-3/4" hole. Cement with 600sx Interfill H w/ .1% HR-7 followed by 400sx Super H w/ .5% HR-344 + .4% CFR-3 + 5#/sx Gilsonite + 1#/sx salt + .2% HR-7.

Estimated top of cement is 7500'.

Note: Cement volumes may need to be adjusted to hole caliper.

11. Pressure Control Equipment

0-625' None

625-4500' 13-3/8" 3M annular preventer, to be used as divertor only. Exhibit A

4500-12400'

11" 5000# ram type preventers with one set blind rams and one set pipe rams and a 5000# annular type preventer. A choke manifold and 120 gallon accumulator with floor and remote operating stations and auxiliary power system. Rotating head below 8500'. Exhibit A.

APD - OXY Bounder Federal #1 Page 3

A kelly cock will be installed and maintained in operable condition and a drill string safety valve in the open position will be available on the rig floor.

After setting the 9-5/8" casing, the blowout preventers and related control equipment shall be pressure tested to 5000 psi. Any equipment failing to test satisfactorily shall be repaired or replaced. Results of the BOP test will be recorded in the Driller's Log. The BOP's will be maintained ready for use until drilling operations are completed.

BOP drills will be conducted as necessary to assure that equipment is operational and each crew is properly trained to carry out emergency duties.

Accumulator shall maintain a pressure capacity reserve at all times to provide for the close-open-close sequence of the blind and pipe rams of the hydraulic preventers.

12. Mud Program:

0-625' Fresh water/native mud. Lime for pH control (9-10). Paper for seepage. Wt.8.7-9.2 ppg, vis 32-34 sec.

Fresh/*brine water. Lime for pH control (10-10.5). Paper for seepage.

Wt. 8.3-9.0/10.0-10.1ppg, vis 28-29 sec.

*Fresh water will be used unless chlorides in the mud system increase to 20000PPM.

4500-8700' Fresh water. Lime for pH control (9-9.5). Paper for seepage.

Wt. 8.3-8.5 ppg, vis 28-29 sec.

8700-10000' Cut brine. Lime for pH control (10-10.5). Wt. 9.6-10.0 ppg, vis 28-29 sec.

Mud up with an Duo Vis/Flo Trol system. Wt. 9.6-10.0 ppg, Vis 32-36sec, WL<10cc.

Mud system monitoring equipment with derrick floor indicators and visual/audio alarms shall be installed and operative prior to drilling into the Wolfcamp formation. This equipment will remain in use until the production casing is run and cemented. Monitoring equipment shall consist of the following:

- A recording pit level indicator.
- A pit volume totalizer.
- A flowline sensor.

APD - OXY Bounder Federal #1 Page 4

- 13. Testing, Logging and Coring Program:
 - A. Testing program: No DST's are anticipated.
 - B. Mud logging program: One-man unit from 6000' to TD.
 - C. Electric logging program: CNL/LDT/CAL/GR, DLL/CAL/GR.
 - D. Coring program: Possible sidewall rotary cores.
- 14. No abnormal temperatures, or H2S gas are anticipated. H2S Contingency Plan is attached per NMOCD requirements. The highest anticipated pressure gradient would be .55psi/ft. Adequate flare lines will be installed off the mud/gas separator where gas may be flared safely.
- 15. Anticipated starting date is September 1, 2005. It should take approximately 30 days to drill the well and another 10 days to complete.
- 16. The Multi-Point Surface Use & Operation Plan is attached.
- 17. If the Bureau of Land Management needs additional information to evaluate this application, please advise.

Very truly yours,

David Stewart

Sr. Regulatory Analyst

OXY USA WTP LP

DRS/drs

Attachments