ATS-12-525 RECEIVED **OCD Artesia** SEP 06 2012 FORM APPROVED Form 3160-3 OMB No 1004-0137 Expires October 31, 2014 (March 2012) NMOCD ARTESIA UNITED STATES 5. Lease Serial No. DEPARTMENT OF THE INTERIOR NMLC068431 BUREAU OF LAND MANAGEMENT 6. If Indian, Allotee or Tribe Name APPLICATION FOR PERMIT TO DRILL OR REENTER 7 If Unit or CA Agreement, Name and No **✓** DRILL la. Type of work REENTER NMNM071016X 8. Lease Name and Well No. lb. Type of Well: ✓ Oil Well Gas Well Single Zone Multiple Zone PLU REMUDA BASIN 4 24 30 USA 1H Name of Operator Chesapeake Agent for Bopco 3a. Address PO Box 18496 405-935-2896 BONE-SPRING W.C. G-06 S243024m; Oklahoma City, OK 73154-0496 11. Sec., T. R. M. or Blk, and Survey or Area Location of Well (Report location clearly and in accordance with arry State requirements,*) At surface NENE 175 FNL & 1250 FEL 4-24S-30E NMP Mer At proposed prod. zone SESE 100 FSL & 660 FEL 13 State 12 County or Parish 14 Distance in miles and direction from nearest town or post office* NM 21 Miles to Loving, Nm Eddy Distance from proposed* 16 No. of acres in lease 2480.84 17 Spacing Unit dedicated to this well 175' to the North location to nearest 160.46 property or lease line, ft (Also to nearest drig. unit line, if any) 20 BLM/BIA Bond No. on file 19 Proposed Depth 18. Distance from proposed location* Distance from proposed location*
to nearest well, drilling, completed,
proposed lateral 13950 MD - 9118 TVD ESB000159 applied for, on this lease, ft. Pilot TD 9460 MD Elevations (Show whether DF, KDB, RT, GL, etc.) 22. Approximate date work will start* 23. Estimated duration 02/07/2013 3409 GL 30 Days 24. Attachments The following, completed in accordance with the requirements of Onshore Oil and Gas Order No.1, must be attached to this form: 1. Well plat certified by a registered surveyor. Bond to cover the operations unless covered by an existing bond on file (see Item 20 above). 2 A Drilling Plan 3 A Surface Use Plan (if the location is on National Forest System Lands, the Operator certification SUPO must be filed with the appropriate Forest Service Office) Such other site specific information and/or plans as may be required by the

25 Signature	m (and	Name (Printed/Typed) Erin Carson		Date 05/23/2012
l'itle Regulatory Comp	liance Technician			
Approved by (Signature)	/s/ Jesse J. Juen	Name (Printed/Typed)	/s/ Jesse J. Juen	Date AUG 2 4 2012
Title	STATE DIRECTOR	Office	NM STATE OFFI	

NM STATE OFFICE Application approval does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Conditions of approval, if any, are attached

APPROVAL FOR TWO YEARS

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Continued on page 2)

*(Instructions on page 2)

Carlsbad Controlled Water Basin

Approval Subject to General Requirements & Special Stipulations Attached A 25 1

SEE ATTACHED FOR CONDITIONS OF APPROVAL

CERTIFICATION

I hereby certify that I, or someone under my direct supervision, have inspected the drill site and access route proposed herein; that I am familiar with the conditions which currently exist; that I have full knowledge of state and Federal laws applicable to this operation, that the statements made in this APD package are, to the best of my knowledge, true and correct; and, that the work associated with the operations proposed will be performed in conformity with this APD package and the terms and conditions under which it is approved. I also certify that I, or the company I represent, am responsible for the operations conducted under this application. These statements are subject to the provisions of 18 U.S.C. 1001 for the filing of a false statement.

Executed this 22 day	of NARCH . 2011
•	
Name: \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	R
Toby Reid - Field Supe	intendent

Address: 1616 W Bender Blvd Hobbs, NM 88240

Telephone: <u>575-725-8497</u>

E-mail: toby.reid@chk.com

DISTRICT I 1625 N. French Dr., Hobbs, NM 88240 Phone (575) 393-8161 Fax: (575) 393-0720 DISTRICT II
P11 S. First St., Artesia, NM 88210
0 (575) 748-1283 Fax: (575) 748-9720

1000 Rio Brazos Rd., Aztec, NM 87410 Phone (505) 334-6176 Fax: (505) 334-6170

TRICT III

DISTRICT IV

State of New Mexico Energy, Minerals and Natural Resources Department


Form C-102 Revised August 1, 2011

OIL CONSERVATION DIVISION

1220 South St. Francis Dr. Santa Fe, New Mexico 87505 Submit one copy to appropriate District Office

1220 S. St. Francis Dr., Santa Fe, NM 67505 Phone (505) 476-3460 Fax: (505) 476-3462 ☐ AMENDED REPORT WELL LOCATION AND ACREAGE DEDICATION PLAT C-06 Pool Name WILDCAT: API Number Pool Code WILDCAT: BONE SPRING 96403 Well Number Property Name PLU REMUDA BASIN 4 24 30 USA 1H Operator Name Elevation OĞRID No. 3495' 147179 CHESAPEAKE OPERATING CO. Surface Location UL or lot No. Section Township Range Lot Idn Feet from the North/South line Feet from the East/West line County **EDDY** 24 S 30 E 175 NORTH 1250 **EAST** LOT 1 4 Bottom Hole Location If Different From Surface UL or lot No. Lot Idn Feet from the North/South line East/West line Section Township Range Feet from the County 4 24 S 30 E 100 SOUTH 660 **EAST EDDY** Consolidation Code Dedicated Acres Joint or Infill Order No. : 160.46 13950 8/24

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

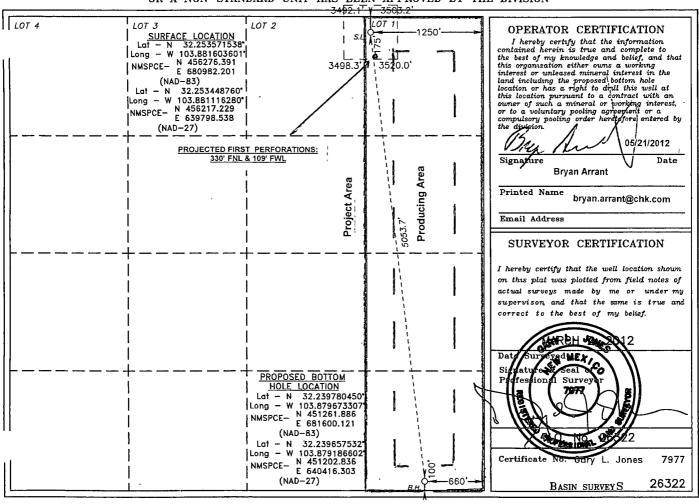

ONSHORE ORDER NO. 1
Chesapeake Operating, Inc. Agent for BOPCO
PLU Remuda Basin 4 24 30 USA 1H

CONFIDENTIAL -- TIGHT HOLE. Lease No

Eddy, NM

DRILLING PLAN
PAGE. 1

OHSORE OIL & GAS ODER NO 1 Approval of Operations on Onshore Federal and Indian Oil and Gas Leases

All lease and/or unit operations are to be conducted in such a manner that full compliance is made with the applicable laws, regulations (CFR 43, Part 3160) and the approved Application for Permit to Drill. The operator is considered fully responsible for the actions of his subcontractors. A copy of the approved APD must be on location during construction, drilling and completion operations.

Approval of this application does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease, which would entitle the applicant to conduct operations thereon.

. 1. FORMATION TOPS

The estimated tops of important geologic markers are as follows:

FORMATION	SUB-SEA	KBTVD	, MD
Rustler, . , , , ,	. 299,8		522
Top of Salt	2708	812	812
Base of Salt.	-131,	3651,	3651
Lamar	-412	3932	3938
Bell Canyon	-4,32	3952	" 3952
Cherry Canyon	-1363	4883	4883
Brushy Canyon	-2632	6152	6152
Bone Spring	-4287	7807	7807
1'st`Bone Spring Sand	-5240	87,60	. 876,1
Pilot TD	-5940	9460	9460
Lateral TD	559,8	9118	13950

2. ESTIMATED DEPTH OF WATER, OIL, GAS & OTHER MINERAL BEARING FORMATIONS

The estimated depths at which the top and bottom of the anticipated water, oil, gas, or other mineral bearing formations are expected to be encountered are as follows:

Substance	Formation	Depth
Water	Rustler	522
,Oil/Gas	Brush'y'Canyon	. 6152
Qil/Gas	, Bone:Spring:	7807

All shows of fresh water and minerals will be reported and protected.

Additional Operator Remarks:

Chesapeake Operating, Inc. respectfully requests permission to drill a well to 13,182 to test the Bone Spring formation. If productive, casing will be run and the well completed. If dry, the well will be plugged and abandoned as per BLM and New Mexico Oil Conservation Division requirements.

Please find the Surface Use Plan and Drilling Plan as required by Onshore Order No. 1.

Attached are the Exhibit A-1 to A-5 Survey plats, Exhibit B 1 mile radius plat, Exhibit C Production facility, Exhibit D Water Transfer Line, Exhibit E Patterson Rig #62 layout, Exhibit F-1 to F-2 BOP & Choke Manifold and Exhibit G Directional Drill Plan.

Archeological Survey will be delivered to the BLM when completed.

Chesapeake Operating, Inc. has an agreement with the grazing lessee.

Please be advised that Chesapeake Operating, Inc. is the Designated Agent for BOPCO, the Operator of this unit. Chesapeake Operating, Inc. agrees to be responsible under the terms and conditions of the lease for the operations conducted upon the lease lands

ONSHORE ORDER NO. 1
Chesapeake Operating, Inc. Agent for BOPCO
PLU Remuda Basin 4 24 30 USA 1H

CONFIDENTIAL -- TIGHT HOLE Lease No:

DRILLING PLAN

Eddy, NM

PAGE:

2

3. BOP EQUIPMENT

Will have a 5000 psi rig stack (see proposed schematic) for drill out below surface casing. Stack will be tested as specified below. Surface casing and Intermediate Casing shoes will be tested to 10.5 ppg equivalent after drilling out 10' of new formation.

Chesapeake Operating Inc 's minimum specifications for pressure control equipment are as follows:

1 BOP, Annular, Choke Manifold Pressure Test - See Exhibit F-1 and F-2

A Equipment

- 1. The equipment to be tested includes all of the following that is installed on the well-
 - (a) Ram-type and annular preventers
 - (b) Choke manifolds and valves
 - (c) Kill lines and valves
 - (d) Upper and lower kelly cock valves, inside BOP's and safety valves

B. Frequency

- 1. All tests shall be performed with clear water
 - (a) when installed
 - (b) before drilling out each casing string
 - (c) at any time that there is a repair requiring a pressure seal to be broken in the assembly
 - (d) at least once every 30 days while drilling

C Frequency

- 1. In some drilling operations, the pressures to be used for low and high pressure testing of preventers and casing may be different from those given below due to governmental regulations or approved local practices.
- 2. If an individual component does not test at the low pressure, do not test to the high pressure and then drop back down to the low pressure.
- 3. All valves located downstream of a valve being tested must be placed in the open position
- 4 All equipment will be tested with an initial "low pressure" test at 250 psi
- 5 The subsequent "high pressure" test will be conducted at the rated working pressure of the equipment for all equipment except the annular preventer.
- 6. The "high pressure" test for the annular preventer will be conducted at 70% of the rated working pressure
- 7. A record of all pressures will be made on a pressure-recording chart.

II. Accumulator Performance Test

A Scope

1. The purpose of this test is to check the capabilities of the Bop control systems and to detect deficiencies in the hydraulic oil volume and recharge time.

B. Test Requency

1. The accumulator is to be tested each time the BO's are tested, or any time a major repair is performed.

ONSHORE ORDER NO. 1	
Chesapeake Operating, Inc. Agent for BOPCO	
PLU Remuda Basin 4 24 30 USA 1H	

CONFIDENTIAL ... TIGHT HOLE Lease No:

DRILLING PLAN

PAGE:

3

Eddy, NM

C. Minimum Requirements

- 1. The accumulator should be of sufficient volume to supply 1.5 times the volume to close and hold all BOP equipment in sequence, without recharging and the pump turned off, and have remaining pressures of 200 psi above the precharge pressure.
- 2. Minimum precharge pressures for the various accumulator systems per manufacturers recommended specifications are as follows:

System Operating Pressure	Precharge Pressure
1500 psi	750 psi
2000 ps i	1000; p ši ,
3000 ∂ps i	1000 psi

- 3. Closing times for the annular preventer should be less than 20 seconds and for the ram-type preventers less than 10 seconds.
- 4. System recharge time should not exceed 10 minutes.

D. Test Procedure

- 1. Shut accumulator pumps off and record accumulator pressure.
- 2. In sequence, close the annular and one set of properly sized pipe rams, and open the HCR valve
- 3. Record time to close or open each element and the remaining accumulator pressure after each operation.
- 4. Record the remaining accumulator pressure at the end of the test sequence. Per the previous requirement, this pressure should not be less than the following pressures:

ı	System Operating Pressure	Remaining Pressure After Test				
1	1500,psi	950,psi				
ı	,2000 pši	1200 p si				
1	3000;psi	1200 pši				

- 5. Turn the accumulator pumps on and record the recharge time. This time should not exceed 10 minutes.
- 6. Open annular and ram-type preventers. Close HCR valve.
- 7. Place all 4-way control valves in full open or full closed position. Do not leave in neutral position.

3. CASING PROGRAM

a. The proposed casing program will be as follows.

Purpose	From	Tò	Hole Size	Csg Size	Weight	Grade	Thread	Condition
Surface	0,	625'	17-1/2"	13-3/8"	48 #	H-40	STC	New
Shallow Intermediate	0'	, 3,800'	11"	8-5/8"	32 #	, J-55	LTC	New
·							1	
Production	0' ,	.13;950'	. 77/8" ,	5-4/2"	17.0 #	P-110	LTC.	New

b. Casing design subject to revision based on geologic conditions encountered.

ONSHORE ORDER NO. 1 Chesapeake Operating, Inc. Agent for BOPCO PLU Remuda Basin 4 24 30 USA 1H CONFIDENTIAL -- TIGHT HOLE Lease No:

DRILLING PLAN

Eddy, NM

PAGE:

4

c. Casing Safety Factors

Casing String	Min SF Burst	Min.SF.Collapse	, Min SF Tension
Surface	, ,1.38 ,	2.72	2.56
Shallow Intermediate	2.15 . :	. 154	2.05
			" . <u>.</u>
Production !	. 1.43 . '	2.02	2.04

Min SF is the smallest of a group of safety factors that include the following considerations:

	Surf	Int ,	Prod
Burst Design			
Pressure Test- Surface, Int, Prod Csg .	X	×	X
P external: Water	İ	ŀ	
P internal: Test psi + next section heaviest mud in csg.			
Displace to Gas- Surf Csg .	X		
P external; Water			ľ
P_internal: Dity Gas from Next Csg Point			
Frac at Shoe, Gas to Surf- Int Csg	T	X	-
P external: Water			j '
P internal. Dry Gas, 15 ppg Frac Gradient		<u> </u>	
Stimulation (Frac) Pressures- Prod Csg	T		X
P external. Water		1.	Ί
P internal: Max inj pressure w/ heaviest injected fluid].	, .	·.
Tubing leak- Prod Csg (packer at KOP)		ľ	Х
P external: Water		Ī	
F internal: Leak just below surf, 8.7 ppg,packer fluid			
Collapse Design			
Full Evacuation	X	X	X
P external: Water gradient in cement, mud above TOC	Í		
P internal none	1	, .	•
Cementing- Surf, Int, Prod Csg	X	×	X
P external: Wet cement		<u>[</u>	
P internal water .			
Tension Design		ľ	,
100k lb overpull	Ŕ.	X .	X

ONSHORE ORDER NO 1 Chesapeake Operating, Inc. Agent for BOPCO PLU Remuda Basin 4 24 30 USA 1H CONFIDENTIAL -- TIGHT HOLE Lease No:

DRILLING PLAN

PAGE 5

Eddy, NM

5. **CEMENTING PROGRAM**

Slurry	Туре	Тор	Btm	Wt	Yld	%Exc	Sx
<u>Surface</u>				(ppg)	(sx/cu ft)	Open Hole	
Single Slurry	C + 4% Gel	0'	625'	13.5	1.73	200	728
Shallow Int							
Lead	TXI + 5% Salt	0'	3,300'	12	1.99	200	1169
Tail	50C/50Poz +5% Salt	3,300'	3,800'	14.2	1.37	200	290
<u>Production</u>							
Lead	35/65Poz H +8% Gel	3,700'	8,625'	12.4	2.11	100	801
Tail	50/50Poz H +2% Gel	8,625'	13,950'	14.5	1 27	100	1462
	35/65Poz C +6% Gel						
2nd Stage Lead	+ 5% Salt	0'	3,450'	12.4	2.19	200	264
2nd Stage Tail	С	3,450'	3,700'	14.8	1.33	200	33

1. Final cement volumes will be determined by caliper.

2. Surface casing shall have at least one centralizer installed on each of the bottom three joints starting with the shoe joint.

3. The production casing will be cemented in two stages with the stage tool placed at 3700

4. Production casing will have one centralizer on every other joint from TD to KOP (horizontal type) and from KOP to intermediate casing (bowspring type).

Pilot Hole Plugging Plan:

Pilot hole will be plugged back from TD of 9,460' TVD to KOP of 8,624' TVD with a single balanced plug using tubing that will be cemented in place on the bottom of the Smith Trackmaster OH-Openhole whipstock cmenting system (previously approved by BLM). This will be accomplished using 400 sx (40% excess) of 17.0 ppg 0.99 cuft/sk yield Class H cement.

see below so below previous previous ONSHORE ORDER NO. 1 Chesapeake Operating, Inc. Agent för BOPCO PLU Remuda Basın 4 24 30 USA 1H CONFIDENTIAL -- TIGHT HOLE Lease No:

psi

D'RILLING PLAN

PAGE: 6

Eddy, NM

6. MUD PROGRAM

From	To	Type	Weight	F. Vis	Filtrate
0'	625'	S p ud Mud	8.4 - 8.7	32 - 34	NC - NC
625'	3,800'	Brine .	. 9.5 - 10.1	28 - 29`	NC - NC
3,800'	8,625'	Cut Brine	8.3 - 9	28 - 29.	NC - NC
8,625°	9,460'	, Cut Brine	8.3 - 9	28 - 29 `	NC - NC
8,625'	9,373'	Cut Brine	8.3 - 9	28 - 29	NC - NC
9,373'	13,950'	Cut Brine	8.3 - 9	28 - 29	NC - NC

A closed system will by utilized consisting of above ground steel tanks. All wastes accumulated during drilling operations will be contained in a portable trash cage and removed from location and deposited

All fluids and cuttings will be disposed of in accordance with New Mexico Oil Conservation Division rules and regulations.

A mud test shall be performed every 24 hours after mudding up to determine, as applicable: density, viscosity, gel strength, filtration, and pH.

7. TESTING, LOGGING, AND CORING

The anticipated type and amount of testing, logging, and coring are as follows:

- a. Drill stem tests are not planned.
- b. The logging program will be as follows:


TYPE	Logs.	Interval	Timing	Vendor
Mud Log	2 man Mudlog	.Surf to TD	Spud	Suttles
OH .	Triple Combo	Pilot TD to Int Cs g ,	After Pilot TD	TBD
			` ,	
OH _	GR/Neutron	Int Cas to Surf	After Pilot TD	TBD
		•	<u>'</u>	
LWD `	MWD Gam'ma	Curve and Lateral	While Drilling	Phoenix

- c. Core samples are not planned.
- d. A Directional Survey will be run.

8. ABNORMAL PRESSURES AND HYDROGEN SULFIDE

a. No abnormal pressures or temperatures are expected. Estimated BHP is: 4023

b. Hydrogen sulfide gas is not anticipated.

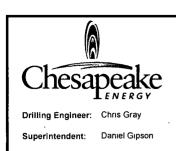

Geologist:

Chris Persellin

Well Name:

PLU Remuda Basin 4 24 30 USA 1H

First Bone Spring Shale Target:

Eddy, NM County, State:

Surface Location: 175' FNL 1250' FEL, Section 4, Township 24S, Range 30E

BH Location:

100 FSL 660' FEL, Section 4, Township 24S, Range 30E

SHL Latitude: 32 253572 SHL Longitude: -103 881604

6,152'

7,807'

8,041'

8,267

Brushy Canyon

Bone Spring

Upper Avalon

Bone Spring C1

BHL Latitude: 32 23978045 BHL Longitude: -103 8796733 NAD 83

SHL North: 456276 SHL East: 680982 BHL North: 451262 BHL East: 681600

Coordinates: NMSPCE Drilling Rig:

Patterson 62

Directional:

Phoenix

Drilling Mud:

Nova

Cement:

Schlumberger

Wellhead:

Sunbelt 643672

Property Number: AFE Number:

161928

			Coordi	nates:	NAD 83
		KBF	Elevation:	3,520'	KB: 25'
		Ground F	Elevation:	3,495'	
Conductor OD 20 Wt	60' Hole Size: 17 1/2	↓ 📑		522'	Rustler
Surface Casing		625'	Ì		
WBS- 13 3/8" Wt 48.# Grd H-40 Con STC	Hole Size	11"	1	812'	Top of Salt
Shallow int Casing OD 8 5/8" Wt 32.# Grd J-55 Con LTC	. Hole Size	3,800' 7 7/8"		3,651' 3,700' 3,932' 3,952'	Base of Halite DV tool depth Lamar Bell Canyon Cherry Canyon

Wellhead Equipment							
A Section	13-3/8" x 13-5/8" 5K SOW (Multibowl)						
B Section	N/A (Multibowl)						
C Section	11" 5K X 7-1/16" 10K w/10k gate valve						
D Section	N/A						
Required BOP Stack	13-5/8" 5K- Double, Annular, Rot Head w/orbit valve						

			Mud			
	Dept	h	Туре	Weight	F. Vis	FL
0'		625'	Spud Mud	84-87	32 - 34	NC - NC
625'	-	3,800'	Brine	95-101	28 - 29	NC - NC
3,800'	-	8,625'	Cut Brine	83-9	28 - 29	NC - NC
8,625'	-	9,460'	Cut Brine	83-9	28 - 29	NC - NC
8,625	-	9,373'	Cut Brine	83-9	28 - 29	NC - NC
9,373'	-	13,950'	Cut Brine	83-9	28 - 29	NC - NC

		Cemen	ıt				
Slurry	Top	Btm	Wt	Yld	%Exc	Bbl	Sx
Surface							
Single Slurry	0'	625'	13 5	1 73	200	224	728
Shallow Int							
Lead	0'	3,300'	12 0	1 99	200	414	1169
Tail	3,300'	3,800'	14 2	1 37	200	71	290
Production			L				
1st Lead	3,700'	8,625'	12 4	2 11	100	301	801
1st Tail	8,625'	13,950'	14 5	1.27	100	331	1462
2nd Lead	0'	3,450'	12 4	2 19	200	103	264
2nd Tail	3,450'	3,700'	148	1 33	200	8	33

8,433 Lower Avalon 8,760' 1st Bone Spring Sand Hole Size 7 7/8" Hole Size. 7 7/8" 13,950' Production Casing OD 5 1/2" Wt 17.# Grd. P-110 Hole Size 7 7/8" 9,045 1st Bone Spring Shale Con LTC

_	Туре	Logs	Interval	Vendor
L	Mud Log	2 man Mudlog	Surf to TD	Suttles
0	ОН	Triple Combo	Pilot TD to Int Csg	TBD
_				
G	OH	GR/Neutron	Int Cas to Surf	TBD
S				
<u> </u>	LWD	MWD Gamma	Curve and Lateral	Phoenix

Pilot TD: 9,460

Directional Plan											
Target Line: 9101' @ 0' VS w/89 8 deg inclination											
Target Wind	ow:	20'	above, 20	below, 50	left, 50' rig	ht					
	MD	-	INC	AZM	TVD	VS	DLS				
KOP	8,6	25'	0 00	0 00	8,625'	0'	0.00				
EOB	9,3	73'	89 80	173 00	9,102'	476'	12 00				
TD	13,9	50'	89 80	173.00	9,118'	5,052'	0 00				
Hardlines:	Latera	F 33	30' from pa	rallei lease	lines.						
	Vertica	ıl- A	ctual Leas	e Lines							
Notes:	Please	no.	te SHL and	BHL							
ļ	distance from lease lines										

Permian District

Poker Lake PLU Remuda Basin 4-24-30 USA 1H Well #1

Wellbore #1

Plan: Plat

Standard Planning Report

24 April, 2012

EXHIBIT G

Planning Report

Drilling Databas Permian District Database: Local Co-ordinate Reference: Company TVD Reference: WELL @ 0.00ft (Onginal Well Elev) Poker Lake Project: MD Reference: WELL @ 0.00ft (Original Well Eley) PLU Remuda Basin 4-24-30 USA 1H Site: North Reference: Grid Well #1. Well: Survey Calculation Method: Minimum Curvature Wellbore #1 Wellbore: Design:

Project Poker Lake: Eddy County, NM

Map System: US State Plane 1983 System Datum: Ground Level

Geo Datum: North American Datum 1983

Map Zone: New Mexico Eastern Zone

PLU Remuda Basin 4-24-30 USA 1H Site TO THE WAY THE WAY WANTED Northing: 456,276.39 usft Site Position: 32 253572 Easting: 680,982 20 usft -103 881604 From: Мар Longitude: 0 00 ft Position Uncertainty: Slot Radius: 13,200 in Grid Convergence: 0 24 '

Well. Well Position +N/-S 0,00 ft Northing: 456,276.39 usft Latitude: 32 253572 +E/-W 0 00 ft Easting: 680,982 20 usft -103 881604 Longitude: 0 00 ft Wellhead Elevation: Ground Level: Position Uncertainty 0 00 ft

Wellbore # Wellbore # Declination Dip Angle Field Strength

(°) (°) (nT)

IGRF200510 1/27/2012 7 65 60.17 48,579

Design we have been a training to have a give and his house wife and we come and a surface of the surfa **Audit Notes:** Version: Phase: **PROTOTYPE** Tie On Depth: 0 00 Vertical Section: Depth From (TVD) +E/-W-+N/-S Direction (ft) (ft)A (ft) (2) 0.00 0.00 0 00 172 98

Plan Sections Measured Depth (ft)	Inclination (°)	Azimuth	Vertical Depth (n)	+N/-S - 7 (ft)	+E/-W	Dogleg Rate (*/100usft)	Build Rate (*/100usft)	Turn Râte (?/100usft)		Targot
0 00	0.00	0 00	0.00	0 00	0.00	0 00	0 00	0:00	0 00	واستهدد فلنبد المستهدية والقادار المستهدي ويستم
8,624 56	0 00	0,00	8,624 56	0 00	0 00	0 00	0.00	- 0 00	0 00	
9,372.90	89 80	172 98	9,102.02	-472 23	58.19	12.00	12 00	0 00	172 98	
13,949 57	89.80	172 98	9,118 00	-5,014.52	617 92	0 00	0.00	0 00	0 00 BHL	

Planning Report

Database: Company: Project: Well Well # WELL @ 0.00ft (Original Well Eley)
WELL @ 0.00ft (Original Well Eley)
Grid Drilling Database
Permian District
Poker Lake
PLU Remuda Basin 4-24-30 USA 1H
Well #1 Local Co-ordinate Reference: TVD Reference: MD Reference: North Reference: Site:

North Reference. Survey Calculation Method: Minimum Curvature Well: Wellbore:

ign:		Plat	بمبسين أنفيت ستففأ	وروا أوارا والمساورة	ا ئىرىسىرىسىسىڭ ئىكىتىتىنىنىن		- Annual Company	- Principle Sections	era in more per	
nnéd	Survey		Service Service Spring		Line in	وراد مراد والمساورة المادة	the grant of a copy of		STATE OF THE	The state of the state
, .	Measured -			Vertical	*		Vertical	Dogleg	Build	Tum
	Depth	To allowation as		Depth	W C	+E/-W-	Section	Rate	Rate	Rate
		_ Inclination ;	Azimuth		+N/-S					(°/100usft)
	"(ft)	(°) 3	(°)	(ft)	(ft)	(ft)	(ft)	(°/100usft)	(°/100usft)	(7100usit)
· + · • • • • • • • • • • • • • • • • •	0.00	0,00	ò 00	0.00	0.00	0.00	0.00	0.00	0.00	0,00
	100.00	0 00	0 00	100.00	0.00	. 0 00	0.00	0 00	0 00	0.00
	200 00	0 00	0 00	200 00	0.00	0 00	0.00	0 00	0 00	0,00
	300.00	0.00	0.00	300.00	0.00	0.00	0.00	0 00	0.00	0.00
	400.00	0,00	0.00	, 400 00	0.00	0.00	0.00	0 00	0.00	0 00
	400.00	0,00	. 000	,400 00	0.00	0.00	, 0.00	0 00	0 00	0 00
	500 00	0 00	0 00	500 00	0.00	0 00	0 00	0 00	0.00	0 00
	600 00	0 00	0.00	600 00	0.00	0 00	0.00	0.00	0 00	0.00
	700 00	0 00	0 00	700.00	0 00	0.00	0.00	0.00	0.00	0 00
	800 00	0.00	0 00	800 00	0.00	0 00	. 0.00	0.00	0 00	0.00
	900 00	0.00	0.00	900.00	0 00	0 00	0 00	0.00	0 00	0 00
	1,000 00	0 00	0 00	1,000 00	0.00	0 00	0,00	0 00	0 00	0 00
	1,100 00	0 00	0 00	1,100.00	0 00	0.00	0.00	0 00	0 00	0 00
	1,200 00	0 00	0.00	1,200 00	0 00	0 00	0 00	0.00	0 00	0 00
	1,300 00	0.00	0 00	1,300 00	0 00	0 00	0 00	0 00	0.00	0 00
	1,400 00	0 00	0.00	1,400 00	0 00	0 00	0 00	0 00	0 00	0 00
		•								
	1,500 00	0 00	0.00	1,500.00	0 00	0.00	0 00	0.00	0.00	.0 00
	1,600 00	0 00	0.00	1,600 00	0.00	0 00	0.00	0 00	0.00	0.00
	1,700 00	0.00	0.00	1,700.00	0.00	0.00	0.00	0.00	0.00	0.00
	1,800 00	0 00	0 00	1,800.00	0 00	0.00	0 00	0.00	0.00	0 00
	1,900 00	0 00	0 00	1,900,00	0 00	0 00	0 00	0 00	0.00	0.00
	2,000.00	0 00	0.00	2.000 00 •	0 00	0.00	0 00	0 00	. 0 00	0.00
				-,						
	2,100 00	0 00	0 00	2,100:00	0 00	0 00	0.00	0 00	0 00	0 00
	2,200 00	0 00	0 00	2,200 00	0 00	0 00	0 00	0.00	0 00	0.00
	2,300.00	0 00	0.00	2,300 00	0.00	0.00	0.00	0 00	0 00	0.00
	2,400 00	0 00	0 00	2,400 00	0 00	0 00	0 00	0 00	0 00	0 00
	2,500 00	0 00	0 00	2,500 00	0.00	0 00	0 00	0 00	0 00	0 00
	2,600.00	0 00	0 00	2,600.00	0.00	0 00	0 00		0.00	0 00
•				•				0.00		
	2,700.00	0 00	0 00	2,700 00:	0.00	0.00	0.00	0 00	0.00	0.00
	2,800 00	0 00	0 00	2,800 00	. 0.00	0.00	0 00	0.00	0 00	0.00
	2,900.00	0 00 4	0 00	2,900.00	0.00	0 00	0 00	0 00	0 00	0.00
	3,000 00	0 00	0 00	3,000 00	0.00	. 0 00	0.00	0.00	Ó 00	0.00
	3,100 00	0 00	0 00	3,100 00	0.00	0.00	0:00	• 0.00	0.00	0.00
	3,200 00	0 00	0.00	3,200 00	0.00	0.00	0.00	0.00	0.00	0.00
					o 00					
	3,300 00	0.00	0 00	3,300 00		0 00	0 00	0 00	0 00	0 00
	3,400 00	0 00	- 0 00	3,400 00	0 00 _	0.00	0.00	0 00	0 00	0 00
	3,500 00	0 00	0 00	3,500 00	0.00	0 00	0 00	0.00	0 00	0 00
	3,600,00	0,00	0 00	3,600 00	0 00	0 00	0.00	0.00	0 00	0 00
	3,700.00	0.00	0.00	3,700 00	0 00	0.00	0 00	0 00	0 00	0 00
	3,800.00	0.00	0.00	3,800 00	0 00	0.00	0.00	0 00	0 00	0 00
	3,900.00	0 00	0.00	3,900.00	0.00	0.00	0.00	0 00	0 00	0.00
									, 000	0.00
	4,000 00	0 00	0.00	4,000.00	0.00	0.00	0 00 (0 00	. 0 00	0.00
	4,100.00	0 00	0.00	4,100 00	0 00	0 00	0 00	0 00	0 00	0 00
	4,200.00	0.00	0.00	4,200 00	0 00	0.00	0 00	0 00	0 00	0.00
	4,300 00	0 00	0.00	4,300,00	0 00	0 00	0 00	0.00	0.00	0.00
	4,400.00	0 00	0.00	4,400.00	0.00	0 00	0 00 .	0 00	0.00	0.00
	4,500.00	0.00	0 00	4,500 00	0.00	0 00	0.00	0.00	0 00	0.00
	4,600 00	0 00	0.00	4,600 00	0 00	0.00	0.00	0.00	0 00	0 00
	4,700.00	Ó 00	0 00	4,700 00	0 00	0 00	0 00	0 00	0.00	0.00
	4,800.00	0 00	0 00	4,800 00	0 00	0.00	0 00	0.00	0.00	0.00
	4,900 00	0.00	0.00	4,900:00	0 00	0.00	0 00	0.00	0.00	0.00
									0 00	0.00
	5,000 00	0.00	0.00	5,000.00	0 00	0 00	0.00	0.00	0 00	0.00
	5,100 00	0 00	0 00	5,100 00	.0,00	0.00	0.00	0 00	0 00	0 00
	5,200 00	0 00	0.00	5,200.00	0 00	0 00	0.00	0 00	0 00	. 0 00
	5,300 00	0.00	0.00	5,300 00	0 00	0 00	0,00	0.00	0.00	. 0,00

Planning Report

Database: Company: Orilling Dalabase
Peirmian District
Roker Lake
PEU Reminda Basin 4-24-30 USA 1H
Well,#1
Wellbore #1

Site. Well: Wellbore: Design:

TVD Reference: MD Reference: North Reference:

Survey Calculation Method:

'ŴĕĨĨ-ŴeĨĨ #1

WELL @ 0.00ft (Original Well Elev)
WELL @ 0.00ft (Original Well Elev)
Grid

Minimum Curvature

Planned Survey

Planned Survey	٠ <u>٠</u> ٠.	en flander on con	مستدر والمعارض المستراب	المنطب فأساد المساوة		بكالمه بدووا أأنكه أرماك	ب وستاه سناه سال و در	سنشد ما تعالماند	ب عد في المان	The Johnson was a see in	- 0 1
		· in the	. at		· · · · · ·	**			4.53	أنه المسأ منابعة الأراث	. 4
Measur				Vertical '			Vertical.	Dogleg,	Build Rate	Turn ,	. 4
Depti	n, _	linclination	Azimuth	Depth/ ,(ft). ;;	+N/-S		Section (ft)	Rate,	(°/100usft)	.^- Rate (%/100usft)	
(ft)	، پارسور ریشانته	(é)		(II).	(ft)	· (ft) ·	TE)	्र (°/100usft)। '	(1,100 nair)	(s/Tousit)	فبثي
5,40	0 00	0 00	0.00	5,400 00	0 00	0 00	0 00	0 00	0.00	0 00	
5,50	0 00	0 00	0.00	5;500 00	0 00	0 00	0 00	0 00	0 00	0 00	
5.60	0 00	0 00	0.00	5,600,00	0 00	0 00	0 00	0 00	0 00	0 00	
5,70		0 00	0 00	5,700 00	0 00	0 00	0 00	0 00	0.00	0 00	,
5,80		0.00	0.00	5,800 00	0 00	0 00	0 00	0.00	0.00	0.00	
5,90		. 0 00	0 00	5,900 00	0 00	0 00	0 00	0 00	. 0 00	0 00	
6,00	0.00	0 00	0 00	6,000 00	0 00	0 00	0 00	0 00	0 00	0 00	
6.10		0 00	0 00	6,100 00	0.00	0 00	0 00	0.00	0 00	0 00	
6,20		0 00	0 00	6,200 00	0,00	0 00	0 00	0.00	0 00	0.00	
6,30		0 00	. 0 00	6,300 00	0 00	0 00	0 00	0 00	0 00 ·	0 00	
6,40		0 00	0 00	6,400 00	0 00	0 00	0 00	0 00	0 00	0 00	
6,500		0 00	0 00	6,500 00	0 00	0 00	0 00	0.00	0 00	0.00	İ
6,600		0 00	0 00	6,600 00	0 00	0 00	0 00	0.00	0 00	0 00	
6,70		0 00	0 00	6,700 00	0 00	0 00	0.00	0 00	0 00	0 00	
•					0 00						
6,800 6,900		0 00	0.00 00 0	6,800 00 6,900 00	0 00	0 00	0.00 0 00	0 00 0 00	0 00 0 00	0 00 0.00	
1 .		0 00	0 00		0 00	0 00			0 00	0.00	
7,000				7,000.00			0 00	0.00			
7,100		0 00	0 00	7,100 00	0.00	0 00	0 00	0 00	0.00	0 00	- 1
7,200		0 00	0.00.	7,200 00	0 00	0 00	0.00	0 00	0 00	0 00	
7,300		0 00	0 00	7,300 00	0.00	, 0.00	0 00	. 000	0,00	0 00	- [
7,400	00 0	0 00	0 00	7,400 00	0.00	0 00	0 00	0 00	0 00	0 00	
7,500		0.00	0 00	7,500 00	0 00	0 00	0.00	0 00	0 00	0 00	Į
7,600		0 00	0 00	7,600 00	0 00	0 00	0 00	0 00	0 00	0 00	
7,700		0 00	0 00	7,700.00	0 00	0 00	0.00	0 00	0 00	. 0.00	- 1
. 7,800	00	0 00	0.00	7,800 00	0 00	. 0.00	. 0 00	0.00	0 00	0 00	- 1
7,900	00	0 00	0 00	7,900 00	0 00	0 00	0 00	0 00	0 00	0 00	
8,000		0 00	0 00	8,000 00	0 00	0 00	0 00	0 00	0.00 .	0 00	
8,100	0.00	0 00	0 00	8,100 00	0 00	0 00	0,00	0 00	0 00	0 00	1
8,200	00	0 00	0 00	8,200 00	0.00	0 00	0 00	0 00	0.00	0 00	
8,300	0.00	0 00	0 00	8,300 00	0.00	0 00	0.00	0 00	0 00	0 00	
8,400	00	0 00	0 00	8,400 00	0 00	0.00	0 00	0 00	0 00	0 00	- 1
8,500	00	0 00	0 00	8,500 00	0.00	0 00	0 00	0 00	0 00	0 00	
8,600		0 00	0 00	8,600 00	0 00	0 00	0 00	0,00	0 00	0 00	ŧ
8,624		0 00	0 00	8,624 56	0 00	0 00	0 00	0 00	0 00	0 00	8
8,700	00	9 05	172 98	8,699 69	5 90	0 73	5 95	12 00	12 00	0 00	- [
8,800	00	21 05	172 98	8,796 08	-31 63	3 90	31.87	12 00	, 12.00	0,00	
8,900		33 05	172 98	8,884 98	-76 69	9.45	77 27	12.00	12 00	0 00	
9,000		45 05	172 98	8,962.49	-139 10	17,14	140 16 ·		12 00	0 00	- 1
9,100	00	57 05	172.98	9,025 24	-216.15	26 64	217.79	12 00	12 00	0.00	- 1
9.200	00	69.05	172 98	9,070.47	-304 46	37.52	306 77	12 00.	12 00	0 00	
9,300	.00	81 05	172.98	9,096 22	-400 18	49,31	403 21	12.00	12 00	0 00	
9,372		89 80	172 98	9,102 02	-472 23	58 19	475.80	12.00	12 00	0 00	- 1
9,400	00	89 80	172 98	9,102 12	-499 13	61 51	502.90	0 00	0 00	0 00	
9,500	00	89 80	172 98	9,102 47	-598 38	73.74	602.90	0 00	0 00	0 00	
9,600	00	89 80	172 98	9,102 82	-697 62	85 97	702 90	0 00	0.00	0 00	-
9,700	00	89 80	∙172 98	9,103 17	-796 87	98 20	802 90	0 00	0 00	0 00	1
9,800	00	89 80	172 98	9,103 52	-896 12	110 43	902 90	0 00	0 00	0 00	
9,900	.00	89 80	172 98	9,103 86	-995 37	. 122 66	1,002 90	0 00	0 00	0 00	- 1
10,000	.00	89 80	172 98	9,104 21	-1,094 62	134 89	1,102 90	0 00	. 0 00	0 00	
10,100		89 80	172 98	9 104 56	-1,193 87	147 12	1,202.90	0 00	0.00	0 00	-
10,200		89 80	172 98	9,104 91	-1,293 12	159 35	1,302 90	0 00	0 00	0 00	
10,300	00	89 80	172 98	9,105 26	-1,392 37	171 58	1,402 90	0.00	0 00	0.00	
10,400		89 80	172 98	9,105 61	-1,491,61	183 81	1,502 90	0 00	0 00	0.00	
10:500		89.80	172.98 .	9,105,96	-1,590,86	196,04	1,602,90	0,00	0 00	0.00	-

Planning Report

Database: Company: Project:

Site:

Well:

Wellbore:

Design:

Drilling Database Permian District

Poker Lake

PĽU Remuda Basifi 4-24-30 USA 1H

Well #1 Wellbore #1 Plat

Local Co-ordinate Reference:

TVD Reference: MD Reference: North Reference:

Survey Calculation Method:

Well Well #1 WELL @ o oott (Original Well Elev) WELL @ o.oott (Original Well Elev)

Minimum Curvature

Planned Survey

Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft):	Dogleg Rate (*/100usft)	Build Rate (°/100usft)	Turn Rate (*/100usft)
10,600 00	89.80	172 98	9,106 31	-1,690 11	208 27	1,702 90	0 00	0 00	0 00
10,700 00	89 80	172 98	9,106 66	-1,789 36	220 50	1,802 89	0 00	0 00	0.00
10,800 00	89 80	172 98	9,107 01	-1,888.61	232 73	1,902 89	0 00	0 00	0.00
10,900 00	89 80	172 98	9,107 36	-1,987.86	244 96	2,002 89	0 00	0.00	0 00
11,000 00	89 80	172 98	9,107 70	2,087.11	257,19	2,102 89	0 00	0 00	0 00
11,100 00	89 80	172 98	9,108 05	-2,186 36	269 42	2,202 89	0 00	0 00	0.00
11,200 00	89 80	172 98	9,108 40	-2,285 60	281 65	2,302 89	0 00	0 00	0.00
11,300 00	89 80	172 98	9,108.75	-2,384 85	293 88	2,402 89	0 00	0 00	0 00
11,400 00	89 80	172 98	9,109 10	-2,484 10	306 11	2,502 89	0 00	0.00	0 00
11,500 00	89 80	172 98	9,109 45	-2,583.35	318 34	2,602 89	0 00	0 00	0 00
11,600 00	89 80	172 98	9,109 80	-2,682 60	330 57	2,702 89	0 00	0 00	0 00
11,700 00	89 80	172 98	9,110 15	-2,781.85	342 80	2,802 89	0 00	0 00	0 00
11,800.00	89 80	172 98	9,110 50	-2,881 10	355 03	2,902 89	0 00	0 00	0 00
11,900 00	89.80	172 98	9,110 85	-2,980 34	. 3,67 26	3,002 89	0.00	0 00	0 00
12,000 00	89 80	172 98	9,111 19	-3,079 59	379 49	3,102 89	0 00	, 0.00	0 00
12,100 00	89 80	172 98	9,111 54	-3,178 84	391 72	3,202 89	0 00	0.00	0.00
12,200 00	89.80	172 98	9,111 89	-3,278.09	403 95	3,302 89	0 00	0 00	0 00
12,300 00	89 80	172 98	9,112.24	-3,377.34	416 18	3,402 88	0 00	0 00	0 00
12,400.00	89 80	172,98	9,112 59	-3,476 59	428 41	3,502 88	0 00	0 00	0.00
12,500 00	89 80	172.98	9,112 94	-3,575 84	440 64	3,602 88	0.00	0 00	0 00
12,600 00	89 80	172 98.	9,113 29	-3,675 09	452 87	3,702 88	. 0 00	0 00	0 00
12,700 00	89 80	172 98	9,113 64	-3,774 33	465 10	3,802.88	0.00	0 00	0.00
12,800 00	89 80	172 98	9,113 99	-3.873 58	477 33	3,902.88	0.00	0 00	0 00
12,900 00	89 80	172,98	9,114 34	-3,972.83	489 56	4,002 88	0 00	0 00	,0 00
13,000 00	89 80	172 98	9,114 69	-4,072 08	501 79	4,102 88	0 00	0 00	0 00
13,100 00	89 80	172.98	9,115.03	-4,171 33	514.02	4,202.88	0.00	. 0 00	0 00
13,200 00	89 80	172 98	9,115 38	-4,270 58	526 25	4,302 88	0 00 ,	0.00	0 00
13,300 00	89 80	172 98	•9,115 73	-4,369 83	538 48	4,402 88	0 00	0.00	0.00
13,400 00	89 80	172 98 ·	9,116,08	-4,469 08	550 71	4,502 88	0.00	0 00	0 00
13,500.00	89 80	172.98	9,116 43	-4;568 32	562.94	. 4,602 88	0 00	0 00	0 00
13,600 00	89 80	172 98	9,116 78	-4,667.57	575 17	4,702 88	0 00	0 00	0 00
13,700 00	89 80	172 98	9,117 13	-4,766 82	587 40	4,802 88	0.00	0 00	0 00
13,800 00	89 80	172 98	9,117 48	-4,866 07	599 63	4,902 88	0.00	0 00	0 00
13,900,00	89 80	172 98	9,117.83	-4,965.32	611 86	5,002 88	0 00	0:00	0 00
13,949 57	89 80	172 98	9,118 00	-5,014,52	617 92	5,052 44	0.00	0 00	0 00

	ı Ta		

Target Name - hil/miss target D	ip Angle	Dlp Dir.	TVD	+Ñ/-S	+E/-W	Northing	Easting		
Shape	(s)		(ft)	(ft)	(ft)	(usft)	(usft)	Latitude	Longitude
SHL	0 00	0:00 15# at 9000 (9,101 00	0,00 62.49 TVD -13	0 00 80 10 N 17 1	456,276.39	680,982.20	32.253572	-103 881604

- Point

0 00

0 00 9,118 00 -5,014 52

617.92


451,261 89

681,600 12

32 239781

-103 879674

plan hits target center

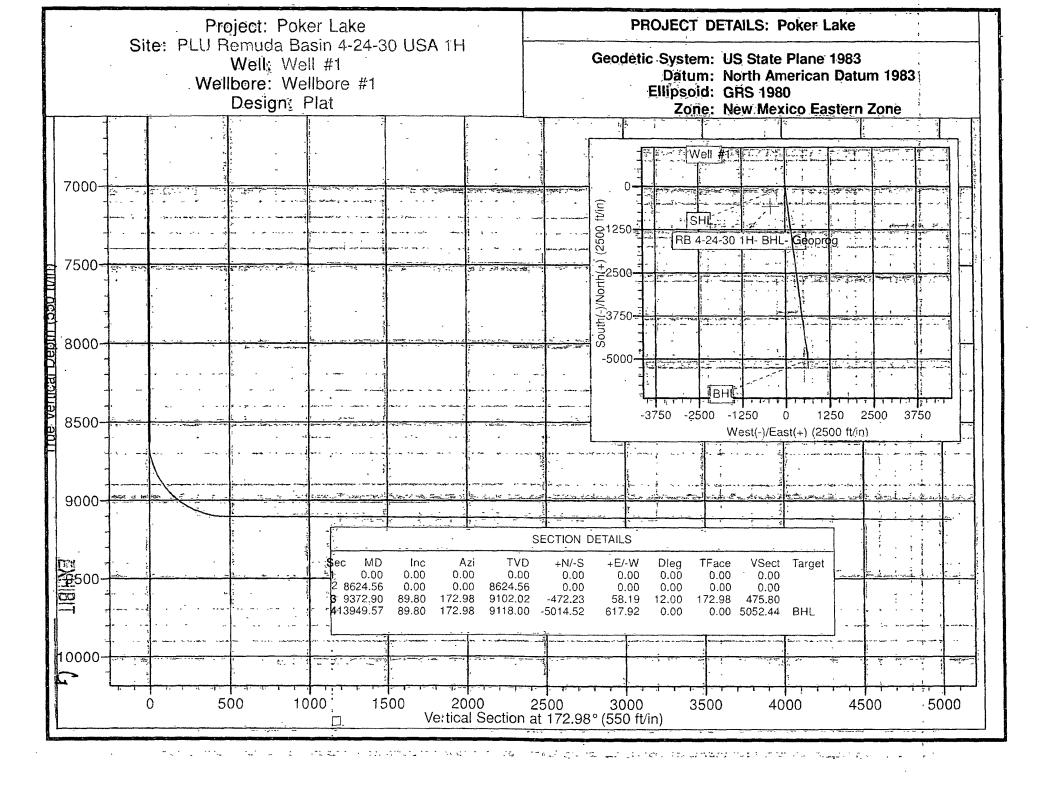

Chesapeake Minimum BOPE Requirements

Wellname: PLU Remuda Basin 4 24 30 USA 1H

Operation: Intermediate and Production Hole Sections

BLOWOUT PREVENTOR SCHEMATIC

CHESAPEAKE OPERATING INC

Permian District-Minimum Requirements

FIELD


: Avalon

OPERATION: Intermediate and Production Hole Sections

SIZE PRESSURE DESCRIPTION Rotating Head 500 В Annular 13 5/8 5,000 C 13 6/8 5,000 Pipe Ram D 13,518 5,000 Blind Ram Mud Cross E. 5,000 13 5/6 DSA As required for each hole size C-Sec 13-5/8" 3K x 11" 5K A-Sec 13:3/8" SOW x 13-5/8" 3K

Test Notes

- Pressure test to rating of BOP or wellhead every,21 days. Function test on trips H2S service trim required

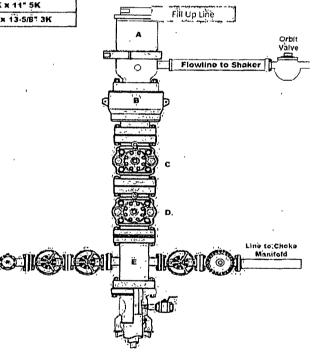

Kill Line

2" 5,000 Check Valve 2" 5,000 Gate Valve 2" 5,000 Gate Valve	SIZE	PRESSURE	DESCRIPTION
- S,000 Cute valve	2"	5,000	Check Valve
2" 5,000 Gate Välve	2"	. 5,000	Gate Valve
	· . 5	5,000	Gate Välve
		 -	

Choke Line

SIZE	PRESSURE	DESCRIPTION	
3"	5,000	Gate Valve	
3"	5,000	HCR Valvo	
3"	5,000	Steel Line Only	
	1		
	 		
	ł .i		

EXHIBIT FI

Chesapeake Minimum BOPE Requirements

Wellname: PLU Remuda Basin 4 24 30 USA 1H

'Operation': Intermediate and Production Hole Sections

CHOKE MANIFOLD SCHEMATIC CHESAPEAKE OPERATING INC Permian District **Avalon Minimum Requirements** Manual 2" Line and Valves 2" Line and Valves to Gas Separator 3" Hard Line from BOP Valve with Guage (on too 3" Panic/Line and Valves to open top pit block and to hydraulic choke) 2" Line and Valves 2" LÎne:and Valves to Pits Hydraulic Choke **Choke Manifold** SIZE PRESSURE DESCRIPTION 2" or 3" 5,000 Gate Valves 3'x 15' Gas Separator Gas Separator vent line 8"

Chesapeake Operating, Inc.'s Closed Loop System PLU REMIDA BASIN 4 24 30 USA 1H Unit P, Sec. 4, T-24-S R-30-E Eddy Co., NM API # TBD

Equipment & Design:

Chesapeake Operating, Inc. is to use a closed loop system with roll-off steel pits. This rig has:
One Derrick FLC-503 Dual Shale Shaker
One Derrick 3-Cone Desander
One Atmospheric Degasser

One Atmospheric Degasser One 500 bbl frac tank for fresh water One 500 bbl frac tank brine water

Operations & Maintenance:


During each and every tour, the rig's drilling crew will inspect and monitor closely the drilling fluids contained within the steel pits and visually monitor any spill which may occur.

Within 48 hours should a spill, release or leak occur, the NMOCD District II office in Artesia (575-748-1283) will be notified. Please note that notifications may be made earlier to the district office should a greater release occur.

Closure:

During and after drilling operations, liquids (which apply), all drill cuttings and drilling fluids will be hauled and disposed to the Controlled Recovery, Inc.'s location.

The permit number for Controlled Recovery, Inc. is: NM-01-0006 The alternative disposal facility will be Sundance Disposal. Their permit # is: NM-01-0003.

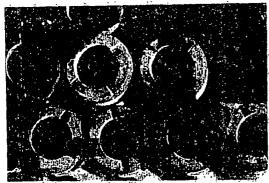





RIG #62

DRAWWORKS

Skytop Brewster N-75-M (1000HP) 1 1/4" drill line, Parmac 342 auxillary brake

POWER

(2) Caterpillar 379 engines (550HP each)

LIGHT PLANTS

(2) Caterpillar C-15 engines w/ 320 KW generators

MAST

Ideal 137' w/ 622,000# capacity on 10 lines

SUBSTRUCTURE

Ideal 15' box on box KB 17' · Rotary beam clearance 12' 3"

BLOCK HOOK

McKissick (300 Ton) combo

PUMPS

(2) National 10-P-130 (1300HP each) triplex pumps Each independently powered by (1) Caterpil'ar 3512 engine

MUD PITS

(2) tank system - 980 bbl capacity w/ 100 bbl slug pit

SOLIDS EQUIPMENT

Derrick FLC 503 Dual Shaker Derrick 3 cone desander Derrick 20 cone desilter Atmospheric degasser (5) mud agitators

BOP'S

13 5/8" X 5,000 psi Hydril annular 13 5/8" X 5,000 psi Shaffer double

ACCUMULATOR

Koomey 5-Station, 110 gallon accumulator

CHOKE MANIFOLD

5,000 psi choke manifold

SWIVEL

Continental Emsco (400 Ton)

ROTARY TABLE National (27 1/2")

DRILL PIPE

4 1/2" drill pipe

DRILL COLLARS

6" and 6 1/2" drill collars *quantity subject to availability

AUXILIARY EQUIPMENT

Pason EDR (base, system) Fuel Tank - 10,000 gallon capacity Water Tank ; (2) 500 barrel capacity each Rig Manager Quarters NOV ST-90 from Roughneck Satellite automatic driller Mathey/survey/unit




Revised 10.01 09,

Chesapeake Operating, Inc.

Legals: PLU REMUDA BASIN 4-24-30 USA 1H 643672

32.25344880 / -103.88111630 Rig Line: 5, Contractor: Latshaw, Rig Number: 14 Eddy County, NM

H₂S "Contingency Plan"

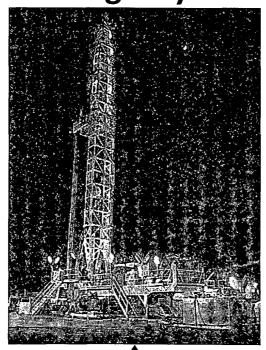



Safety Solutions, LLC 7907 Industrial

(432) 563-0400 Midland, TX 79706

Emergency Assistance Telephone List

PUBLIC SAFETY:		911 or
Eddy Nm County Sheriff's Department		(575) 887-7551
Fire Department:		
Eddy County		(575) 628-5451
Carlsbad		(575) 885-3125
Hospitals:		
Carlsbad Medical Center		(505) 887-4100
Artesia General Medical		(505) 748-3333
Dept. of Public Safety/Carlsbad NM		(575) 887-7551
NM Dept. of Transportation		(505) 827-5100
NM Railroad Commission		(817) 307-7210
U.S. Dept. of Labor		(806) 743-7681
AirMed/ Care Star		(877) 264-3570
Chesapeake Operating, Inc.		
Chesapeake / Midland	Offi	ce (432) 687-2992
Company Drilling Consultants:		
Nathan Berg	Cell	(405) 618-0767
Marcus Garcia		
Trailer		(832) 380-6700
Drilling Engineer		
Chris Gary	Cell	(405) 935-4346
Drilling Superintendent		
Tim Hartsfield	Ce	II (432) 940-9978
Latshaw Superintendent		
Ray Ash	Cel	l (432) 638-2008
<u>Latshaw</u>		(918) 355-4380
Tool Pusher:		
Lupe Rodriquez	Cell	(432) 755-4418
Jason	Cell	(432) 556-0675
		(832) 380-6700
Safety Director	6.11	(0.40) 0.67, 4403
Cody Ashley	Cell	•
Arron Gallegos	Cell	(432) 638-7734
Safety Consultants		(400) 500 0400
Safety Solutions, LLC		(432) 563-0400
Cliff Strasner	Cell	(432) 894-9789
Craig Strasner	Cell	(432) 894-0341
Table of Contents		

I. H₂S Contingency Plan

- a. Scope
- b. Objective
- c. Discussion of Plan

II. Emergency Procedures

- a. Emergency Procedures
- b. Emergency Reaction Steps
- c. Simulated Blowout Control Drills

III. Ignition Procedures

- a. Responsibility
- b. Instructions

IV. Training Requirements

V. Emergency Equipment

VI. Check Lists

- a. Status Check List
- b. Procedural Check List

VII. Briefing Procedures

VIII. Evacuation Plan

- a. General Plan
- b. Emergency Phone Lists

IX. Maps and Plats

- a. Location Plat
- b. Map to Location
- c. Radius of Exposure

X. General Information

- a. Drilling/Re-entry Permits
- b. H-9 Permit
- c. H₂S Permissible Limits
- d. Toxicity Table
- e. Physical Properties
- f. Respirator Use
- g. Emergency Rescue

H2S CONTINGENCY PLAN SECTION

Scope:

This contingency plan provides an organized plan of action for alerting and protecting the public within an area of exposure prior to an intentional release, or following the accidental release of a potentially hazardous volume of hydrogen sulfide. The plan establishes guidelines for all personnel whose work activity may involve exposure to Hydrogen Sulfide Gas (H₂S).

Objective:

Prevent any and all accidents, and prevent the uncontrolled release of H₂S into the atmosphere.

Provide proper evacuation procedures to cope with emergencies.

Provide immediate and adequate medical attention should an injury occur.

Discussion of Plan:

Suspected Problem Zones:

Implementation: This plan, with all details, is to be fully implemented 1000' before drilling into the first sour zone.

Emergency Response Procedure: This section outlines the conditions and denotes steps to be taken in the event of an emergency.

Emergency Equipment and Procedure: This section outlines the safety and emergency equipment that will be required for the drilling of this well.

Training Provisions: This section outlines the training provisions that must be adhered to 1000' before drilling into the first sour zone.

Emergency call list: Included are the telephone numbers of all persons that would need to be contacted, should an H₂S emergency occur.

Briefing: This section deals with the briefing of all persons involved with the drilling of this well.

Public Safety: Public Safety Personnel will be made aware of the drilling of this well.

Check Lists: Status check lists and procedural check lists have been included to ensure adherence to the plan.

General Information: A general information section has been included to supply support information.

EMERGENCY PROCEDURES SECTION

- I. In the event of any evidence of H₂S level above 10ppm, take the following steps immediately:
 - a. Secure breathing apparatus.
 - b. Order non-essential personnel out of the danger zone.
 - c. Take steps to determine if the H₂S level can be corrected or suppressed, and if so, proceed with normal operations.
- II. If uncontrollable conditions occur, proceed with the following:
 - Take steps to protect and/or remove any public downwind of the rig, including partial evacuation or isolation. Notify necessary public safety personnel and the New Mexico Oil Conservation Division of the situation.
 - b. Remove all personnel to the Safe Briefing Area.
 - c. Notify public safety personnel for help with maintaining roadblocks and implementing evacuation.
 - d. Determine and proceed with the best possible plan to regain control of the well. Maintain tight security and safety measures.

III. Responsibility:

- a. The Company Approved Supervisor shall be responsible for the total implementation of the plan.
- b. The Company Approved Supervisor shall be in complete command during any emergency.
- c. The Company Approved Supervisor shall designate a back up Supervisor in the event that he/she is not available.

EMERGENCY PROCEDURE IMPLEMENTATION

I. Drilling or Tripping

a. All Personnel

- i. When alarm sounds, don escape unit and report to upwind Safe Briefing Area.
- ii. Check status of other personnel (buddy system).
- iii. Secure breathing apparatus.
- iv. Wait for orders from supervisor.

b. Drilling Foreman

- i. Report to the upwind Safe Briefing Area.
- **ii.** Don Breathing Apparatus and return to the point of release with the Tool Pusher or Driller (buddy system).
- iii. Determine the concentration of H₂S.
- iv. Assess the situation and take appropriate control measures.

c. Tool Pusher

- i. Report to the upwind Safe Briefing Area.
- ii. Don Breathing Apparatus and return to the point of release with the Drilling Foreman or the Driller (buddy system).
- iii. Determine the concentration of H₂S.
- iv. Assess the situation and take appropriate control measures.

d. Driller

- i. Check the status of other personnel (in a rescue attempt, always use the buddy system).
- ii. Assign the least essential person to notify the Drilling Foreman and Tool Pusher, in the event of their absence.
- iii. Assume the responsibility of the Drilling Foreman and the Tool Pusher until they arrive, in the event of their absence.

e. Derrick Man and Floor Hands

i. Remain in the upwind Safe Briefing Area until otherwise instructed by a supervisor.

f. Mud Engineer

- i. Report to the upwind Safe Briefing Area.
- ii. When instructed, begin check of mud for pH level and H₂S level.

g. Safety Personnel

- i. Don Breathing Apparatus.
- ii. Check status of personnel.
- iii. Wait for instructions from Drilling Foreman or Tool Pusher.

II. Taking a Kick

- a. All Personnel report to the upwind Safe Briefing Area.
- b. Follow standard BOP procedures.

III. Open Hole Logging

- a. All unnecessary personnel should leave the rig floor.
- **b.** Drilling Foreman and Safety Personnel should monitor the conditions and make necessary safety equipment recommendations.

IV. Running Casing or Plugging

- a. Follow "Drilling or Tripping" procedures.
- **b.** Assure that all personnel have access to protective equipment.

SIMULATED BLOWOUT CONTROL DRILLS

All drills will be initiated by activating alarm devices (air horn). One long blast, on the air horn, for ACTUAL and SIMULATED Blowout Control Drills. This operation will be performed by the Drilling Foreman or Tool Pusher at least one time per week for each of the following conditions, with each crew:

Drill #1 Bottom Drilling

Drill #2 Tripping Drill Pipe

In each of these drills, the initial reaction time to shutting in the well shall be timed as well as the total time for the crew to complete its entire pit drill assignment. The times must be recorded on the IADC Driller's Log as "Blowout Control Drill".

Drill No.:

Reaction Time to Shut-In: minutes, seconds.

Total Time to Complete Assignment: minutes, seconds.

I. Drill Overviews

- a. Drill No. 1 Bottom Drilling
 - i. Sound the alarm immediately.
 - ii. Stop the rotary and hoist Kelly joint above the rotary table.
 - iii. Stop the circulatory pump.
 - iv. Close the drill pipe rams.
 - v. Record casing and drill pipe shut-in pressures and pit volume increases.
- b. Drill No. 2 Tripping Drill Pipe
 - i. Sound the alarm immediately.
 - ii. Position the upper tool joint just above the rotary table and set the slips.
 - iii. Install a full opening valve or inside blowout preventer tool in order to close the drill pipe.
 - iv. Close the drill pipe rams.
 - v. Record the shut-in annular pressure.

II. Crew Assignments

a. Drill No. 1 - Bottom Drilling

i. Driller

- 1. Stop the rotary and hoist Kelly joint above the rotary table.
- 2. Stop the circulatory pump.
- 3. Check Flow.
- 4. If flowing, sound the alarm immediately
- 5. Record the shit-in drill pipe pressure
- 6. Determine the mud weight increase needed or other courses of action.

ii. Derrickman

- 1. Open choke line valve at BOP.
- 2. Signal Floor Man #1 at accumulator that choke line is open.
- 3. Close choke and upstream valve after pipe tam have been closed.
- 4. Read the shut-in annular pressure and report readings to Driller.

iii. Floor Man #1

- 1. Close the pipe rams after receiving the signal from the Derrickman.
- 2. Report to Driller for further instructions.

iv. Floor Man #2

- 1. Notify the Tool Pusher and Operator representative of the H₂S alarms.
- 2. Check for open fires and, if safe to do so, extinguish them.
- 3. Stop all welding operations.
- 4. Turn-off all non-explosions proof lights and instruments.
- 5. Report to Driller for further instructions.

v. Tool Pusher

- 1. Report to the rig floor.
- 2. Have a meeting with all crews.

- 3. Compile and summarize all information.
- 4. Calculate the proper kill weight.
- 5. Ensure that proper well procedures are put into action.

vi. Operator Representative

- 1. Notify the Drilling Superintendent.
- 2. Determine if an emergency exists and if so, activate the contingency plan.

b. Drill No. 2 - Tripping Pipe

i. Driller

- Sound the alarm immediately when mud volume increase has been detected.
- 2. Position the upper tool joint just above the rotary table and set slips.
- 3. Install a full opening valve or inside blowout preventer tool to close the drill pipe.
- 4. Check flow.
- 5. Record all data reported by the crew.
- 6. Determine the course of action.

ii. Derrickman

- 1. Come down out of derrick.
- 2. Notify Tool Pusher and Operator Representative.
- 3. Check for open fires and, if safe to do so, extinguish them.
- 4. Stop all welding operations.
- 5. Report to Driller for further instructions.

iii. Floor Man #1

- 1. Pick up full opening valve or inside blowout preventer tool and stab into tool joint above rotary table (with Floor Man #2).
- 2. Tighten valve with back-up tongs.

- 3. Close pipe rams after signal from Floor Man #2.
- 4. Read accumulator pressure and check for possible high pressure fluid leaks in valves or piping.
- 5. Report to Driller for further instructions.

iv. Floor Man #2

- 1. Pick-up full opening valve or inside blowout preventer tool and stab into tool joint above rotary table (with Floor Man #1).
- 2. Position back-up tongs on drill pipe.
- 3. Open choke line valve at BOP.
- 4. Signal Floor Man #1 at accumulator that choke line is open.
- 5. Close choke and upstream valve after pipe rams have been closed.
- 6. Check for leaks on BOP stack and choke manifold.
- 7. Read annular pressure.
- 8. Report readings to the Driller.

v. Tool Pusher

- 1. Report to the rig floor.
- 2. Have a meeting with all of the crews.
- 3. Compile and summarize all information.
- 4. See that proper well kill procedures are put into action.

vi. Operator Representative

- 1. Notify Drilling Superintendent
- 2. Determine if an emergency exists, and if so, activate the contingency plan.

IGNITION PROCEDURES

Responsibility:

The decision to ignite the well is the responsibility of the DRILLING FOREMAN in concurrence with the STATE POLICE. In the event the Drilling Foreman is incapacitated, it becomes the responsibility of the RIG TOOL PUSHER. This decision should be made only as a last resort and in a situation where it is clear that:

- 1. Human life and property are endangered.
- 2. There is no hope of controlling the blowout under the prevailing conditions.

If time permits, notify the main office, but do not delay if human life is in danger. Initiate the first phase of the evacuation plan.

Instructions for Igniting the Well:

- Two people are required for the actual igniting operation. Both men must wear self-contained breathing apparatus and must use a full body harness and attach a retrievable safety line to the D-Ring in the back. One man must monitor the atmosphere for explosive gases with the LEL monitor, while the Drilling Foreman is responsible for igniting the well.
- 2. The primary method to ignite is a 25mm flare gun with a range of approximately 500 feet.
- 3. Ignite from upwind and do not approach any closer than is warranted.
- 4. Select the ignition site best suited for protection and which offers an easy escape route.
- 5. Before igniting, check for the presence of combustible gases.
- 6. After igniting, continue emergency actions and procedures as before.
- 7. All unassigned personnel will limit their actions to those directed by the Drilling Foreman.

Note: After the well is ignited, burning Hydrogen Sulfide will convert to Sulfur Dioxide, which is also highly toxic. Do not assume the area is safe after the well is ignited.

TRAINING PROGRAM

When working in an area where Hydrogen Sulfide (H_2S) might be encountered, definite training requirements must be carried out. The Company Supervisor will ensure that all personnel, at the well site, have had adequate training in the following:

- 1. Hazards and characteristics of Hydrogen Sulfide.
- 2. Physicals effects of Hydrogen Sulfide on the human body.
- 3. Toxicity of Hydrogen Sulfide and Sulfur Dioxide.
- 4. H₂S detection, Emergency alarm and sensor location.
- 5. Emergency rescue.
- 6. Resuscitators.
- 7. First aid and artificial resuscitation.
- 8. The effects of Hydrogen Sulfide on metals.
- 9. Location safety.

Service company personnel and visiting personnel must be notified if the zone contains H₂S, and each service company must provide adequate training and equipment for their employees before they arrive at the well site.

EMERGENCY EQUIPMENT REQUIREMENTS

Lease Entrance Sign:

Should be located at the lease entrance with the following information:

CAUTION – POTENTIAL POISON GAS HYDROGEN SULFIDE NO ADMITTANCE WITHOUT AUTHORIZATION

Respiratory Equipment:

- Fresh air breathing equipment should be placed at the safe briefing areas and should include the following:
- Two SCBA's at each briefing area.
- Enough air line units to operate safely, anytime the H₂S concentration reaches the IDLH level (100 ppm).
- Cascade system with enough breathing air hose and manifolds to reach the rig floor, the derrickman and the other operation areas.

Windsocks or Wind Streamers:

- A minimum of two 10" windsocks located at strategic locations so that they may be seen from any point on location.
- Wind streamers (if preferred) should be placed at various locations on the well site to ensure wind consciousness at all times. (Corners of location).

Hydrogen Sulfide Detector and Alarms:

- 1 Four channel H₂S monitor with alarms.
- Four (4) sensors located as follows: #1 Rig Floor, #2 Bell Nipple, #3 Shale Shaker, #4 Mud
- Gastec or Draeger pump with tubes.
- Sensor test gas.

Well Condition Sign and Flags:

The Well Condition Sign w/flags should be placed a minimum of 150' before you enter the location. It should have three (3) color coded flags (green, yellow and red) that will be used to denote the following location conditions:

GREEN – Normal Operating Conditions YELLOW – Potential Danger RED – Danger, H₂S Gas Present

Auxiliary Rescue Equipment:

- Stretcher
- 2 100' Rescue lines.
- First Aid Kit properly stocked.

Mud Inspection Equipment:

Garret Gas Train or Hach Tester for inspection of Hydrogen Sulfide in the drilling mud system.

Fire Extinguishers:

Adequate fire extinguishers shall be located at strategic locations.

Blowout Preventer:

- The well shall have hydraulic BOP equipment for the anticipated BHP.
- The BOP should be tested upon installation.
- BOP, Choke Line and Kill Line will be tested as specified by Operator.

Confined Space Monitor:

There should be a portable multi-gas monitor with at least 3 sensors (O_2 , LEL H_2S). This instrument should be used to test the atmosphere of any confined space before entering. It should also be used for atmospheric testing for LEL gas before beginning any type of Hot Work. Proper calibration documentation will need to be provided.

Communication Equipment:

- Proper communication equipment such as cell phones or 2-way radios should be available at the rig.
- Radio communication shall be available for communication between the company man's trailer, rig floor and the tool pusher's trailer.

• Communication equipment shall be available on the vehicles.

Special Control Equipment:

- Hydraulic BOP equipment with remote control on the ground.
- Rotating head at the surface casing point.

Evacuation Plan:

- Evacuation routes should be established prior to spudding the well.
- Should be discussed with all rig personnel.

Designated Areas:

Parking and Visitor area:

- All vehicles are to be parked at a pre-determined safe distance from the wellhead.
- · Designated smoking area.

Safe Briefing Areas:

- Two Safe Briefing Areas shall be designated on either side of the location at the maximum allowable distance from the well bore so they offset prevailing winds or they are at a 180 degree angle if wind directions tend to shift in the area.
- Personal protective equipment should be stored at both briefing areas or if a moveable cascade trailer is used, it should be kept upwind of existing winds. When wind is from the prevailing direction, both briefing areas should be accessible.

Note:

- Additional equipment will be available at the Safety Solutions, LLC office.
- Additional personal H₂S monitors are available for all employees on location.
- Automatic Flare Igniters are recommended for installation on the rig.

CHECK LISTS

Status Check List

Note: Date each item as they are implemented.

1.	Sign at location entrance.
2.	Two (2) wind socks (in required locations).
3.	Wind Streamers (if required).
4.	SCBA's on location for all rig personnel and mud loggers.
5.	Air packs, inspected and ready for use.
6.	Spare bottles for each air pack (if required).
7.	Cascade system for refilling air bottles.
8.	Cascade system and hose line hook up.
9.	Choke manifold hooked-up and tested. (before drilling out surface casing.)
10.	Remote Hydraulic BOP control (hooked-up and tested before drilling out surface casing).
11.	BOP tested (before drilling out surface casing).
12.	Mud engineer on location with equipment to test mud for H₂S.
13.	Safe Briefing Areas set-up
14.	Well Condition sign and flags on location and ready.
15.	Hydrogen Sulfide detection system hooked -up & tested.
16.	Hydrogen Sulfide alarm system hooked-up & tested.
17.	Stretcher on location at Safe Briefing Area.
18.	2 – 100' Life Lines on location.
19.	1 – 20# Fire Extinguisher in safety trailer.
20.	Confined Space Monitor on location and tested.
21.	All rig crews and supervisor trained (as required).

22. Access restricted for unauthorized personnel.	
23. Drills on H ₂ S and well control procedures.	
24. All outside service contractors advised of potential H ₂ S on the well.	
25. NO SMOKNG sign posted.	
26. H₂S Detector Pump w/tubes on location.	
27. 25mm Flare Gun on location w/flares.	
28. Automatic Flare Igniter installed on rig.	

Procedural Check List

Perform the following on each tour:

- 1. Check fire extinguishers to see that they have the proper charge.
- 2. Check breathing equipment to insure that they have not been tampered with.
- 3. Check pressure on the supply air bottles to make sure they are capable of recharging.
- 4. Make sure all of the Hydrogen Sulfide detection systems are operative.

Perform the following each week:

- 1. Check each piece of breathing equipment to make sure that they are fully charged and operational. This requires that the air cylinder be opened and the mask assembly be put on and tested to make sure that the regulators and masks are properly working. Negative and Positive pressure should be conducted on all masks.
- 2. BOP skills.
- 3. Check supply pressure on BOP accumulator stand-by source.
- 4. Check all breathing air mask assemblies to see that straps are loosened and turned back, ready for use.
- 5. Check pressure on cascade air cylinders to make sure they are fully charged and ready to use for refill purposes if necessary.
- 6. Check all cascade system regulators to make sure they work properly.
- 7. Perform breathing drills with on-site personnel.
- 8. Check the following supplies for availability:
 - Stretcher
 - Safety Belts and Ropes
 - Spare air Bottles
 - Spare Oxygen Bottles (if resuscitator required)
 - Gas Detector Pump and Tubes
 - Emergency telephone lists
- 9. Test the Confined Space Monitor to verify the batteries are good

BRIEFING PROCEDURES

The following scheduled briefings will be held to ensure the effective drilling and operation of this project:

Pre-Spud Meeting

Date: Prior to spudding the well.

Attendance: Drilling Supervisor

Drilling Engineer
Drilling Foreman
Rig Tool Pushers
Rig Drillers
Mud Engineer
All Safety Personnel

Key Service Company Personnel

Purpose: Review and discuss the well program, step-by-step, to insure complete understanding of

assignments and responsibilities.

EVACUATION PLAN

General Plan

The direct lines of action prepared by SAFETY SOLUTIONS, LLC to protect the public from hazardous gas situations are as follows:

- 1. When the company approved supervisor (Drilling Foreman, Tool Pusher or Driller) determine that Hydrogen Sulfide gas cannot be limited to the well location, and the public will be involved, he will activate the evacuation plan. Escape routes are noted on the area map.
- 2. Company safety personnel or designee will notify the appropriate local government agency that a hazardous condition exists and evacuation needs to be implemented.
- 3. Company approved safety personnel that have been trained in the use of the proper emergency equipment will be utilized.
- 4. Law enforcement personnel (State Police, Local Police Department, Fire Department, and the Sheriff's Department) will be called to aid in setting up and maintaining road blocks. Also, they will aid in evacuation of the public if necessary.

NOTE: Law enforcement personnel will not be asked to come into a contaminated area. Their assistance will be limited to uncontaminated areas. Constant radio contact will be maintained with them.

5. After the discharge of gas has been controlled, "Company" safety personnel will determine when the area is safe for re-entry.

See Emergency Action Plan

MAPS AND PLATS (Maps & Plats Attached)

Affected Notification List

The geologic zones that will be encountered during drilling are known to contain hazardous quantities of H_2S . The accompanying map illustrates the affected areas of the community. The residents within this radius will be notified via a hand delivered written notice describing the activities, potential hazards, conditions of evacuation, evacuation drill siren alarms and other precautionary measures.

Evacuee Description:

Residents: THERE ARE NO RESIDENTS WITHIN 3000' ROE.

Notification Process:

A continuous siren audible to all residence will be activated, signaling evacuation of previously notified and informed residents.

Evacuation Plan:

All evacuees will migrate lateral to the wind direction.

The Oil Company will identify all home bound or highly susceptible individuals and make special evacuation preparations, interfacing with the local and emergency medical service as necessary.

***Given no offset well info about H2S Production, Chesapeake is assuming a ROE of 3000' for 100 ppm, as per Onshore Order 6. A search of the area surrounding the drilling location found no public buildings, roadways, or residences within 3000'.

GENERAL INFORMATION

Toxic Effects of H₂S Poisoning

Hydrogen Sulfide is extremely toxic. The acceptable ceiling concentration for eight-hour exposure is 10 PPM, which is .001% by volume. Hydrogen Sulfide is heavier than air (specific gravity -1.192) and is colorless and transparent. Hydrogen Sulfide is almost as toxic as Hydrogen Cyanide and is 5-6 times more toxic than Carbon Monoxide. Occupational exposure limits for Hydrogen Sulfide and other gases are compared below in Table 1. Toxicity table for H_2S and physical effects are shown in Table 2.

Table 1
Permissible Exposure Limits of Various Gases

Common Name	Symbol	Sp. Gravity	TLV	STEL	IDLH
Hydrogen Cyanide	HCN	.94	4.7 ppm	С	
Hydrogen Sulfide	H₂S	1.192	10 ppm	15 ppm	100 ppm
Sulfide Dioxide	SO ₂	2.21	2 ppm	5 ppm	
Chlorine	CL	2.45	.5 ppm	1 ppm	
Carbon Monoxide	СО	.97	25 ppm	200 ppm	
Carbon Dioxide	CO ₂	1.52	5000 ppm	30,000 ppm	
Methane	CH₄	.55	4.7% LEL	14% UEL	

Definitions

- A. TLV Threshold Limit Value is the concentration employees may be exposed based on a TWA (time weighted average) for eight (8) hours in one day for 40 hours in one (1) week. This is set by ACGIH (American Conference of Governmental Hygienists) and regulated by OSHA.
- B. STEL Short Term Exposure Limit is the 15 minute average concentration an employee may be exposed to providing that the highest exposure never exceeds the OEL (Occupational Exposure Limit). The OEL for H₂S is 19 PPM.
- C. IDLH Immediately Dangerous to Life and Health is the concentration that has been determined by the ACGIH to cause serious health problems or death if exposed to this level. The IDLH for H_2S is 100 PPM.
- D. TWA Time Weighted Average is the average concentration of any chemical or gas for an eight(8) hour period. This is the concentration that any employee may be exposed based on an TWA.

TABLE 2

		Toxicity Table of H₂S
Percent %	PPM	Physical Effects
.0001	1	Can smell less than 1 ppm.
.001	10	TLV for 8 hours of exposure.
.0015	15	STEL for 15 minutes of exposure.
.01	100	Immediately Dangerous to Life & Health. Kills sense of smell in 3 to 5 minutes.
.02	200	Kills sense of smell quickly, may burn eyes and throat.
.05	500	Dizziness, cessation of breathing begins in a few minutes.
.07	700	Unconscious quickly, death will result if not rescued promptly.
.10	1000	Death will result unless rescued promptly. Artificial resuscitation may be necessary.

PHYSICAL PROPERTIES OF H₂S

The properties of all gases are usually described in the context of seven major categories:

COLOR

ODOR

VAPOR DENSITY

EXPLOSIVE LIMITS

FLAMMABILITY

SOLUBILITY (IN WATER)

BOILING POINT

Hydrogen Sulfide is no exception. Information from these categories should be considered in order to provide a fairly complete picture of the properties of the gas.

COLOR - TRANSPARENT

Hydrogen Sulfide is colorless so it is invisible. This fact simply means that you can't rely on your eyes to detect its presence. In fact that makes this gas extremely dangerous to be around.

ODOR – ROTTEN EGGS

Hydrogen Sulfide has a distinctive offensive smell, similar to "rotten eggs". For this reason it earned its common name "sour gas". However, H₂S, even in low concentrations, is so toxic that it attacks and quickly impairs a victim's sense of smell, so it could be fatal to rely on your nose as a detection device.

VAPOR DENSITY - SPECIFIC GRAVITY OF 1.192

Hydrogen Sulfide is heavier than air so it tends to settle in low-lying areas like pits, cellars or tanks. If you find yourself in a location where H_2S is known to exist, protect yourself. Whenever possible, work in an area upwind and keep to higher ground.

EXPLOSIVE LIMITS - 4.3% TO 46%

Mixed with the right proportion of air or oxygen, H₂S will ignite and burn or explode, producing another alarming element of danger besides poisoning.

FLAMMABILITY

Hydrogen Sulfide will burn readily with a distinctive clear blue flame, producing Sulfur Dioxide (SO₂), another hazardous gas that irritates the eyes and lungs.

SOLUBILITY – 4 TO 1 RATIO WITH WATER

Hydrogen Sulfide can be dissolved in liquids, which means that it can be present in any container or vessel used to carry or hold well fluids including oil, water, emulsion and sludge. The solubility of H_2S is dependent on temperature and pressure, but if conditions are right, simply agitating a fluid containing H_2S may release the gas into the air.

BOILING POINT - (-76 degrees Fahrenheit)

Liquefied Hydrogen Sulfide boils at a very low temperature, so it is usually found as a gas.

RESPIRATOR USE

The Occupational Safety and Health Administration (OSHA) regulate the use of respiratory protection to protect the health of employees. OSHA's requirements are written in the Code of Federal Regulations, Title 29, Part 1910, Section 134, Respiratory Protection. This regulation requires that all employees who might be required to wear respirators, shall complete a OSHA mandated medical evaluation questionnaire. The employee then should be fit tested prior to wearing any respirator while being exposed to hazardous gases.

Written procedures shall be prepared covering safe use of respirators in dangerous atmospheric situations, which might be encountered in normal operations or in emergencies. Personnel shall be familiar with these procedures and the available respirators.

Respirators shall be inspected prior to and after each use to make sure that the respirator has been properly cleaned, disinfected and that the respirator works properly. The unit should be fully charged prior to being used.

Anyone who may use respirators shall be properly trained in how to properly seal the face piece. They shall wear respirators in normal air and then in a test atmosphere. (Note: Such items as facial hair (beard or sideburns) and eyeglass temple pieces will not allow a proper seal.) Anyone that may be expected to wear respirators should have these items removed before entering a toxic atmosphere. A special mask must be obtained for anyone who must wear eyeglasses. Contact lenses should not be allowed.

Respirators shall be worn during the following conditions:


- A. Any employee who works near the top or on the top of any tank unless tests reveal less than 20 ppm of H_2S .
- B. When breaking out any line where H₂S can reasonably be expected.
- C. When sampling air in areas where H₂S may be present.
- D. When working in areas where the concentration of H_2S exceeds the Threshold Limit Value for H_2S (10 ppm).
- E. At any time where there is a doubt as to the H₂S level in the area to be entered.

EMERGENCY RESCUE PROCEDURES

DO NOT PANIC!!!

Remain Calm - Think

- 1. Before attempting any rescue you must first get out of the hazardous area yourself. Go to a safe briefing area.
- 2. Sound alarm and activate the 911 system.
- 3. Put on breathing apparatus. At least two persons should do this, when available use the buddy system.
- 4. Rescue the victim and return them to a safe briefing area.
- 5. Perform an initial assessment and begin proper First Aid/CPR procedures.
- 6. Keep victim lying down with a blanket or coat, etc.., under the shoulders to keep airway open. Conserve body heat and do not leave unattended.
- 7. If the eyes are affected by H₂S, wash them thoroughly with potable water. For slight irritation, cold compresses are helpful.
- 8. In case a person has only minor exposure and does not lose consciousness totally, it's best if he doesn't return to work until the following day.
- 9. Any personnel overcome by H₂S should always be examined by medical personnel. They should always be transported to a hospital or doctor.

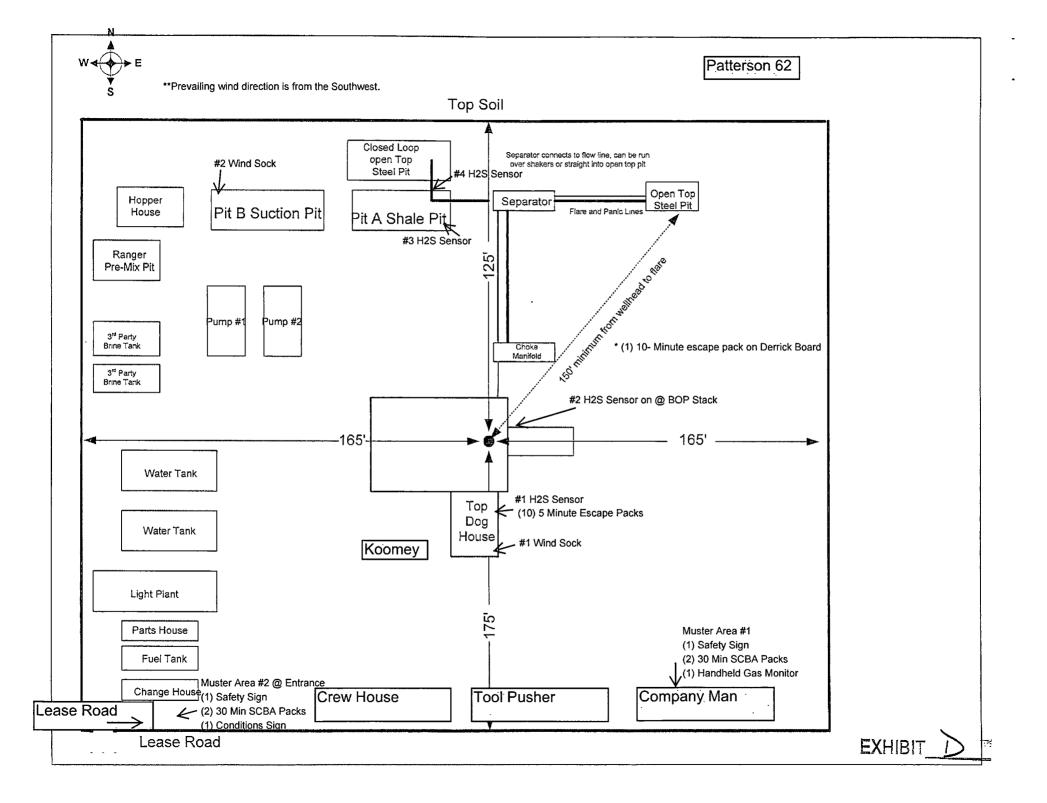





PLU Remuda Basin 4-24-30 USA 1H

Property # 643672

Lat.: N 32.2536" - Long.: W -103.8816" S04/T24S/R30E - 175' FNL & 1250' FWL



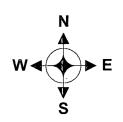

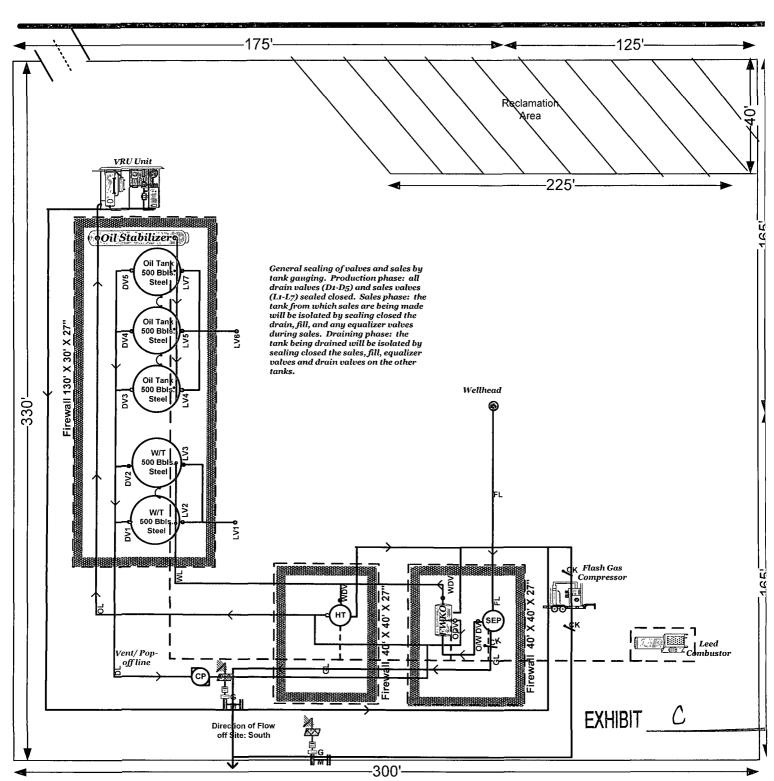

Prepared by: Donny Lowry Date: 03/20/2012 This lease is subject to Chesapeake's Site Security Plan located at 6100 N. Western Oklahoma City, OK 73118 All equipment shown will be on location, but subject to changes in positioning

PECOS DISTRICT CONDITIONS OF APPROVAL

OPERATOR'S NAME: CHESAPEAKE AGENT FOR BOPCO
LEASE NO.: LC068431
WELL NAME & NO.: 1H-PLU REMUDA BASIN 4 24 30
SURFACE HOLE FOOTAGE: 0175'/N. & 1250'/E.
BOTTOM HOLE FOOTAGE 0100'/S. & 0660'/E.
LOCATION: Section 4, T. 24 S., R. 30 E., NMPM
COUNTY: Eddy County, New Mexico

TABLE OF CONTENTS

Standard Conditions of Approval (COA) apply to this APD. If any deviations to these standards exist or special COAs are required, the section with the deviation or requirement will be checked below.

General Provisions
☐ Permit Expiration
Archaeology, Paleontology, and Historical Site
Noxious Weeds
Special Requirements
Temporary frac line not permitted
Commercial Well Determination
☐ Construction
Notification
Topsoil
Closed Loop System
Federal Mineral Material Pits
Well Pads
Roads
Road Section Diagram
Drilling
R-111-P Potash
Medium Cave/Karst
Logging requirements
Waste Material and Fluids
☐ Production (Post Drilling)
Well Structures & Facilities
Pipelines
Electric Lines
Interim Reclamation
Final Ahandanment & Reclamation