Form 3160-5 (August 2007)	UNITED STATES DEPARTMENT OF THE I	NTERIOR I	A E CFO	OMB	4 APPROVED NO. 1004-0135 s: July 31, 2010
SUNDE	BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS		5. Lease Serial No. NMNM109756		
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.			6. If Indian, Allottee or Tribe Name		
SUBMIT IN TRIPLICATE - Other instructions on reverse side.			7. If Unit or CA/Agreement, Name and/or No.		
1. Type of Well Gas Well Other			8. Well Name and No. PEACHES 19 FEDERAL 3H		
2. Name of Operator OXY USA INCORPORATED Contact: DAVID STEWART			9. API Well No. 30-015-42446-00-X1		
3a. Address 5 GREENWAY PLAZA ST HOUSTON, TX 77046-05		3b. Phone No. (include and code Ph: 432.685.5717	SOCD	10. Field and Pool, COTTONWO	or Exploratory OD DRAW
4. Location of Well (Footage, Se	and the second	AUG .	<u>I I 2015</u>	11. County or Paris	h, and State
Sec 19 T25S R27E SESW 32.110024 N Lat, 104.230			CEIVED	EDDY COUN	TY, NM
12. CHECK A	PPROPRIATE BOX(ES) TO	O INDICATE NATURE OF	NOTICE, R	EPORT, OR OTH	ER DATA
TYPE OF SUBMISSION		TYPE C	F ACTION		
Notice of Intent	□ Acidize	Deepen		tion (Start/Resume)	UWater Shut-Of
Subsequent Report	□ Alter Casing	Fracture Treat	Reclan		Well Integrity
Final Abandonment Notice	Casing Repair Change Plans	New Construction Plug and Abandon	Recom Tempo	plete rarily Abandon	Other Change to Origina
	Convert to Injection	— -			PD
following completion of the invest testing has been completed. Find determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pre	work will be performed or provide lved operations. If the operation re al Abandonment Notices shall be fi for final inspection.) requests approval for the fo -set surface casing for time	, give subsurface locations and meas c the Bond No. on file with BLM/BI ssults in a multiple completion or rec led only after all requirements, inclu sollowing changes to the drilling angeomesaving FACHE	A. Required so completion in a ding reclamation p plan: D FOR	rertical depths of all per ubsequent reports shall new interval, a Form 3 on, have been complete	rtinent markers and zones. be filed within 30 days 160-4 shall be filed once
following completion of the investigation of the investigation of the second completed. Final determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pre- Description of Operations 1. Spudder rig contractor 1 pre-set surface casing on a. After drilling each surface	work will be performed or provide lved operations. If the operation of a Abandonment Notices shall be fi- for final inspection.) requests approval for the fo -set surface casing for time a franscend Drilling will move all of the wells on a given pa be hole section, the rig will ru	, give subsurface locations and meas c the Bond No. on file with BLM/BI ssults in a multiple completion or rec led only after all requirements, inclu solowing changes to the drilling angene saving ACHE in Goon Durit Ache d. un casing and cement followi	A. Required su completion in a ding reclamation plan: DFOR Feapper	rertical depths of all per absequent reports shall new interval, a Form 3 on, have been complete ROVAL	tinent markers and zones. be filed within 30 days 160-4 shall be filed once d, and the operator has
following completion of the inve- testing has been completed. Fina determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pre Description of Operations 1. Spudder rig contractor 1 pre-set surface casing on a. After drilling each surface the applicable rules and re b. Rig will utilize fresh wat	work will be performed or provide lived operations. If the operation re al Abandonment Notices shall be fi for final inspection.) requests approval for the fo -set surface casing for time a franscend Drilling will move all of the wells on a given pa be hole section, the rig will ru gulations (OnShore Order 2 er based mud to drill 14-3/4"	, give subsurface locations and mease c the Bond No. on file with BLM/BI csults in a multiple completion or rec led only after all requirements, inclu angent saving Achter in CONDITIIONSCO d. un casing and cement followin , all COAs and NMOCD regu surface hole to TD. Solids co	A. Required si completion in a ding reclamatic p plan: D FOR ReAPP ng all of lations).	rertical depths of all per absequent reports shall new interval, a Form 3 on, have been complete ROVAL NM OII	trinent markers and zones. be filed within 30 days 160-4 shall be filed once d, and the operator has CONSERVATI RTESIA DISTRICT
following completion of the inve- testing has been completed. Fina determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pre Description of Operations 1. Spudder rig contractor 1 pre-set surface casing on a. After drilling each surface the applicable rules and re b. Rig will utilize fresh wat	work will be performed or provide lved operations. If the operation re al Abandonment Notices shall be fi for final inspection.) requests approval for the fo -set surface casing for time franscend Drilling will move all of the wells on a given pa be hole section, the rig will ru gulations (OnShore Order 2	, give subsurface locations and meas c the Bond No. on file with BLM/BI issults in a multiple completion or rec led only after all requirements, inclu angene saving ACHE in GON DUITINONSCO d. In casing and cement followi , all COAs and NMOCD regu 'surface hole to TD. Solids co its will be used.	A. Required si completion in a ding reclamatic p plan: D FOR ReAPP ng all of lations).	rertical depths of all per absequent reports shall new interval, a Form 3 on, have been complete ROVAL NM OII AF	tinent markers and zones. be filed within 30 days 160-4 shall be filed once d, and the operator has
following completion of the invertesting has been completed. Find determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pree Description of Operations 1. Spudder rig contractor Torre-set surface casing on a. After drilling each surface the applicable rules and reb. Rig will utilize fresh wat be handled entirely on a complexed of the set of t	work will be performed or provide lived operations. If the operation re al Abandonment Notices shall be fi for final inspection.) requests approval for the fo -set surface casing for time a -set surface casing for time a -ranscend Drilling will move all of the wells on a given pa be hole section, the rig will ru gulations (OnShore Order 2 er based mud, to drill 14-3/4" osed loop basis. No earth pi	, give subsurface locations and meas c the Bond No. on file with BLM/BI issults in a multiple completion or rec led only after all requirements, inclu angene saving ACHE in GON DUITINONSCO d. In casing and cement followi , all COAs and NMOCD regu 'surface hole to TD. Solids co its will be used.	A. Required su completion in a ding reclamation plan: DFOR FOR FOR MECAPPI ng all of lations). ontrol will	ROVAL NM OII AF AF AF AF AF	trinent markers and zones. be filed within 30 days 160-4 shall be filed once d, and the operator has CONSERVATI RTESIA DISTRICT
following completion of the investigation of the investigation of the stready OXY USA Inc. respectfully Utilize a spudder rig to pree Description of Operations 1. Spudder rig contractor The pre-set surface casing on a. After drilling each surface the applicable rules and results and results and led entirely on a complete the term of the stready of the applicable rules and results and results and led entirely on a complete the term of the stready of the term of the stready of the term of the stready of the stready of the stready of the stready of the term of the stready	work will be performed or provide lived operations: If the operation or al Abandonment Notices shall be fi for final inspection.) requests approval for the fo -set surface casing for time all of the wells on a given pa be hole section, the rig will ru gulations (OnShore Order 2 er based mud, to drill 14-3/4" osed loop basis. No earth pi	, give subsurface locations and meas c the Bond No. on file with BLM/BI soults in a multiple completion or rec led only after all requirements, inclu sollowing changes to the drilling angene saving ACHE in Good ND International Completion d. In casing and cement followin , all COAs and NMOCD regu surface hole to TD. Solids co its will be used.	A. Required si completion in a ding reclamatic plan: DFOR DFOR DFOR DFOR DFOR DFOR DFOR DFOR	ROVAL NM OII AF ROVAL NM OII AF	tinent markers and zones. be filed within 30 days 160-4 shall be filed once d, and the operator has CONSERVATI RTESIA DISTRICT
following completion of the investigation has been completed. Final determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pree Description of Operations 1. Spudder rig contractor 1 pre-set surface casing on a. After drilling each surface the applicable rules and reb. Rig will utilize fresh wat be handled entirely on a complex of the surface casing on a complex of the surface entirely	work will be performed or provide lived operations: If the operation or al Abandonment Notices shall be fi for final inspection.) requests approval for the fo -set surface casing for time all of the wells on a given pa be hole section, the rig will ru gulations (OnShore Order 2 er based mud, to drill 14-3/4" osed loop basis. No earth pi	, give subsurface locations and meas c the Bond No. on file with BLM/BI soults in a multiple completion or rea led only after all requirements, inclu angene saving Acheel in their hyberright Acheel in their hyberright Acheel d. In casing and cement followin , all COAs and NMOCD regu surface hole to TD. Solids co its will be used.	A. Required si completion in a ding reclamatic plan: DFOR DFOR DFOR DFOR DFOR DFOR DFOR DFOR	ROVAL ROVAL NM OII AF AF AF AF AF AF AF AF AF AF	tinent markers and zones. be filed within 30 days 160-4 shall be filed once d, and the operator has CONSERVATI RTESIA DISTRICT
following completion of the invertesting has been completed. Find determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pree Description of Operations 1. Spudder rig contractor T pre-set surface casing on a. After drilling each surface the applicable rules and reb. Rig will utilize fresh wat be handled entirely on a c	work will be performed or provide lived operations: If the operation of a Abandonment Notices shall be fi- for final inspection.) requests approval for the fo- -set surface casing for time all of the wells on a given pa be hole section, the rig will ru- gulations (OnShore Order 2 er based mud, to drill 14-3/4" osed loop basis. No earth pi Electronic Submission f For OXY US, nmitted to AFMSS for process	, give subsurface locations and meas c the Bond No. on file with BLM/BI soults in a multiple completion or rea led only after all requirements, inclu angene saving Acheel in their hyberright Acheel in their hyberright Acheel d. In casing and cement followin , all COAs and NMOCD regu surface hole to TD. Solids co its will be used.	A. Required si completion in a ding reclamatic plan: DFOR DFOR DFOR DFOR DFOR DFOR DFOR DFOR	ROVAL ROVAL NM OII AF AF AF AF AF AF AF AF AF AF	tinent markers and zones. be filed within 30 days 160-4 shall be filed once d, and the operator has CONSERVATI RTESIA DISTRICT
following completion of the invertesting has been completed. Find determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pree Description of Operations 1. Spudder rig contractor T pre-set surface casing on a. After drilling each surface the applicable rules and reb. Rig will utilize fresh wat be handled entirely on a c	work will be performed or provide lived operations: If the operation re al Abandonment Notices shall be fi for final inspection.) requests approval for the fo -set surface casing for time a franscend Drilling will move all of the wells on a given pa ce hole section, the rig will ru gulations (OnShore Order 2 er based mud, to drill 14-3/4" osed loop basis. No earth pi <u>For OXY US</u> nmitted to AFMSS for process O STEWART	, give subsurface locations and meas c the Bond No. on file with BLM/BI soults in a multiple completion or rec led only after all requirements, inclu and EDE saving ACHED in Gasing and cement followin , all COAs and NMOCD regu surface hole to TD. Solids co its will be used.	A. Required si completion in a ding reclamatic plan: DFOR DFOR DFOR DFOR DFOR DFOR DFOR DFOR	ROVAL ROVAL NM OII AF A A A A A A A A A A A A A	tinent markers and zones. be filed within 30 days 160-4 shall be filed once d, and the operator has CONSERVATI RTESIA DISTRICT
following completion of the invertesting has been completed. Final determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pree Description of Operations 1. Spudder rig contractor Tore-set surface casing on a. After drilling each surface the applicable rules and reb. Rig will utilize fresh wate be handled entirely on a complex of the interval of the complex of the	work will be performed or provide lived operations: If the operation re al Abandonment Notices shall be fi for final inspection.) requests approval for the fo -set surface casing for time a franscend Drilling will move all of the wells on a given pa ce hole section, the rig will ru gulations (OnShore Order 2 er based mud, to drill 14-3/4" osed loop basis. No earth pi <u>For OXY US</u> nmitted to AFMSS for process O STEWART	, give subsurface locations and meas c the Bond No. on file with BLM/BI soults in a multiple completion or real completion or real completion or real completion or real completion or real completion or real completion or real and EDE saving A CHED and EDE saving A CHED in their Hy Durill Indestructor d. In casing and cement followin , all COAs and NMOCD regu 'surface hole to TD. Solids co its will be used.	A. Required si completion in a ding reclamatic plan: DFOR DFOR DFOR DFOR DFOR DFOR DFOR DFOR	ROVAL ROVAL NM OII AF A A A A A A A A A A A A A	L CONSERVATION A constraint of the operator has CONSERVATION CONSERVA
following completion of the invertesting has been completed. Fina determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pre Description of Operations 1. Spudder rig contractor pre-set surface casing on a. After drilling each surfact the applicable rules and re b. Rig will utilize fresh wata be handled entirely on a c 14. 1 hereby certify that the foregoi Signature (Electro	work will be performed or provide lived operations. If the operation re al Abandonment Notices shall be fi for final inspection.) requests approval for the fo -set surface casing for time and ranscend Drilling will move all of the wells on a given pa be hole section, the rig will ru- gulations (OnShore Order 2 er based mud, to drill 14-3/4" osed loop basis. No earth pi ng is true and correct. Electronic Submission f For OXY US nmitted to AFMSS for process 0 STEWART nic Submission) THIS SPACE Fe	, give subsurface locations and meas c the Bond No. on file with BLM/BI soults in a multiple completion or real completion or r	A. Required si completion in a ding reclamatic plan: DFOR DFOR DFOR DFOR DFOR DFOR DFOR DFOR	ROVAL ROVAL NM OII AF A A A A A A A A A A A A A	tinent markers and zones. be filed within 30 days 160-4 shall be filed once d, and the operator has CONSERVATI RTESIA DISTRICT
following completion of the invertesting has been completed. Find determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pree Description of Operations 1. Spudder rig contractor pre-set surface casing on a. After drilling each surface the applicable rules and re b. Rig will utilize fresh wat be handled entirely on a c 14. I hereby certify that the foregoi Cor Name (Printed/Typed) DAVIE Signature (Electro Approved By T Conditions of approval, if any, are att certify that the applicant holds legal certify that the applicant hold	work will be performed or provide lived operations: If the operation ro- l Abandonment Notices shall be fi- for final inspection.) requests approval for the fo- -set surface casing for time and all of the wells on a given pa- te hole section, the rig will ru- gulations (OnShore Order 2 er based mud, to drill 14-3/4" osed loop basis. No earth pi- For OXY US- nmitted to AFMSS for processed O STEWART nic Submission) THIS SPACE Fi- ached. Approval of this notice doc r equitable title to those rights in th	, give subsurface locations and meas c the Bond No. on file with BLM/BI soults in a multiple completion or re- led only after all requirements, inclu angene saving ACHED in their high burner ACHED in their high burner ACHED in their high burner ACHED d. In casing and cement followin , all COAs and NMOCD regu 'surface hole to TD. Solids co its will be used.	A. Required si completion in a ding reclamatic plan: DFOR DFOR DFOR DFOR DFOR DFOR DFOR DFOR	rertical depths of all per absequent reports shall new interval, a Form 3 on, have been complete ROVAL NM OII AF SECTO IS (15CRW0089SE) DVISOR	L CONSERVATION A construction of the operator has CONSERVATION CONSER
following completion of the invertesting has been completed. Final determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pre Description of Operations 1. Spudder rig contractor pre-set surface casing on a. After drilling each surfact the applicable rules and re b. Rig will utilize fresh wata be handled entirely on a c 14. I hereby certify that the foregoi 14. I hereby certify that the foregoi 14. I hereby certify that the foregoi 15. Signature (Electron Approved By 7 Conditions of approval, if any, are att certify that the applicant holds legal c which would entitle the applicant to c Title 18 U.S.C. Section 1001 and Titl	work will be performed or provide lived operations: If the operation of a Abandonment Notices shall be fi for final inspection.) requests approval for the fo -set surface casing for time and franscend Drilling will move all of the wells on a given pa the hole section, the rig will ru- gulations (OnShore Order 2 er based mud, to drill 14-3/4" osed loop basis. No earth pi Electronic Submission for For OXY US nmitted to AFMSS for processed O STEWART nic Submission) THIS SPACE For ached. Approval of this notice doe r equitable title to those rights in th onduct operations thereon. e 43 U.S.C. Section 1212, make it is	, give subsurface locations and meas c the Bond No. on file with BLM/BI soults in a multiple completion or re- led only after all requirements, inclu angeneric saving ACHED in their Hyborrill Indestriated d. In casing and cement followin , all COAs and NMOCD regu 'surface hole to TD. Solids co its will be used.	ALCONTRACTORY AL	rertical depths of all per absequent reports shall new interval, a Form 3 on, have been complete ROVAL NM OII AF A COTC ISCRW0089SE) DVISOR A A A A A A A A A A A A A	L CONSERVATIA And the operator has CONSERVATIA CONSERVATIA RTESIA DISTRICT NUG 1 3 2015 RECEIVED Date
following completion of the invertesting has been completed. Final determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pre Description of Operations 1. Spudder rig contractor pre-set surface casing on a. After drilling each surfact the applicable rules and re b. Rig will utilize fresh wata be handled entirely on a c 14. I hereby certify that the foregoi 14. I hereby certify that the foregoi 14. I hereby certify that the foregoi 15. Signature (Electron Approved By 7 Conditions of approval, if any, are att certify that the applicant holds legal of which would entitle the applicant to c Title 18 U.S.C. Section 1001 and Titl States any false, fictitious or fraudu	work will be performed or provide lived operations: If the operation of a Abandonment Notices shall be fi for final inspection.) requests approval for the fo -set surface casing for time all franscend Drilling will move all of the wells on a given pa be hole section, the rig will ru- gulations (OnShore Order 2 er based mud, to drill 14-3/4" osed loop basis. No earth pi <u>For OXY US</u> nmitted to AFMSS for process O STEWART nic Submission) THIS SPACE Fe ached. Approval of this notice doe r equitable title to those rights in th onduct operations thereon. e 43 U.S.C. Section 1212, make it a lent statements or representations a	, give subsurface locations and meas c the Bond No. on file with BLM/BI soults in a multiple completion or real completion or r	ALTORY AL ALTORY AL AUG AUG AUG AUG AUG AUG AUG AUG	ROVAL ROVAL NM OII AF AF AF AF AF AF AF AF AF AF	tinent markers and zones. be filed within 30 days i f60-4 shall be filed once d, and the operator has ECEIVED Date Date
following completion of the invertesting has been completed. Final determined that the site is ready OXY USA Inc. respectfully Utilize a spudder rig to pre Description of Operations 1. Spudder rig contractor pre-set surface casing on a. After drilling each surfact the applicable rules and re b. Rig will utilize fresh wata be handled entirely on a c 14. I hereby certify that the foregoi 14. I hereby certify that the foregoi 14. I hereby certify that the foregoi 15. Signature (Electron Approved By 7 Conditions of approval, if any, are att certify that the applicant holds legal of which would entitle the applicant to c Title 18 U.S.C. Section 1001 and Titl States any false, fictitious or fraudu	work will be performed or provide lived operations: If the operation of a Abandonment Notices shall be fi for final inspection.) requests approval for the fo -set surface casing for time and franscend Drilling will move all of the wells on a given pa the hole section, the rig will ru- gulations (OnShore Order 2 er based mud, to drill 14-3/4" osed loop basis. No earth pi Electronic Submission for For OXY US nmitted to AFMSS for processed O STEWART nic Submission) THIS SPACE For ached. Approval of this notice doe r equitable title to those rights in th onduct operations thereon. e 43 U.S.C. Section 1212, make it is	, give subsurface locations and meas c the Bond No. on file with BLM/BI soults in a multiple completion or real completion or r	ALTORY AL ALTORY AL AUG AUG AUG AUG AUG AUG AUG AUG	ROVAL ROVAL NM OII AF AF AF AF AF AF AF AF AF AF	tinent markers and zones. be filed within 30 days if60-4 shall be filed once d, and the operator has ECEIVED Date tor agency of the United

Additional data for EC transaction #309528 that would not fit on the form

32. Additional remarks, continued

2. The wellhead will be installed and tested as soon as the 10-3/4" surface casing is cut off and the WOC time has been reached.

3. A blind flange as the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with needle valves installed on two wing valves. A means for intervention will be maintained while the drilling rig is not over the well.

4. Spudder rig operations is expected to take 2-3 days on a single well pad and 7-10 days on a four well pad.

5. The BLM will be contacted and notified 24 hours prior to commencing spudder rig operations.


6. Drilling operation will start with a larger rig and an approved BOP stack will be nippled up and tested on the wellhead before drilling operations resumes on each well. a. On multi-well pads the rig will skid and move as each well is drilled and casing run and cemented to TD as planned.

b. The BLM will be contacted/notified 24 hours before the larger rig moves back on the pre-set locations.

7. Oxy will have supervision on the rig to ensure compliance with all BLM and NMOCD regulations and to oversee operations.



Transcend Drilling is a drilling contractor that specializes in pre-setting surface casing in the Permian Basin. With a fleet of two Atlas Copco top drive rigs, we have completed various projects for customers since we began operations in 2010. Drilling depths range from 300'-2,300'. Casing sizes range from 8 5/8" to 13 3/8".

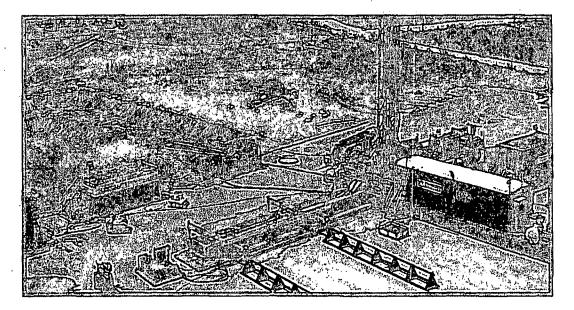

2012

TD Rig #1 had 131 well starts while drilling and running surface casing with total feet drilled at over 171,000'.

2013

Keith Boyd

Drilling Manager

432438:5889 -: Cell

kbyod@gaanscenting.com

TD Rig #1 has had 120 well starts and drilled over 150,000 feet in the area; throughout the first three quarters of the year. With the addition of TD Rig #2, it's operations have seen similar success and performance.

Kerry Nicholson

432-957-1628


knicholson@transcendrig.com

Drilling

Superintendent

Rig Summaries

in most on the sover 400 wells we have preserved in gen, we have drilled with full However, both also are capable of drilling with all or full.

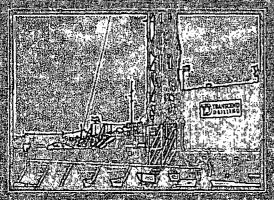

TDRIght

Atlas CopcoRD20111-7551HB top drive includes 120,000 pounds of pullback. This rig is also accompanied by a state of the art ABL (dutomatic Pipe Ecoder) and cosing handling system:

TDRig#2

Atlas Copeo RD20111XG=7551HP, top/drive/induces 120,000, pounds of pullback: This rig includes an added safety reature that allows for a hands free tip out hydraulielint; elevator & slip system.

Periormance


Over the last few, years, Transcend Drilling has developed an eputation second to none in the industry. We have had spuditoire lease times in as little as eight hours, while deeper, wells usually take less than 48 hours. Our mobilization times also average just a few hours. Both rigs work 24 hours a day and have four to five men crews and

two pushers on location

Ourstrategicalliances allowus to perform a variety of operations which include surface drilling; cat & mouse holes, pit lining and more

Personnel

Keith Boydijoined Transcend Drilling in 2013. He comes to the company with a nextensive background in drilling throughout the Permian Basin as well as other areas. Keith was with a

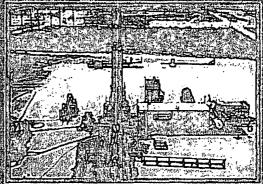

large contract drilling company for over 25 years prior to joining the Transcend Dolling team: His knowledge of various drilling conditions is a beneficial tool to our customers as we work to provide cost-savings solutions.

Safety

The most important component to our operation is safety. Onlevery single (ob commain goal/is zero) incidents. We have a very clean safety record with no lost time accidents. We require USAs throughout every step of allob; as well as during mobilization. Sifety meetings are held every shift change and during the well process. We have developed and maintained a culture among allof our single on safety first.

Transcend Rig #2 Supplemental Rig Information

TOP DRIVE

Model: 4SF-2-12 spur gear head RPM: 0 to 120

Torque: 8,000 ft-lb. (10,848 N-m) maximum

Swivel: 3 in. (76-mm) swivel with chevron packing

Piping: Circulation piping rated at 3,000 psi (10.3 MPa) working pressure. 3 in. (76 mm) manifold provided for auxiliary compressor and booster connection. Remotely operated main air valve and blow down valves.

TOP DRIVE CASING RUNNING ADAPTER

This includes bales and casing elevators that can safely and efficiently handle casing up to 13 3/8".

PIPE HANDLING SYSTEM

The hydraulically powered pipe changer holds one 4-1/2 in. (114 mm) drill pipe and one 5-1/2 in. (140 mm) drill collar. The loader is set up to handle 30 ft. (9.14 m) long drill pipe or drill collars

PETOL FLOOR TONG

Type: Hydraulically powered, self-adjusting

Rating: 20,000 ft-lb. (27,120 N-m) torque with torque gauge in console

POWER TRAIN

Standard: Cummins QSK-19C

HP/RP: 755 hp / 563 KW @ 1,800 RPM

POWER PLANT GENERATOR SYSTEM

One 85k generator to run all of Transcend Drilling auxiliary rig related equipment.

MAST

RAISING AND LOWERING BY TWIN HYDRAULIC CYLINDERS - RATED 120,000lb Dimensions

Length: 61 ft. 11-1/2 in. (18.88 m) Width: 48-1/2 in. (1231.9 mm)

Depth: 41 in. (1041.4 mm)

Top of Table to Spindle: 51 ft. 6 in. (15.70 m)

Table to Ground (rig sitting on tires): 44 in. (1117.6 mm)

Table to Ground (jacks fully extended): 92 in. (2336.8 mm)

SUBSTRUCTURE

The unique RD20III centralizer table folds up and down as the derrick is lowered and raised for travel and drilling operations. The centralizer table has two manually operated stabilizer jacks that provide easy leveling and excellent load support. The table has removable pins that allow it to be opened for casing and drill tool handling. The drilling platform provides a safe, convenient work area with good, clear access. The substructure has a 4 FT drill floor height with 120,00LBS master bushing load.

DRILLER CONTROLS

A lockable, aluminum cover protects the operator console from vandals and operated by hydraulics.

MUD PUMPS

The rig has one Gardner Denver PZ-8 Tri-plex. The pump is driven by CAT C15 / Pump has 8" stroke with 6 %" liners. Total pump output is 390 gpm.

MUD SYSTEM


The rig will supply a 150 bbl active (pre mix) system, including one 4 x 4 centrifugal pump.

ADDITIONAL FEATURES:

Hydraulic links and elevators on top drive Optional Hydraulic slips for up to 4 in O.D. pipe 17 1/2 in (445 mm) API split master bushings Hydraulic make up and break out wrenches 3,000 psi (206.8 bar) mud piping Directional disc brake D TRANSCEND D RILLING


ы, қ

Rig #2 Layout (Equipment Layout)

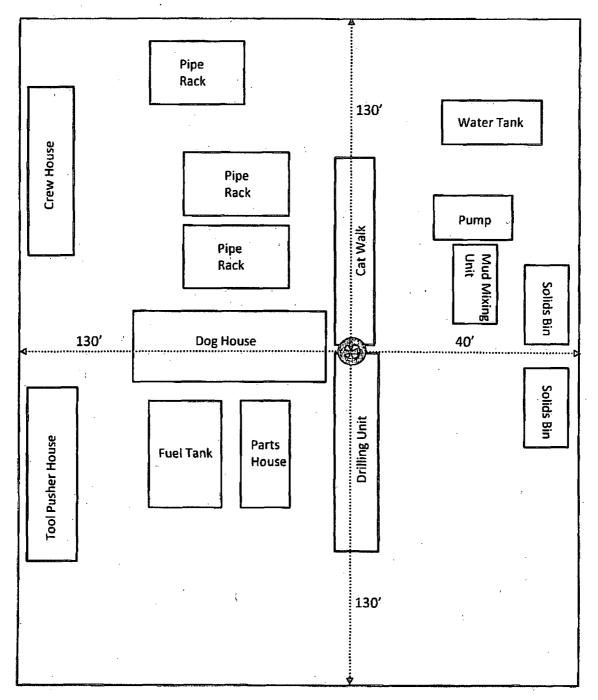

()

Note: Dimensional information reflected on this drawing are estimated measurements only.

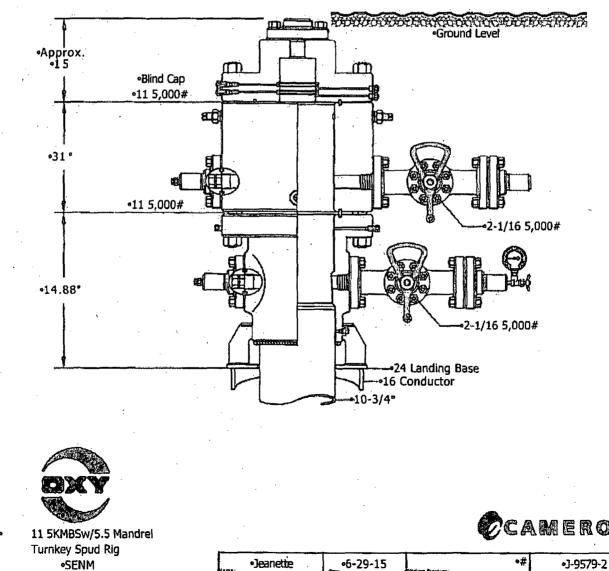

CAMERON

•6-29-15

arking Pressure:

•J-9579-2

NM OIL CONSERVATION

ARTESIA DISTRICT

PECOS DISTRICT CONDITIONS OF APPROVAL

AUG 1 3 2015

OPERATOR'S NAME:	OXY USA Inc.	RECEIVED
LEASE NO.:	NMNM-109756	
WELL NAME & NO.:	Peaches 19 Federal 3H	
SURFACE HOLE FOOTAGE:	0730' FSL & 1980' FWL	
BOTTOM HOLE FOOTAGE	0180' FNL & 1980' FWL	
LOCATION:	Section 19, T. 25 S., R 27 E., NMPM	
COUNTY:	Eddy County, New Mexico	

A. DRILLING OPERATIONS REQUIREMENTS

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)

Eddy County

Call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (575) 361-2822

- 1. Although Hydrogen Sulfide has not been reported in the area, it is always a potential hazard. Operator has stated that they will have monitoring equipment in place prior to drilling out of the surface shoe. If Hydrogen Sulfide is encountered, report measured amounts and formations to the BLM.
- 2. Setting surface casing with Transcend Drilling Spudder Rig
 - a. Notify the BLM when removing the Transcend Drilling Spudder Rig.
 - b. Notify the BLM when moving in the H&P Flex Rig. Rig to be moved in within 90 days of notification that Transcend Drilling Spudder Rig has left the location. Failure to notify or have rig on location within 90 days will result in an Incident of Non-Compliance.
 - c. Once the H&P Flex Rig is on location, it will drill the Peaches 19 Federal 3H.
 - d. BOP/BOPE test to be conducted per Onshore Oil and Gas Order No. 2 as soon as H&P Flex Rig is rigged up on well. CIT for the surface casing shall be performed and results recorded on subsequent sundry.

- 3. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works is located, this does not include the dog house or stairway area.
- 4. The record of the drilling rate along with the GR/N well log run from TD to surface (horizontal well – vertical portion of hole) shall be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies. The top and bottom of Salt are to be recorded on the Completion Report.

B. CASING

Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). Centralizers required on surface casing per Onshore Order 2.III.B.1.f.

Centranzers required on surface casing per Onshore Order 2.111.D.1.1.

Wait on cement (WOC) time prior to drilling out for a primary cement job will be a minimum 18 hours for a water basin, 24 hours in the potash area, or 500 pounds compressive strength, whichever is greater for all casing strings. DURING THIS WOC TIME, NO DRILL PIPE, ETC. SHALL BE RUN IN THE HOLE. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. IF OPERATOR DOES NOT HAVE THE WELL SPECIFIC CEMENT DETAILS ONSITE PRIOR TO PUMPING THE CEMENT FOR EACH CASING STRING, THE WOC WILL BE 30 HOURS. See individual casing strings for details regarding lead cement slurry requirements.

No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.

Medium Cave/Karst Possible water flows in the Castile. Possible lost circulation in the Salado and Delaware.

- 1. The **10-3/4** inch surface casing shall be set at approximately **350** feet (a minimum of 25 feet into the Rustler Anhydrite and above the salt) and cemented to the surface.
 - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
 - b. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry.
 - c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
 - d. If cement falls back, remedial cementing will be done prior to drilling out that string.

Formation below the 10-3/4 inch shoe to be tested according to Onshore Order 2.III.B.1.i. Test to be done as a mud equivalency test using the mud weight necessary for the pore pressure of the formation below the shoe and the mud weight for the bottom of the hole. Report results to BLM office.

2. The minimum required fill of cement behind the **7-5/8** inch intermediate casing, which shall be set at approximately **1900** feet, is:

Ņ

Cement to surface. If cement does not circulate see B.1.a, c-d above. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst.

If cement does not circulate to surface on the intermediate casing, the cement on the production casing must come to surface.

Formation below the 7-5/8 inch shoe to be tested according to Onshore Order 2.III.B.1.i. Test to be done as a mud equivalency test using the mud weight necessary for the pore pressure of the formation below the shoe (not the mud weight required to prevent dissolving the salt formation) and the mud weight for the bottom of the hole. Report results to BLM office.

Centralizers required on horizontal leg, must be type for horizontal service and a minimum of one every other joint.

3. The minimum required fill of cement behind the 5-1/2 X 4-1/2 inch production casing is:

Cement as proposed by operator. Operator shall provide method of verification.

4. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.

C. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. Variance approved to use flex line from BOP to choke manifold. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor. If the BLM inspector questions the straightness of the hose, a BLM engineer will be contacted and will review in the field or via picture supplied by inspector to determine if changes are required (operator shall expect delays if this occurs).
- 3. Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi.
 - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
 - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
 - c. Manufacturer representative shall install the test plug for the initial BOP test.
 - d. Operator shall perform the intermediate casing integrity test to 70% of the casing burst. This will test the multi-bowl seals.
 - e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.

5M system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.

- 4. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
 - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead when specified), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
 - b. The tests shall be done by an independent service company utilizing a test plug **not a cup or J-packer**.
 - c. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock with a corresponding chart (i.e. two hour clock-two hour chart, one hour clock-one hour chart).

d. The results of the test shall be reported to the appropriate BLM office.

- e. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- f. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.

D. DRILL STEM TEST

If drill stem tests are performed, Onshore Order 2.III.D shall be followed.

E. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

KGR 08072015