	UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT			OCD Artesia		OMB N Expires: Ja	APPROVED O. 1004-0137 anuary 31, 2018
	SUNDRY NOTICES AND REPORTS ON WELLS					5. Lease Serial No. NMNM02860	
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.						6. If Indian, Allottee or Tribe Name	
SUBMIT IN TRIPLICATE - Other instructions on page 2						 If Unit or CA/Agreement, Name and/or NMNM71016G 	
1. Type of Well Gas Well Other						8. Well Name and No. POKER LAKE UNIT 216	
2. Name of Operato	Contact:			9. API Well No. 20.015.23861			
BOPCO LP		E-Mail: tracie_cher	2h Dhone No	(include area code)		30-015-33861 10. Field and Pool or	Exploratory Area
	AY HILL RD BLD X 79701	Ph: 432-221-7379 NM OIL CONSERV			NASH DRAW;DEL/BS (AV SNE		
4. Location of Well	1 (Footage, Sec., T	, R., M., or Survey Description)	ARTES	A DISTRIC	T11. County or Parish,	State
Sec 19 T24S	R30E Mer NMP	SWNE 1980FNL 178FEL		FEB	08 2019	EDDY COUNT	Y, NM
12. (CHECK THE AI	PPROPRIATE BOX(ES)	TO INDICA1	E NATURE	ENVE ICE,	REPORT, OR OT	HER DATA
TYPE OF SU	IBMISSION TYPE OF ACTION						
Notice of In	atent	Acidize	🗂 Deep	en	Product	ion (Start/Resume)	U Water Shut
-		Alter Casing	🗖 Hydr	aulic Fracturing	🗖 Reclam	ation	🗋 Well Integr
Subsequent	Report	Casing Repair	🗋 New	Construction	🗖 Recomp	olete	🗖 Other
🗖 Final Abanc	donment Notice	Change Plans	🔀 Plug	and Abandon		arily Abandon	
		Convert to Injection	🗖 Plug	Back	🖸 Water I	Disposal	
following compl testing has been determined that	letion of the involved completed. Final Al the site is ready for f	•	sults in a multiple led only after all r	completion or reco equirements, includ	mpletion in a i ing reclamatio	new interval, a Form 31	60-4 must be filed o and the operator ha
BOPCO, LP		nits this sundry notice to p	-				
	OH w/rods and p	ump. Remove wellhead a Dump Be: } 35 d	and install 3K F	BOP. Test.	ne Spri	, <u>set</u> (o 60	DO.
2. Tag PB1D 6870'-6770'. ' 6870'-6770'. ' 3. Spot 25 sx) @ 7440', RIH w WOC & tag, Circ (e 	/5-1/2" CIBP, set @ -68/0 ulate 9.5# salt gel mud. T 930'. WOC & tag.	est csg to 500	hair (aans-shu	ng peris) 🖸	el anser e	
2. Tag PB1D 6870'-6770'. ' 6870'-6770'. ' 3. Spot 25 sx) @ 7440', RIH w WOC & tag, Circ (e 	/5-1/2" CIBP, set @ -68/0 ulate 9.5# salt gel mud. T 930'. WOC & tag.	est csg to 500	hair (aans-shu	ng peris) 🖸	el anser e	
2. Tag PBID 6870'-6770'. 6 8 00 - 1 3. Spot 25 sx 3. Perf 5-1/2"	0 @ 7440'. RIH w. WOC & tag. Circ (class C 4030'-4 " csg @ 3500'. So	/5-1/2" CIBP, set @ 58/0 ulate 9.5# sait gel mud. T	F. Tag to verify est csg to 500 8390'WOC &	tag (T/Delaware	e) 318 4	o (T/De/ 1 GC	L 13/Salt. 2/19/11
2. Tag PBID 6870'-6770'. 6 8 00 - 1 3. Spot 25 sx 3. Perf 5-1/2"	0 @ 7440'. RIH w. WOC & tag. Circ (class C 4030'-4 " csg @ 3500'. So	/5-1/2" CIBP, set @ 68/0 ulate 9.5# sait gel mud. T 930'. WOC & tag. qz 110 sx Class C 3500' .6 100 sxs Class C 550'- 46	9: Tag to verify est csg to 500 9390'WOC & 10 ¹ : (Csg shoe,	tag (T/Delaware	e) 318 4	o (T/De/ 1	L B/Salt.
2. Tag PBID 6070-6770: 6 800- 3. Spot 25 sx 3. Perf 5-1/2" 4. Perf 5-1/2"	0 @ 7440'. RIH w. WOC & tag. Circ (class C 4030'-4 " csg @ 3500'. So	25-1/2" CIBP, set @ 6870 ulate 9.5# salt gel mud. T 930'. WOC & tag. gz 110 sx Class C 3500'-€ 100 sxs Class C 550'-450 	2. Tag to verify est csg to 500 8390'WOC & 6 ¹ : (Csg shoe, 20 (tag (T/Delaward T/Salt). 44 <u>ac Kec</u>	e) 3184 3 <u>(equi)</u>	GC Accepted for	L 13/Salt. 2/19/11
2. Tag PBID 6070-6770: 6 800- 3. Spot 25 sx 3. Perf 5-1/2" 4. Perf 5-1/2"	שטר אנח אוד איז שטר ג tag. Circ ג Class C 4030'-4 " csg @ 3500'. Sqz " csg @550'. Sqz	25-1/2" CIBP, set @ 6870 ulate 9.5# salt gel mud. T 930'. WOC & tag. gz 110 sx Class C 3500' € 100 sxs Class C 550' 46 <u>level dry h</u> s true and correct. Electronic Submission #	- 1 ag to verify est csg to 500 	tag (T/Delaward T/Salt). 44 <u>ac Kec</u>	e) 3184 3 <u>(دو مة (</u> 11 Information	GC Accepted for	L B/Salt.
2. Tag PBID 6070-6770: 6 800- 3. Spot 25 sx 3. Perf 5-1/2" 4. Perf 5-1/2"	0 @ 7440'. RIH w. WOC & tag. Circ (class C 4030'-4 " csg @ 3500'. So " csg @550'. Soz <u>9000000000000000000000000000000000000</u>	25-1/2" CIBP, set @ 6870 ulate 9.5# salt gel mud. T 930'. WOC & tag. gz 110 sx Class C 3500' € 100 sxs Class C 550' -45 <u>level</u> <u>dry</u> <u>h</u> s true and correct. Electronic Submission # For E	- 1 ag to verify est csg to 500 	tag (T/Delaward T/Salt). 44 <u>ac Ke c</u> I by the BLM We Int to the Carisba	e) 318 4 <u>3</u> <u>(egui(</u> 11 Information d	GC Accepted for	L B/Salt.
2. Tag PBID 6070'-6770'. 3. Spot 25 sx 3. Perf 5-1/2" 4. Perf 5-1/2" <u>3. Perf 5-1/2"</u> 14. I hereby certify	0 @ 7440'. RIH w. WOC & tag. Circ (class C 4030'-4 " csg @ 3500'. So " csg @550'. So <u>greun d</u> y that the foregoing is	25-1/2" CIBP, set @ 6870 ulate 9.5# salt gel mud. T 930'. WOC & tag. gz 110 sx Class C 3500' € 100 sxs Class C 550' -45 <u>level</u> <u>dry</u> <u>h</u> s true and correct. Electronic Submission # For E	- 1 ag to verify est csg to 500 	tag (T/Delaward T/Salt). 44 <u>ac Ke c</u> I by the BLM We Int to the Carisba	e) 318 4 <u>3</u> <u>(egui(</u> 11 Information d	Accepted for System	L 13/Salt. 2/19/11
2. Tag PBID 6070'-6770'. 3. Spot 25 sx 3. Perf 5-1/2" 4. Perf 5-1/2" <u>3. Perf 5-1/2"</u> 14. I hereby certify	0 @ 7440'. RIH w. WOC & tag. Circ (class C 4030'-4 " csg @ 3500'. So " csg @550'. So <u>greun d</u> y that the foregoing is	15-1/2" CIBP, set @ 6870 ulate 9.5# salt gel mud. T 930'. WOC & tag. 2 110 sx Class C 3500' 4 100 sxs Class C 550' 46 100 sxs Class C 550' 46	2. Tag to verify est csg to 500 3390'WOC & 6': (Csg shoe, 20 C M 452668 verifie BOPCO LP, se	tag (T/Delaward T/Salt). 44 <u>ackec</u> by the BLM We nt to the Carlsba <u>Title</u> REGUL Date 01/31/2	e) 3 8 3 <u>(دو من (</u> <u>1</u> 11 Information d ATORY CC	or dans ar a GC Accepted for Accepted for DORDINATOR	L B/Salt.
2. Tag PBID 6070'6770'. 3. Spot 25 sx 3. Perf 5-1/2" 4. Perf 5-1/2" 14. I hereby certify Name (Printed/)	0 @ 7440'. RIH w. WOC & tag. Circ (class C 4030'-4 " csg @ 3500'. So " csg @ 550'. So <u>greun d</u> y that the foregoing is <i>Typed</i>) TRACIE J	75-1/2" CIBP, set @ 6870 ulate 9.5# salt gel mud. T 930'. WOC & tag. az 110 sx Class C 3500' 6 100 sxs Class C 550' -45 <u>level</u> <u>dry</u> strue and correct. Electronic Submission # For E	2. Tag to verify est csg to 500 3390'WOC & 6': (Csg shoe, 20 C M 452668 verifie BOPCO LP, se	tag (T/Delaward T/Salt). 44 <u>ackec</u> by the BLM We nt to the Carlsba <u>Title</u> REGUL Date 01/31/2	e) 3 8 3 <u>(دو من (</u> <u>1</u> 11 Information d ATORY CC	or dans ar a GC Accepted for Accepted for DORDINATOR	L 13/Salt. 2/19/11
2. Tag PBID 6070-6770'. (0 @ 7440'. RIH w. WOC & tag. Circ (class C 4030'-4 " csg @ 3500'. So " csg @ 550'. So <u>greun d</u> y that the foregoing is <i>Typed</i>) TRACIE J	15-1/2" CIBP, set @ 6870 ulate 9.5# salt gel mud. T 930'. WOC & tag. 2 110 sx Class C 3500' 4 100 sxs Class C 550' 46 100 sxs Class C 550' 46	2. Tag to verify est csg to 500 3390'WOC & 6': (Csg shoe, 20 C M 452668 verifie BOPCO LP, se	tag (T/Delaward T/Salt). 44 <u>ackec</u> by the BLM We nt to the Carlsba <u>Title</u> REGUL Date 01/31/2	e) 3 8 3 <u>(دو من (</u> <u>1</u> 11 Information d ATORY CC	or dans ar a GC Accepted for Accepted for DORDINATOR	L B/Salt.
2. Tag PBID 6070-6770'. (a 800-1) 3. Spot 25 sx 3. Perf 5-1/2" 4. Perf 5-1/2" 14. I hereby certify Name (Printed/I Signature 	(a) (440', RIH w. WOC & tag. Circ (a) (a) (a) (a) (a) (a) (a) (a) (a) (a)	15-1/2" CIBP, set @ 6870 ulate 9.5# salt gel mud. T 930'. WOC & tag. 2 110 sx Class C 3500' 4 100 sxs Class C 550' 46 100 sxs Class C 550' 46	S not warrant or	tag (T/Delaward T/Salt). 44 <u>ackec</u> by the BLM We in to the Carisba <u>Title</u> REGUL Date 01/31/2 L OR STATE	e) 3 8 3 <u>(دو من (</u> <u>1</u> 11 Information d ATORY CC	or dans ar a GC Accepted for Accepted for DORDINATOR	2 /1 9 /20/14. 2 /1 9 /10 25 record - NM NTERE 4 2-12-19 7 2-2

(Instructions on page 2) ** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED **

Additional data for EC transaction #452668 that would not fit on the form

`

32. Additional remarks, continued


۰,

•

5. Perf 5-1/2" cs @ 60'. Sqz 25 sx Class C, verify cmt to surface.

6. Cut off wellhead. Install marker.

BOPCO, LP Poker Lake Unit #216 (30-015-33861) Before & After Wellbore Diagram

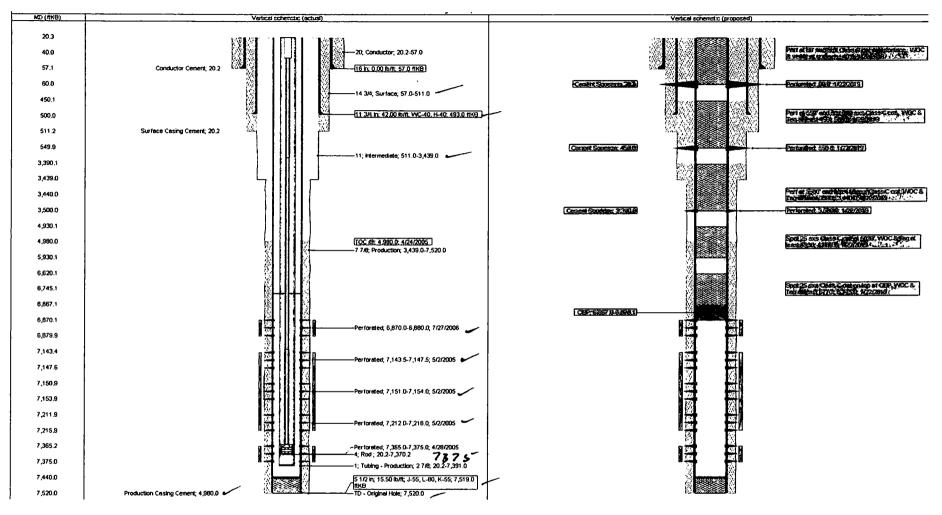

Rustler 15° 0 T/Selt 500 B/Selt 3230 Del. 3440 BS 7240

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

• • • •

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses.** Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted