# Form 3160-5 (August 2007)

OCD-ARTESIA

FORM APPROVED
OMB No. 1004-013
Expires: July 31, 201

UNITED STATES	
DEPARTMENT OF THE INTERIOR	Ł
BUREAU OF LAND MANAGEMEN	7

5. Lease Serial No.


SUNDRY NOTICES	AND REP	ORIS	ON WELLS
----------------	---------	------	----------

NM-04557
6. If Indian, Allottee or Tribe Name

outur	TIN TOID ICATE OF	notrustions 0		7. If Unit of CA/Agreen	ment, Name and/or No.
. Type of Well	T IN TRIPLICATE – Other i	nstructions on page 2.		Big Eddy Unit	
Oil Well X Gas W	/ell Other		4.5	8. Well Name and No. Big Eddy Unit	
Name of Operator BOPCO, L.P.				9. API Well No. 30-015-27454	
a. Address	,	3b. Phone No. (include area co	ode)	10. Field and Pool or Ex	xploratory Area
P.O. Box 2760 Midland T	X 79702	(432)683-2277		Hackberry (Mo	orrow)
. Location of Well (Footage, Sec., T.,	R., M., or Survey Description)		<del></del>	11. Country or Parish, S	
1980' FNL, 1980' FWL Se	c. 4, 1205, R31E			Eddy	NM
12. CHEC	CK THE APPROPRIATE BOX	X(ES) TO INDICATE NATUR	E OF NOTIC	E, REPORT OR OTHE	ER DATA
TYPE OF SUBMISSION	,	TY	YPE OF ACT	ION	
N Nation of Intent	Acidize	Deepen	Prod	action (Start/Resume)	Water Shut-Off
Notice of Intent	Alter Casing	Fracture Treat	Recla	mation	Well Integrity
Cubacaman Paran	Casing Repair	New Construction	Reco	mplete	Other
Subsequent Report	Change Plans	X Plug and Abandon	Temi	orarily Abandon	-
Notice of Intent  Subsequent Report  Final Abandonment Notice  3. Describe Proposed or Completed O the proposal is to deepen directions	Convert to Injection	Plug Back	☐ Wate	r Disposal	
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C	r final inspection.) y requests permission plugging equipment abing. nulus to check tubin cmt from 6,775'-6,9	e filed only after all requirements on to plug and aband t. Set open top steel p to g integrity. Circulate 48'. WOC & TAG.	nts, including	reclamation, have been abject wellbore a gging. ND WH &	NU 3,000 psi
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C 4. Spot 25 sx Class C 41 5. RU Wireline and freepe 6. Spot 75 sx Class C 282 7. PERF @ 2600 & SQZ 1	r final inspection.) ly requests permission plugging equipment bing. nulus to check tubin cmt from 6,775'-6,9 10' - 4290' WOC, TAC oint 5-1/2". Cut and plugging of the county 22' - 3055'. WOC & T. 80 sx Class C 2380'	e filed only after all requirements on to plug and aband t. Set open top steel p ig integrity. Circulate 48'. WOC & TAG. 6. pull same from +/- 300 AG 2630' WOC, TAG.	nts, including from the subit for plu w/ 9.5 pp	reclamation, have been a libject wellbore a gging. ND WH & g mud and pull t	completed and the operator has as follows:  NU 3,000 psi tbg.  IED FOR
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C 4. Spot 25 sx Class C 4. Spot 25 sx Class C 41. Spot 75 sx Class C 282. PERF @ 2600 & SQZ 1 8. PERF @ 1050 & SQZ 3	r final inspection.) ly requests permission plugging equipment bing. nulus to check tubin cmt from 6,775'-6,9 10' - 4290' WOC, TAC oint 5-1/2". Cut and plugging of the compact of the com	e filed only after all requirements on to plug and aband t. Set open top steel p ig integrity. Circulate 48'. WOC & TAG. 6. pull same from +/- 300 AG 2630' WOC, TAG. 1050' WOC, TAG.	nts, including from the subit for pluw/ 9.5 pp	reclamation, have been abject wellbore a gging. ND WH & g mud and pull to EE ATTACH ONDITIONS	completed and the operator has as follows:  NU 3,000 psi  abg.  HED FOR  S OF APPROVAL
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C 4. Spot 25 sx Class C 41. Spot 25 sx Class C 28. T. PERF @ 2600 & SQZ 1 8. PERF @ 1050 & SQZ 3 9. Pump 25 sxs Class C c	r final inspection.) by requests permission plugging equipment ubing. cut from 6,775'-6,9 10' - 4290' WOC, TAC oint 5-1/2". Cut and plugging example of the color	e filed only after all requirements on to plug and aband t. Set open top steel p ig integrity. Circulate 48'. WOC & TAG. 6. pull same from +/- 300 AG 2630' WOC, TAG. 1050' WOC, TAG.	nts, including lon the subit for pluw/ 9.5 pp	reclamation, have been abject wellbore a gging. ND WH & g mud and pull to EE ATTACH ONDITIONS as Class C cmt from the contract of the contract	completed and the operator has as follows:  NU 3,000 psi tbg.  IED FOR S OF APPROVAL
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C 4. Spot 25 sx Class C 4. Spot 25 sx Class C 41. Spot 75 sx Class C 282. PERF @ 2600 & SQZ 1 8. PERF @ 1050 & SQZ 3	r final inspection.) ly requests permission plugging equipment bing. nulus to check tubin c cmt from 6,775'-6,9 10' - 4290' WOC, TAC oint 5-1/2". Cut and p 22' - 3055'. WOC & T 80 sx Class C 2380' 10 sx Class C 625' - cmt 60' down 8-5/8" remediate location.	e filed only after all requirements on to plug and aband t. Set open top steel p ig integrity. Circulate 48'. WOC & TAG. 6. pull same from +/- 300 AG 2630' WOC, TAG. 1050' WOC, TAG.	nts, including lon the subit for pluw/ 9.5 pp	reclamation, have been abject wellbore a gging. ND WH & g mud and pull to EE ATTACH ONDITIONS	completed and the operator has as follows:  NU 3,000 psi tbg.  IED FOR S OF APPROVAL
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C 4. Spot 25 sx Class C 41. Spot 25 sx Class C 41. Spot 75 sx Class C 282. RU Wireline and freepe 6. Spot 75 sx Class C 282. PERF @ 2600 & SQZ 1 8. PERF @ 1050 & SQZ 3 9. Pump 25 sxs Class C 10. Set P&A marker and 11. Use steel tank and ha	r final inspection.) ly requests permission plugging equipment bing. nulus to check tubin cmt from 6,775'-6,9 10' - 4290' WOC, TAC oint 5-1/2". Cut and p 22' - 3055'. WOC & T 80 sx Class C 2380' 10 sx Class C 625' - cmt 60' down 8-5/8" remediate location. aul all fluids. the previous sundry	e filed only after all requirements on to plug and aband at. Set open top steel page integrity. Circulate 48'. WOC & TAG. 5. pull same from +/- 300 AG 2630' WOC, TAG. 1050' WOC, TAG. x 11-3/4" annulus & set (approved by the BL	nts, including from the subit for plu w/ 9.5 pp 00'.  Spot 25 sx REC	reclamation, have been abject wellbore a gging. ND WH & g mud and pull to EE ATTACH ONDITIONS as Class C cmt from CLAMATION PROCE ATTACHED	completed and the operator has as follows:  NU 3,000 psi  abg.  HED FOR  S OF APPROVAL  com 0-60'.
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C 4. Spot 25 sx Class C 41 5. RU Wireline and freepe 6. Spot 75 sx Class C 282 7. PERF @ 2600 & SQZ 1 8. PERF @ 1050 & SQZ 3 9. Pump 25 sxs Class C 10. Set P&A marker and 11. Use steel tank and ha	r final inspection.) ly requests permission plugging equipment bing. nulus to check tubin cmt from 6,775'-6,9 10' - 4290' WOC, TAC oint 5-1/2". Cut and p 22' - 3055'. WOC & T 80 sx Class C 2380' 10 sx Class C 625' - cmt 60' down 8-5/8" remediate location. aul all fluids. the previous sundry	e filed only after all requirements on to plug and aband at. Set open top steel page integrity. Circulate 48'. WOC & TAG. 5. pull same from +/- 300 AG 2630' WOC, TAG. 1050' WOC, TAG. x 11-3/4" annulus & set (approved by the BL	nts, including from the subit for plu w/ 9.5 pp 00'.  Spot 25 sx REC	reclamation, have been abject wellbore a gging. ND WH & g mud and pull to EE ATTACH ONDITIONS as Class C cmt from CLAMATION PROCE ATTACHED	completed and the operator has as follows:  NU 3,000 psi tbg.  IED FOR S OF APPROVAL com 0-60'.  DURE esting approval to
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C 4. Spot 25 sx Class C 41. Spot 25 sx Class C 41. Spot 75 sx Class C 282. RU Wireline and freepe 6. Spot 75 sx Class C 282. PERF @ 2600 & SQZ 1 8. PERF @ 1050 & SQZ 3 9. Pump 25 sxs Class C 10. Set P&A marker and 11. Use steel tank and ha	r final inspection.) ly requests permission plugging equipment bing. nulus to check tubin cmt from 6,775'-6,9 10' - 4290' WOC, TAC oint 5-1/2". Cut and p 22' - 3055'. WOC & T 80 sx Class C 2380' 10 sx Class C 625' - cmt 60' down 8-5/8" remediate location. aul all fluids. the previous sundry	e filed only after all requirements on to plug and aband at. Set open top steel page integrity. Circulate 48'. WOC & TAG. 5. pull same from +/- 300 AG 2630' WOC, TAG. 1050' WOC, TAG. x 11-3/4" annulus & set (approved by the BL	on the subit for plu w/ 9.5 pp 00'. Spot 25 sx REC	reclamation, have been abject wellbore a gging. ND WH & g mud and pull to EE ATTACH ONDITIONS as Class C cmt from CLAMATION PROCE ATTACHED of 10, 2010) reque	completed and the operator has as follows:  NU 3,000 psi tbg.  IED FOR S OF APPROVAL com 0-60'.  DURE esting approval to
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C 4. Spot 25 sx Class C 4. Spot 25 sx Class C 41. Spot 75 sx Class C 28. The street of th	r final inspection.) ly requests permission plugging equipment bing. nulus to check tubin cmt from 6,775'-6,9 10' - 4290' WOC, TAC oint 5-1/2". Cut and p 22' - 3055'. WOC & T. 80 sx Class C 2380' 10 sx Class C 625' - cmt 60' down 8-5/8" remediate location. aul all fluids. the previous sundry a SWD well. true and correct. Name (Printed	e filed only after all requirements on to plug and aband it. Set open top steel page integrity. Circulate 48'. WOC & TAG. G. pull same from +/- 30' AG 2630' WOC, TAG. 1050' WOC, TAG. x 11-3/4" annulus & set (approved by the BL	on the subit for plu w/ 9.5 pp 00'. Spot 25 sx REC	reclamation, have been abject wellbore a gging. ND WH & g mud and pull to EE ATTACH ONDITIONS as Class C cmt from CLAMATION PROCE ATTACHED of 10, 2010) reque	completed and the operator has as follows:  NU 3,000 psi tbg.  IED FOR S OF APPROVAL com 0-60'.  DURE esting approval to
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C 4. Spot 25 sx Class C 4175. RU Wireline and freepe 6. Spot 75 sx Class C 2827. PERF @ 2600 & SQZ 18. PERF @ 1050 & SQZ 39. Pump 25 sxs Class C 610. Set P&A marker and 11. Use steel tank and ha *This sundry will cancel convert the BEU #122 to 4. I hereby certify that the foregoing is the steel tank and the steel convert the BEU #122 to 4.	r final inspection.) ly requests permission plugging equipment bing. nulus to check tubin cmt from 6,775'-6,9 10' - 4290' WOC, TAC oint 5-1/2". Cut and p 22' - 3055'. WOC & T. 80 sx Class C 2380' 10 sx Class C 625' - cmt 60' down 8-5/8" remediate location. aul all fluids. the previous sundry a SWD well. true and correct. Name (Printed	e filed only after all requirements on to plug and aband it. Set open top steel page integrity. Circulate 48'. WOC & TAG. G. pull same from +/- 30' AG 2630' WOC, TAG. 1050' WOC, TAG. x 11-3/4" annulus & set (approved by the BL	ints, including from the substitute of the subst	reclamation, have been abject wellbore a gging. ND WH & g mud and pull to EE ATTACH ONDITIONS as Class C cmt from CLAMATION PROCE ATTACHED of 10, 2010) reque	completed and the operator has as follows:  NU 3,000 psi  abg.  HED FOR  S OF APPROVAL  com 0-60'.
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C 4. Spot 25 sx Class C 4. Spot 25 sx Class C 41. Spot 75 sx Class C 28. The street of th	r final inspection.)  ly requests permission  plugging equipment  bing.  nulus to check tubin  c cmt from 6,775'-6,9  10' - 4290' WOC, TAC  oint 5-1/2". Cut and plugging  22' - 3055'. WOC & Tac  10 sx Class C 2380'  10 sx Class C 625' -  cmt 60' down 8-5/8"  remediate location.  aul all fluids.  the previous sundry  a SWD well.  true and correct. Name (Printed	on to plug and aband t. Set open top steel p g integrity. Circulate 48'. WOC & TAG. G. pull same from +/- 300 AG 2630' WOC, TAG. 1050' WOC, TAG. x 11-3/4" annulus & s f (approved by the BL	ints, including for the subit for plu w/ 9.5 pp 00'.  Spot 25 sx REC	reclamation, have been abject wellbore a gging. ND WH & g mud and pull to the company of the com	completed and the operator has as follows:  NU 3,000 psi tabg.  HED FOR SOF APPROVAL from 0-60'.  DURE esting approval to
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C 4. Spot 25 sx Class C 4. Spot 25 sx Class C 41. Spot 75 sx Class C 28. The street of th	r final inspection.)  ly requests permission  plugging equipment  bing.  nulus to check tubin  c cmt from 6,775'-6,9  10' - 4290' WOC, TAC  oint 5-1/2". Cut and plugging  22' - 3055'. WOC & Tac  10 sx Class C 2380'  10 sx Class C 625' -  cmt 60' down 8-5/8"  remediate location.  aul all fluids.  the previous sundry  a SWD well.  true and correct. Name (Printed	to filed only after all requirements on to plug and aband at. Set open top steel page integrity. Circulate 48'. WOC & TAG.  G. pull same from +/- 30'. AG 2630' WOC, TAG. 1050' WOC, TAG. x 11-3/4" annulus & serical contents.	ints, including for the subit for plu w/ 9.5 pp 00'.  Spot 25 sx REC	reclamation, have been abject wellbore a gging. ND WH & g mud and pull to the company of the com	completed and the operator has as follows:  NU 3,000 psi tabg.  HED FOR SOF APPROVAL from 0-60'.  DURE esting approval to
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C 4. Spot 25 sx Class C 4. Spot 25 sx Class C 41. Spot 75 sx Class C 282. The standard of the spot 75 sx Class C 282. PERF @ 2600 & SQZ 1 8. PERF @ 1050 & SQZ 3 9. Pump 25 sxs Class C 10. Set P&A marker and 11. Use steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of the steel tank and hat a three transports of three tran	r final inspection.)  ly requests permission  plugging equipment  bing.  nulus to check tubin  cent from 6,775'-6,9  10' - 4290' WOC, TAC  oint 5-1/2". Cut and plugging expected by the continuous of the continuous of the continuous of the continuous of the previous sundry a SWD well.  THIS SPACE  THIS SPACE	e filed only after all requirement on to plug and aband it. Set open top steel page integrity. Circulate 48'. WOC & TAG.  Solution of the property of the second of the page integrity of the second of the page integrity. Circulate 48'. WOC & TAG.  Solution of the page integrity of the second of the second of the page integrity of the second of	ints, including from the subit for plu w/ 9.5 pp 00'.  Spot 25 sx REC.  M on Novellatory Claractery	reclamation, have been abject wellbore a gging. ND WH & g mud and pull to EE ATTACH ONDITIONS as Class C cmt from CLAMATION PROCE ATTACHED to 10, 2010) requestrick	completed and the operator has as follows:  NU 3,000 psi tabg.  HED FOR SOF APPROVAL from 0-60'.  DURE esting approval to
determined that the site is ready for BOPCO, L. P. respectfull  1. MIRU pulling unit and manual BOP for 2-3/8" tu 2. Test 2-3/8" x 5-1/2" and 3. Sqeeze 25 sxs Class C 4. Spot 25 sx Class C 4. Spot 25 sx Class C 41/5. RU Wireline and freepo 6. Spot 75 sx Class C 28/7. PERF @ 2600 & SQZ 1 8. PERF @ 1050 & SQZ 3 9. Pump 25 sxs Class C 6 10. Set P&A marker and 11. Use steel tank and ha *This sundry will cancel convert the BEU #122 to 14. I hereby certify that the foregoing is to Valerie Truax	r final inspection.)  ly requests permission  plugging equipment  plugging equipment  comt from 6,775'-6,9  10' - 4290' WOC, TAC  coint 5-1/2". Cut and plugging expected by the complex  22' - 3055'. WOC & T.  80 sx Class C 2380'  10 sx Class C 625' -  comt 60' down 8-5/8"  remediate location.  aul all fluids.  the previous sundry a SWD well.  Thus SPACE  THIS SPACE	e filed only after all requirements on to plug and aband it. Set open top steel page integrity. Circulate 48'. WOC & TAG.  Solution of the steel page integrity. Circulate 48'. WOC & TAG.  Government of the steel page integrity. Circulate 48'. WOC & TAG.  Government of the steel page integrity. Circulate 48'. WOC & TAG.  Government of the steel page integrity. Title Regulate 12/14  FOR FEDERAL OR Solution of the steel page integrity. Title Regulate 12/14  FOR FEDERAL OR Solution of the steel page integrity.	ints, including from the subit for plu w/ 9.5 pp 00'.  Spot 25 sx REC.  M on Novellatory Claractery	reclamation, have been abject wellbore a gging. ND WH & g mud and pull to EE ATTACH ONDITIONS as Class C cmt from CLAMATION PROCE ATTACHED to 10, 2010) requestrick	completed and the operator has as follows:  NU 3,000 psi abg.  IED FOR S OF APPROVAL  Com 0-60'.  DURE  Esting approval to

fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

#### PROPOSED PLUG AND ABANDONMENT WELLBORE DIAGRAM

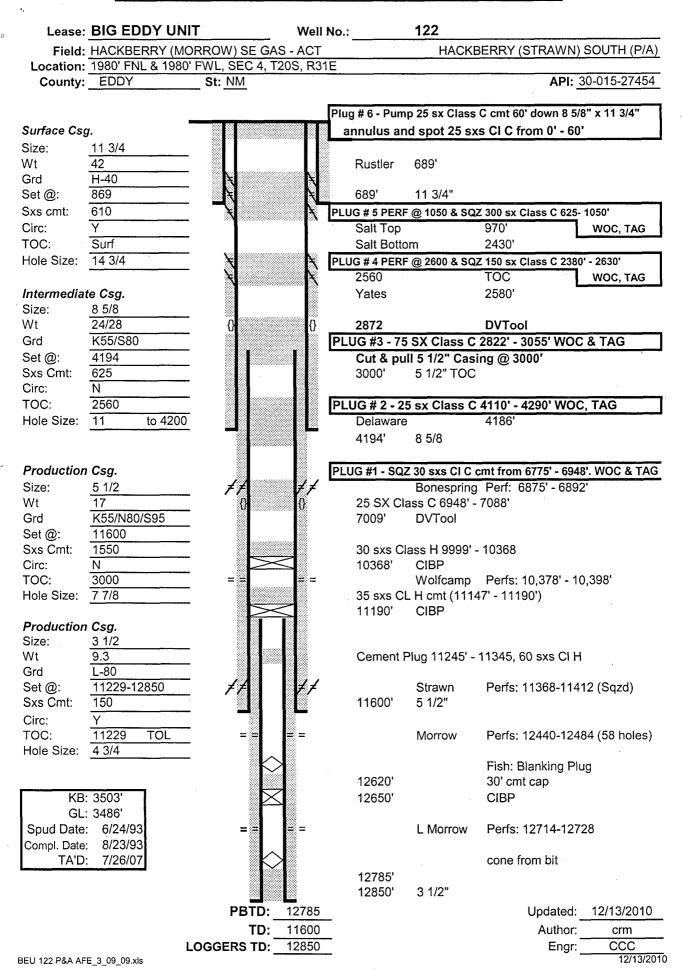

Schematic - Production

Well ID: 30-015-27454


Field: Hackberry Strawn, South 29460

BOPCO, L.P. - West Texas
Well Name: BIG EDDY UNIT #122

Sect: Town: 20S Rng: Eddy Co., State: New Mexico

 Most Recent Job
 Job Category
 Primary Job Type
 Secondary Job Type
 Job Start Date
 Job End Date

 Completion/Workover
 Recompletion
 3/3/2010
 3/10/2010

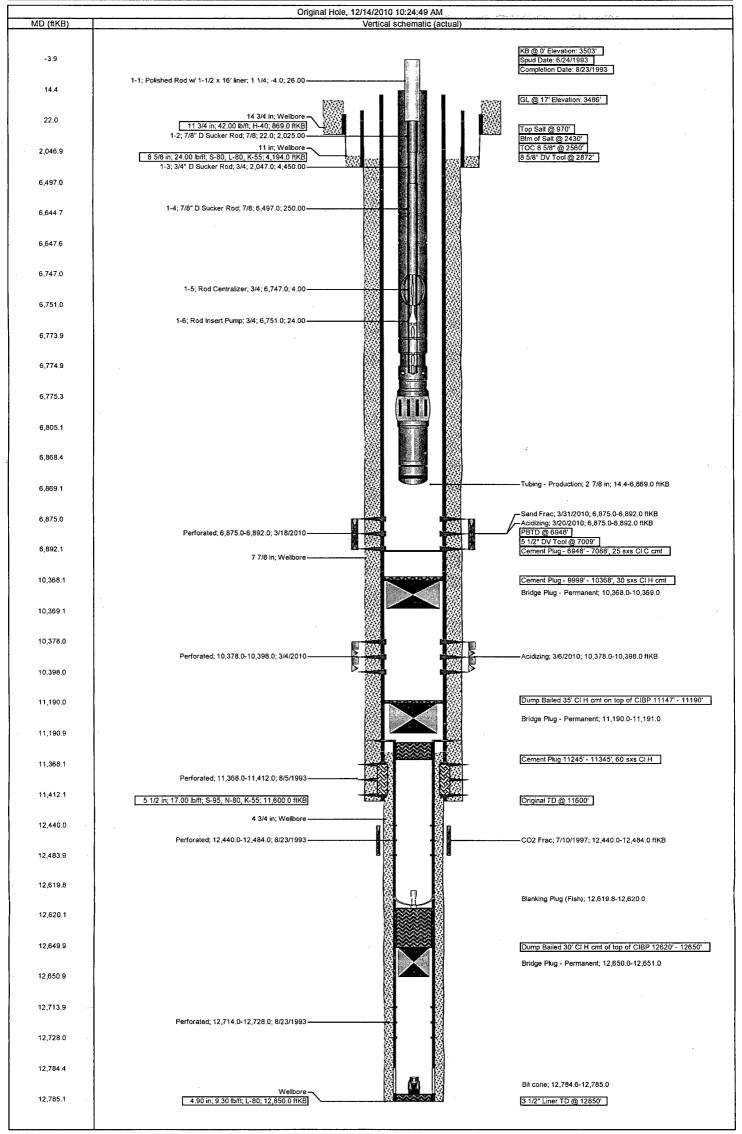

BOPCO, LP

NM-04557: Big Eddy Unit #122

API: 30-015-27454

Eddy County, New Mexico

RE: Plugging and Abandonment Requirements, Conditions of Approval

- 1. OK
- 2. OK
- 3. Change: Spot cement from 7060'-6825'. WOC and tag at 6825' or shallower Otherwise OK (DV Tool Perfs Bone Spring)
- 4. Change: Spot from 4240' Otherwise OK (Delaware)
- 5. OK
- 6. Spot 50' below cut or 2970', whichever is deeper, and tag 80' above or 2820', whichever is shallower Otherwise OK (Capitan Reef Stub DV Tool)
- 7. Tag at 2380' or shallower Otherwise OK (Yates BOS)
- 8. Tag at 625' or shallower Otherwise OK (TOS Casing shoe)
- 9. OK (Surface)
- 10. Verify that all annuluses have cement to surface and fill in as required Otherwise OK
- 11. OK
- 12. Submit a subsequent report to the BLM.

H<sub>2</sub>S monitoring equipment shall be on location.

See attached standard COAs.

DHW 122910

### **BUREAU OF LAND MANAGEMENT**

Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

#### Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation procedure.

DHW 122010



## **United States Department of the Interior**

**BUREAU OF LAND MANAGEMENT** 

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

#### **Reclamation Objectives and Procedures**

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.

- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.
- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Environmental Protection Specialist 575-234-5909, 575-361-2648 (Cell)

Terry Gregston Environmental Protection Specialist 575-234-5958

Bobby Ballard Environmental Protection Specialist 575-234-2230

Randy Rust Natural Resource Specialist 575-234-5943

Linda Denniston Environmental Protection Specialist 575-234-5974

Jennifer Van Curen Environmental Protection Specialist 575-234-5905

Justin Frye Environmental Protection Specialist 575-234-5922 Cody Layton Natural Resource Specialist 575-234-5959

Trishia Bad Bear Natural Resource Specialist 575-393-3612

Todd Suter Surface Protection Specialist 575-234-5987

Doug Hoag Civil Engineering Technician 575-234-5979

Tanner Nygren Natural Resource Specialist 575-234-5975

John Fast Natural Resource Specialist 575-2345996