

Submit 3 Copies
to Appropriate
District Office

State of New Mexico

Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I


P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

811 South First, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd, Aztec, NM 87410

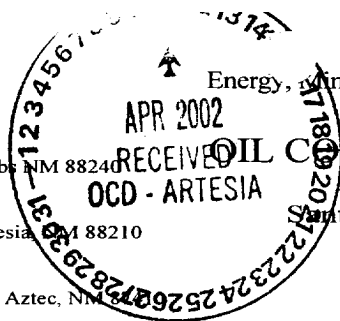

OIL CONSERVATION DIVISION

2040 South Pacheco

Santa Fe, New Mexico 87505

WELL API NO.

30-015-10810

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil & Gas Lease No.

B-9563

7. Lease Name or Unit Agreement Name

GJ West Coop Unit

8. Well No.

45

9. Pool name or Wildcat

Grbg Jackson SR Q Grbg SA

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS).

1. Type Of Well:

OIL
WELL ☒

GAS
WELL ☐

OTHER

2. Name of Operator

Mack Energy Corporation

3. Address of Operator

P.O. Box 960, Artesia, NM 88211-0960

4. Well Location

Unit Letter A : 660 Feet From The North Line and 660 Feet From The East Line

Section 21 Township 17S Range 29E NMPM Eddy, NM County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3550' GL

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Mack Energy Corporation proposes to plug and abandon as follows:

1. Notify OCD 24 hours before starting.
2. Set CIBP @ 2163' and cap w/35' cement 100' above top perforation.
3. Spot 35 sx cement from 850'-750' bottom of salt. *Inside & outside of 4 1/2" casing - Tag*
4. Spot 35 sx cement from 409'-309' 50' above and below 8 5/8 casing shoe. *Inside & outside of 4 1/2" casing - Tag*
5. Spot 10 sx cement from 60' to surface. *Inside & outside of 4 1/2"*
6. Cut off well head and install dry hole marker.

Salt gel mud consisting of 10#
Brine W/25# of gel per bbl
must be placed between each plug

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Crissa D. Carter

TITLE

Production Analyst

DATE

4/10/02

TYPE OR PRINT NAME

Crissa D. Carter

TELEPHONE NO. 748-1288

(This space for State Use)

APPROVED BY:

TITLE

Wild Sep ID

DATE

APR 17 2002

CONDITIONS OF APPROVAL, IF ANY:

[Signature]

1. The first part of the document is a list of the names of the persons who have been appointed to the various positions of the Board of Directors of the company.