



**GCU 40**  
 Fruitland Coal  
 API # 30-045-07182  
 T-28N, R-12-W, Sec. 29  
 San Juan County, New Mexico

**Well History**

Spud Date: 05/14/1953  
 Completion Date: 7/2/1953  
 Recomplete: 3/2/1994  
 Set CIBP @ 1274' Perf and Frac Fruitland Coal  
 10/15/07: Installed pump and rods with sinker bars.  
 Set CIBP @ 1274' Perf and Frac Fruitland Coal  
 3/27/2013: Tubing Repair. Found hole in joint #29 corrosion.  
 Cleanout with bailer 3' to PBTB 1287'  
 RIH land TBG @ 1281'. Run pump and rods


**Formation Tops**

Fruitland Coal 1272'  
 Pictured Cliffs 1303'

NIPPLE, PROFILE, "F", 2.375 OD, 1.780 ID @ 1266'

EOT @ 1281'

CIBP @ 1287'

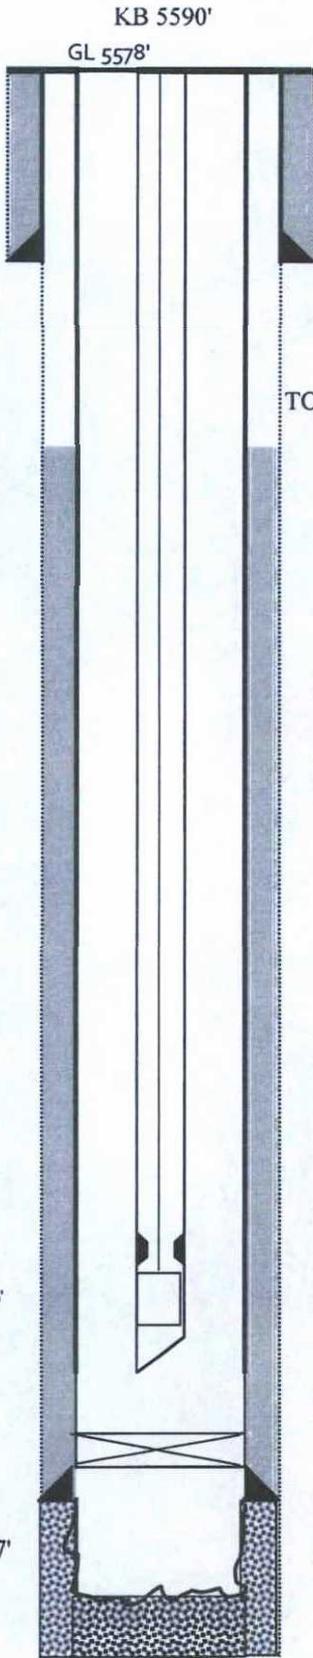

TOC: Unknown

**Surface Casing Data**

9 5/8" 32.3# H-40 @ 72'  
 cmt w/ 75 sx

TOC: unknown

**Rod Details**

ROD PUMP 2 in,  
 SINKER ROD 1.5 in, , C  
 ROD 0.75 in, , D  
 POLISHED ROD 1.5 in,

	<u>Length</u>
ROD PUMP 2 in,	9
SINKER ROD 1.5 in, , C	50
ROD 0.75 in, , D	1,200
POLISHED ROD 1.5 in,	14

**Tubing Details**

Tubing, 2 3/8 , 4.7 , J-55, External-Ups  
 Tubing SUB, 2 3/8 , 4.7 , J-55, External-Ups  
 Tubing SUB, 2 3/8 , 4.7 , J-55, External-Ups  
 Tubing SUB, 2 3/8 , 4.7 , J-55, External-Ups  
 Tubing, 2 3/8 , 4.7 , J-55, External-Ups  
 PROFILE NIPPLE 2.375 in,  
 MULE SHOE COLLAR 2.375 in, , J-55, 4.'

	<u>Length</u>
Tubing, 2 3/8 , 4.7 , J-55, External-Ups	31.62
Tubing SUB, 2 3/8 , 4.7 , J-55, External-Ups	2.25
Tubing SUB, 2 3/8 , 4.7 , J-55, External-Ups	10.07
Tubing SUB, 2 3/8 , 4.7 , J-55, External-Ups	10.15
Tubing, 2 3/8 , 4.7 , J-55, External-Ups	1202.31
PROFILE NIPPLE 2.375 in,	0.97
MULE SHOE COLLAR 2.375 in, , J-55, 4.'	12

**Fruitland Perforations (1994)**

1272 - 1282' 4 JSPF

**Fruitland Frac (1994)**

Frac w/ 38,700# sand & 237 bbl gel and 65Q N2 Foam

**Production Casing Data**

7" 22 & 17# J-55 & N-80 @ 1291'  
 cmt w/ 100 sxS

**PC Openhole ( 1291-1366')( 1953)**

Treated PC w/ 102 quarts explosive material SNG

PBTB: 1287  
 TD: 1366'

updated3/29/2013