

API 30-045-24152

OIL CONS. DIV DIST. 3

DEC 18 2015



Hutton GC 1E
Dakota
API # 30-045-24152
T-29N, R-12-W, Sec. 06
San Juan County, New Mexico

History

Spud Date: 04/1980

Repair (1996) - Cement Squeeze and Reperf of DK

2/1/2010: Found hole in tubing 3rd joint from
f nipple (worn split). Replaced bad joint of tubing.

Cleaned out to 6096'. Relanded tubing, ran pump and rods.

Tubing Detail (2013)

TUBING, 2.375, 4.7#, J-55, EUE

NIPPLE, PROFILE, "F", 2.375 OD, 1.780 ID

MULE SHOE, 2.375

Rod Detail (2012)

ROD, POLISHED: 1.25 X 16 FT

Rods: 4' pony

RODS, PONY: 8' x 0.75 GRD. D

RODS: 3/4" rods (203 jts)

RODS: 3/4" molded guide rods (32jts)

RODS: 1.25" sinker bars (5 jts)

PUMP, RHAC, 2.0 X 1.25 X 14

F nipple @ 6046

EOT @ 6064

Formation Tops

Ojo Alamo 1,050'

Kirtland 1,160'

PC 1,415

Mesaverde 3,705'

Mancos 4,010'

Gallup 5,050'

Dakota 6,020'

Deviation

Depth: 301' - 3/4 degrees

Depth: 1325' - 3/4 degrees

Depth: 1,828' - 1 degrees

Depth: 2,323' - 3/4 degrees

Depth: 2,699' - 1/4 degrees

Depth: 3,200' - 1/4 degrees


Depth: 3,700' - 1/2 degrees

Depth: 4,450' - 1/2 degrees

Depth: 4,950' - 3/4 degrees

Depth: 5,448' - 3/4 degrees

Depth: 5,948' - 1/2 degrees

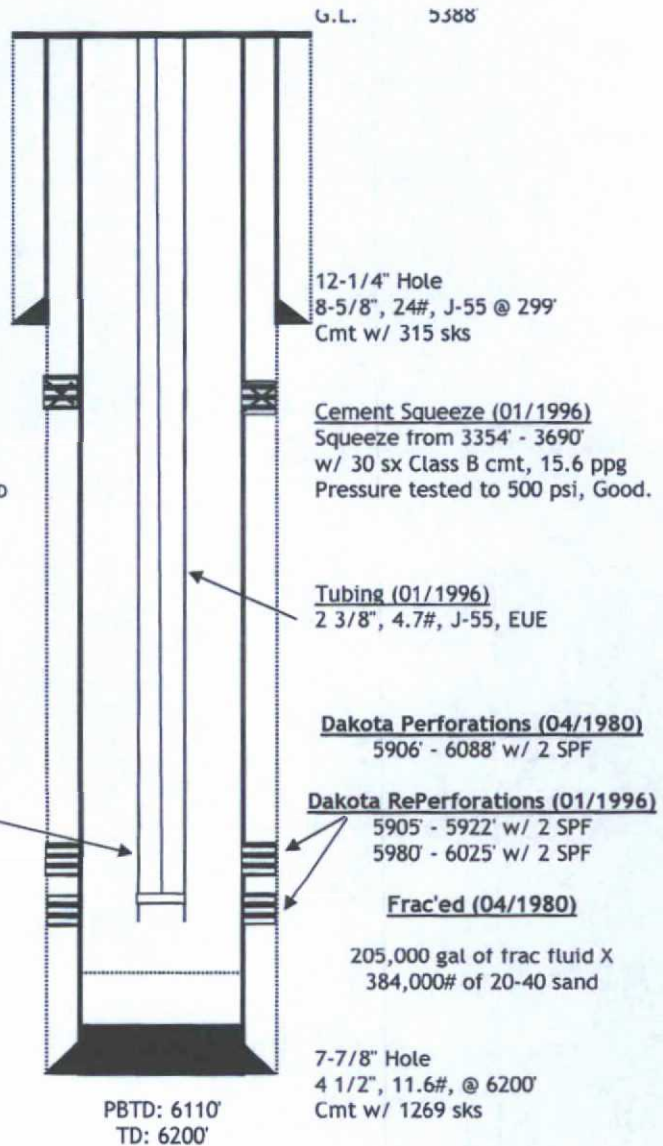

Updated 3/17/15