

30-045-24988

**Heaton Com LS 009A**

MV

API # 30-045-24988

Unit I - Sec. 32 - T31N - R11W
San Juan, NM**Fruitland Perforations**

2060' - 2065'	4 jspf
2068' - 2070'	4 jspf
2075' - 2082'	4 jspf
2134' - 2136'	4 jspf
2140' - 2142'	4 jspf
2145' - 2147'	4 jspf
2149' - 2151'	4 jspf
2153' - 2155'	4 jspf
2159' - 2162'	4 jspf
2172' - 2176'	4 jspf
2183' - 2186'	4 jspf
2238' - 2241'	4 jspf
2257' - 2276'	4 jspf
2314' - 2317'	4 jspf

Frac'd w/ 70% Q foam & 172k# 20/40 sd

Mesa Verde Perforations

4565' - 4568'	2 jspf
4632' - 4658'	2 jspf
4664' - 4669'	2 jspf

Frac'd w/ 70% Q foam & 75k# 12/20 sd

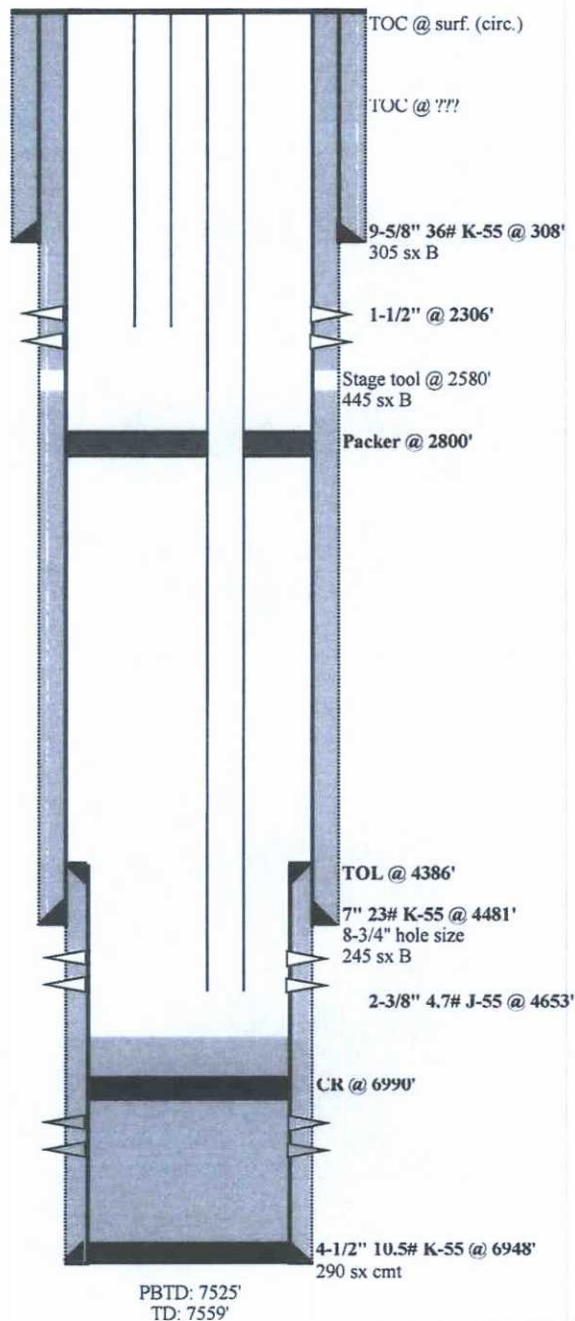
Dakota Perforations

6760' - 6764'	
6812' - 6828'	
6851' - 6860'	

Acidized w/ 1200 gal 15% HCl

Frac'd w/ 60k gal 70% Q foam & 112k# 20/40 sd

GL: 6281'

PBTD: 7525'
TD: 7559'**OIL CONS. DIV DIST. 3**

DEC 18 2015

Depth	Deviation	
	Inclination	
309	0.75	
808	1.00	
1216	1.00	
1728	1.00	
1947	1.00	
2470	1.25	
2762	1.50	
3263	1.50	
3753	1.50	
4034	1.00	
4485	0.75	
4980	1.00	
5480	0.75	
5763	1.25	
6015	2.00	
6365	2.00	
6514	2.00	
6965	1.50	

Formation Tops

Ojo Alamo	866
Kirtland-Fruitland	911
Pictured Cliffs	2300
Cliff House	3970
Menefee	4130
Point Lookout	4630
Mancos	4899
Gallup	5890
Greenhorn	6624
Dakota	6735

Updated: 7/23/2015 ABC

History

3/1/1982 Spudded well. Completed in the DK.

5/25/1994 P&A'd DK. Recompleted to the MV & FT.

1/12/2001 Removed CT from MV tubing string.