

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLI
(Other Instructions
reverse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 0336039 -A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Federal "34"

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Vada Penn

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Section 34,

Twp 9 South, Rge 34 East

12. COUNTY OR PARISH

Lea

13. STATE

N. Mexico

SUNDRY NOTICES AND REPORTS ON WELLS
(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Union Oil Company of California

3. ADDRESS OF OPERATOR

P. O. Box 671 - Midland, Texas 79701

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

555' FNL and 555' FWL of Section 34

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

4233' GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☒CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

T.D. 9,884' P.B.T.D. 9,826' PERFS. 9,806' to 9,814'
CASING RECORD: 11-3/4" @ 392' w/ 300sx, 8-5/8" @ 4,086' w/ 400 sx,
5-1/2" @ 9,884' w/ 300 sx

PROPOSED PLUGGING PROCEDURE:

Set 25 sx plug 9,826' - 9,600'

Set 25 sx plug at 7,800'

Free-Point 5-1/2" Casing and cut off (Approx. 6,000')

31 Set 25 sx plug in and out of 5-1/2" Casing stub

31 Set 25 sx plug at top of Glorieta (Approx. 5,425')

31 Set 25 sx plug at 8-5/8" Casing Shoe

Free-Point 8-5/8" Casing and cut off (Approx. 1,900')

60 Set 25 sx plug in and out of 8-5/8" Casing stub

60 Set 30 sx plug at 11-3/4" Casing Shoe

Set 10 sx plug at surface

Weld steel plate on 11-3/4" Casing and install surface marker as per regulations

Clean up location and abandon

APPROVED SUBJECT TO POSSIBLE FUTURE
REQUIREMENT THAT PAD AND/OR ROAD
BE RIPPED AND RELEVELLED

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Acting Dist. Drilling Supt.

DATE


April 23, 1974

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

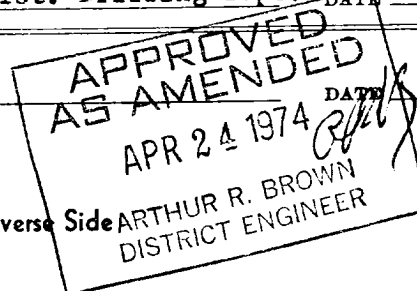

*See Instructions on Reverse Side