

Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.
30-015-26454
5. Indicate Type of Lease
STATE [] FEE [x]
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)
1. Type of Well: Oil Well [x] Gas Well [] Other []
2. Name of Operator: EOG Resources, Inc.
3. Address of Operator: 104 South Fourth Street, Artesia, NM 88210
4. Well Location: Unit Letter B : 660 feet from the North line and 1980 feet from the East line. Section 1 Township 20S Range 24E NMPM Eddy County
11. Elevation (Show whether DR, RKB, RT, GR, etc.): 3592'GR

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:
PERFORM REMEDIAL WORK [] PLUG AND ABANDON [x]
TEMPORARILY ABANDON [] CHANGE PLANS []
PULL OR ALTER CASING [] MULTIPLE COMPL []
DOWNHOLE COMMINGLE []
CLOSED-LOOP SYSTEM []
OTHER: []
SUBSEQUENT REPORT OF:
REMEDIAL WORK [] ALTERING CASING []
COMMENCE DRILLING OPNS. [] P AND A []
CASING/CEMENT JOB []
OTHER: []
Notify OCD 24 hrs. prior to any work done

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

2/17/2018 CBL 2800' to Surface - No log in file

EOG Resources, Inc. plans to plug and abandon this well as follows:

- 1. MIRU all safety equipment as needed. NU BOP. POOH with production equipment.
2. Set a CIBP at 7630'. Pressure test. Spot 25 sx Class "H" cement on top of CIBP to 7497'. WOC and tag. This will cover Canyon perms and top.
3. Perforate at 5743'. Attempt injection rate. Spot a 62 sx Class "C" cement plug from 5843'-5476'. WOC and tag. This will cover DV tool and Wolfcamp top.
4. Spot a 26 sx Class "C" cement plug from 5233'-5078'. This will cover Abo top. Perf & attempt injection - WOC & tag
5. Spot a 25 sx Class "C" cement plug from 3444'-3295'. This will cover Bone Spring top. Perf & attempt injection - WOC & tag
6. Spot a 25 sx Class "C" cement plug from 2232'-2083'. This will cover Glorieta top. Perf & attempt injection - WOC & tag
7. Perforate at 1136'. Attempt injection rate. Spot a 25 sx Class "C" cement plug from 1136'-987'. WOC and tag. This will cover surface casing shoe.
8. Perforate at 640'. Attempt injection rate. Squeeze with 60 sx Class "C" cement from 729'-520'. WOC and tag. This will cover TOC and San Andres top.
9. Perforate at 100'. Attempt injection/circulation. Squeeze with 29 sx Class "C" cement from 100' and circulate up to surface. Back fill as needed.
10. Cut off wellhead and install dry hole marker. Clean location as per regulated. Perf @ 200' & attempt to Circ to surface

Wellbore schematics attached

Spud Date: []

Rig Release Date: []

****SEE ATTACHED COA's****

Must be plugged by 1/25/2023

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Tina Huerta TITLE Regulatory Specialist DATE January 19, 2022

Type or print name Tina Huerta E-mail address: tina.huerta@eogresources.com PHONE: 575-748-4168
For State Use Only

APPROVED BY: [Signature] TITLE Staff Manager DATE 1/25/2022
Conditions of Approval (if any):

Foster AN 2 Current


Sec-TWN-RNG: Sec. 1 - T20S - R24E
FOOTAGES: 660' FNL & 1980' FEL **API: 30-015-26454**
GR: 3,592'

Calc TOC at 679'

Sqz'd Yeso Perfs: 2,686' - 2,706'

DV Tool at 5,793'

Existing Canyon Perfs: 7,680' - 7,790'

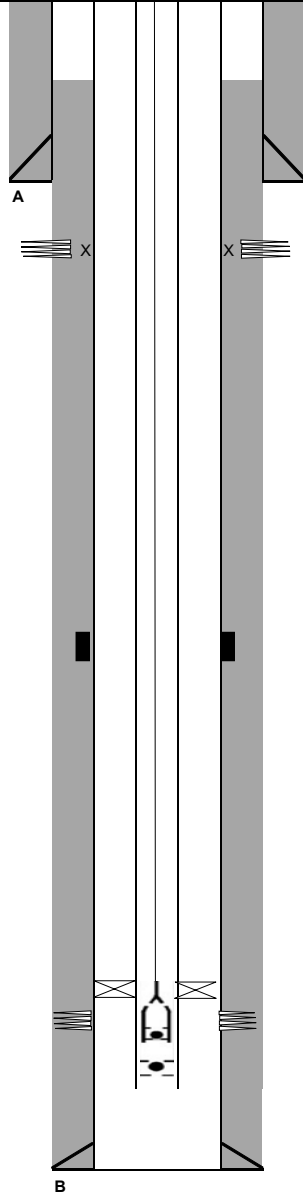

PBD: 8,162 MD
 TD: 8,275 MD

CASING DETAIL

#	HOLE SIZE	SIZE	WGHT	GRADE	Top	Bottom	Sx Cmt	Circ/TOC	TOC Method
A	14 3/4	9 5/8	36	J-55	0	1,086	1100	Surface	Redi-Mix
B	8 3/4	7	23/26	J-55/N-80	0	8,275	1750	679	0% Excess Calc

FORMATION TOPS

Formation	Top (MD)	Formation	Top (MD)
San Andres	570	Wolfcamp	5526
Glorieta	2182	Canyon	7597
Bone Springs	3394		
3rd Bone Springs	4800		
Abo	5183		

TUBING DETAIL 2.25.11

240 jts 2 7/8" tbg + 6.75" TAC + 10 jts 2 7/8" tbg + SN + slotted sub + 1 jt 2 7/8" tbg + bull plug
 Cum. Length - 7940'

Total of 251 jts 2 7/8" tbg

ROD DETAIL 2.25.11

Ct.	Dia.	Length	Type	Ct.	Dia.	Length	Type
1	1.5"	30'	Polished Rod	1	1.5"	24'	25-150-RHBC-24-4 Rod Pump
1	1"	8'	Rod Sub				
100	1"	2500'	Sucker Rod				
99	7/8"	2475'	Sucker Rod				
105	3/4"	2625'	Sucker Rod				
10	1"	250'	Sucker Rod				

PERFORATION DETAIL

Formation	Top	Bottom
Canyon	7,680	7,790
Yeso [Sqz'd]	2,686	2,706

ADDITIONAL DETAIL

DV Tool set at 5,793'
 2.15.18 - CIBP w/ 35' cmt at 7,625'
 1.24.19 - Squeezed Yeso Perfs from 2,686' - 2706'
 1.26.19 - Drilled out CIBP to 8,130'

KJP 10.13.21

Foster AN 2 Proposed

Plug 8 - Perf @ 100. 0-100. Verify @ Surface. Surface plug

Plug 7 - Perf @ 640. 520-729. WOC & tag. TOC & San Andres
Calc TOC at 679'

Plug 6 - Perf @ 1136. 987-1136. WOC & tag. Sur. Csg. Shoe

Plug 5 - 2083-2232. Glorieta Top

Sqz'd Yeso Perfs: 2,686' - 2,706'


Plug 4 - 3295-3444. Bone Spring Top

Plug 3 - 5078-5233. Abo Top

DV Tool at 5,793'

Plug 2 - Perf @ 5743. 5476-5843. WOC & tag. DV Tool & Wolfcamp Top

Plug 1 - CIBP @ 7630. Pressure test. WOC & tag. Canyon Perfs + Canyon top
Existing Canyon Perfs: 7,680' - 7,790'

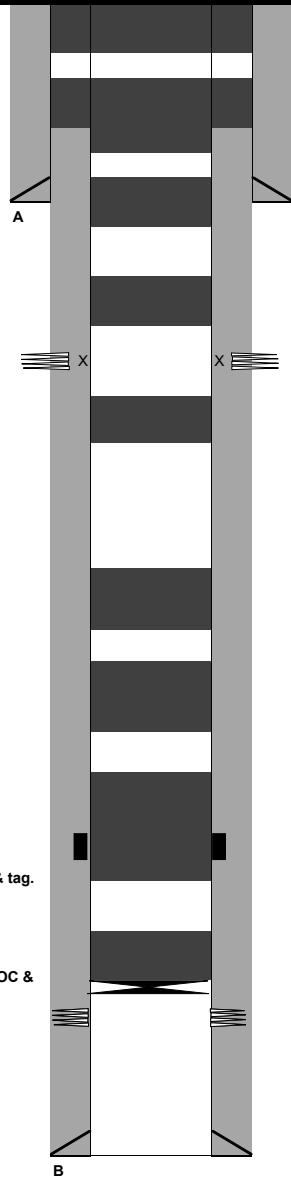

PBTD: 8,162 MD
TD: 8,275 MD

Sec-TWN-RNG:		Sec. 1 - T20S - R24E		API: 30-015-26454					
FOOTAGES:		660' FNL & 1980' FEL		GR: 3,592'					
CASING DETAIL									
#	HOLE SIZE	SIZE	WGHT	GRADE	Top	Bottom	Sx Cmt	Circ/TOC	TOC Method
A	14 3/4	9 5/8	36	J-55	0	1,086	1100	Surface	Redi-Mix
B	8 3/4	7	23/26	J-55/N-80	0	8,275	1750	679	Calc
FORMATION TOPS									
	Formation	Top (MD)		Formation	Top (MD)		Formation	Top (MD)	
	San Andres	570		Wolfcamp	5526				
	Glorieta	2182		Canyon	7597				
	Bone Springs	3394							
	3rd Bone Springs	4800							
	Abo	5183							
PLUGS									
#	SX	Class	Top	Bottom	Δ	Notes	Tag		
1	25	H	7497	7630	133	CIBP @ 7630. Pressure test. Spot 25sx. WOC & tag. Canyon Perfs + Canyon top	Y		
2	62	C	5476	5843	367	Perf @ 5743. Attempt Inj. Spot 62sx. WOC & tag. DV Tool & Wolfcamp Top	Y		
3	26	C	5078	5233	155	Spot 26sx. Abo Top	N		
4	25	C	3295	3444	149	Spot 25sx. Bone Spring Top	N		
5	25	C	2083	2232	149	Spot 25sx. Glorieta Top	N		
6	25	C	987	1136	149	Perf @ 1136. Attempt Inj. Spot 25sx. WOC & tag. Surface Casing Shoe	Y		
7	60	C	520	729	209	Perf @ 640'. Attempt Inj. Sqz 60sx. WOC & tag. TOC & San Andres Top	Y		
8	29	C	0	100	100	Perf @ 100' Attempt Inj. Circ. Sqz 29sx. Verify @ Surface. Surface plug	Y		
PERFORATION DETAIL									
	Formation	Top	Bottom						
	Canyon	7,680	7,790						
	Yeso [Sqz'd]	2,686	2,706						
ADDITIONAL DETAIL									
DV Tool set at 5,793'									
2.15.18 - CIBP w/ 35' cmt at 7,625'									
1.24.19 - Squeezed Yeso Perfs from 2,686' - 2706'									
1.26.19 - Drilled out CIBP to 8,130'									
KJP 10.13.21									

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, **Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.**

1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
3. Trucking companies being used to haul oilfield waste fluids to a disposal – commercial or private – shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
8. Produced water **will not** be used during any part of the plugging operation.
9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
11. Class 'C' cement will be used above 7500 feet.
12. Class 'H' cement will be used below 7500 feet.
13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash---(In the R-111-P Area (Page 3 & 4), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIREMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3. API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)-----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

R-111-P Area

T 18S – R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

T 19S – R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A- F. Sec 27 Unit A,B,C,F,G,H.

T 19S – R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

T 19S – R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

T 20S – R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G.

T 20S – R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 20 – 29. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

T 20S – R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36.

T 21S – R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

T 21S – R 30E

Sec 1 – Sec 36

T 21S – R 31E

Sec 1 – Sec 36

T 22S – R 28E

Sec 36 Unit A,H,I,P.

T 22S – R 29E

Sec 1. Sec2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

T 22S – R 30E

Sec 1 – Sec 36

T 22S – R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

T 23S – R 28E

Sec 1 Unit A

T 23S – R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

T 23S – R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

T 23S – R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E.

T 24S – R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

T 24S – R 30E

Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.

T 24S – R 31E

Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.

T 25S – R 31E

Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720

District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720

District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 73480

CONDITIONS

Operator: EOG RESOURCES INC P.O. Box 2267 Midland, TX 79702	OGRID: 7377
	Action Number: 73480
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	1/25/2022