Rec'd 06/08/2020 - NMOCD

Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 201

	IDEALIGET AND MANA				Expires: Jan	uary 31, 2018	
BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.					5. Lease Serial No. NMNM03677		
					6. If Indian, Allottee or Tribe Name		
SUBMIT IN 1	RIPLICATE - Other inst	tructions on	page 2		7. If Unit or CA/Agreer	ment, Name and/or No.	
1. Type of Well					8. Well Name and No. STEBBINS GQ FEDERAL COM 1		
☐ Oil Well ☑ Gas Well ☐ Oth						DERAL COM 1	
2. Name of Operator Contact: KAY MADDOX EOG RESOURCES, INC E-Mail: kay_maddox@eogresources.com					9. API Well No. 30-015-21939		
3a. Address PO BOX 2267 ATTENTION; KAY MADDOX MIDLAND, TX 79702 3b. Phone No. (include area of Ph: 432-686-3658)					10. Field and Pool or Exploratory Area BURTON FLAT;STRAWN,E GAS		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					11. County or Parish, State		
Sec 20 T20S R29E Mer NMP NWNE 660FNL 1980FEL 32.564392 N Lat, 104.095123 W Lon					EDDY COUNTY, NM		
12. CHECK THE AF	PPROPRIATE BOX(ES)	TO INDICA	ΓE NATURE O	F NOTICE	, REPORT, OR OTH	ER DATA	
TYPE OF SUBMISSION		· · · · · · · · · · · · · · · · · · ·	TYPE OF	ACTION			
S Nation of Intent	☐ Acidize	□ Dee	en	☐ Produc	tion (Start/Resume)	☐ Water Shut-Off	
☑ Notice of Intent	☐ Alter Casing	☐ Hyd	raulic Fracturing	☐ Reclam	nation	■ Well Integrity	
☐ Subsequent Report	☐ Casing Repair	□ New	Construction	☐ Recom	plete	Other	
☐ Final Abandonment Notice	☐ Change Plans	□ Plug	and Abandon	□ Tempo	rarily Abandon		
	☐ Convert to Injection	☐ Plug	Back	☐ Water	Disposal		
If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for fit EOG PROPOSES TO PLUG WELLBORE DIAGRAMS ALS	k will be performed or provide operations. If the operation re bandonment Notices must be fil inal inspection. AND ABANDON THIS WI	the Bond No. or sults in a multipl led only after all	file with BLM/BIA e completion or reco requirements, includ	. Required sompletion in a ing reclamation	ubsequent reports must be finew interval, a Form 3160 on, have been completed an JRE.	iled within 30 days -4 must be filed once	
			ROVAL SUB				
			ERAL REQU				
		SPE(CIAL STIPU	LATION	S		
		ATTA	CHED				
				Accepte	d - KMS NMOCI	D	
14. I hereby certify that the foregoing is	Electronic Submission #	509813 verifie	d by the BLM Wel	I Informatio	n System		
	Committed to AFMSS for	or processing	y PRISCILLA PE	REZ on 04/0	06/2020 ()		
Name (Printed/Typed) KAY MAD	DOX		Title REGUL	ATORY SF	PECIALIST		
Signature (Electronic S	Submission)		Date 04/06/2	020			
	THIS SPACE FO	OR FEDERA	L OR STATE	OFFICE L	JSE		
Approved By Long Vo	2		Title Petrol	oum F	ngineer	Date 4/16/2	93
Conditions of approval, it any, are attache certify that the applicant holds legal or equ	uitable title to those rights in the	s not warrant or e subject lease			J	Dut 4// 6/ A	No.
which would entitle the applicant to condu			Office CF		1	Cd. XX 1. 1	
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent				willfully to n	nake to any department or a	igency of the United	



Stebbins GQ Federal Com #1 - P&A

SEC 20, T20S, R29E

API # 30-015-21939

- 1. Notify Regulatory Agency 24 hours prior to commencing work. MIRU well service unit and all necessary safety equipment.
- 2. ND WH, NU BOP, Unset PKR @ 10,319 and TOH laying down 2 3/8" production string.
- 3. Set 5.5" CIBP at 11,388'.
- 4. Tag CIBP, circulate plugging mud and spot 25 sx Class H on top of CIBP; WOC & Tag.
- 5. Set 5.5" CIBP at 10,340'. Leak Jest CIBP
- 6. Tag CIBP, circulate plugging mud and spot 25 sx Class H on top of CIBP; WOC & Tag.
- 7. Pick up, spot a 25 sx class H cement plug from 9,240' 9,040'.
- 8. Pick up, perf @ 6,040' and sqz a 55 sx class C cement plug to 5,820'. 5711' 805x TAL
- 9. Pick up, perf @ 3,195' and sqz a 35 sx class C cement plug to 3,050'.
- 10. Pick up, perf @ 900' and sqz a 215 sx class C cement plug to surface.
- 11. Cut off WH 3' below surface; verify cement to surface & weld on P&A marker.
- 12. Cut off anchors 3' below surface and clean location.

Well Name:

Stebbins GQ Federal Com #1

Location: County:

660' FNL & 1980' FEL Sec. 20-20S-29E

Lat/Long: API#: Spud Date:

Eddy, NM 32.5643921,-104.0951233 NAD83 30-015-21939 10/28/76

Compl. Date: 1/24/77

Current Wellbore Diagram:

KB: 3279' GL: 3261'

17-1/2" Hole


13-3/8" 48# H-40 @ 605' Cmt w/ 600 sx; TOC @ surf

12-1/4" Hole

8-5/8" 32# J-55 @ 3,100' Cmt w/ 2,000 sx; TOC @ surf

7-7/8" Hole

5-1/2" 17 & 20# N-80 @ 11,895' Cmt w/ 600 sx; TOC @ 8,350 (TS)



2-3/8" TBG & PKR @ 10,319'

-Strawn perfs: 10,389 - 10,572'

RBP @ 10,800'

Atoka perfs: 10,875 - 10,882'

Morrow perfs: 11,438' - 11,513'

Formation Tops				
Salado	440			
Yates	850			
Delaware	3,141			
Bone Spring	5,871			
Wolfcamp	9,190			
Strawn	10,359			
Atoka	10,610			
Morrow	11,314			

Not to Scale By: HJG 3/24/20

Well Name:

Stebbins GQ Federal Com #1

Location:

660' FNL & 1980' FEL Sec. 20-20S-29E

County: Eddy, NM

Lat/Long: API #: Spud Date: 32.5643921,-104.0951233 NAD83

30-015-21939

10/28/76 Compl. Date: 1/24/77

Proposed Wellbore Diagram:

KB: 3279' GL: 3261'

17-1/2" Hole


13-3/8" 48# H-40 @ 605' Cmt w/ 600 sx; TOC @ surf

12-1/4" Hole

8-5/8" 32# J-55 @ 3,100' . Cmt w/ 2,000 sx; TOC @ surf

7-7/8" Hole

5-1/2" 17 & 20# N-80 @ 11,895' Cmt w/ 600 sx; TOC @ 8,350 (TS)

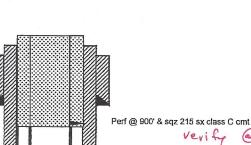

Formation Tops Salado Yates 850 Delaware 3,141 Bone Spring 5,871 Wolfcamp 9,190 Strawn 10,359 10,610 Atoka Morrow 11,314

eog resources

Perf @ 900' & sqz 215 sx class C cmt to surf

verify @ surface

Perf @ 3,195' & sqz 35 sx class C cmt to 3,050' 7 ft WOC & Tag

80 5x

Perf @ 6,040' & sqz 55 sx class C cmt to 5,820'

Spot 25 sx class H cmt plug @ 9,240 - 9,040*

Set CIBP w/ 25 sx class H cmt @ 10,340' Leak test CIBP WOC & Tag Strawn perfs: 10,389 - 10,572'

Atoka perfs: 10,875 - 10,882'

PBTD @ 11,872 TD @ 11,909'

Set CIBP w/ 25 sx class H cmt @ 11,388' WOC & Tag Morrow perfs: 11,438' - 11,513'

> Not to Scale By: HJG

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

I. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 2.5 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and

embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well.
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/mn



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide crosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of
 Operations must include adequate measures for stabilization and reclamation of disturbed lands.
 Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
 process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well completion, and final reclamation.
- The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Henryetta Price Environmental Protection Specialist 575-234-5951

Shelly Tucker Environmental Protection Specialist 575-234-5979

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612