

Submit 1 Copy To Appropriate District Office
 District I - (575) 393-6161
 1625 N. French Dr., Hobbs, NM 88240
 District II - (575) 748-1283
 811 S. First St., Artesia, NM 88210
 District III - (505) 334-6178
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV - (505) 476-3460
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 October 13, 2009

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

WELL API NO. 30-015-23207
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. L-6381
7. Lease Name or Unit Agreement Name Carlsbad State Com
8. Well Number 1
9. OGRID Number 229137
10. Pool name or Wildcat Carlsbad; Wolfcamp, South (Gas)
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3105' GL

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well Gas Well Other

2. Name of Operator
COG Operating, LLC

3. Address of Operator
600 W. Illinois Ave. Midland, TX 79701

4. Well Location
 Unit Letter **E** : **2140** feet from the **NORTH** line and **990** feet from the **WEST** line
 Section **16** Township **22S** Range **27E** NMPM County **EDDY**

NM OIL CONSERVATION
 ARTESIA DISTRICT
 JUL 26 2017
 RECEIVED

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Tag cement plug @ 10232'.
2. Set 7 5/8" CIBP @ 9330'. Circulate hole w/ mud laden fluid. Pressure test csg. Spot 25 sx cmt @ 9330-9230'. -WOC & TAG
3. Spot 25 sx cmt @ 7000-6900'. - (WOLF CAMP)
4. Perf & Sqz 50 sx cmt @ 5320-5220'. WOC & Tag (10 3/4 Shoe, Bone Springs)
5. Perf & Sqz 50 sx cmt @ 2050-1950'. (Delaware) - WOC & TAG
6. Perf & Sqz 50 sx cmt @ 1830-1730'. WOC & Tag (DV Tool)
7. Perf & Sqz 70 sx @ 515-320'. WOC & Tag (16 Shoe, T/Salt)
8. Perf & Sqz 50 sx cmt @ 100'-Surface.
9. Cut off well head, verify cmt to surface, weld on Dry Hole Marker.

Spud Date: Rig Release Date:

WELL MUST BE PLUGGED BY 7/26/18

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Abigail Montgomery TITLE Agent DATE 7/25/17
 Type or print name Abigail Montgomery E-mail address: abbym@bcmandassociates.com PHONE: 432-580-7161
For State Use Only

APPROVED BY: Robert R. Byrd TITLE COMPLIANCE OFFICER DATE 7/26/2017
 Conditions of Approval (if any):

★ SEE ATTACHED COA-S


32.3939819
-104.200264

CPI # 30-015-2320'1

Updated 3/9/00 by ILC 1-4-2016
S. Line PT KBL

OPERATOR INTERNORTH, INC.
FIELD SOUTH CARLSBAD (MORROW)
ELEVATION KB 3121 DF 3120 CL 3105
RD 11827 PBD 11704 COMPL 8-4-80

LEASE & WELL NO. CARLSBAD ST. COM. #41
LOCATION 2140' ENL & 990' E WL
SEC 16 TWP 22-S Range 5 SURVEY 27-E
COUNTY EDDY STATE NEW MEXICO

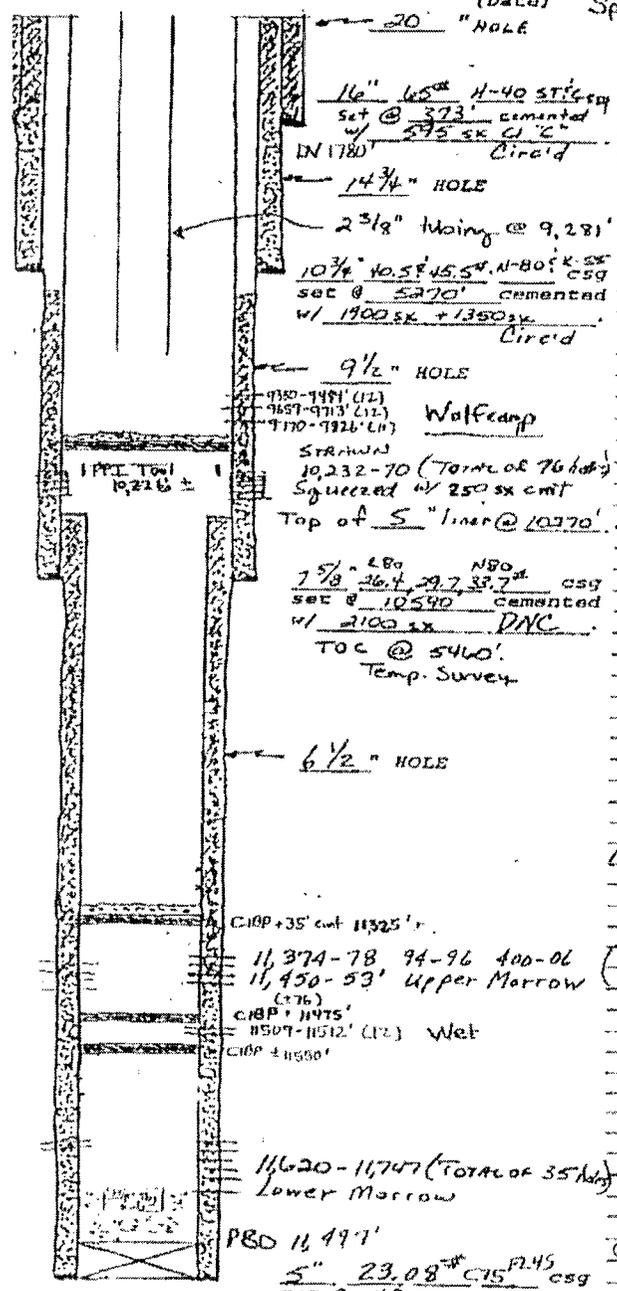

(Dacor) Spud. 3-14-1990

AVAILABLE DATA

LOGS: DLL, CN-FD, GRI/CRI/CLL
SAMPLE LOGS:
CORE:
DST:

COMPLETION & REMEDIAL WORK

5-28-80 - Perf w/ 1 SPB 11620, 621, 630-640, 700-712 1/2, 723-733, 740-747 (Total of 35 holes - 0.02)
5-29-80 - Acidize w/ 1750 gals 10% mactha acid
5-31-80 - Acidize w/ 5700 gals 10% mactha acid w/ 500 gal 1661 N₂
6-11-80 - Treat w/ 2% KCl wtr + surfactant - clay stabilizer + 1000 SCF 1661 N₂
7-6-80 - Perf Stratum 10,232-270 w/ 2 SPB (Total of 76 holes)
7-7-80 - Acidize Stratum w/ 3500 gals 15% acid + 1000 SCF N₂/1661
7-9-80 - Acidize w/ 14,490 gals Series 72 Type 20 acid + treated w/ 2% KCl wtr, 1000 SCF N₂/1661
7-13-80 - Acidize w/ 20,000 gals Series 72 Type 20 acid
7-17-80 - Squeeze Stratum parts 10,232-270 w/ 100 gal C/L
7-22-80 - Re-squeeze Stratum w/ 150 SK cement
8-20-80 - Flowed ARO 1.1 mmpd on 20/60" chd FTP 348 psi. Producing from Morrow #2 11747.
1-24-81 - Intake delivery ARO 274 mmpd w/ FTP 500 psi.
11-3-89 - Install compressor.
12/11/89 RHM w/ water bar, tag @ 2900'. pieces 50g stuck on bar. SWB 1 run, rec sm wtr. RD.
8/95 Unattached permanent packer, Set another packer @ 11,497'. Perf'd Upper Morrow (1 SPB) @ 11,374-78, 94-96 (9'uns) 11,400-06 @ 150-53'. Acidized same w/ 3100 gal 1 1/2% HCl w/ 19,000 gal N₂ w/ 100 B.S.'s. Ret to prod 6 1/2 mmpd Upper Morrow only: closed & spaced @ 145 mmpd. (5117' 2500' w/ 10% acid)
6/76 - Squeeze 16,620' & scattered. V. little flow. Light gas blow.
1/01 - Blowed in 100 15 bbls 27.5% HCl. RHM w/ water. Hydrobed to 6000 psi. Hole TD 10' from bottom. Sumb to 5M w/ th slight blow and run. 1000' ENP West AM.
Acid job performed out 2 times before initially put a cap.

CIP + 35' cmt 11325' r.
11,374-78, 94-96 400-06
11,450-53' Upper Morrow
(176)
CIP @ 11475'
11507-11512' (172) Wet
CIP @ 11550'
11620-11747 (Total of 35 holes)
Lower Morrow
PBD 11,497'
5" 23.08' C15 P.45
sec @ 11827 cemented
w/ 225 SK Circ'd.

32.3939819
-104.200264

API# 30-015-23207

Updated 3/9/00 by TIC 1-4-2016
S. Limit
KBL
LEASE & WELL NO. CARLSBAD ST. Com. #1

OPERATOR INTERNORTH, INC.

FIELD SOUTH CARLSBAD (MORROW)


ELEVATION KB 3121 DF 3120 GE 3105

FD 11827 PSTD 11784 COMPL 8-4-80

LOCATION 2140' FNL & 990' FNL

SEC 16 TWP 22-S Range 27-E SURVEY

COUNTY EDDY STATE NEW MEXICO

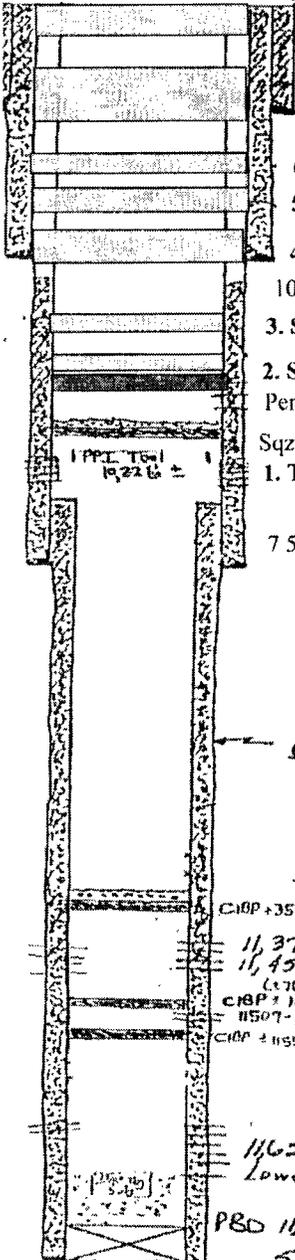

8. Perf & Sqz 50 sx cmt @ 100'-Surface.

16" csg @ 373' w/ 595 sx cmt. TOC-Surface. 20" hole

7. Perf & Sqz 70 sx @ 515-320'. WOC & Tag (16 Shoe, T/Salt)

6. Perf & Sqz 50 sx cmt @ 1830-1730'. WOC & Tag (DV Tool)

5. Perf & Sqz 50 sx cmt @ 2050-1950'. (Delaware)

4. Perf & Sqz 50 sx cmt @ 5320-5220'. WOC & Tag (10 3/4 Shoe, Bone Springs)

10 3/4" csg @ 5270' w/ 3250 sx cmt. TOC @ Surface. 14 3/4" hole

3. Spot 25 sx cmt @ 7000-6900'. - (W/C)

2. Set 7 5/8" CIBP @ 9330'. Spot 25 sx cmt @ 9330-9230'. - WOC & TAG

Perfs @ 9380-9826'

Sqz'd 250 sx cmt @ 10232-10270'

1. Tag cement plug @ 10232'.

7 5/8" csg @ 10590' w/ 2100 sx cmt. TOC @ 5460'. 9 1/2" hole

6 1/2" HOLE

CIBP + 35' cmt 11325' +

11,374-78 94-96 400-06

11,450-53' Upper Morrow

(176)

CIBP 11475'

11507-11512' (17) Wet

CIBP 11550'

11,620-11,747 (TOTAL OF 35' holes)
Lower Morrow

PBD 11,497'

5" 23.08" C75 FL45 csg

set @ 11827 cemented

w/ 225 sx Circoid

CONDITIONS FOR PLUGGING AND ABANDONMENT

District II / Artesia N.M.

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, **Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work.**

1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs.
2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
3. Trucking companies being used to haul oilfield waste fluids to a disposal – commercial or private – shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
6. **Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.**
7. Produced water **will not** be used during any part of the plugging operation.
8. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
9. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
10. **Class 'C' cement will be used above 7500 feet.**
11. **Class 'H' cement will be used below 7500 feet.**
12. **A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged**
13. **All Casing Shoes Will Be Perforated and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing**
14. **A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.**
15. **If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing**

16. **When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set**
17. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, **(WOC 4 hrs and tag)**.
18. **No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.**
19. Any Production Formations will be isolated with cement plugs: Some of these are:
 - A) **Strawn, Fusselman, Devonian, Marrow, Atoka, Wolfcamp, Bone springs, Delaware, San Andres, Abo, Glorieta, Any Salt Section, (Potash), Grayburg, Queen, Yates, Tubb, 7-Rivers**
 - B) **Potash---** (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, **WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.**
20. **If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing**

DRY HOLE MARKER REQUIREMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County

(SPECIAL CASES)

AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)