UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

5.	Lease Serial No.
	NMNM2748

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.

6. If Indian, Allottee or Tribe Name


	·							
SUBMIT IN TRIPLICATE - Other instructions on page 2						7. If Unit or CA/Agreement, Name and/or No.		
Type of Well	8. Well Name and No. GISSLER B 18							
2. Name of Operator EOG Y RESOURCES INC		9. API Well No. 30-015-25224-00-\$1						
3a. Address 104 S 4TH STREET ARTESIA, NM 88210			o. (include area code) 18-4168		10. Field and Pool or Exploratory Area SQUARE LAKE			
4. Location of Well (Footage, Sec., T	, R., M., or Survey Description)	·		11. County or Parish	, State		
Sec 11 T17S R30E NWSE 19		EDDY COUNTY, NM						
12. CHECK THE A	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE OI	F NOTICE,	REPORT, OR OT	HER I	DATA	
TYPE OF SUBMISSION			TYPE OF	ACTION				
Notice of Intent ■	☐ Acidize	☐ Dee	pen	☐ Producti	on (Start/Resume)	0 /	Water Shut-Off	
_	☐ Alter Casing	🗖 Нус	Iraulic Fracturing	□ Reclama	☐ Reclamation		Well Integrity	
☐ Subsequent Report	□ Casing Repair	☐ Nev	v Construction	☐ Recomp	lete		Other	
☐ Final Abandonment Notice	□ Change Plans	🛛 Plu	g and Abandon	☐ Tempora	arily Abandon			
	Convert to Injection	☐ Plu	g Back	■ Water D	isposal			
13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. EOG Y Resources, Inc. plans to plug and abandon this well as follows: 1. MIRU all safety equipment as needed. POOH with production equipment. 2. RIH with bit and scraper to 2932 ft. 3. Set a CIBP at 2932 ft, with 252 ft (30 sx) Class C cement on top to 2680 ft calc TOC. This will cover the top of the San Andres and Grayburg. WOC. Tag TOC. 4. Perforate at 440 ft, Attempt to establish circulation between 8-5/8 inch and 5-1/2 inch casing. 5. Spot 440 ft (120 sx) Class C cement plug from 440 ft up to surface inside and outside 5-1/2 inch casing. This will, cover the 8-5/8 inch casing shoe and surface plug. WOC. Back fill as necessary. 6. Cut off wellhead and install dry hole marker. Clean location. 14. I hereby certify that the foregoing is true and correct. Electronic Submission #4444493 verified by the BLM Well Information System For EOG Y RESOURCES INC, sent to the Carlsbad								
Commi Name(Printed/Typed) TINA HUE	RAH MCKINNEY o	n 11/19/2018 ATORY SPE	•	KEC	EIVED			
Signature (Electronic S	Date 11/19/20							
	THIS SPACE FO	R FEDERA	L OR STATE (OFFICE US	BE			
Approved By Conditions of approval, it any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to conduct the conductive of the co	itable title to those rights in the ct operations thereon.	subject lease	Office CFC	ET.	ke to any denartment	or agency	12-3-18 Date	
States any false, fictitious or fraudulent s	tatements or representations as	to any matter w	ithin its jurisdiction.	williamy to ina	ke to any department (л адепсу	or the United	

(Instructions on page 2)
** BLM REVISED ** BLM REVI



WELL NAME: Gissler B #18 FIELD: LOCATION: 1980' FSL & 1980' FEL Sec.11-17S-30E Eddy County, NM **GL**: 3718' **ZERO**: **KB**: 10' COMMENTS: API No.: 30-015-25224

Casing Program				
Size & Grade	Depth (ft)			
8-5/8" J-55 24#	390			
5-1/2" J-55 15.5#	3539			

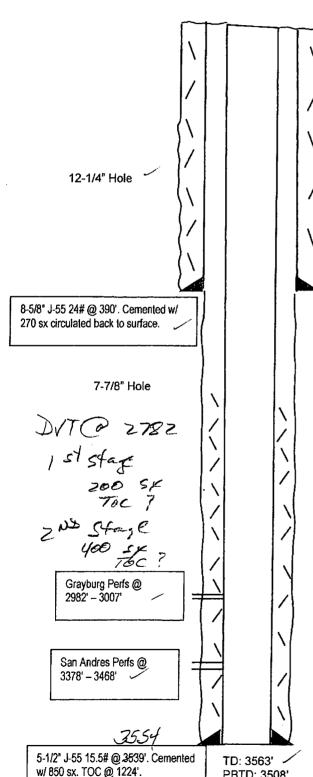

PBTD: 3508'

Before

Formations				
Tops	Depth (ft)			
Rustler	380			
Salt Top	490			
Salt Base	1240			
Red Sand	2298			
Grayburg	2730			
San Andres	3010			

Perf @ 1860, 202 San Andres 3010
250x cm+ 6 1790. (4/26/85)
Perf @ 2560, NO SQZ

Not to Scale 11/15/2018 SAA


WELL NAME: Gissler B #18 FIELD: LOCATION: 1980' FSL & 1980' FEL Sec.11-17S-30E

Eddy County, NM

GL: 3718' ZERO: KB: 10'

COMMENTS: API No.: 30-015-25224

Casing Program				
Size & Grade	Depth (ft)			
8-5/8" J - 55 24#	390			
5-1/2" J-55 15.5#	3539			

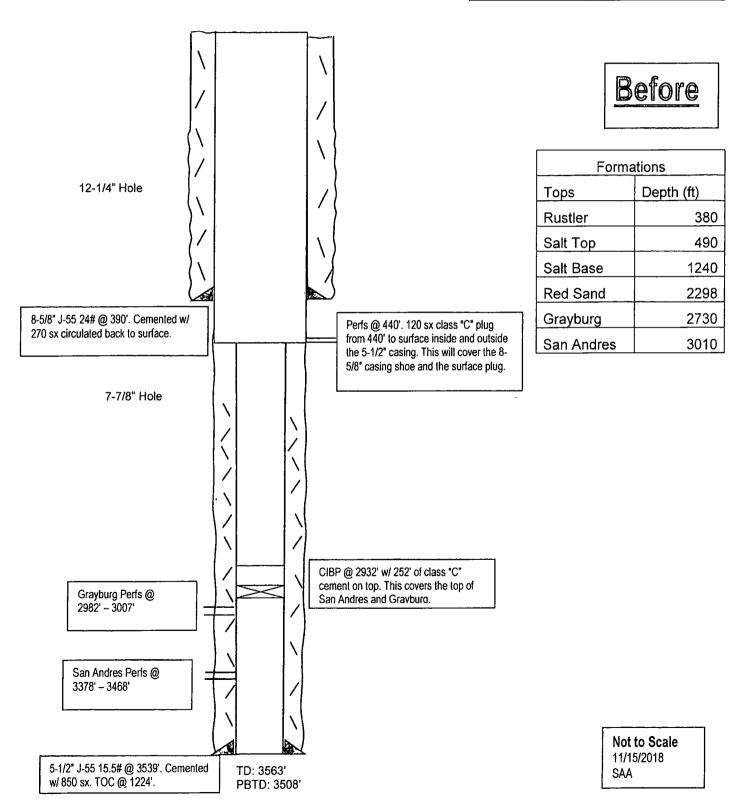

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted