Form 3160-5	UNITED STATES	, RECEIVED		FORM APPROVED			
	PARTMENT OF THE IN			OMB No. 1004-0137 Expires: January 31, 2018			
BUR	REAU OF LAND MANA	GEMENTIUN 252)19 5.	. Lease Serial No.			
	NOTICES AND REPO		LC-029415-A				
Do not use this	form for proposals to Use Form 3160-3 (AF	dringratory appres	AO.C.D.	If Indian, Allottee or Tribe Name			
	ITRIPLICATE - Other instruc	ctions on page 2	7.	If Unit of CA/Agreement, Name and/or No.			
1. Type of Well	8.	8. Well Name and No. PUCKETT "A" WH 2					
2. Name of Operator HUDSON OIL	9.	9. API Well No. 35-015-31082					
3a. Address		3b. Phone No. (include area co	nclude area code) 10. Field and Pool or Exploratory Area				
	Worth, TX 76102	817-336-7109					
4. Location of Well <i>(Footage, Sec., T.,</i> Sec 24, T17S – R31E 1330' FN		· ·		11. Country or Parish, State EDDY COUNTY, NM			
12. CHI	ECK THE APPROPRIATE BO	X(ES) TO INDICATE NATU	RE OF NOTICE	E, REPORT OR OTHER DATA			
TYPE OF SUBMISSION		YPE OF ACTION	YPE OF ACTION				
✓ Notice of Intent				luction (Start/Resume) Water Shut-Off			
	Alter Casing	Hydraulic Fracturing					
Subsequent Report	Casing Repair	New Construction		omplete Other			
Final Abandonment Notice	Change Plans	✓ Plug and Abandon Plug Back	Water I	arily Abandon			
		os n. Ung	pail 30	s'ent on top of CIB			
3. RIH with tbg and tag cemei 19001780'. WOC. RIH and	nt @ 2,000 If necessary, p d tag cement. POOH.	ump additional cement to b	ring top to 2,99	with 9.5 ppg mud. Test casing to 1000 psi. Spot			
3. RIH with tbg and tag ceme	nt @ 2,000 If necessary, p d tag cement. POOH.	ump additional cement to b	ring top to 2,09	B. Se/+)			
3. RIH with tbg and tag cemei 19001780'. WOC. RIH and	nt @ $\frac{2}{2,800}$ If necessary, p d tag cement. POOH. pm $\frac{736}{736}$ – 536'. WOC. RIH	ump additional cement to b	ring top to 2,09	B. Salt & Shoe GC 6/26/19			
 RIH with tbg and tag ceme 1900'-1780', WOC, RIH and RIH and spot 25 sx plug fro RIH and circulate cement 6 	ant @ $\frac{2}{2}$, 2	ump additional cement to b PSO - 1660 and tag cement. POOH wi	ring top to 2,95	B. Se/+)			
 RIH with tbg and tag cemer 1900 - 1780'. WOC. RIH and 4. RIH and spot 25 sx plug fro 5. RIH and circulate cement 6 6. Cut off well head and verify location. RECLAMATION: "Rip and rem 	int (a) $\frac{2}{2}$, \frac	ump additional cement to b PSD - 1660 and tag cement. POOH wi both casing strings. Install I ounding topography, resee	ring top to 2, 9 At at a 	B. Self & Shoe GC 6/26/19 Accepted for record - NMOC Inv hole marker. Cut off anchors, restore and rest SEE ATTACHED FOR			
 RIH with tbg and tag cement 1900'-1780'. WOC. RIH and 4. RIH and spot 25 sx plug from 5. RIH and circulate cement 6 6. Cut off well head and verify location. RECLAMATION: "Rip and remains." 	ant @ 2,000. If necessary, p d tag cement. POOH. om 736 – 536'. WOC. RIH 50' to surface. y cement to surface around to nove caliche, contour to surr	ump additional cement to b PSO – 1660 and tag cement. POOH wi poth casing strings. Install I ounding topography, resee <i>ued/Typed</i>)	tring top to 2,0 5 At as th tubing. below ground c	B. Salt & Shoe GC 6/26//9 Accepted for record - NMIOC In hole marker. Cut off anchors, restore and rest SEE ATTACHED FOR CONDITIONS OF APPR			
 RIH with tbg and tag cement 1900'-1780'. WOC. RIH and 4. RIH and spot 25 sx plug from 5. RIH and circulate cement 6 6. Cut off well head and verify location. RECLAMATION: "Rip and remains." 	int (a) $\frac{2}{2}$, \frac	ump additional cement to b PSO – 1660 and tag cement. POOH wi poth casing strings. Install I ounding topography, resee <i>ued/Typed</i>)	ring top to 2, 9 At at a 	B. Salt & Shoe GC 6/26//9 Accepted for record - NMIOC In hole marker. Cut off anchors, restore and rest SEE ATTACHED FOR CONDITIONS OF APPR			
 RIH with tbg and tag cement 1900'-1780', WOC, RIH and 4. RIH and spot 25 sx plug from 5. RIH and circulate cement 6 6. Cut off well head and verify location. RECLAMATION: "Rip and rement 14. I hereby certify that the foregoing is 	ant @ 2,000. If necessary, p d tag cement. POOH. om 736 – 536'. WOC. RIH 50' to surface. y cement to surface around to nove caliche, contour to surr	ump additional cement to b PSO – 1660 and tag cement. POOH wi poth casing strings. Install I ounding topography, resee ted/Typed) REGUL	tring top to 2,0 5 At as th tubing. below ground c	B. Salt & Shoe GC 6/26//9 Accepted for record - NMIOC In hole marker. Cut off anchors, restore and rest SEE ATTACHED FOR CONDITIONS OF APPR			
 RIH with tbg and tag cemei 1900'-1780'. WOC. RIH and RIH and spot 25 sx plug from 5. RIH and circulate cement 6 Cut off well head and verify location. RECLAMATION: "Rip and remination." 14. I hereby certify that the foregoing is CAREAL AND AND AND AND AND AND AND AND AND AND	int @ $\frac{2}{2}$, 2	ump additional cement to b PSO – 1660 and tag cement. POOH wi both casing strings. Install ounding topography, resee ted/Typed) Title REGUL	th tubing.	B. Se/F) (T. Se/F & SLoc) (T. Se/F & SLoc) (Se/F & Se/F & SLoc) (Se/F & SLoc) (Se/F & Se/F & Se/F & SLoc) (Se/F & Se/F & Se/			
 RIH with tbg and tag cemei 1900'-1780'. WOC. RIH and RIH and spot 25 sx plug from 5. RIH and circulate cement 6 Cut off well head and verify location. RECLAMATION: "Rip and remination." 14. I hereby certify that the foregoing is CAREAL AND AND AND AND AND AND AND AND AND AND	Int @ 2,000. If necessary, p d tag cement. POOH. for 766 – 536'. WOC. RIH 50' to surface. y cement to surface around to nove caliche, contour to surr s true and correct. Name (Prin MES Comments THE SPACE	ump additional cement to b PSD - 1660 and tag cement. POOH wi both casing strings. Install I ounding topography, resee ted/Typed) Title REGUL Date	th tubing.	B. Se/f Accepted for record - NMIOC Accepted for record - NMIOC Inv hole marker. Cut off anchors, restore and rest SEE ATTACHED FOR CONDITIONS OF APPR 04/29/2019 E USE			
 RIH with tbg and tag cement 1900'-1780', WOC, RIH and 1900'-1780', WOC, RIH and 4. RIH and spot 25 sx plug from 5. RIH and circulate cement 6. Cut off well head and verify location. RECLAMATION: "Rip and remented in the foregoing is signature for the fo	int @ 2,000. If necessary, p d tag cement. POOH. om 766 – 536'. WOC. RIH 50' to surface. y cement to surface around to nove caliche, contour to surr s true and correct. Name (Prin NES Check Approval of this notice do equitable title to those rights in	ump additional cement to b PSO - 1660 and tag cement. POOH wi both casing strings. Install (ounding topography, resee ted/Typed) Title FOR FEDERAL OR S Title Date Title	th tubing.	B. Self Accepted for record - NAMOC SEE ATTACHED FOR CUNDITIONS OF APPR 04/29/2019 E USE			

Hudson Oil of Texas – P&A Procedure – 4/16/2019

Puckett "A" W.H #2

API #: 35-015-31082 AFE#: Field: Maljamar, Grayburg-San Andres Surf Location: Sec 24, T17S – R31E 1330' FNL & 10' FWL Latitude: 00.0000⁰ N / Longitude: -00.0000⁰ W Eddy County, NM Spud Date: 11-6-00

Directions to Location

From Maljamar: West on Hwy 82 for 4 miles. Turn south into location.

Description	Size	Wght	Grade	ID	Drift	Burst	Collapse	Btm MD	TOC
Surface	8-5/8"	24	J-55	8.097"	7.972"	2,940	1.370	636'	Surface
Production	5-1/2"	17 .	J-55	4.89"	4.767"	5,320	4,910	4,007'	Surf (CBL)
Tubing	2-3/8"	4.7	J-55	1.995"	1.901"	7,700	8,100	3,542'	

KB: 3,901 **GL:** 3,888' **PBTD**: 3,640' **TD:** 4,052'

Current Perfs: 3,294' – 3,460'

Objective: P&A Well Bore in compliance with the rules and regulations for the state of New Mexico.

Proposed Perfs: None

Procedure

1. MIRU well service rig and plugging equipment. POOH and lay down rods. RD pumping tee and install 7-1/6" 3K BOP's. Strap tubing out of hole and stand back in derrick. RIH Teg CIBA 3570. Duma Bail 35' cmf on top CIBA.

2. RIH with 5-1/2" GR to 3,250'. Set CIBP @ 3,240'. RIH with tubing and tag CIBP. Displace well with 9.5 ppg mud. Test casing to 1000 psi. Spot 25'sx cement on top of CIBP. POOH with tubing and WOC. 40 SX 3240-2845 (Perfs & SQZ Holes)

3. RIH with tbg and tag cement @ 2,990⁺. If hecessary, pump additional cement to bring top to 2,990⁺. 2845 POOH with tbg to 1960⁺. Spot 25 sx plug from $\frac{1900^{-}}{1780^{-}}$. WOC. RIH and tag cement. POOH. 1950 - 1660 (Yetes & Figure 1750)

4. RIH and spot 25 sx plug from 736' – 536'. WOC. RIH and tag cement. POOH with tubing.

5. RIH and circulate cement 60' to surface.


6. Cut off well head and verify cement to surface around both casing strings. <u>Install below ground dry</u> hole marker. Cut off anchors, restore and reseed location.

THIS PROCEDURE HAS BEEN PROPOSED IN CONSIDERATION OF AND WITH RESPECT GIVEN TO THE MANY VARIABLES AND POTENTIAL PROBLEMS THAT MAY BE ENCOUNTERED IN THIS WELL IN THIS GEOGRAPHICAL AREA. THEREFORE, THIS PROCEDURE IS TO SERVE AS A GENERAL GUIDELINE AND WILL BE REVIEWED AND MODIFIED WHEN REQUIRED AS DETERMINED BY ACTUAL WELLBORE CONDITIONS ENCOUNTERED IN THE OPERATIONS. SAFETY AND PRUDENT PRACTICES WILL TAKE PRIORITY AT ALL TIMES.

Prior to rig up of any operations and prior to the actual operations, always hold safety meeting to discuss any potential hazards, accurately record names of all personnel on location, pick meeting place, discuss evacuation plans, designate hospital of choice and have coordinates and phone numbers for care flight operations if necessary. Completely discuss the operation and/or rig-up so that all personnel understand the plan, responsibilities and any potential changes that may take place during the rig up or operation

Prepared By:


Greg Milner Petroleum Engineer Date: 4-18-19

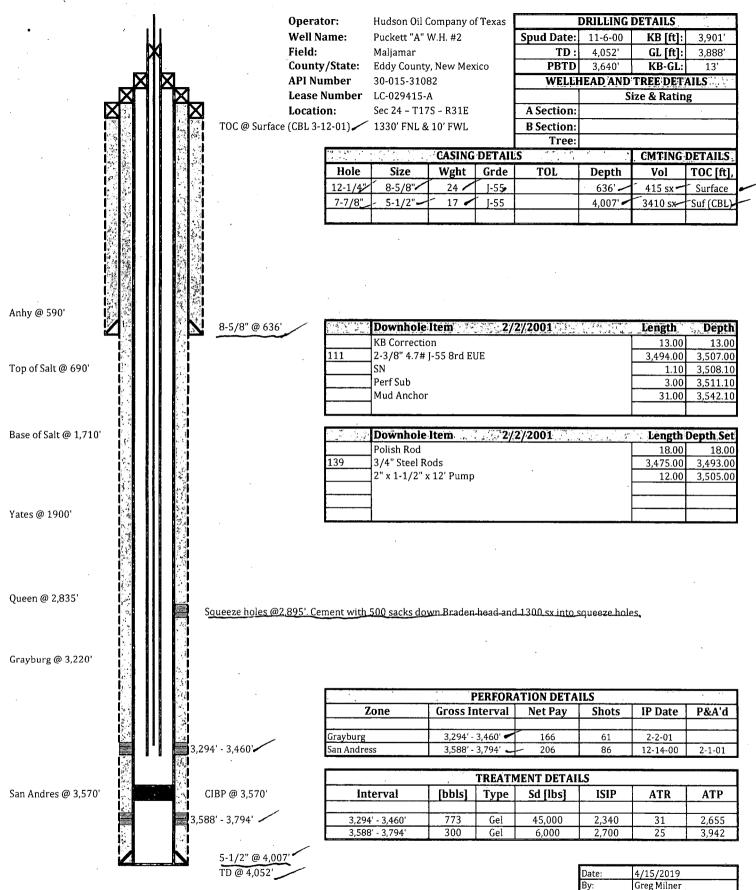

reg Milner

.

.

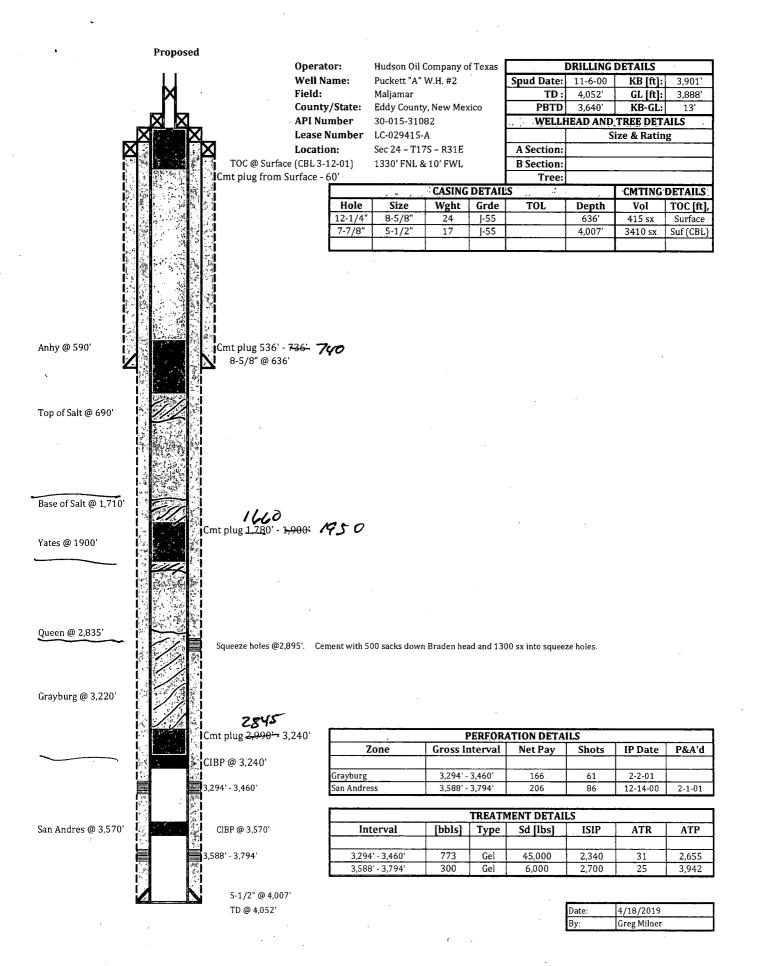

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted