

Form 3160-5  
(July 1989)  
(Formerly 9-331)

NM Oil Cons. Commission  
Drawer DD

CONTACT RECEIVED  
OFFICE FOR NUM  
OF COPIES REQUIRED  
(Other instructions on re-  
verse side)  
**RECEIVED**

BLM Roswell District  
Modified Form No.  
NM60-3160-4

UNITED STATES 88210  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

**SUNDRY NOTICES AND REPORTS ON WELLS**

(Do not use this form for proposals to drill or to deepen or plug back to a different depth.  
Use "APPLICATION FOR PERMIT" for such proposals.)

SEP 28 '89

1. ☐ OIL WELL ☐ GAS WELL ☐ OTHER ☐ P&A **O. C. D.**

2. NAME OF OPERATOR **ABO PETROLEUM CORPORATION /** 3a. Area **ABO** & Phone No. **505/748-1471**

3. ADDRESS OF OPERATOR  
**105 South 4th St., Artesia, NM 88210**

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.  
See also space 17 below.)  
At surface  
**1980' FSL & 660' FEL**

14. PERMIT NO.  
**API #30-005-62585**

15. ELEVATIONS (Show whether DF, RT, GR, etc.)  
**4123.5' GR**

5. LEASE DESIGNATION AND SERIAL NO.  
**NM 31633**

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME  
**Pozna Federal**

9. WELL NO.  
**1**

10. FIELD AND POOL, OR WILDCAT  
**Und. West Pecos Slope Abo**

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
**Unit I, Sec. 30-T5S-R24E**

12. COUNTY OR PARISH **Chaves** 13. STATE **NM**

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREAT

MULTIPLE COMPLETE

FRACTURE TREATMENT

ALTERING CASING

SHOOT OR ACIDIZE

ABANDON\*

SHOOTING OR ACIDIZING

ABANDONMENT\*

REPAIR WELL

CHANGE PLANS

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Propose to plug and abandon as follows:

Load tubing. Unseat packer and POOH. GBIH w/tubing open-ended.

Spot cement plug from 3655-3525' across Abo perms 3591-3607'. Tag plug.

Find casing free point. Cut and pull 4½" casing. Estimated cut at approximately 2850' based on cement top at 2920' by cement bond log.

GIH w/tubing and circulate hole w/salt gel.

Spot 130' cement plug across 4½" casing stub (65' in & 65' out). Tag plug.

Spot cement plug from 1410' (50' below Glorieta top) up to 1250' (50' inside 9-5/8" casing shoe). Tag plug.

Set 50' plug at surface and install regulation abandonment marker.

Verbal approval of procedure given by Mr. Peter Chester, BLM, Roswell, New Mexico on 9-20-89.

NOTIFY BLM, ROSWELL, NM, 24 HOURS BEFORE START PLUGGING OPERATIONS.

18. I hereby certify that the foregoing is true and correct

SIGNED Peter Chester

TITLE Production Supervisor


DATE 9-20-89

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

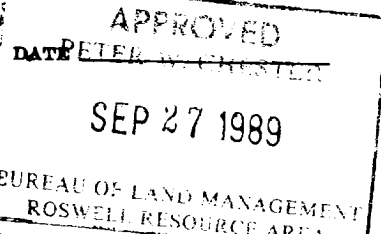

\*See Instructions on Reverse Side