

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator


Nadel and Gussman Permian

3. Address and Telephone No.

801 N Marienfeld, Suite 508, Midland, Texas 79701

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

660' FNL, 1650' FWL
Unit C, Sec 15, T15S, R29E

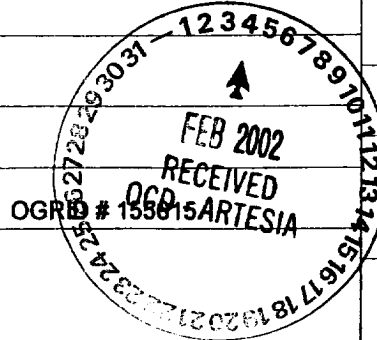

5. Lease Designation and Serial No.

NM - 54400

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Shell 15 Federal #2

9. API Well No.

30 - 005 - 62558

10. Field and Pool, or Exploratory Area

Lucky Lake Queen

11. County or Parish, State

Chaves Co., NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Notify BLM 24 hrs prior to starting P&A.
2. MIRU. Pull rods and pump. NU BOP. Pull tubing.
3. By wireline, set CIBP at 1800' and cap with 35' cement by bailer. Shoot 2 squeeze holes at 325'.
→ Perf. CS at 1008'. Squeeze 100' of cement inside? Outside CS. Tag
4. TIH with tubing. Fill casing with 10 PPG salt gel mud as per BLM requirements.
5. POH to 320'. Establish circulation through the annulus to the surface.
6. Circulate 50 sx "C" to the surface. Fill casing with 35 sx to the surface.
7. Cut off wellhead, fill annulus with cement if necessary, and set regulation 4' dry hole marker.
8. Remove pumping unit and flowline. Clean location and remediate as necessary.

OCD approval conditional.
Well must meet BLM
requirements and acquire
their approval.

14. I hereby certify that the foregoing is true and correct

Signed [Signature] Title R. McNaughton - Operations Engineer Date 2-1-02
(This space for Federal or State office use)

Approved by _____ Title _____ Date _____
Conditions of approval, if any: _____

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See instruction on Reverse Side

FEB 5 2002